

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY

SUNDRY NOTICES AND REPORTS ON WELLS

(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir. Use Form 9-331-C for such proposals.)

1. oil well ☒ gas well ☐ other ☐

2. NAME OF OPERATOR

Yates Petroleum Corporation

3. ADDRESS OF OPERATOR

207 South 4th St., Artesia, NM 88210

4. LOCATION OF WELL (REPORT LOCATION CLEARLY. See space 17 below.)

AT SURFACE:

AT TOP PROD. INTERVAL:

AT TOTAL DEPTH:

16. CHECK APPROPRIATE BOX TO INDICATE NATURE OF NOTICE, REPORT, OR OTHER DATA

REQUEST FOR APPROVAL TO:

SUBSEQUENT REPORT OF:

TEST WATER SHUT OFF

FRACURE TREAT

SHOOT OR ACIDIZE

REPAIR WELL

PULL OR ALTER CASING

MULTIPLE COMPLETE

CHANGE ZONES

ABANDON*

(other) Production Casing

XX

XX

X

5. LEASE

NM 27912

6. INDIAN, ALLOTTEE OR TRIBE NAME

7. UNIT AGREEMENT NAME

8. FARM OR LEASE NAME

Lincoln "PC" Federal

9. WELL NO.

1

10. FIELD OR WILDCAT NAME

Penasco Draw-SA-Yeso Associated

11. SEC., T., R., M., OR BLK. AND SURVEY OR AREA

Unit E, Sec. 33-18S-25E

12. COUNTY OR PARISH: 13. STATE


Eddy

NM

14. API NO.

15. ELEVATIONS (SHOW DF, KDB, AND WD)
3671' GR

(NOTE: Report results of multiple completion or zone change on Form 9-331-C)

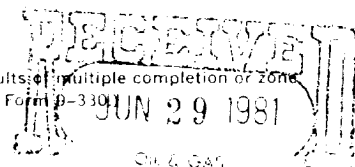

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)*

1D 3000'. Ran 76 jts of 4-1/2" 9.5# J-55 ST&C casing set at 3000'. Diff-fill shoe at 3000'. Float set at 3000'. Cemented w/350 sacks 50-50 Poz, 2% gel, .75% CF-2, .3% TF-4, 2% gel & 3% AF, PD 11:55 AM 6-16-81. Cement circulated 75 sacks to pit. WOC & tested to 1500 psi for 5 min. W/H w/Strip gun on wire-line & perforated 2367-2811' w/25 .50" holes as follows: 2367, 75, 85, 88, 91, 94, 2557, 61, 2634, 37, 40, 43, 46, 2666, 69, 72, 75, 78, 81, 84, 2755, 58, 2797, 2801, 04 & 11'. Frac'd perforations (San Andres)(via casing) w/60000 gallons gelled water, 2000 gallons 15% regular acid, 90000# sand (10000# 100 mesh & 80000# 20/40 sand).

Subsurface Safety Valve: Manu. and Type

Set @

Ft.

18. I hereby certify that the foregoing is true and correct

SIGNED

TITLE Engineering Secty DATE 6-26-81

APPROVED BY

CONDITIONS OF APPROVAL IF ANY

ACCEPTED FOR RECORD
ROGER A. CHAPMAN

TITLE

DATE

JUN 29 1981

U.S. GEOLOGICAL SURVEY
ROSWELL, NEW MEXICO

See Instructions on Reverse Side