

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY

SUNDRY NOTICES AND REPORTS ON WELLS

(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir. Use Form 9-331-C for such proposals.)

1. oil ☒ well gas ☐ well other ☐

JUN 1 1982

2. NAME OF OPERATOR

Anadarko Production Company

3. ADDRESS OF OPERATOR

P. O. Box 67, Loco Hills, New Mexico 88255

4. LOCATION OF WELL (REPORT LOCATION CLEARLY. See space 17 below.)

AT SURFACE: 1980' FNLΔ1880' FEL Sec. 6, T18S, R29E

AT TOP PROD. INTERVAL: Same Eddy County, New Mex.

AT TOTAL DEPTH: Same

16. CHECK APPROPRIATE BOX TO INDICATE NATURE OF NOTICE, REPORT, OR OTHER DATA

REQUEST FOR APPROVAL TO:

TEST WATER SHUT-OFF ☐

FRACTURE TREAT ☐

SHOOT OR ACIDIZE ☐

REPAIR WELL ☐

PULL OR ALTER CASING ☐


MULTIPLE COMPLETE ☐

CHANGE ZONES ☐

ABANDON* ☐

(other) ☐

SUBSEQUENT REPORT OF

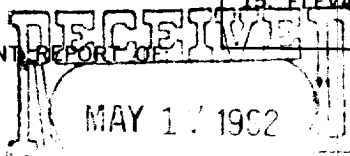

OIL & GAS
U.S. GEOLOGICAL SURVEY
ROSWELL, NEW MEXICO

(NOTE: Report results of multiple completion or zone change on Form 9-330.)

X Spud; drill TD; set Surface & production csg.

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)*

1. Rigged up rotary tools; spudded 12½" hole with fresh water @ 9:30 AM 5-8-82. Drilled to 360' KB.
 2. Ran 8-5/8", 24#, K-55 csg w/csg shoe @ 356' KB. Halliburton cemented with 350 sx Class H w/27% CaCl; circulated 50 sx to pit. PD @ 6:15 PM 5-8-82. Note: Notified Mr. Jones w/USGS prior to cementing.
 3. Installed Series 900 BOP and tested @ 1000 psi. WOC total of 18 hours prior to drilling plug on 8-5/8" casing with 7-7/8" bit. Drilled to TD 2780' KB. w/Brine.
 4. Ran 5½", 17#, K-55, LT&C, 8 Rd, Cond A casing with csg shoe @ 2779' KB. Halliburton cemented w/500 sx HL w/8# Salt/sx, 5# Gilsonite/sx & ¼# Flocele/sx & tailed in w/200 sx Class H w/.5 of 17 CFR-2, 5# Salt/sx & 10# No. 3 Sand/sx. PD @ 5:05 AM 5-13-82. Circulated 250 sx cement to pit.
- Note: Will file appropriate forms upon completion of well.

Arlie Cope witnessed cementing of 5½" casing.

Subsurface Safety Valve: Manu. and Type

18. I hereby certify that the foregoing is true and correct

SIGNED

TITLE

Area Supervisor

(This space for Federal or State office use)

APPROVED BY

TITLE

DATE

CONDITIONS OF APPROVAL, IF ANY:

5. LEASE

N. M. 9026

6. IF INDIAN, ALLOTTEE OR TRIBE NAME

7. UNIT AGREEMENT NAME

Ballard Grayburg San Andres Unit

8. FARM OR LEASE NAME

Tract No. 18

9. WELL NO.

1

10. FIELD OR WILDCAT NAME

Loco Hills-Queen-Grayburg-San Andres

11. SEC., T., R., M., OR BLK. AND SURVEY OR AREA

6 - 18S - 29E

12. COUNTY OR PARISH

Eddy

13. STATE

New Mexico

14. API NO.

15. ELEVATIONS (SHOW DF, KDB, AND WD)

3620.4 GL

RECORDED

INDEXED

MAY 25 1982

U.S. GEOLOGICAL SURVEY

ROSWELL, NEW MEXICO