

UNITED STATES
DEPARTMENT OF THE INTERIOR
BUREAU OF LAND MANAGEMENT

V.M. of Cons. Division
811 S. 1st St. E
Artesia, NM 88210-2848

FORM APPROVED
Budget Bureau No. 1004-0135
Expires: March 31, 1993

SUNDRY NOTICES AND REPORTS ON WELLS

Do not use this form for proposals to drill or to deepen or reentry to a different reservoir.
Use "APPLICATION FOR PERMIT—" for such proposals.

SUBMIT IN TRIPLICATE

1. Type of Well
☐ Oil Well ☒ Gas Well ☐ Other

2. Name of Operator
Anadarko Petroleum Corporation

3. Address and Telephone No.
PO Box 37, Loco Hills, NM 88255 505/677-2411

4. Location of Well (Footage, Sec., T., R., M., or Survey Description)
1650' FNL & 2110 FWL
Sec. 11, T18S, R28E

NM-54184

6. If Indian, Allottee or Tribe Name

N/A

7. If Unit or CA, Agreement Designation

N/A

8. Well Name and No.

Federal 11 #1

9. API Well No.

30-015-25086

10. Field and Pool, or Exploratory Area

Empire South, Morrow

11. County or Parish, State

Eddy, NM

12. CHECK APPROPRIATE BOX(s) TO INDICATE NATURE OF NOTICE, REPORT, OR OTHER DATA

TYPE OF SUBMISSION

- ☐ Notice of Intent
☒ Subsequent Report
☐ Final Abandonment Notice



TYPE OF ACTION

- ☐ Abandonment
☐ Recompletion
☒ Plugging Back
☐ Casing Repair
☐ Altering Casing
☐ Other _____
- ☐ Change of Plans
☐ New Construction
☐ Non-Routine Fracturing
☐ Water Shut-Off
☐ Conversion to Injection
☐ Dispose Water

(Note: Report results of multiple completion on Well Completion or Recompletion Report and Log form.)

13. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)*

1. Set CIBP at 9700' & dumped 40' cement on top of CIBP.
2. Western Atlas perforated 3rd Bone Springs w/LSPF at 7374', 78,80,7400, 02,04,06,10,12,26,28,30,34,36,40,41' (16 holes), (.49" Dia hole). RD Western Atlas.
3. TIH w/pkr. 7448' & spotted 2.4 bbls 15% HCL Acid across perfs. Pulled pkr to 7289'. Acidized w/1900 gals acid w/30 BS. AIR&P 6.5 BPM at 4800# PSI.
4. RU swab & swabbed part of 8 days. Recovered no oil but lots of water. RDP.
5. Wait on plugging unit.

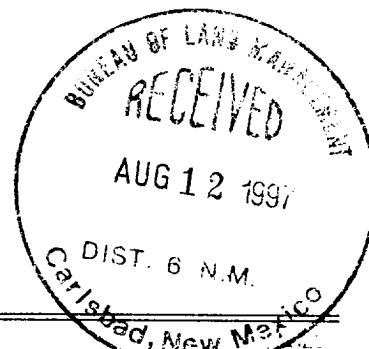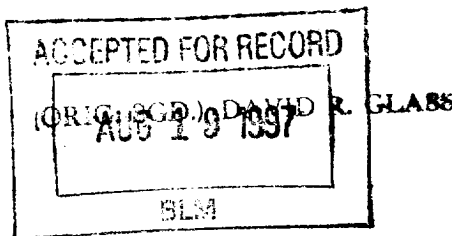

14. I hereby certify that the foregoing is true and correct

Signed Howard D. McKee Title Field Foreman

Date 08-04-97

(This space for Federal or State office use)

Approved by _____
Conditions of approval, if any:

Title _____

Date _____