


(SUBMIT IN TRIPLICATE)

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY

Land Office Las Cruces
Lease No. 947182
Unit Sunray Oil Corp., Leases

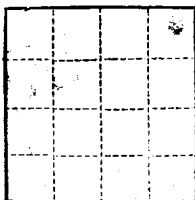

SUNDRY NOTICES AND REPORTS ON WELLS

NOTICE OF INTENTION TO DRILL	SUBSEQUENT REPORT OF WATER SHUT-OFF
NOTICE OF INTENTION TO CHANGE PLANS	SUBSEQUENT REPORT OF SHOOTING OR ACIDIZING
NOTICE OF INTENTION TO TEST WATER SHUT-OFF	SUBSEQUENT REPORT OF ALTERING CASING
NOTICE OF INTENTION TO RE-DRILL OR REPAIR WELL	SUBSEQUENT REPORT OF RE-DRILLING OR REPAIR
NOTICE OF INTENTION TO SHOOT OR ACIDIZE	SUBSEQUENT REPORT OF ABANDONMENT
NOTICE OF INTENTION TO PULL OR ALTER CASING	SUPPLEMENTARY WELL HISTORY
NOTICE OF INTENTION TO ABANDON WELL	

(INDICATE ABOVE BY CHECK MARK NATURE OF REPORT, NOTICE, OR OTHER DATA)

Well No. 1-Standard of Texas Federal is located 271 ft. from N line and 600 ft. from E line of sec. 9
175 27E N. M. P. M.
(1/4 Sec. and Sec. No.) (Twp.) (Range) (Meridian)
Wilcox Colo New Mexico
(Field) (County or Subdivision) (State or Territory)

The elevation of the derrick floor above sea level is 3443 ft.

DETAILS OF WORK

(State names of and expected depths to objective sands; show sizes, weights, and lengths of proposed casings; indicate mudding jobs, cement-
ing jobs, and all other important proposed work.)
12-13-58 to 12-16-58 Cleaned out hole to 225' and tested open hole section for two
days. No show on test.
12-17-58 to 12-18-58 Set 40 cu. cement plug 2000'-2170' and 45 cu. cement plug 1481' -
1575'. Two sacks of Cal Seal from 1472'-1481'.
12-19-58 Perforated a Jetco/H. from 1496'-1498'. Fresh water rose to 100' from
surface in 8 hours. Squipped perfor with 50 sacks cement. Witnessed and
approved by a representative of the New Mexico State Water Engineer.
12-19-58 Set 18 sacks cement plug from 9'-10', replaced dry hole marker at the
surface, and cleaned up the location.

I understand that this plan of work must receive approval in writing by the Geological Survey before operations may be commenced.

Company Rate Brothers
Standard of Texas
Address 107 Carter Building
Artesia, New Mexico

By M. E. Spiller
Geologist
Title _____