

Details of bop test

Hondo Drilling Company


TX State #1

6/19/74

Contractor: Hondo Drlg. Rig 3

Test by Yellow Jacket Tools and Services, Inc.

=====Transposition of the pressure recorder chart=====

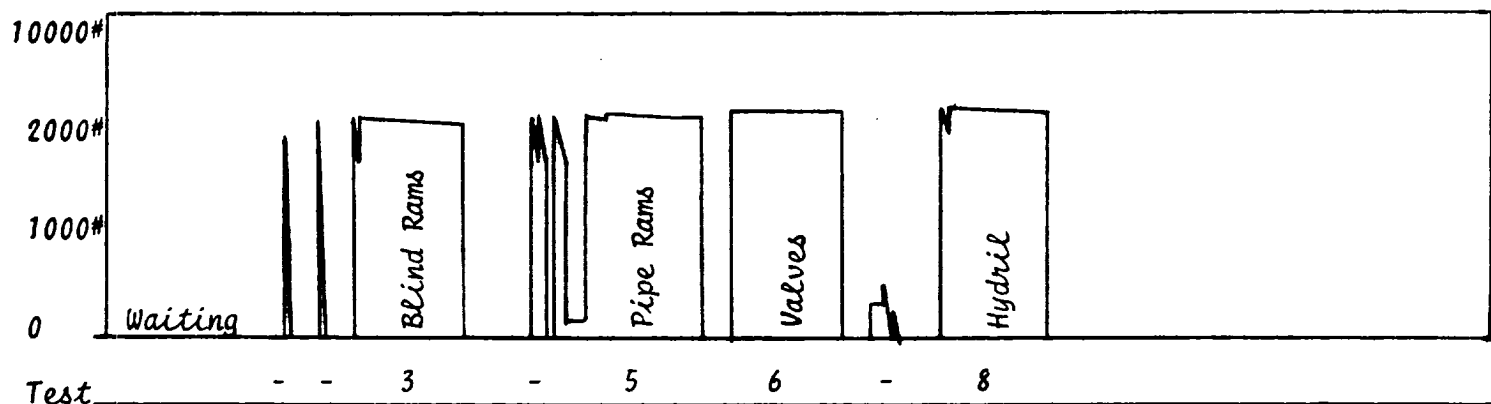

The above is a transposition of the pressure recorder chart covering test to the blowout control equipment in service on your well drilling in the Carlsbad, New Mexico Area, Midland District, Texas. Test was made with test plug landed in casing head with the following test results:

Waiting on rig.

TESTING: Blind Rams with outside valve closed off stack on kill line, outlet valve closed off choke-manifold cross, and outside wing valves closed off manifold cross - pressure applied thru guage connection.

Test #1 Pressured to 1800# with leak to flange between valve next to stack and chokeline. Tightened.

Test #2 Repeated test. Pressured to 2000# with leak to flange between inlet valve off choke-manifold cross and chokeline. Tightened.

Test #3 Repeated test. Pressured to 2000# with loss of pressure; re-pressured to 2000# with loss of approximately 100# during first seventeen minutes then leveling out for remaining one minute of test.

NO VISIBLE LEAK. PRESSURE LEVELING OUT TOWARDS APPROXIMATELY 1900#.