

Details of bop test

Coquina Oil Company


Midwest State #1

5/4/74

Contractor: Hondo Drlg. Rig 3

Test by Yellow Jacket Tools and Services, Inc.

=====Transposition of the pressure recorder chart=====

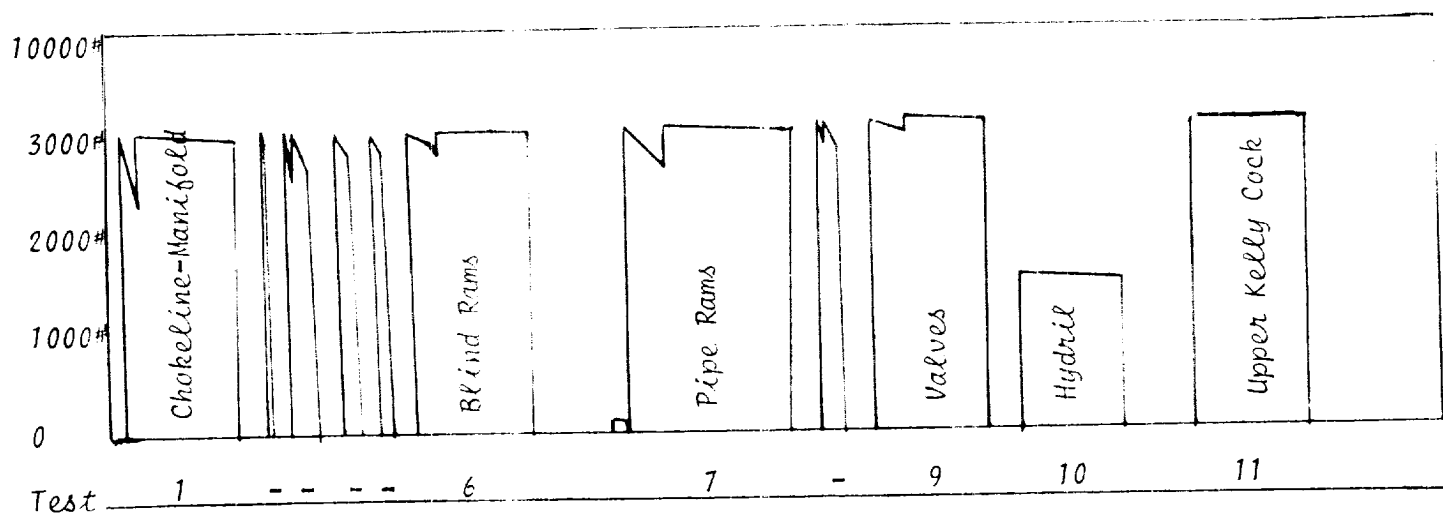

The above is a transposition of the pressure recorder chart covering test to the blowout control equipment in service on your well drilling in the Sitting Bull Falls, New Mexico Area, Midland District, Texas. Test was made with test plug landed in casing head with the following test results:

Arrived location - rig coming out of hole.

TESTING: Chokeline-Manifold with valve closed next to stack on chokeline, outlet valve closed off choke-manifold cross, and outside wing valves closed off manifold cross - pressure applied thru guage connection.

Test #1 Pressured to 3000# with loss of pressure; repressured to 3000# with loss of approximately 100# during first ten minutes then leveling out for remaining five minutes of test.

NO VISIBLE LEAK. PRESSURE LEVELING OUT TOWARDS APPROXIMATELY 2900#.

TESTING: Blind Rams with check valve closed off stack on kill line, outlet valve