

Details of bop test

Hamplin Petroleum Company


State 36 #1

5/30/74

Contractor: Ard Drlg, Rig 3

Test by Yellow Jacket Tools and Services, Inc.

=====Transposition of the pressure recorder chart=====

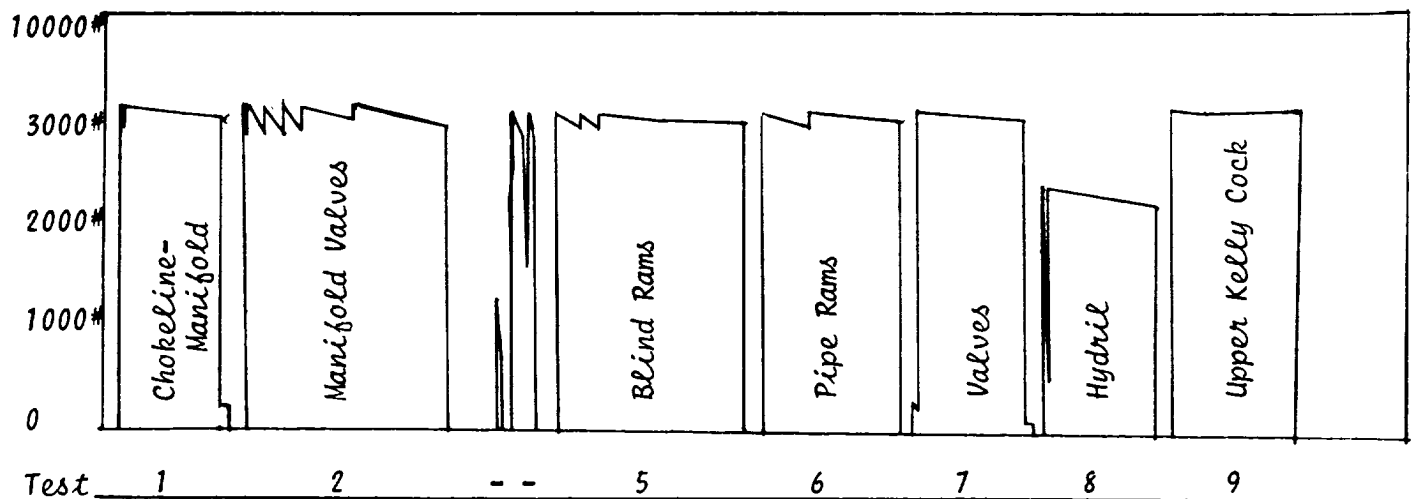

The above is a transposition of the pressure recorder chart covering test to the blowout control equipment in service on your well drilling in the Carlsbad, New Mexico Area, Midland District, Texas. Test was made with test plug landed in casing head and with test packer with the following test results:

Arrived location - rig coming out of hole.

---

TESTING: Chokeline-Manifold with outside valve closed off stack on chokeline, outside outlet valve closed off choke-manifold cross, and outside wing valves closed off manifold cross - pressure applied thru guage connection.

Test #1 Pressured to 3100# with loss of pressure; repressured to 3100# with loss of approximately 100# during first fourteen minutes then leveling out for remaining one minute of test.

NO VISIBLE LEAK. PRESSURE LEVELING OUT TOWARDS APPROXIMATELY 3000#.

---

RETEST: Chokeline-Manifold same as before but with inside outlet valve closed off choke-manifold cross and inside wing valves closed off manifold cross - pressure applied as