


Contractor McVay Drlg. Co.
Rig No. 3
Spot 1980' FSL & FWL
Sec. 15
Twp. 21 S
Rng. 29 E
Field Wildcat
County Eddy
State New Mexico
Elevation --
Formation Strawn

Top Choke 1/4" & 1/2"
Bottom Choke 1"
Size Hole 7 7/8"
Size Rat Hole --
Size & Wt. D. P. 4 1/2" 16.60
Size Wt. Pipe --
I. D. of D. C. 2 1/4"
Length of D. C. --
Total Depth 11601'
Interval Tested 11324-11601'
Type of Test Bottom Hole
Conventional

Flow No. 1 28 Hrs. Min.
Shut-in No. 1 -- Min.
Flow No. 2 -- Min.
Shut-in No. 2 -- Min.
Flow No. 3 -- Min.
Shut-in No. 3 -- Min.

Bottom
Hole Temp. --
Mud Weight 10.4
Gravity --
Viscosity 37

Tool opened @ 6:57 AM.

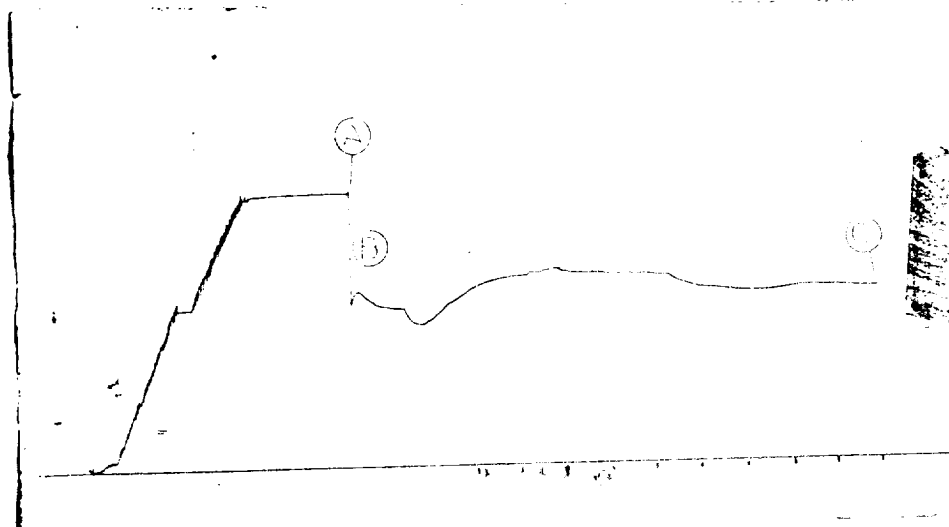

PRD Make Kuster K-3
No. 13672 Cap. 10300 @ --

Press	Corrected
Initial Hydrostatic A	5996
Final Hydrostatic K	--
Initial Flow B	3567
Final Initial Flow C	3762*
Initial Shut-in D	--
Second Initial Flow E	--
Second Final Flow F	--
Second Shut-in G	--
Third Initial Flow H	--
Third Final Flow I	--
Third Shut-in J	--

Lynes Dist. Hobbs, N.M.
Our Tester Mike Walter
Witnessed By Bob Yates

Did Well Flow - Gas Yes Oil No Water No

RECOVERY IN PIPE 11268' Gas cut saltwater with trace of condensate

Flow - See Gas Volume Report.

*Clock ran out 735 minutes into flow period.

Ran 2500 psig nitrogen cushion.

REMARKS.

Address Midland, Texas

Ticket No.

12443

Date

8-3-78

No. Final Copies

5