

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY

SUBMIT IN TRIPPLICATE*
(Other instructions on re-
verse side)

Form approved.
Budget Bureau No. 42-R1424.

5. LEASE DESIGNATION AND SERIAL NO.

U-1-D129588

6. IF INDIAN, ALLOTTEE OR TRIBE NAME

AUG 07 1981

7. UNIT AGREEMENT NAME

8. FARM OR LEASE NAME

Harris Federal

9. WELL NO.

2

10. FIELD AND POOL, OR WILDCAT

Golden Lane Morrow

11. SEC., T., R., M., OR BLK. AND
SURVEY OR AREA

Sec. 5, T-21S, R-29-E

12. COUNTY OR PARISH 13. STATE

Eddy

New Mexico

SUNDRY NOTICES AND REPORTS ON WELLS

(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir.
Use "APPLICATION FOR PERMIT—" for such proposals.)

1. OIL WELL ☐ GAS WELL ☒ OTHER

2. NAME OF OPERATOR

Meadco Properties, Ltd.

3. ADDRESS OF OPERATOR

P. O. Box 2236, Midland, Texas 79702

4. LOCATION OF WELL (Report location clearly and in accordance with any State requirements.*

See also space 17 below.)
At surface

1980' FWL & 660' FSL, Section 5, T-21-S, R-29-E

UT. N

14. PERMIT NO.

15. ELEVATIONS (Show whether DF, RT, GR, etc.)

3389.7 Gr.

16. Check Appropriate Box To Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

TEST WATER SHUT-OFF

FRACTURE TREAT

SHOOT OR ACIDIZE

REPAIR WELL

(Other)

PULL OR ALTER CASING

MULTIPLE COMPLETE

ABANDON*

CHANGE PLANS

SUBSEQUENT REPORT OF:

WATER SHUT-OFF

FRACTURE TREATMENT

SHOOTING OR ACIDIZING

(Other) Perforating

REPAIRING WELL

ALTERING CASING

ABANDONMENT*

(NOTE: Report results of multiple completion on Well
Completion or Recompletion Report and Log form.)

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)*

Page 2 of 2

07/25/81 - Perf 32 holes 12310 - 12775'. Pkr set @ 10370', tbq set @ 10403', 328 jts.


07/27/81 - 10 hr SITP 200#. A/2250 gal 7 1/2% Morflow II + 10,000 SCFN₂. Treated 3 BPM @ 5100#. ISI 4200#. 170 BLW. Opened & flwd 50 BLW. Csg split w/2000# pressure. Prep to find csg split.

07/28/81 - Found hole in csg at 3070'. Prep to cut csg off at 4000' & repair.

07/29/81 - Cut 5 1/2 csg off at 4027'. Going in hole with mill to dress csg.

07/30/81 - Dressed csg to 4028'. Ran csg bowl & latched onto 5 1/2' csg & set slips. Tested csg to 2000#. Tested O.K.

07/31/81 - Ran 2 3/8 tbq to 10403'. Pkr 10370'. Swb well down to 8400'. No show. Prep to A/7000 gal.

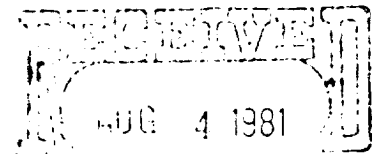

18. I hereby certify that the foregoing is true and correct

SIGNED

Marvin Russell

TITLE Agent

(This space for Federal Office Use Only)

ROGER A. CHAPMAN

APPROVED BY
CONDITIONS OF APPROVAL, IF ANY:

AUG 4 1981

TITLE

DATE

U.S. GEOLOGICAL SURVEY

*See Instructions on Reverse Side