

N.M.O.G.S.D. COPY

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY

SUNDRY NOTICES AND REPORTS ON WELLS

(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir. Use Form 9-331-C for such proposals.)


1. oil ☒ well gas ☐ well other ☐
2. NAME OF OPERATOR
Bliss Petroleum, Inc.
3. ADDRESS OF OPERATOR
P.O. Box 1817 Hobbs, N.M. 88240
4. LOCATION OF WELL (REPORT LOCATION CLEARLY. See space 17 below.)
AT SURFACE: 2310' FSL & 330' FEL
AT TOP PROD. INTERVAL: Sec. 22, T20S, R29E
AT TOTAL DEPTH:
16. CHECK APPROPRIATE BOX TO INDICATE NATURE OF NOTICE, REPORT, OR OTHER DATA

REQUEST FOR APPROVAL TO:

- TEST WATER SHUT-OFF ☐
FRACTURE TREAT ☐
SHOOT OR ACIDIZE ☐
REPAIR WELL ☐
PULL OR ALTER CASING ☐
MULTIPLE COMPLETE ☐
CHANGE ZONES ☐
ABANDON* ☐
(other) ☐

SUBSEQUENT REPORT OF:

- ☐
☐
☐
☐
☐
☐
☐
☐
☒

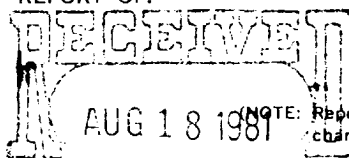

OIL & GAS
U.S. GEOLOGICAL SURVEY
ROSWELL, NEW MEXICO

5. LEASE
NM 13995
6. IF INDIAN, ALLOTTEE OR TRIBE NAME
7. UNIT AGREEMENT NAME RECEIVED
8. FARM OR LEASE NAME DB Federal SEP 8 1982
9. WELL NO. 1 O. C. D.
10. FIELD OR WILDCAT NAME ARTESIA, OFFICE
Undesignated
11. SEC., T., R., M., OR BLK. AND SURVEY OR AREA Sec. 22, T20S, R29E
12. COUNTY OR PARISH Eddy 13. STATE N.M.
14. API NO.
15. ELEVATIONS (SHOW DF, KDB, AND WD)
3274' GL

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)*

Ran DP in hole open ended to 1600'. Spotted 25 sx. class "C" cmt. w/ 2% CaCl₂. POH w/ DP. Waited 3 1/2 hrs. Went back in to tag plug. It was not there. Ran DP back to 1600'. Spotted 50 sx. class "C" cmt. w/ 4% CaCl₂. POH w/ DP. Waited 3 1/2 hrs. Went back in w/ DP & tagged cmt. at 1280'. Spotted 25 sx. class "C" cmt. w/ 4% CaCl₂ & 25 sx. class "C" neat cmt. from 1280' - 960'. Spotted 50 sx. class "C" cmt. from 640' - 320'. 167' fillup in bottom of 7" Csg. Spotted 10 sx. cmt. plug from 40' - 0. Used total of 235 sx. cmt. Did not pull any Csg. Finished plugging at 3:00 A.M. on 8-8-81.

Subsurface Safety Valve: Manu. and Type _____ Set @ _____ Ft.

18. I hereby certify that the foregoing is true and correct

SIGNED Paul Bliss TITLE President DATE 8-14-81

(This space for Federal or State office use)

APPROVED BY _____ TITLE _____ DATE _____
CONDITIONS OF APPROVAL, IF ANY:

*See Instructions on Reverse Side

APPROVED

SEP 8 1982
JAMES A. GILLHAM
DISTRICT SUPERVISOR