

YATES PETROLEUM CORPORATION
Brannigan ANF Federal #2
Section 6-T22S-R24E
Eddy County, New Mexico

SUNDRY NOTICE CONTINUED:

rope socket and sinker bar.


2-15-97 - TIH with packer and tubing. Unset RBP. Pulled up and reset RBP at 7916' and tested to 1200 psi. Pulled up and set packer at 7822'. Acidized perforations 7849-7882' with 1500 gallons 20% iron control HCL acid and ball sealers. Perfs already broke. Swabbing. NOTE: Broke sand line and lost sinker bar. Shut well in.

2-16-17-97 - Bled well down. Loaded tubing with 2% KCL water. Unset packer. TOOH with tubing and packer. Retrieved sinker bars off of seating nipple. Installed new sandline on rig.

2-18-97 - TIH with packer and tubing. Unset RBP. Pulled up and reset RBP at 7822' and tested to 1300 psi. Pulled up and set packer at 7707'. Acidized perforations 7767-7809' with 3000 gallons 20% iron control HCL acid and ball sealers. Swabbing and flowing.

2-19-97 - Continue to flow well. Shut well in.

2-20-97 - Acidized perforations 7767-7809' with 20000 gallons 20% gelled iron control acid and ball sealers. Swabbed. Loaded tubing with 2% KCL water. Unset packer. Dropped down and unset RBP. TOOH with tubing, packer and RBP. Released well to production department.

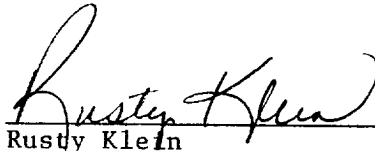

Rusty Klein
Operations Technician
March 4, 1997