


Details of bop test      Texas International Petroleum Co.      Alide State #1      10/6/73

Contractor: Moran Drlg. Rig 8      Test by Yellow Jacket Tools and Services, Inc.

=====Transposition of the pressure recorder chart=====

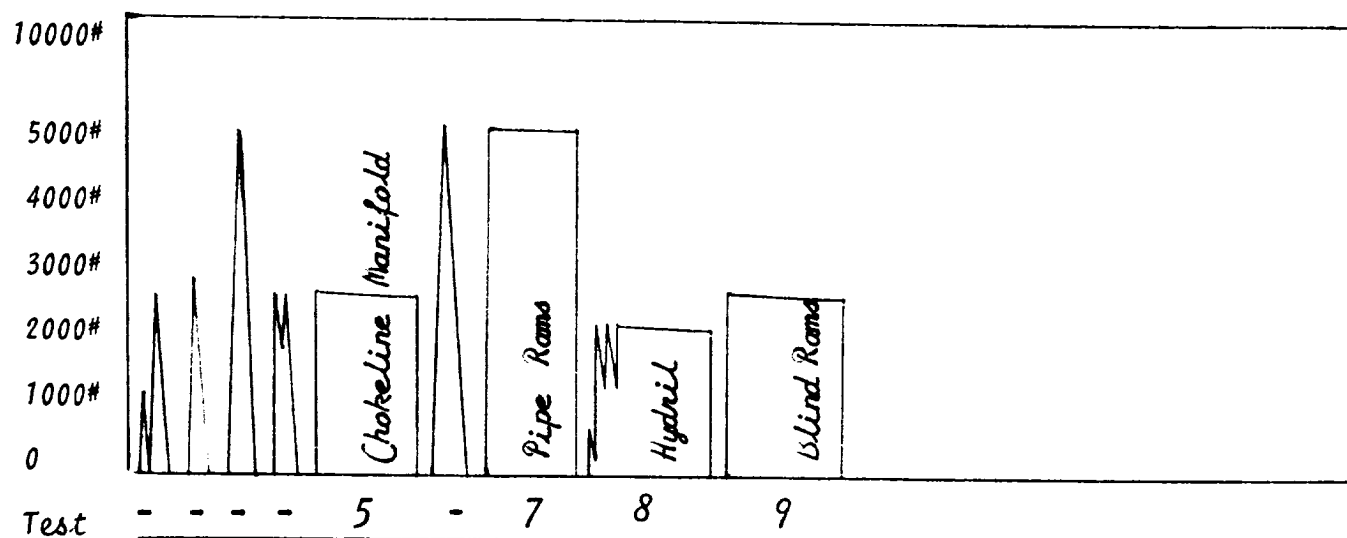

The above is a transposition of the pressure recorder chart covering test to the blowout control equipment in service on your well drilling in the Carlsbad, New Mexico Area, Midland District, Texas. Test was made with test plug landed in casing head with the following test results:

Arrived location - rig ready to test.

Trying to seat test plug.

TESTING: Chokeline-Manifold with valve closed next to stack on chokeline and all valves closed off choke-manifold cross - pressure applied thru guage connection.

Test #1 Pressured to 1000# and released air; repressured to 2500# with leak to guage connection. Tightened.

Test #2 Repeated test. Pressured to 2800# with same leak. Tightened.

Test #3 Repeated test. Pressured to 5000# to check testing pump.

Test #4 Repeated test. Pressured to 2500# with loss of pressure; re-