

Details of bop test

Exxon Company, USA


Gas Unit Combo #41

3/26/74

Contractor: Noble Drlg. Rig OW77

Test by Yellow Jacket Tools and Services, Inc.

=====Transposition of the pressure recorder chart=====

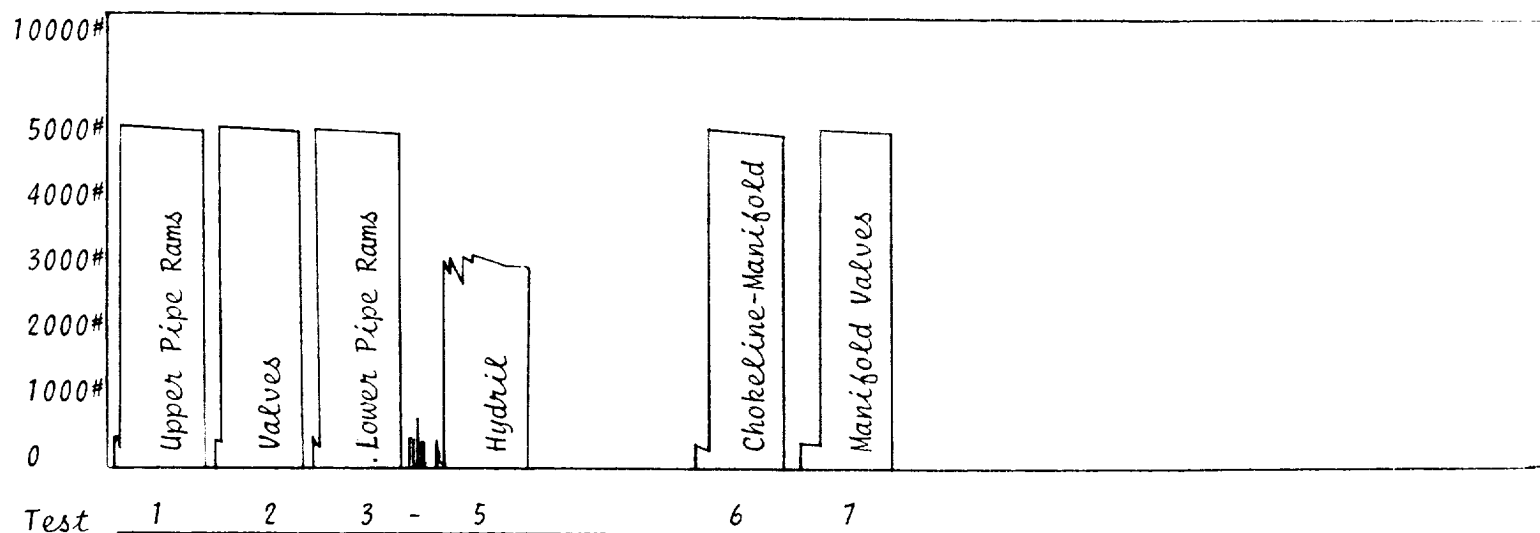

The above is a transposition of the pressure recorder chart covering test to the blowout control equipment in service on your well drilling in the Carlsbad, New Mexico Area, Midland District, Texas. Test was made with test plug landed in casing head with the following test results:

Arrived location - rig drilling.

TESTING: Upper Pipe Rams with outside valve and valve off tee closed off stack on kill line and outside valve closed off stack on chokeline - pressure applied down drill pipe.

Test #1 Pressured to 200# with loss of pressure; no visible external leak; repressured to 5000# with loss of approximately 100# during first eleven minutes then leveling out for remaining one minute of test.

NO VISIBLE LEAK. PRESSURE LEVELING OUT TOWARDS APPROXIMATELY 4900#.