

Details of bop test

Mobil Oil Corporation


Etter #1

2/27/74

Contractor: Marcum Drlg. Rig 3

Test by Yellow Jacket Tools and Services, Inc.

=====Transposition of the pressure recorder chart=====

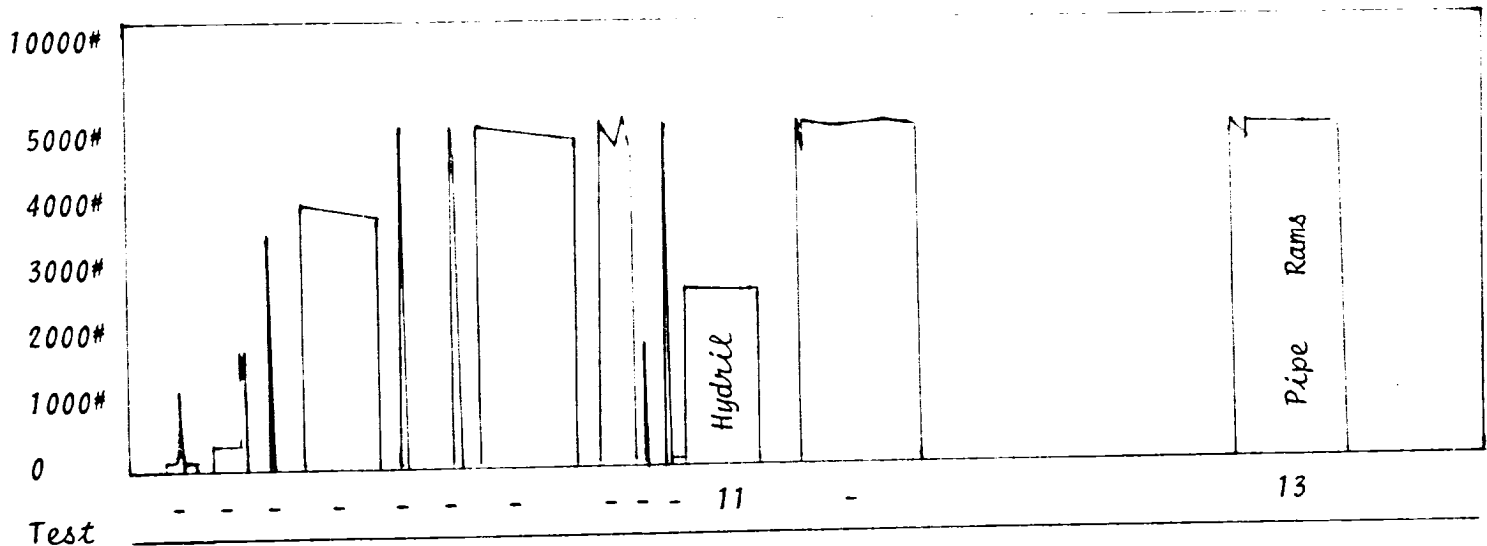

The above is a transposition of the pressure recorder chart covering test to the blowout control equipment in service on your well drilling in the Carlsbad Area, Hobbs District, New Mexico. Test was made with test packer landed in top of casing with the following test results:

Arrived location - rig nipping up.

Waiting on rig.

TESTING: Pipe Rams with valve closed next to stack on kill line and all valves closed off choke-manifold cross - pressure applied down drill pipe.

Test #1 Pressured to 1000# and released air. No test.

Test #2 Repeated test. Pressured to 400# with pressure steady; re-pressured to 1500# with loss of pressure; repressured to 1500# with leak to flange between stack and valve next to stack on kill line. Tightened.

Test #3 Repeated test. Pressured to 3500# with leak to flange between spacer spool and casing spool. Tightened.