

Details of bop test

AMOCO Production Company


South Rock Tank #1

8/5/74

Contractor: Noble Drlg. Rig N-83

Test by Yellow Jacket Tools and Services, Inc.

=====Transposition of the pressure recorder chart=====

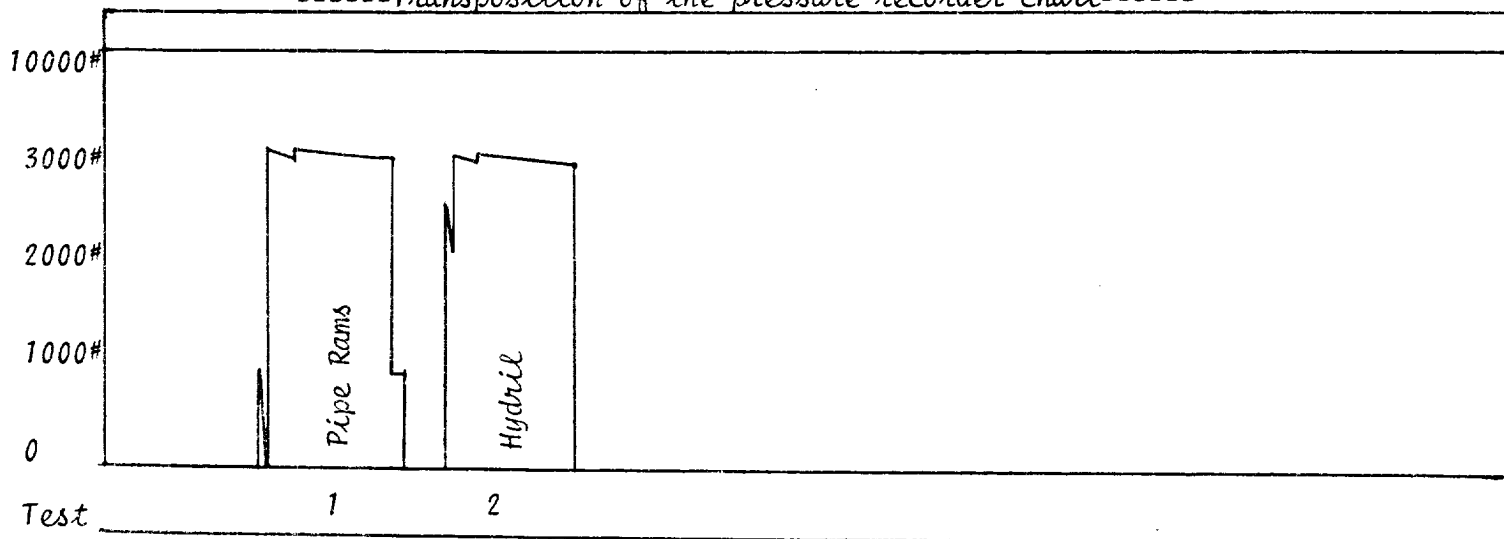

The above is a transposition of the pressure recorder chart covering test to the blowout control equipment in service on your well drilling in the Carlsbad Area, Hobbs District, New Mexico. Test was made with test plug landed in casing head with the following test results:

Arrived location - rig nipping up.

TESTING: Pipe Rams with inside valve closed next to stack on kill line and outside valve closed off stack on choke line - pressure applied down drill pipe.

Test #1 Pressured to 800# and released air; repressured to 3000# with loss of pressure; repressured to 3000# with loss of approximately 100# during first thirteen minutes then leveling out for remaining three minutes of test. Released pressure to 800# and closed Hydril and opened rams.

NO VISIBLE LEAK. PRESSURE LEVELING OUT TOWARDS APPROXIMATELY 2900#.