

Details of bop test

Coquina Oil Company


Jack State #1

10/4/74

Contractor: Tri-Service Drlg. Rig 6

Test by Yellow Jacket Tools and Services, Inc.

=====Transposition of the pressure recorder chart=====

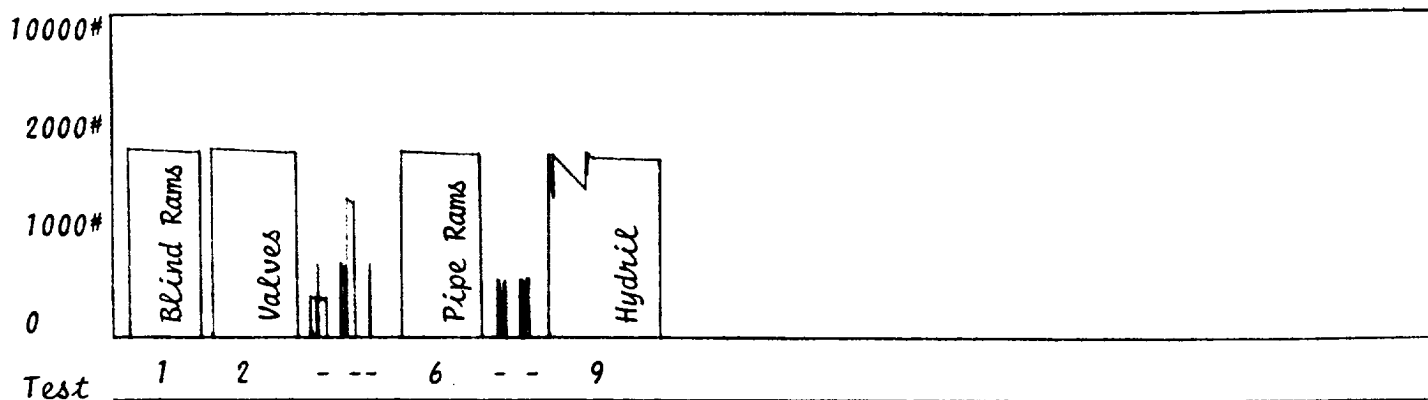

The above is a transposition of the pressure recorder chart covering test to the blowout control equipment in service on your well drilling in the Carlsbad, New Mexico Area, Midland District, Texas. Test was made with test plug landed in casing head with the following test results:

Arrived location - rig coming out of hole.

---

TESTING: Blind Rams with outlet valve closed off choke-manifold cross and inside wing valves closed off manifold cross - pressure applied thru guage connection.

Test #1 Pressured to 1800# with loss of approximately 100# during first eleven minutes then leveling out for remaining one minute of test.

NO VISIBLE LEAK. PRESSURE LEVELING OUT TOWARDS APPROXIMATELY 1700#.

---

TESTING: Outlet valve off choke-manifold cross and outside wing valves off manifold cross with blind rams closed - pressure applied as before.

Test #2 Pressured to 1800# with loss of approximately 100# during first twelve minutes then leveling out for remaining one