

Details of bop test

Apexco, Inc.


Henry Grady #1

11/2/74

Contractor: Marcum Drlg. Rig 2

Test by Yellow Jacket Tools and Services, Inc.

=====Transposition of the pressure recorder chart=====

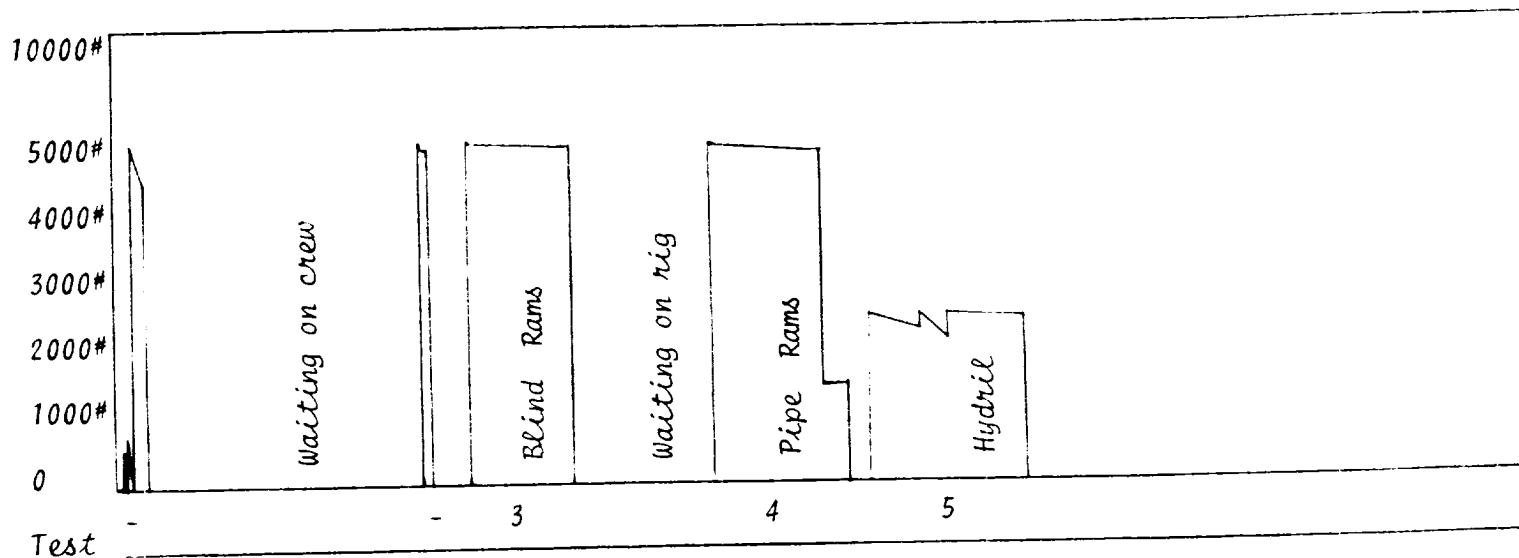

The above is a transposition of the pressure recorder chart covering test to the blowout control equipment in service on your well drilling in the Carlsbad, New Mexico Area. Levelland District, Texas. Test was made with test plug landed in casing head with the following test results:

Arrived location - rig nipping up.

TESTING: Blind Rams with valve closed next to stack on kill line, outlet valve closed off choke-manifold cross, and outside wing valves closed off manifold cross - pressure applied thru guage connection.

Test #1 Pressured to 400# and released air; repressured to 600# and released air; repressured to 5000# with leak to flange between blind rams bop and casing spool.

Waiting on crew to tighten.

Test #2 Repeated test. Pressured to 5000# with leak to flange between tee and chokeline. Tightened.