

YATES PETROLEUM CORPORATION
Lechuguilla Canyon AJ Federal #1
Section 8-T24S-R24E
Eddy County, New Mexico

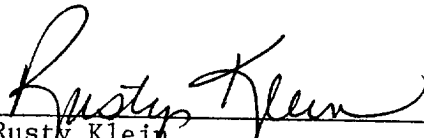
SUNDRY NOTICE CONTINUED

Nippled up casing head and BOP. Rigged up floor and 2-7/8" tubing equipment. RIH with tubing to 5061'. Spotted 50 sacks Class C cement. POOH with tubing. Shut well in for night.

4-5-2000 - TIH with tubing and tagged plug at 4905'. Loaded hole with mud laden fluid. Pulled up hole to 2578'. Spotted 50 sacks Class C Neat cement. POOH with tubing. WOC. Shut well in.

4-6-2000 - RIH with tubing to tag plug - no tag. Spotted 50 sacks Class C Neat cement at 2578'. POOH with tubing. WOC 4 hours. RIH with tubing and tagged plug at 2476'. Circulated hole with mud laden fluid. Pulled up hole to 670'. Spotted 50 sacks Class C Neat cement. POOH with tubing. Shut well in.

4-7-2000 - RIH with tubing and tagged plug at 525'. POOH with tubing. Rigged down tubing equipment and floor. Nippled down BOP. RIH with 1 joint of 2-7/8" tubing. Spotted 20 sacks Class C Neat cement from 31' to surface. POOH with tubing. Installed regulation abandonment marker. PLUGGED AND ABANDONED - FINAL REPORT. Plugging completed 4-6-2000.


Rusty Klein
Operations Technician
January 2, 2001