


Details of bop test Phillips Petroleum Company Malaga A-1 1/8/74

Contractor: Warton Drilling Co. Rig 6 Test by Yellow Jacket Tools and Services, Inc.

=====Transposition of the pressure recorder chart=====

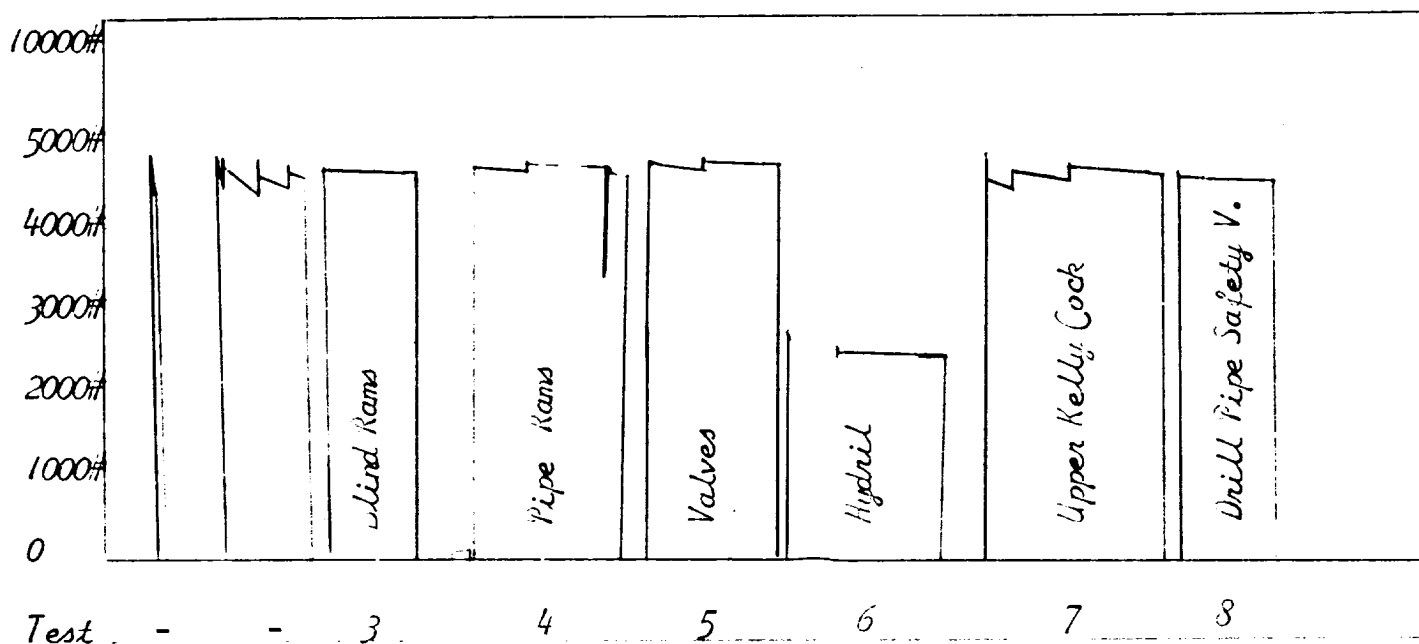

The above is a transposition of the pressure recorder chart covering test to the blowout control equipment in service on your well drilling in the Carlsbad Area, Hobbs District, New Mexico. Test was made with test plug landed in casing head with the following test results:

Arrived location - rig nipping up.

TESTING: Blind Rams with outside valve closed off stack on kill line, wing valve closed off manifold cross (pump side), wing valve closed off manifold cross (pipe rack side) and outlet valve closed off choke-manifold cross - pressure applied thru gauge connection.

Test #1 Pressured to 4500# with leak to flange between drilling
spool and casing spool. Tightened.

Test #2 Repeated test. Pressured to 4500# with loss of pressure;