

UNITED STATES DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY
ARTESIA, NM 88210

Form approved.
Budget Bureau No. 42-R1424.

5. LEASE DESIGNATION AND SERIAL NO.

0542015

6. IF INDIAN, ALLOTTEE OR TRIBE NAME

SUNDRY NOTICES AND REPORTS ON WELLS

(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir.
Use "APPLICATION FOR PERMIT" for such proposals.)

1. OIL WELL ☒ GAS WELL ☐ OTHER ☐

SEP 23 1981

2. NAME OF OPERATOR

Delta Drilling Company /

3. ADDRESS OF OPERATOR

3100-C North "A" Midland, Texas 79701

4. LOCATION OF WELL (Report location clearly and in accordance with any State requirements.*
See also space 17 below.)
At surface

1740' FEL & 660' FNL

7. UNIT AGREEMENT NAME

South Culebra Bluff

8. FARM OR LEASE NAME

South Culebra Bluff Unit

9. WELL NO.

7

10. FIELD AND POOL, OR WILDCAT
South Culebra Bluff
(Bone Spring)

11. SEC., T., R., M., OR BLK. AND
SURVEY OR AREA

14-23S-28E

14. PERMIT NO.

15. ELEVATIONS (Show whether DF, RT, GR, etc.)

2978.4 GR

12. COUNTY OR PARISH 13. STATE

Eddy

New Mexico

16. Check Appropriate Box To Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

TEST WATER SHUT-OFF

<input type="checkbox"/>
<input type="checkbox"/>
<input type="checkbox"/>
<input type="checkbox"/>

PULL OR ALTER CASING

<input type="checkbox"/>
<input type="checkbox"/>
<input type="checkbox"/>
<input type="checkbox"/>

FRACTURE TREAT

MULTIPLE COMPLETE

SHOOT OR ACIDIZE

ABANDON*

REPAIR WELL

CHANGE PLANS

(Other)

SUBSEQUENT REPORT OF:

WATER SHUT-OFF

<input type="checkbox"/>
<input type="checkbox"/>
<input type="checkbox"/>

FRACTURE TREATMENT

SHOOTING OR ACIDIZING

(Other) Setting Casing

REPAIRING WELL

ALTERING CASING


ABANDONMENT*

<input type="checkbox"/>
<input type="checkbox"/>
<input type="checkbox"/>
<input checked="" type="checkbox"/>

(NOTE: Report results of multiple completion on Well Completion or Recompletion Report and Log form.)

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)*

Drilled 7 7/8" hole to total depth of 7500'. Run 162 joints 5 1/2" 17# N-80 LT&C casing to 7478' and cemented with 1100 sacks 50-50 poz, 1350 sacks Halliburton Lite and 100 sacks Class "C" cement. Cement did not circulate. Ran 1" tubing to 723' and cemented with 275 sacks Class "C" cement. Circulated 10 sacks to pit.

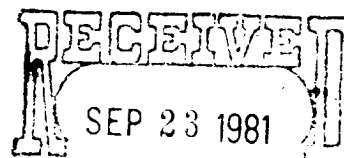

OIL & GAS
U.S. GEOLOGICAL SURVEY
ROSWELL, NEW MEXICO

18. I hereby certify that the foregoing is true and correct

SIGNED

Robert A. Chapman
ROBERT A. CHAPMAN

TITLE

Production Engineer

DATE

9-22-81

(This space for Federal or State office use)

APPROVED BY

SEP 24 1981

TITLE

DATE

U.S. GEOLOGICAL SURVEY
ROSWELL, NEW MEXICO

*See Instructions on Reverse Side