


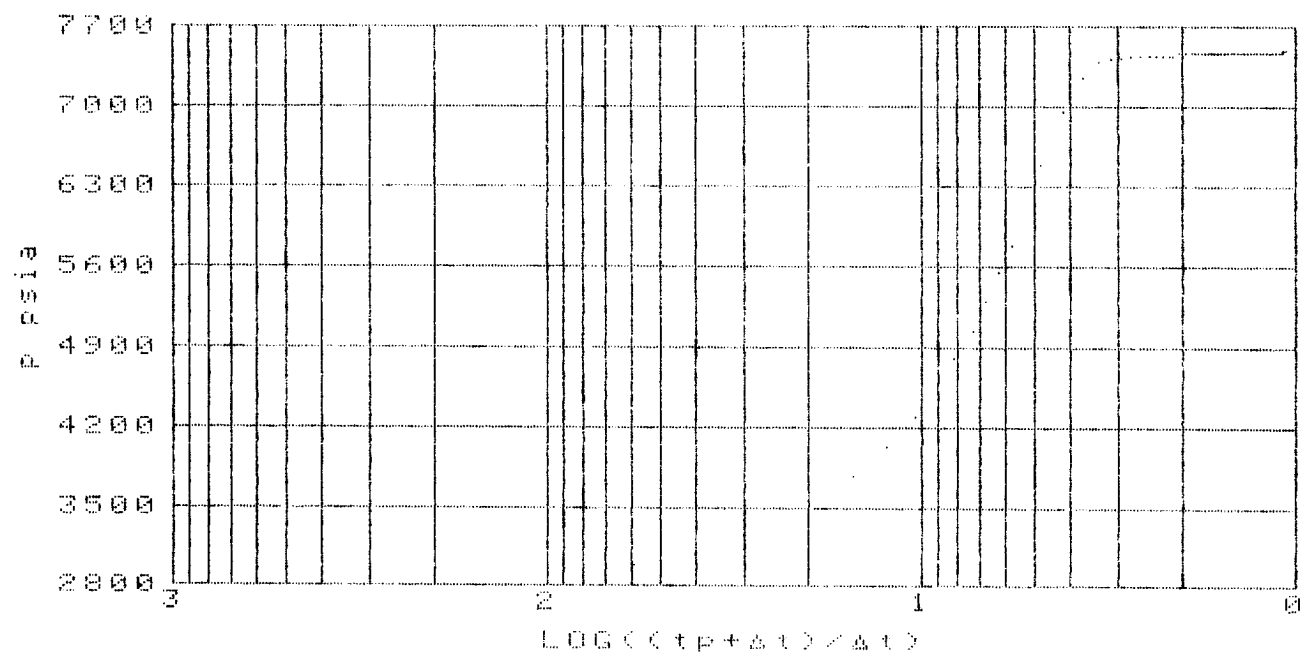

COMPANY: SANTA FE ENERGY
 LEASE: STERLING SILVER 33
 FIELD:
 COUNTY: LEA
 STATUS: BOTTOM HOLE PRESSURE BUILD UP TEST

CONTACT: TOMMY FOLSON
 WELL: #2
 ZONE:
 STATE: NEW MEXICO
 OPERATOR: JOE HERNANDEZ

PERFORATIONS FROM: 14808 ft
 DEPTH: 14725 ft

TO: 14818 ft
 TEMPERATURE: 190°F

ELEMENT# RFG3#24374
 CLOCK# 30315
 ELEMENT# RFG3#25676
 CLOCK# 28656

RANGE: 12275 psi
 RANGE: 120 hrs
 RANGE: 15125 psi
 RANGE: 120 hrs

START CLOCK	04/16/87	09:12:00	1713 psig
SET ELEMENT	04/16/87	13:39:00	1907 psig
WELL SHUT IN	04/17/87	02:10:00	1868 psig
TEST ENDED	04/20/87	07:15:00	5877 psig

FILE: 136-STG:D701

24C/qB= 0 hrs/psi

Gain= 1

tsi= 0 hrs

tp= 4.75 hrs

m= 0 psi/cycle

pA= 13.2 psia

Bias= 10 psi

pwf= 2718.16 psia

dps= 0 psi

p*= 0 psia