

UNITED STATES
DEPARTMENT OF THE INTERIOR
BUREAU OF LAND MANAGEMENT

N.M. Cons. Division
811 S. 1st Street
Artesia, NM 88210-2834

FORM APPROVED
Budget Bureau No. 1004-0135
Expires: March 31, 1993

SUNDRY NOTICES AND REPORTS ON WELLS
Do not use this form for proposals to drill or to deepen or reentry to a different reservoir.
Use "APPLICATION FOR PERMIT-" for such proposals

SUBMIT IN TRIPLICATE

1. Type of Well
☒ Oil Well ☐ Gas Well ☐ Other

2. Name of Operator
Penwell Energy, Inc.

3. Address and Telephone No.
600 N. Marienfeld, Suite 1100, Midland, Tx 79701 (915) 682-2534

4. Location of Well (Footage, Sec., T., R., M., or Survey Description)

1980' FNL & 660' FWL, Sec. 28, T-23S, R-29E

5. Lease Designation and Serial No.
NM 86024

6. If Indian, Allottee or Tribe Name

7. If Unit or CA, Agreement Designation

8. Well Name and No.
Cochiti "28" Fed. #1

9. API Well No.
30-015-30113

10. Field and Pool, or Exploratory Area
Wildcat-Bone Spring

11. County or Parish, State
Eddy County, NM

12. CHECK APPROPRIATE BOX(s) TO INDICATE NATURE OF NOTICE, REPORT, OR OTHER DATA

TYPE OF SUBMISSION	TYPE OF ACTION	
<input type="checkbox"/> Notice of Intent	<input type="checkbox"/> Abandonment	<input type="checkbox"/> Change of Plans
<input checked="" type="checkbox"/> Subsequent Report	<input type="checkbox"/> Recompletion	<input type="checkbox"/> New Construction
<input type="checkbox"/> Final Abandonment Notice	<input type="checkbox"/> Plugging Back	<input type="checkbox"/> Non-Routine Fracturing
	<input type="checkbox"/> Casing Repair	<input type="checkbox"/> Water Shut-Off
	<input type="checkbox"/> Altering Casing	<input type="checkbox"/> Conversion to Injection
	<input type="checkbox"/> Other Spud & Surface Casing	<input type="checkbox"/> Dispose Water


(Note: Report results of multiple completion on Well Completion or Recompletion Report and Log form.)

13. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)

COCHITI "28" FEDERAL #1

5/3/98 MIRU WEK Rig #3. Spudded 17 1/2" surface hole @ 12:30 AM CST 5/3/98.

5/4/98 Ran 13 3/8" surface casing, set @ 403'. Ran Centarliers in middle of 1st jt. & on collars of jts. #2, 4, & 6. BJ Services cemented w/440 sx. Class "C" cmt. containing 2% CaCl mixed @ 14.8ppg, mixing water 6.36 gals./sk., yield 1.34 cu. ft./sk. PD to 360' w/200# @ 3:30 PM CST 5/3/98. Float held OK. Circulated 85 sx. of cmt. to the pit. Job witnessed by Gene Hunt of Carlsbad BLM office.

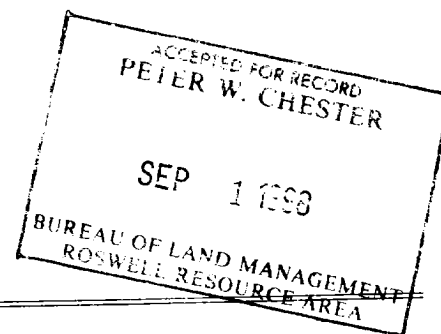

14. I hereby certify that the foregoing is true and correct

Signed Linda Walker Title Regulatory Analyst
(This space for Federal or State office use)

Date 08/04/98

Approved by _____
Conditions of approval, if any:

Title _____

Date _____