


UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY

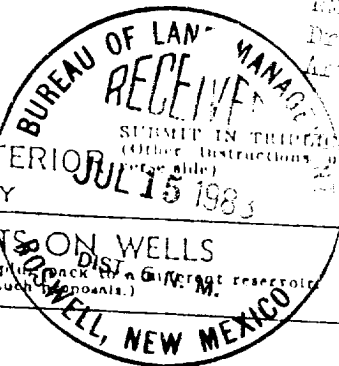

ENV. OIL CONGR. COMMISSION
Dr. J. B. B.
Artesia, NM 8810

Form approved
Budget Bureau No. 42-R11.
5. LEASE DESIGNATION AND SERIAL NO.

NM-14124

6. IF INDIAN, ALLOTTEE OR TRIBE NAME

SUNDRY NOTICES AND REPORTS ON WELLS

(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir. Use "APPLICATION FOR PERMIT" for such proposals.)

1. OIL WELL ☐ GAS WELL ☐ OTHER ☐

2. NAME OF OPERATOR

Gulf Oil Corporation

3. ADDRESS OF OPERATOR

P. O. Box 670, Hobbs, NM 88240

4. LOCATION OF WELL (Report location clearly and in accordance with any State requirements. See also space 17 below.)
At surface

AUG 15 1983

O. C. D.
ARTESIA, OFFICE

7. UNIT AGREEMENT NAME

8. FARM OR LEASE NAME

Marguarette

9. WELL NO.

White City Park

11. SEC. T. R. M. OR BLM AND SURVEY OR AREA

Sec 1-T25S-R26E

12. COUNTY OR PARISH 13. STATE

Eddy NM

14. PERMIT NO.

15. ELEVATIONS (Show whether OF, RT, GR, etc.)

3315' GL

16.

Check Appropriate Box To Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

TEST WATER SHUT-OFF

FRACTURE TREAT

SHOOT OR ACIDIZE

REPAIR WELL

(Other)

PULL OR ALTER CASING

MULTIPLE COMPLETE

ABANDON*

CHANGE PLANS

SUBSEQUENT REPORT OF:

WATER SHUT-OFF

FRACTURE TREATMENT

SHOOTING OR ACIDIZING

(Other)

REPAIRING WELL

ALTERING CASING

ABANDONMENT*

(Note: Report results of multiple completion on Well Completion or Recompletion Report and Log form.)

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting and proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)

Perf 11/13-17' 11/101-05' 11/086-90' 11/059-61' (4) JHPF. AC. w/1000 gals
7 1/2% Morrow acid, avg pres 3520# 131P 3800# AIR 4 1/2 BPM Swab.
Perf 11/194-46' w/11 JHPF. 11/299-303' 11/352-56' 11/435-39' w/12 JHPF +
11/466-68' w/11 JHPF. Swab. AC. w/5000 gals 7 1/2% Morrow acid (48)
RCNB's. AIR 4 1/2 BPM, 131P 5000# avg pres 6500#. Swab water only.
Complete after adding perf's + acidizing. Job unsuccessful.
Well closed in pending evaluation.

18. I hereby certify that the foregoing is true and correct

SIGNED

R. D. Pite

TITLE

Area Engineer

(This space for Federal or State office use)

ACCEPTED FOR RECORD

APPROVED BY

CONDITIONS OF APPROVAL, IF ANY:

TITLE

AUG 17 1983