


District I
1625 N. French Dr., Hobbs, NM 88240
District II
1301 W. Grand Avenue, Artesia, NM 88210
District III
1000 Rio Brazos Road, Aztec, NM 87410
District IV
1220 S. St. Francis Dr., Santa Fe, NM 87505

State of New Mexico
Energy Minerals and Natural Resources

Oil Conservation Division
1220 South St. Francis Dr.
Santa Fe, NM 87505

Submit 1 copy to
appropriate
District Office
and 1 copy to
the Santa Fe Office

(Revised 3/9/94)

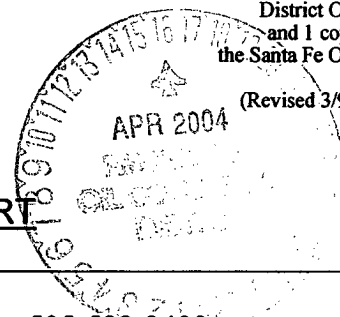

PIT REMEDIATION AND CLOSURE REPORT

30-039-21575

Operator: ConocoPhillips Telephone: 505-599-3400

Address: 5525 US Highway 64, Farmington, NM 87401

Facility Or: SJ 29-6 # 41 A
Well Name

Location: Unit or Qtr/Qtr Sec XJ Sec 24 T 29 N R 6 W County Rio Arriba

Pit Type: Separator X Dehydrator Other

Land Type: BLM X State Fee Other

Pit Location: Pit dimensions: length 25-ft, width 15-ft, depth 3-ft
(Attach diagram)

Reference: wellhead , other Longitude and Latitude

Wellhead: Longitude: -107.41063 Latitude: 36.70827

Pit: Longitude: -107.41071 Latitude: 36.7085

Depth To Ground Water (Vertical distance from contaminants to seasonal high water elevation of ground water.)	Less than 50 feet 50 feet to 99 feet Greater than 100 feet	(20 points) (10 points) (0 points) <u>0</u>
---	--	--

Wellhead Protection Area: (Less than 200 feet from a private domestic water source, or; less than 1000 feet from all other water sources.)	Yes No	(20 points) (0 points) <u>0</u>
---	-----------	-------------------------------------

Distance To Surface Water: (Horizontal distance to perennial lakes, ponds, rivers, streams, creeks, irrigation canals and ditches.)	Less than 200 feet 200 feet to 1000 feet Greater than 1000 feet	(20 points) (10 points) (0 points) <u>0</u>
--	---	--

RANKING SCORE (TOTAL POINTS): 0

Date Remediation Started: 11/13/02 Date completed: 11/13/02

Remediation Method: Excavation _____ Approx. cubic yards _____
(Check all appropriate sections.) Landfarmed _____ Insitu Bioremediation _____

Other Assessed pit by sampling soil beneath pit bottom

Remediation Location: Onsite _____ Offsite _____
(i.e. landfarmed onsite,
name and location of
offsite facility)

General Description of Remedial Action: _____

The pit was assessed and sampled in accordance with NMOCD guidelines

Ground Water Encountered: No X Yes _____ Depth _____

Final Pit: Sample location Soil sample collected from center of pit with hand probe

Closure Sampling:
(if multiple samples,
attach sample results
and diagram of sample
locations and depths)

Sample depth 3-feet below pit bottom

Sample Date 11/13/02 Sample time 13:35

Sample Results

Benzene(ppm) 0.083

Total BTEX(ppm) 12.443

Field headspace(ppm) _____

TPH 26 ppm

Ground Water Sample: Yes _____ No X (If yes, attach sample results)


I hereby certify that the information above is true and complete to the best of my knowledge and belief.

Date 4/9/04

Signature Larry Trujillo

Printed Name
and Title Larry Trujillo, Sr. Environmental Technician

Site Diagram:

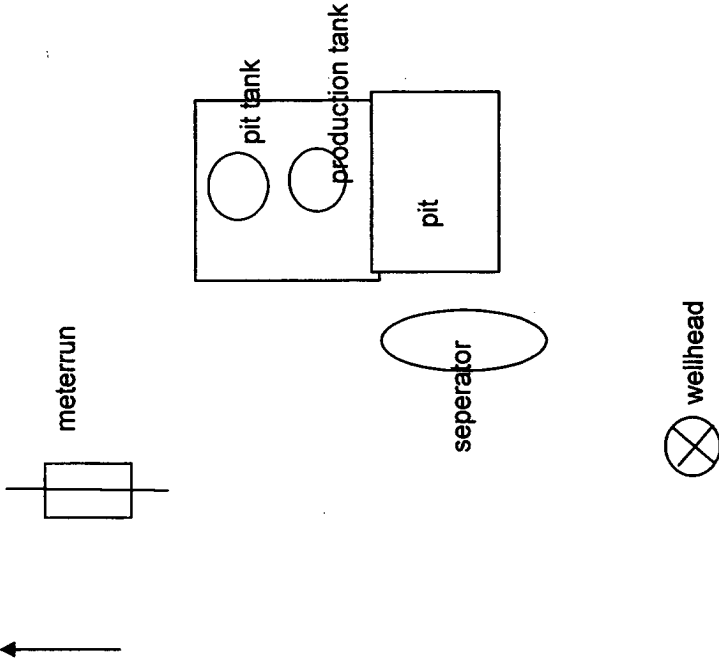


Location:	SJ 29-6 #41A		
Footages:			
Unit Letter:	I	Sec.	24 Twn. 29N Rng 6W
Latitude:			Longitude:
Lease Num.			Land Type:
Pit Type:			
Pit Reference :			
Wellhead:	Longitude: 107.41063	Latitude:	36.70827
Pit	Longitude: 107.41071	Latitude:	36.7085
Initial size:	15x25x3 deep		
Final Size:	15x25x3 deep		
Total Cubic Yards:			
Distanes from (ft):			
Groundwater:	>100 feet		
Wellhead Protection Area:	>1000 feet		
Nearest Surface Water:	>1000 feet		
Distance to ephemeral strea	N/A		
(Navajo/Jicarilla only)			
Ranking Score (points):	0		

Sample ID	Description	OVM Reading
1		
2		
3		
4		
5		
6		
7		
8		
9		
10		

Comments:

Not to Scale





Pace Analytical Services, Inc.
 9608 Loiret Blvd.
 Lenexa, KS 66219
 Phone: 913.599.5665
 Fax: 913.599.1759

Lab Project Number: 6064930
 Client Project ID: PHILLIPS PIT PROGRAM

Lab Sample No: 605613843 Project Sample Number: 6064930-023 Date Collected: 11/13/02 13:35
 Client Sample ID: 133513NOV02 Matrix: Soil Date Received: 11/19/02 09:00

Parameters	Results	Units	Report Limit	DF	Analyzed	By	CAS No.	Qual	RegLmt
------------	---------	-------	--------------	----	----------	----	---------	------	--------

GC Semivolatiles

Total Extractable Hydrocarbons	Prep/Method: OA2 / OA2								
Mineral Spirits	ND	mg/kg	12.		1.2 11/22/02 00:58 SEC				
Jet Fuel	ND	mg/kg	12.		1.2 11/22/02 00:58 SEC				
Kerosene	ND	mg/kg	12.		1.2 11/22/02 00:58 SEC				
Diesel Fuel	ND	mg/kg	12.		1.2 11/22/02 00:58 SEC		68334-30-5		
Fuel Oil	ND	mg/kg	12.		1.2 11/22/02 00:58 SEC		68334-30-5		
Motor Oil	ND	mg/kg	12.		1.2 11/22/02 00:58 SEC				
Total Petroleum Hydrocarbons	26.	mg/kg	12.		1.2 11/22/02 00:58 SEC				
n-Tetracosane (S)	85	%			1.0 11/22/02 00:58 SEC		646-31-1		
p-Terphenyl (S)	99	%			1.0 11/22/02 00:58 SEC		92-94-4		
Date Extracted	11/20/02				11/20/02				

Organics Prep

Percent Moisture	Method:								
Percent Moisture	18.1	%			1.0 11/21/02	MAM			

GC Volatiles

Aromatic Volatile Organics	Prep/Method: EPA 5030 Medium Soil / EPA 8021								
Benzene	83.	ug/kg	60.		1.2 11/21/02 17:42		71-43-2		
Ethylbenzene	260	ug/kg	60.		1.2 11/21/02 17:42		100-41-4		
Toluene	2200	ug/kg	60.		1.2 11/21/02 17:42		108-88-3		
Xylene (Total)	9900	ug/kg	150		1.2 11/21/02 17:42		1330-20-7		
a,a,a-Trifluorotoluene (S)	0	%			1.0 11/21/02 17:42		98-08-8	7	

REPORT OF LABORATORY ANALYSIS

This report shall not be reproduced, except in full,
 without the written consent of Pace Analytical Services, Inc.