


(SUBMIT IN TRIPLICATE)
UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY

Land Office **Jicarilla Tribal**
Lease No. **Jicarilla Tribal**
Unit **Tract #1**

SUNDRY NOTICES AND REPORTS ON WELLS

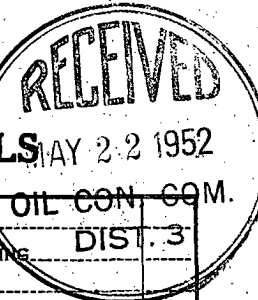

NOTICE OF INTENTION TO DRILL	SUBSEQUENT REPORT OF WATER SHUT-OFF	
NOTICE OF INTENTION TO CHANGE PLANS	SUBSEQUENT REPORT OF SHOOTING OR ACIDIZING	
NOTICE OF INTENTION TO TEST WATER SHUT-OFF	SUBSEQUENT REPORT OF ALTERING CASING	
NOTICE OF INTENTION TO RE-DRILL OR REPAIR WELL	SUBSEQUENT REPORT OF REDRILLING OR REPAIR	
NOTICE OF INTENTION TO SHOOT OR ACIDIZE	SUBSEQUENT REPORT OF ABANDONMENT	
NOTICE OF INTENTION TO PULL OR ALTER CASING	SUPPLEMENTARY WELL HISTORY	
NOTICE OF INTENTION TO ABANDON WELL	Subsequent Report of D.S.T.	X

(INDICATE ABOVE BY CHECK MARK NATURE OF REPORT, NOTICE, OR OTHER DATA)

Farmington New Mexico May 21, 1952

Jicarilla Tribal
Well No. **1** is located **790** ft. from **NE** line and **840** ft. from **EW** line of sec. **21**
SW4 of SW4 Sec. 21 **32-N** **3-W** **N.M.P.M.**
(1/4 Sec. and Sec. No.) (Twp.) (Range) (Meridian)
Wilcoat **Rio Arriba** **New Mexico.**
(Field) (County or Subdivision) (State or Territory)

The elevation of the derrick floor above sea level is **7028** ft.

DETAILS OF WORK

(State names of and expected depths to objective sands; show sizes, weights, and lengths of proposed casings; indicate mudding jobs, cementing points, and all other important proposed work)

Depth 1548' shale. On 5-20-52 took D.S.T. No. 1 from 1259' to 1548'. Test tool open one hour. Steady blow of air thruout test. No gas. Recovered 410 feet of slightly air or gas cut drilling mud. Mud did not have any detectable gas odor. Flowing pressure 95 to 190#. 15 minute shut-in B.H.P. - 175#. Hydrostatic pressure - 660#.

I understand that this plan of work must receive approval in writing by the Geological Survey before operations may be commenced.

Company **The Texas Company**
Address **P.O. Box 1221**
Pampa, Texas

By **P. Bromm**
Title **Asst. Dist. Supt.**