District I 1625 N. French Dr., Hobbs, NM 88240 District II 811 S. First St., Artesia, NM 88210 District III 1000 Rio Brazos Road, Aztec, NM 87410 District IV 1220 S. St. Francis Dr., Santa Fe, NM 87505

14297

Type of action:

Form C-144

## State of New Mexico Energy Minerals and Natural Resources Department Oil Conservation Division 1220 South St. Francis Dr. Santa Fe, NM 87505

Form C-144 Revised June 6, 2013

For temporary pits, below-grade tanks, and multi-well fluid management pits, submit to the appropriate NMOCD District Office.

For permanent pits submit to the Santa Fe Environmental Bureau office and provide a copy to the appropriate NMOCD District Office.

RECEIVED

Page 1 of 6

By kcollins at 8:07 am, Mar 09, 2016

# Pit, Below-Grade Tank, or Proposed Alternative Method Permit or Closure Plan Application

Below grade tank registration

Permit of a pit or proposed alternative method

14297	Closure of a pit, below-grade tank, or proposed alternative method  Modification to an existing permit/or registration  Closure plan only submitted for an existing permitted or non-permitted pit, below-grade tank, posed alternative method
	ctions: Please submit one application (Form C-144) per individual pit, below-grade tank or alternative request
Di la dada dikat annua	and of this request does not relieve the operator of liability should operations result in pollution of surface water, ground water or the
a particular control €0, 1945 may 2	
API Number: 30-045-2	1172OCD Permit Number:
U/L or Qtr/QtrO_	Section 05 Township 29 N Range 8W County: San Juan
Center of Proposed Des	ign: Latitude36.74957 <u>•N</u> Longitude107.69362 <u>•W</u> NAD: □1927 ☑ 1983
Surface Owner: X Fed	eral State Private Tribal Trust or Indian Allotment
2.	
Pit: Subsection F,	G or J of 19.15.17.11 NMAC
Permanent Emer	gency ☐ Cavitation ☐ P&A ☐ Multi-Well Fluid Management Low Chloride Drilling Fluid ☐ yes ☐ no
Lined Unlined	Liner type: Thicknessmil
☐ String-Reinforced	
Liner Seams: Weld	ed Factory Other Volume: bbl Dimensions: L x W x D
	Subsection Lof 19 15 17 11 NMAC
Liner type: Thickness	45 mil   HDFE   FVC   Ottler   EEDFE
4.	
Please be advised that approval of this request does not relieve the operator of liability should operations result in pollution of surface water, ground we environment. Nor does approval relieve the operator of its responsibility to comply with any other applicable governmental authority's rules, regulation of the property of the operator of its responsibility to comply with any other applicable governmental authority's rules, regulation of proposed property of the operator of its responsibility to comply with any other applicable governmental authority's rules, regulation of proposed property of the operator of its responsibility to comply with any other applicable governmental authority's rules, regulation of proposed p	on request is required. Exceptions must be submitted to the Salita Fe Environmental Bureau office for consideration of approval.
5.	the state of the s
Fencing: Subsection	of 19.15.17.11 NMAC (Applies to permanent pits, temporary pits, and below-grade talks)
	in height, two strands of barbed wire at top (Requirea ij locatea within 1000 jeet of a permanent residence, school, hospital,
	our strands of barbed wire evenly spaced between one and four feet

Oil Conservation Division

	6.  Netting: Subsection E of 19.15.17.11 NMAC (Applies to permanent pits and permanent open top tanks)	
	☐ Screen ☐ Netting ☐ Other	
	☐ Monthly inspections (If netting or screening is not physically feasible)	
	7.	
	Signs: Subsection C of 19.15.17.11 NMAC	
	12"x 24", 2" lettering, providing Operator's name, site location, and emergency telephone numbers	
	☐ Signed in compliance with 19.15.16.8 NMAC	
	Variances and Exceptions:	
	Justifications and/or demonstrations of equivalency are required. Please refer to 19.15.17 NMAC for guidance.  Please check a box if one or more of the following is requested, if not leave blank:	
	Variance(s): Requests must be submitted to the appropriate division district for consideration of approval.	
	Exception(s): Requests must be submitted to the Santa Fe Environmental Bureau office for consideration of approval.	
L		
	9. Siting Criteria (regarding permitting): 19.15.17.10 NMAC	n: <b>2:2</b> 0: :::::::::::::::::::::::::::::::::
	Instructions: The applicant must demonstrate compliance for each siting criteria below in the application. Recommendations of accept material are provided below. Siting criteria does not apply to drying pads or above-grade tanks.	table source
	material are provided below. Sitting criteria does not apply to drying pads of above-grade tanks.	
	General siting	
		☐ Yes ☐ No
	Ground water is less than 25 feet below the bottom of a low chloride temporary pit or below-grade tank.  - NM Office of the State Engineer - iWATERS database search; USGS; Data obtained from nearby wells	NA NA
		☐ Yes ☐ No
	Ground water is less than 50 feet below the bottom of a Temporary pit, permanent pit, or Multi-Well Fluid Management pit.  NM Office of the State Engineer - iWATERS database search; USGS; Data obtained from nearby wells	⊠ NA
	Within incorporated municipal boundaries or within a defined municipal fresh water well field covered under a municipal ordinance	☐ Yes ☐ No
	adopted pursuant to NMSA 1978, Section 3-27-3, as amended. (Does not apply to below grade tanks)  - Written confirmation or verification from the municipality; Written approval obtained from the municipality	
	Within the area overlying a subsurface mine. (Does not apply to below grade tanks)  - Written confirmation or verification or map from the NM EMNRD-Mining and Mineral Division	☐ Yes ☐ No
	Within an unstable area. (Does not apply to below grade tanks)	☐ Yes ☐ No
	- Engineering measures incorporated into the design; NM Bureau of Geology & Mineral Resources; USGS; NM Geological Society; Topographic map	
	Within a 100-year floodplain. (Does not apply to below grade tanks)	☐ Yes ☐ No
	- FEMA map	
	Below Grade Tanks	
	Within 100 feet of a continuously flowing watercourse, significant watercourse, lake bed, sinkhole, wetland or playa lake (measured	☐ Yes ☑ No
	from the ordinary high-water mark).	
	- Topographic map; Visual inspection (certification) of the proposed site	
	Within 200 horizontal feet of a spring or a fresh water well used for public or livestock consumption;.  NM Office of the State Engineer - iWATERS database search; Visual inspection (certification) of the proposed site	☐ Yes ☑ No
	Temporary Pit using Low Chloride Drilling Fluid (maximum chloride content 15,000 mg/liter)	
	Within 100 feet of a continuously flowing watercourse, or any other significant watercourse or within 200 feet of any lakebed, sinkhole,	☐ Yes ☐ No
	or playa lake (measured from the ordinary high-water mark). (Applies to low chloride temporary pits.)  - Topographic map; Visual inspection (certification) of the proposed site	
		□ V□ No
	Within 300 feet from a occupied permanent residence, school, hospital, institution, or church in existence at the time of initial application.	Yes No
	- Visual inspection (certification) of the proposed site; Aerial photo; Satellite image	
	Within 200 horizontal feet of a spring or a private, domestic fresh water well used by less than five households for domestic or stock	
	watering purposes, or 300fcet of any other fresh water well or spring, in existence at the time of the initial application.  NM Office of the State Engineer - iWATERS database search; Visual inspection (certification) of the proposed site	Yes No

١	Within 100 feet of a wetland US Fish and Wildlife Wetland Identification map; Topographic map; Visual inspection (certification) of the proposed site	☐ Yes ☐ No
,	Temporary Pit Non-low chloride drilling fluid	
1	Within 300 feet of a continuously flowing watercourse, or any other significant watercourse, or within 200 feet of any lakebed, sinkhole, or playa lake (measured from the ordinary high-water mark).  - Topographic map; Visual inspection (certification) of the proposed site	☐ Yes ☐ No
3	Within 300 feet from a permanent residence, school, hospital, institution, or church in existence at the time of initial application.  - Visual inspection (certification) of the proposed site; Aerial photo; Satellite image	☐ Yes ☐ No
	Within 500 horizontal feet of a spring or a private, domestic fresh water well used by less than five households for domestic or stock watering purposes, or 1000 feet of any other fresh water well or spring, in the existence at the time of the initial application;  - NM Office of the State Engineer - iWATERS database search; Visual inspection (certification) of the proposed site	☐ Yes ☐ No
	Within 300 feet of a wetland US Fish and Wildlife Wetland Identification map; Topographic map; Visual inspection (certification) of the proposed site	Yes No
	Permanent Pit or Multi-Well Fluid Management Pit	
	Within 300 feet of a continuously flowing watercourse, or 200 feet of any other significant watercourse, or lakebed, sinkhole, or playa lake (measured from the ordinary high-water mark).  - Topographic map; Visual inspection (certification) of the proposed site	Yes No
	Within 1000 feet from a permanent residence, school, hospital, institution, or church in existence at the time of initial application.  - Visual inspection (certification) of the proposed site; Aerial photo; Satellite image	☐ Yes ☐ No
	Within 500 horizontal feet of a spring or a fresh water well used for domestic or stock watering purposes, in existence at the time of initial application.  - NM Office of the State Engineer - iWATERS database search; Visual inspection (certification) of the proposed site	Yes No
	Within 500 feet of a wetland US Fish and Wildlife Wetland Identification map; Topographic map; Visual inspection (certification) of the proposed site	☐ Yes ☐ No
	Temporary Pits, Emergency Pits, and Below-grade Tanks Permit Application Attachment Checklist: Subsection B of 19.15.17.9  Instructions: Each of the following items must be attached to the application. Please indicate, by a check mark in the box, that the deattached.  Hydrogeologic Report (Below-grade Tanks) - based upon the requirements of Paragraph (4) of Subsection B of 19.15.17.9 NMAC Hydrogeologic Data (Temporary and Emergency Pits) - based upon the requirements of Paragraph (2) of Subsection B of 19.15.17 Siting Criteria Compliance Demonstrations - based upon the appropriate requirements of 19.15.17.10 NMAC Design Plan - based upon the appropriate requirements of 19.15.17.12 NMAC Operating and Maintenance Plan - based upon the appropriate requirements of 19.15.17.12 NMAC Closure Plan (Please complete Boxes 14 through 18, if applicable) - based upon the appropriate requirements of Subsection C of 19 and 19.15.17.13 NMAC Previously Approved Design (attach copy of design) API Number:  or Permit Number:	.9 NMAC 9.15.17.9 NMAC
	Multi-Well Fluid Management Pit Checklist: Subsection B of 19.15.17.9 NMAC  Instructions: Each of the following items must be attached to the application. Please indicate, by a check mark in the box, that the attached.  Design Plan - based upon the appropriate requirements of 19.15.17.11 NMAC  Design Plan - based upon the appropriate requirements of 19.15.17.12 NMAC  A List of wells with approved application for permit to drill associated with the pit.  Closure Plan (Please complete Boxes 14 through 18, if applicable) - based upon the appropriate requirements of Subsection C of and 19.15.17.13 NMAC  Hydrogeologic Data - based upon the requirements of Paragraph (4) of Subsection B of 19.15.17.9 NMAC  Siting Criteria Compliance Demonstrations - based upon the appropriate requirements of 19.15.17.10 NMAC  Previously Approved Design (attach copy of design) API Number: or Permit Number: or Permit Number:	19.15.17.9 NMAC
	10 Approximate (10 to 10	

12.  Permanent Pits Permit Application Checklist: Subsection B of 19.15.17.9 NMAC  Instructions: Each of the following items must be attached to the application. Please indicate, by a check mark in the box, that the doc	cuments are
attached.  Hydrogeologic Report - based upon the requirements of Paragraph (1) of Subsection B of 19.15.17.9 NMAC  Siting Criteria Compliance Demonstrations - based upon the appropriate requirements of 19.15.17.10 NMAC	
☐ Climatological Factors Assessment ☐ Certified Engineering Design Plans - based upon the appropriate requirements of 19.15.17.11 NMAC ☐ Dike Protection and Structural Integrity Design - based upon the appropriate requirements of 19.15.17.11 NMAC ☐ Leak Detection Design - based upon the appropriate requirements of 19.15.17.11 NMAC ☐ Liner Specifications and Compatibility Assessment - based upon the appropriate requirements of 19.15.17.11 NMAC ☐ Quality Control/Quality Assurance Construction and Installation Plan	
☐ Quality Control Quality Assurance Construction and Installation Fide. ☐ Operating and Maintenance Plan - based upon the appropriate requirements of 19.15.17.12 NMAC ☐ Freeboard and Overtopping Prevention Plan - based upon the appropriate requirements of 19.15.17.11 NMAC ☐ Nuisance or Hazardous Odors, including H₂S, Prevention Plan ☐ Emergency Response Plan	
Oil Field Waste Stream Characterization	
<ul> <li>☐ Monitoring and Inspection Plan</li> <li>☐ Erosion Control Plan</li> <li>☐ Erosion Control Plan</li> </ul>	
Closure Plan - based upon the appropriate requirements of Subsection C of 19.15.17.9 NMAC and 19.15.17.13 NMAC	
13.  Proposed Closure: 19.15.17.13 NMAC  Instructions: Please complete the applicable boxes, Boxes 14 through 18, in regards to the proposed closure plan.	. P'
Type: Drilling Workover Emergency Cavitation P&A Permanent Pit Below-grade Tank Multi-well Flui	id Management Pit
Proposed Closure Method: Waste Excavation and Removal Waste Removal (Closed-loop systems only)	
On-site Closure Method (Only for temporary pits and closed-loop systems)	
☐ In-place Burial ☐ On-site Trench Burial ☐ Alternative Closure Method	
Waste Excavation and Removal Closure Plan Checklist: (19.15.17.13 NMAC) Instructions: Each of the following items must be at closure plan. Please indicate, by a check mark in the box, that the documents are attached.  □ Protocols and Procedures - based upon the appropriate requirements of 19.15.17.13 NMAC  □ Confirmation Sampling Plan (if applicable) - based upon the appropriate requirements of Subsection C of 19.15.17.13 NMAC  □ Disposal Facility Name and Permit Number (for liquids, drilling fluids and drill cuttings)  □ Soil Backfill and Cover Design Specifications - based upon the appropriate requirements of Subsection H of 19.15.17.13 NMAC  □ Re-vegetation Plan - based upon the appropriate requirements of Subsection H of 19.15.17.13 NMAC  □ Site Reclamation Plan - based upon the appropriate requirements of Subsection H of 19.15.17.13 NMAC	
Siting Criteria (regarding on-site closure methods only): 19.15.17.10 NMAC Instructions: Each siting criteria requires a demonstration of compliance in the closure plan. Recommendations of acceptable source provided below. Requests regarding changes to certain siting criteria require justifications and/or demonstrations of equivalency. Plants, 17.10 NMAC for guidance.	e material are ease refer to
Ground water is less than 25 feet below the bottom of the buried waste.  - NM Office of the State Engineer - iWATERS database search; USGS; Data obtained from nearby wells	☐ Yes ☐ No ☐ NA
Ground water is between 25-50 feet below the bottom of the buried waste - NM Office of the State Engineer - iWATERS database search; USGS; Data obtained from nearby wells	Yes No
Ground water is more than 100 feet below the bottom of the buried waste.  - NM Office of the State Engineer - iWATERS database search; USGS; Data obtained from nearby wells	Yes No
Within 100 feet of a continuously flowing watercourse, or 200 feet of any other significant watercourse, lakebed, sinkhole, or playa lake (measured from the ordinary high-water mark).  - Topographic map; Visual inspection (certification) of the proposed site	Yes No
Within 300 feet from a permanent residence, school, hospital, institution, or church in existence at the time of initial application.  - Visual inspection (certification) of the proposed site; Aerial photo; Satellite image	☐ Yes ☐ No
Within 300 horizontal feet of a private, domestic fresh water well or spring used for domestic or stock watering purposes, in existence at the time of initial application.  - NM Office of the State Engineer - iWATERS database; Visual inspection (certification) of the proposed site	Yes No
Written confirmation or verification from the municipality; Written approval obtained from the municipality	☐ Yes ☐ No
Within 300 feet of a wetland. US Fish and Wildlife Wetland Identification map; Topographic map; Visual inspection (certification) of the proposed site	☐ Yes ☐ No
Within incorporated municipal boundaries or within a defined municipal fresh water well field covered under a municipal ordinance	

adopted pursuant to NMSA 1978, Section 3-27-3, as amended.  - Written confirmation or verification from the municipality; Written approval obtained from the municipality	☐ Yes ☐ No
Within the area overlying a subsurface mine.  - Written confirmation or verification or map from the NM EMNRD-Mining and Mineral Division	☐ Yes ☐ No
<ul> <li>Within an unstable area.</li> <li>Engineering measures incorporated into the design; NM Bureau of Geology &amp; Mineral Resources; USGS; NM Geological Society; Topographic map</li> </ul>	☐ Yes ☐ No
Within a 100-year floodplain FEMA map	☐ Yes ☐ No
On-Site Closure Plan Checklist: (19.15.17.13 NMAC) Instructions: Each of the following items must be attached to the closure plan by a check mark in the box, that the documents are attached.  Siting Criteria Compliance Demonstrations - based upon the appropriate requirements of 19.15.17.10 NMAC  Proof of Surface Owner Notice - based upon the appropriate requirements of Subsection E of 19.15.17.13 NMAC  Construction/Design Plan of Burial Trench (if applicable) based upon the appropriate requirements of Subsection K of 19.15.17  Construction/Design Plan of Temporary Pit (for in-place burial of a drying pad) - based upon the appropriate requirements of 19.15.17.13 NMAC	.11 NMAC
Construction/Design Plan of Temporary Pit (for in-place outlat of a drying plan)  Protocols and Procedures - based upon the appropriate requirements of 19.15.17.13 NMAC  Confirmation Sampling Plan (if applicable) - based upon the appropriate requirements of 19.15.17.13 NMAC  Waste Material Sampling Plan - based upon the appropriate requirements of 19.15.17.13 NMAC  Disposal Facility Name and Permit Number (for liquids, drilling fluids and drill cuttings or in case on-site closure standards cant  Soil Cover Design - based upon the appropriate requirements of Subsection H of 19.15.17.13 NMAC  Re-vegetation Plan - based upon the appropriate requirements of Subsection H of 19.15.17.13 NMAC  Site Reclamation Plan - based upon the appropriate requirements of Subsection H of 19.15.17.13 NMAC	
Operator Application Certification:  I hereby certify that the information submitted with this application is true, accurate and complete to the best of my knowledge and be	lief.
Name (Print): Title:	
Signature: Date:	
e-mail address: Telephone:	
18. OCD Approval: Permit Application (including closure plan) Closure Plan (only) COD Conditions (see attachment)	
OCD Representative Signature: Approval Date: 04-06	-2016
Title: Environmental Specialist OCD Permit Number:	
19. Closure Report (required within 60 days of closure completion): 19.15.17.13 NMAC Instructions: Operators are required to obtain an approved closure plan prior to implementing any closure activities and submitted. The closure report is required to be submitted to the division within 60 days of the completion of the closure activities. Please do not section of the form until an approved closure plan has been obtained and the closure activities have been completed.  Closure Completion Date: 6/24//13	ng the closure repor ot complete this
Closure Method:  ☐ Waste Excavation and Removal ☐ On-Site Closure Method ☐ Alternative Closure Method ☐ Waste Removal (Closed ☐ If different from approved plan, please explain.	-loop systems only)
N	
Closure Report Attachment Checklist: Instructions: Each of the following items must be attached to the closure report. Please mark in the box, that the documents are attached.  □ Proof of Closure Notice (surface owner and division) □ Proof of Deed Notice (required for on-site closure for private land only) □ Plot Plan (for on-site closures and temporary pits) □ Confirmation Sampling Analytical Results (if applicable) □ Waste Material Sampling Analytical Results (required for on-site closure) □ Disposal Facility Name and Permit Number □ Soil Backfilling and Cover Installation □ Re-vegetation Application Rates and Seeding Technique □ Site Reclamation (Photo Documentation) □ On-site Closure Location: Latitude □ N Longitude □ W NAD: □ 1927 □ 1983	indicate, by a check

Operator Closure Certification:  I hereby certify that the information and attachments submitted with this closure report is true, accurate and complete to the best of my knowledge and belief. I also certify that the closure complies with all applicable closure requirements and conditions specified in the approved closure plan.
Title: Regulatory Technician
Signature: Date: 3-8-16
e-mail address: Larissa.L.Farrell@cop.com Telephone: (505)326-9504

## Burlington Resources Oil & Gas Company, LP San Juan Basin Below Grade Tank Closure Report

Lease Name: Sunray 5 API No.: 30-045-21172

In accordance with Rule 19.15.17.13 NMAC the following information describes the closure of the below-grade tank referenced above. All proper documentation regarding closure activities is being included with the C-144.

### General Plan:

1. BR shall close a below-grade tank within 60 days of cessation of operations per Subsection G.4 of 19.15.17.13 NMAC. This will include a) below-grade tanks that do not meet the requirements of Paragraphs (1) through (4) of Subsection I of 19.15.17.11 NMAC or is not included in Paragraph (5) of Subsection I of 19.15.17.11 NMAC within five years, if not retrofitted to comply with Paragraphs (1) through (4) of Subsection I of 19.15.17.11 NMAC; b) an earlier date that the division requires because of imminent danger to fresh water, public health or the environment. For any closure, BR will file the C144 Closure Report as required.

The below-grade tank referenced above was permitted and closed within 60 days of cessation of the below-grade tanks operation.

2. BR shall remove liquids and sludge from a below-grade tank prior to implementing a closure method and shall dispose of the liquids and sludge in a division-approved facility. The facilities to be used will be Basin Disposal (Permit #NM-01-005), JFJ Landfarm % Industrial Ecosystem Inc. (Permit # NM-01-0010B) and Envirotech Land Farm (Permit #NM-01-011). The liner after being cleaned well (Subsection D, Paragraph 1, Subparagraph (m) of 19.15.9.712 NMAC) will be disposed of at the San Juan County Regional Landfill located on CR 3100.

All recovered liquids were disposed of at Basin Disposal (Permit #NM-01-005) and any sludge or soil required to be removed to facilitate closure was hauled to Envirotech Land Farm (Permit #NM-01-011) and JFJ Landfarm % IEI (Permit #NM-01-0010B). The liner was cleaned per Subsection D, Paragraph 1, Subparagraph (m) of 19.15.9.712 NMAC was disposed of at the San Juan County Regional Landfill located on CR 3100.

 BR will receive prior approval to remove the below-grade tank and dispose of it in a division-approved facility or recycle, reuse, or reclaim it in a manner that the appropriate division district office approves.

The below-grade tank was disposed of in a division-approved manner.

4. If there is any on-site equipment associated with a below-grade tank, then BR shall remove the equipment, unless the equipment is required for some other purpose.

All on-site equipment associated with the below-grade tank was removed.

5. BR will test the soils beneath the below-grade tank to determine whether a release has occurred. BR shall collect, at a minimum, a five point, composite sample; collect individual grab samples from any area that is wet, discolored or showing other evidence of a release; and analyzed for the constituents listed in Table I of 19.15.17.13 NMAC. COPC shall notify the division of its results on form C-141.

A five point composite sample was taken of the below-grade tank using sampling tools and all samples tested per Subsection B of 19.15.17.1 3(B)(1)(b). (Sample results attached). Form C-141 is attached.

	Tests Method	Limit (mg/kg
Components	EPA SW-846 8021B or 8260B	0.2
Benzene	EPA SW-846 8021B or 8260B	50
BTEX		100
TPH	EPA SW-846 418.1	250
Chlorides	EPA 300.0	250

6. If BR or the division determines that a release has occurred, then BR shall comply with 19.15.3.116 NMAC and 19.15.1.19 NMAC, as appropriate.

# A release was not determined for the above referenced well.

7. If the sampling program demonstrates that a release has not occurred or that any release does not exceed the concentrations specified in Table I of 19.15.17.13 NMAC, then BR shall backfill the excavation with compacted, non-waste containing, earthen material; construct a division-prescribed soil cover; recontour and re-vegetate the

The below-grade tank area passed all requirements of Paragraph (4) of Subsection E of 19.15.17.13 NMAC and was backfilled with compacted, non-waste containing, earthen material.

- 8. Notice of Closure will be given prior to closure to the Aztec Division office between 72 hours and one week via email or verbally. The notification of closure will include the following:
  - i. Operator's name
  - ii. Location by Unit Letter, Section, Township, and Range. Well name and API number.

### Notification was not found.

The surface owner shall be notified of BR's closing of the below-grade tank 72 hours, but not more than one week, prior to closure as per the approved closure plan via certified mail, return receipt requested.

The closure process notification to the landowner was not found.

10. Re-contouring of location will match fit, shape, line, form and texture of the surrounding. Re-shaping will include drainage control, prevent ponding, and prevent erosion. Natural drainages will be unimpeded and water bars and/or silt traps will be place in areas where needed to prevent erosion on a large scale. Final re-contour shall have a uniform appearance with smooth surface, fitting the natural landscape.

The below-grade tank area was re-contoured to match fit, shape, line, form and texture of the surrounding area. Re-shaping including drainage control, to prevent ponding and erosion. Natural drainages were unimpeded and water bars and/or silt traps were placed in areas where needed to prevent erosion on a large scale. Final recontour has a uniform appearance with smooth surface, fitting the natural landscape.

11. BR shall seed the disturbed areas the first favorable growing season following closure of a below-grade tank. Seeding will be accomplished via drilling on the contour whenever practical or by other division-approved methods. BLM stipulated seed mixes will used on federally regulated lands and division-approved seed mixtures (administratively approved if required) will be utilized on all State or private lands. A uniform vegetative cover has been established that reflects a life-form ratio of plus or minus fifty percent (50%) of pre- disturbance levels and a total percent plant cover of at least seventy percent (70%) of pre-disturbance levels, excluding noxious weeds. If alternate seed mix is required by the state, private owner or tribe, it will be implemented with administrative approval if needed. COPC will repeat seeding or planting will be continued until successful vegetative growth occurs.

Provision 13 was accomplished through complying with BLM seeding requirements as allowed by the BLM/OCD MOU.

12. A minimum of four feet of cover shall be achieved and the cover shall include one foot of suitable material, with chloride concentrations less than 600 mg/kg as analyzed by EPA Method 300.0, to establish vegetation at the site, or the background thickness of topsoil, whichever is greater.

The below-grade tank area was backfilled and more than four feet of cover was achieved and the cover included one foot of suitable material to establish vegetation at the site.

- 13. All closure activities will include proper documentation and be available for review upon request and will be submitted to OCD within 60 days of closure of the below-grade tank. Closure report will be filed on C-144 and incorporate the following:
  - Soil Backfilling and Cover Installation (See Report)
  - Re-vegetation application rates and seeding techniques (See Report)
  - Photo documentation of the site reclamation (Included as an attachment)
  - Confirmation Sampling Results (Included as an attachment)
  - Proof of closure notice (Included as an attachment)

<u>District I</u> 1625 N. French Dr., Hobbs, NM 88240 District II
1301 W. Grand Avenue, Artesia, NM 88210
District III
1000 Rio Brazos Road, Aztec, NM 87410 District IV 1220 S. St. Francis Dr., Santa Fe, NM 87505

## State of New Mexico Energy Minerals and Natural Resources

Form C-141 Revised August 8, 2011

Oil Conservation Division 1220 South St. Francis Dr. Santa Fe, NM 87505

Submit 1 Copy to appropriate District Office to accordance with 19.15.29 NMAC.

			Dolo	asa Notific	ation	and Co	rrective A	ction				
			Keic	ascriotin		PERAT			Initia	l Report	$\boxtimes$	Final Report
		" / P.ss	aumaas Oi	1 & Cas I.P			stal Walker					
Name of Con Address 340	mpany Bu	rlington Kes	ources Of	1 & Gas Ex	T	elephone N	lo.(505) 326-98	37				
Facility Nan	1 East 30	5t, Farming	31011, 13171		Fa	acility Typ	e: Gas Well				-	
72				Mineral (	)mor				API No	.30-045-21	172	
Surface Own	ner Federa	ıl										
					ATION	OF REI	LEASE	Foot/W	Vest Line	County		
Unit Letter	Section	Township	Range	Feet from the 1090	- International Control	outh Line	Feet from the 1460	The second contract of	East	San Juan		
0	5	29N	8W				e <u>-107.69362</u>					
				NA'	TURE C	OF REL	EASE		Volume 1	Recovered		
Type of Rele	ase					Date and I	Hour of Occurren	ce	Date and	Hour of Di	scovery	7
Source of Re	elease					Date and						£20
Was Immedi	ate Notice (	liven?				If YES, To	Whom?					
was illilicu	ate Hotico	Γ	] Yes	No Not I	Required						_	
By Whom?						Date and	Hour olume Impacting	the Wat	ercourse			
Was a Water	rcourse Rea	ched?		No		If YES, V	olume impacting	mc wat	orcourse.			
	25-25-2		Yes 🛚									
If a Waterco	urse was In	pacted, Desc	ribe Fully	.*								
N/A												
Describe Ca	use of Prob	lem and Rem	edial Acti	on Taken.*								
No release	was encoun	itered during	the BGI	Closure.								
												Agg Co
				1 4								
	rea Affected	l and Cleanup	Action 1	aken.*								
N/A												
			-iven abo	ve is true and co	mnlete to t	the best of n	ny knowledge and and perform cor	l underst	and that pu	irsuant to N	MOCE	rules and
conserved from the same	all aparatas	re are required	110 (600)	allu/of the corta			a contract of	n 41	I done not r	alieve the o	nerator	OFFIGURITY
1.1: - 6.00	th or the en	vironment. I	ne accepta	illee of a contract	opera			1 +	around 11/9	ter curtace	water.	numan nearm
should their	r operations	have failed t	o adequat	ely investigate ar	d remedia	te contamin does not reli	marked as "Final ation that pose a eve the operator	of respon	nsibility for	r complianc	e with a	any other
or the envi	ronment. Ir	addition, INP	MOCD acc	epiance of a C 1	41 Toport	4005 1100 1411						
federal, sta	ite, or local	laws and/or re	guiations				OIL CO	NSER	VATIO	N DIVIS	ION	
Signature:												
			7.4			Approved	by Environmenta	1 Specia	list:			
Dulated No	me: Lariss	a Farrell				пррготов						
Printed Na	illic. Lairss	a i direii				Ammorrol	Dote:		Expirati	on Date:		
Title: Reg	gulatory Te	chnician				Approval	Dato.					
2 <u></u> 2 244 00400	rd	goo I Eastall	മിലോ ലേ			Condition	s of Approval:			Attac	hed [	
E-mail Ac	iaress: Lari	ssa.L.Farrell(										
Date: 2-2	2-16		(505) 320	6-9504								
* Attach A	dditional S	heets If Nec	essary									



August 7, 2013

Crystal Tafoya ConocoPhillips San Juan Business Unit Office 214-05 5525 Hwy 64 Farmington, New Mexico 87401 www.animasenvironmental.com

624 E. Comanche Farmington, NM 87401 505-564-2281

> Durango, Colorado 970-403-3084

Via electronic mail to: <u>SJBUE-Team@ConocoPhillips.com</u>

RE:

**Below Grade Tank Closure Report** 

Sunray #5

San Juan County, New Mexico

Dear Ms. Tafoya:

Animas Environmental Services, LLC (AES) is pleased to provide the final report associated with the below grade tank (BGT) closure at ConocoPhillips (CoP) Sunray #5, located in San Juan County, New Mexico. Tank removal had been completed by CoP contractors prior to AES' arrival at the location.

## 1.0 Site Information

### 1.1 Location

Site Name – Sunray #5
Legal Description – SW¼ SE¼, Section 5, T29N, R8W, San Juan County, New Mexico
Well Latitude/Longitude – N36.74960 and W107.69366, respectively
BGT Latitude/Longitude – N36.74957 and W107.69362, respectively
Land Jurisdiction – Bureau of Land Management (BLM)
Figure 1. Topographic Site Location Map
Figure 2. Aerial Site Map, June 2013

## 1.2 NMOCD Ranking

In accordance with NMOCD release protocols, action levels were established per NMOCD *Guidelines for Remediation of Leaks, Spills, and Releases* (August 1993) prior to site work. The location was given a ranking score of 20 based on the following factors:

- Depth to Groundwater: A cathodic report dated May 1991 reported the depth to groundwater as 60 feet below ground surface (bgs). (10 points)
- Wellhead Protection Area: The release location is not within a wellhead protection area. (0 points)
- Distance to Surface Water Body: An unnamed wash, which discharges to Salvador Canyon, is located approximately 460 feet southwest of the location. (10 points)

### BGT Closure Assessment 1.3

AES was initially contacted by Bruce Ashcroft, CoP representative, on June 24, 2013, and on the same day, Deborah Watson and Jesse Christopherson of AES mobilized to the location. AES personnel collected six soil samples from below the BGT liner. Four samples were collected from the perimeter of the BGT footprint, one sample was collected from the center of the BGT footprint, and one sample was composited from the four perimeter samples and one center sample.

### Soil Sampling 2.0

On June 24, 2013, AES personnel conducted field screening and collected five soil samples (S-1 through S-5) and one 5-point composite (SC-1) from below the BGT. Soil samples were collected from approximately 0.5 feet below the former BGT for field screening of volatile organic compounds (VOCs) and total petroleum hydrocarbon (TPH). Soil sample SC-1 was field screened for chloride and was submitted for confirmation laboratory analysis. Soil sample locations are included on Figure 2.

### Field Screening 2.1

# 2.1.1 Volatile Organic Compounds

A portion of each sample was utilized for field screening of VOC vapors with a photoionization detector (PID) organic vapor meter (OVM). Before beginning field screening, the PID-OVM was first calibrated with 100 parts per million (ppm) isobutylene gas.

# 2.1.2 Total Petroleum Hydrocarbons

Soil samples were also analyzed in the field for TPH per USEPA Method 418.1 using a Buck Scientific Model HC-404 Total Hydrocarbon Analyzer Infrared Spectrometer (Buck). A 3-point calibration was completed prior to conducting soil analyses. Field analytical protocol followed AES's Standard Operating Procedure: Field Analysis Total Petroleum Hydrocarbons per EPA Method 418.1.

### 2.1.3 Chlorides

Soil sample SC-1 was field screened for chlorides using Chloride Drop Count Titration with silver nitrate. Sampling and analysis methods followed procedures provided by Hach Company.

### Laboratory Analyses 2.2

The composite soil sample SC-1 collected for laboratory analysis was placed into a new, clean, laboratory-supplied container, which was then labeled, placed on ice, and logged onto a sample chain of custody record. The sample was maintained on ice until delivery to the analytical laboratory, Hall Environmental Analysis Laboratory (Hall), in Albuquerque, New Mexico. Soil sample SC-1 was laboratory analyzed for:

- Benzene, toluene, ethylbenzene, and xylene (BTEX) per U.S. Environmental Protection Agency (USEPA) Method 8021B;
- TPH for gasoline range organics (GRO) and diesel range organics (DRO) per USEPA Method 8015D; and
- Chloride per USEPA Method 300.0.

### Field and Laboratory Analytical Results 2.3

Field screening readings for VOCs via OVM ranged from 0.5 ppm in S-1 and S-4 up to 1.4 ppm in S-2. Field TPH concentrations ranged from 71.8 mg/kg in S-4 up to 112 mg/kg in S-3. The field chloride concentration in SC-1 was 40 mg/kg. Field screening results are summarized in Table 1 and presented on Figure 2. The AES Field Screening Report is attached.

> Table 1. Soil Field Screening VOCs, TPH, and Chloride Results Sunray #5 BGT Closure, June 2013

Date Sampled	Depth below BGT (ft)	VOCs OVM Reading (ppm)	Field TPH (mg/kg)	Field Chlorides (mg/kg)
			100	250
	0.5	0.5	99.6	NA
	0.5	1.4	108	NA
	0.5	0.6	112	NA
	0.5	0.5	71.8	NA
		1.3	94.1	NA
		NA	NA	40
	Sampled	Date Sampledbelow BGT (ft)evel (NMAC 19.15.17.13E)0.56/24/130.56/24/130.56/24/130.56/24/130.56/24/130.56/24/130.5	Date Sampled         below BGT (ft)         Reading (ppm)           .evel (NMAC 19.15.17.13E)            6/24/13         0.5         0.5           6/24/13         0.5         1.4           6/24/13         0.5         0.6           6/24/13         0.5         0.5           6/24/13         0.5         1.3	Date Sampled         below BGT (ft)         Reading (ppm)         TPH (mg/kg)           evel (NMAC 19.15.17.13E)          100           6/24/13         0.5         0.5         99.6           6/24/13         0.5         1.4         108           6/24/13         0.5         0.6         112           6/24/13         0.5         0.5         71.8           6/24/13         0.5         1.3         94.1

NA - not analyzed

Laboratory analytical results reported benzene and total BTEX concentrations in SC-1 as less than 0.050 mg/kg and less than 0.25 mg/kg, respectively. TPH concentrations as GRO and DRO were reported at less than 5.0 mg/kg and less than 10 mg/kg, respectively. The laboratory chloride concentration was reported as 49 mg/kg. Laboratory analytical results are summarized in Table 2 and included on Figure 2. Laboratory analytical reports are attached.

Table 2. Soil Laboratory Analytical Results Sunray #5 BGT Closure, June 2013

6 I- ID	Date Sampled	Depth (ft)	Benzene (mg/kg)	Total BTEX (mg/kg)	TPH- GRO (mg/kg)	TPH- DRO (mg/kg)	Chlorides (mg/kg)
Sample ID	Level (NMAC 19.15			50	1	00	250
				<0.25	<5.0	<10	49
SC-1	6/24/13	0.5	<0.050	<0.25	<5.0		<10

# 3.0 Conclusions and Recommendations

NMOCD action levels for BGT closures are specified in New Mexico Administrative Code (NMAC) 19.15.17.13E. Field TPH concentrations exceeded the NMOCD action level of 100 mg/kg in two samples, with the highest concentration reported in S-3 with 112 mg/kg. However, laboratory analytical results for TPH (as GRO/DRO) in SC-1 were reported below the NMOCD action level of 100 mg/kg. Benzene and total BTEX concentrations in SC-1 were below the NMOCD action levels of 0.2 mg/kg and 50 mg/kg, respectively. Chloride concentrations in SC-1 were below the NMOCD action level of 250 mg/kg. Based on field screening and laboratory analytical results for benzene, total BTEX, TPH, and chlorides, no further work is recommended at the Sunray #5.

If you have any questions about this report or site conditions, please do not hesitate to contact Deborah Watson at (505) 564-2281.

Sincerely,

Landrea Cupps

**Environmental Scientist** 

Landre R. Cupps

Crystal Tafoya Sunray #5 BGT Closure Report August 7, 2013 Page 5 of 5


Elizabeth V MeNelly


Elizabeth McNally, P.E.

### Attachments:

Figure 1. Topographic Site Location Map Figure 2. Aerial Site Map, June 2013 AES Field Screening Report 062413 Hall Analytical Report 1306A24

R:\Animas 2000\Dropbox\2013 Projects\ConocoPhillips\Sunray #5\CoP Sunray #5 BGT Closure Report 080713.docx

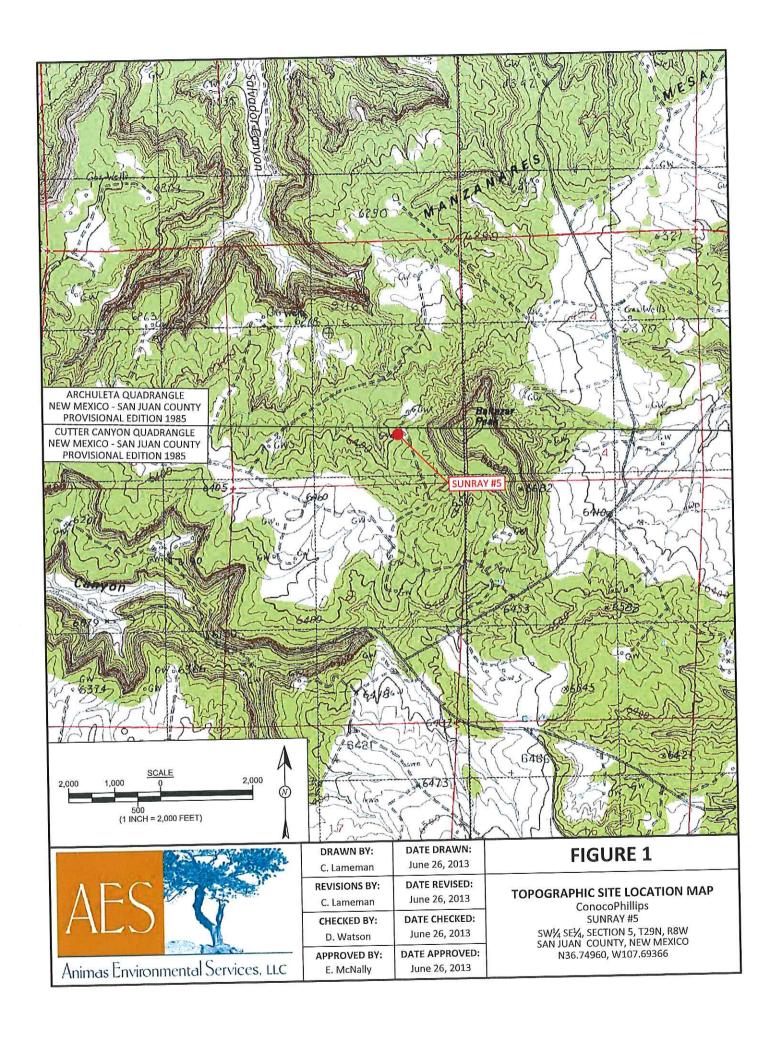

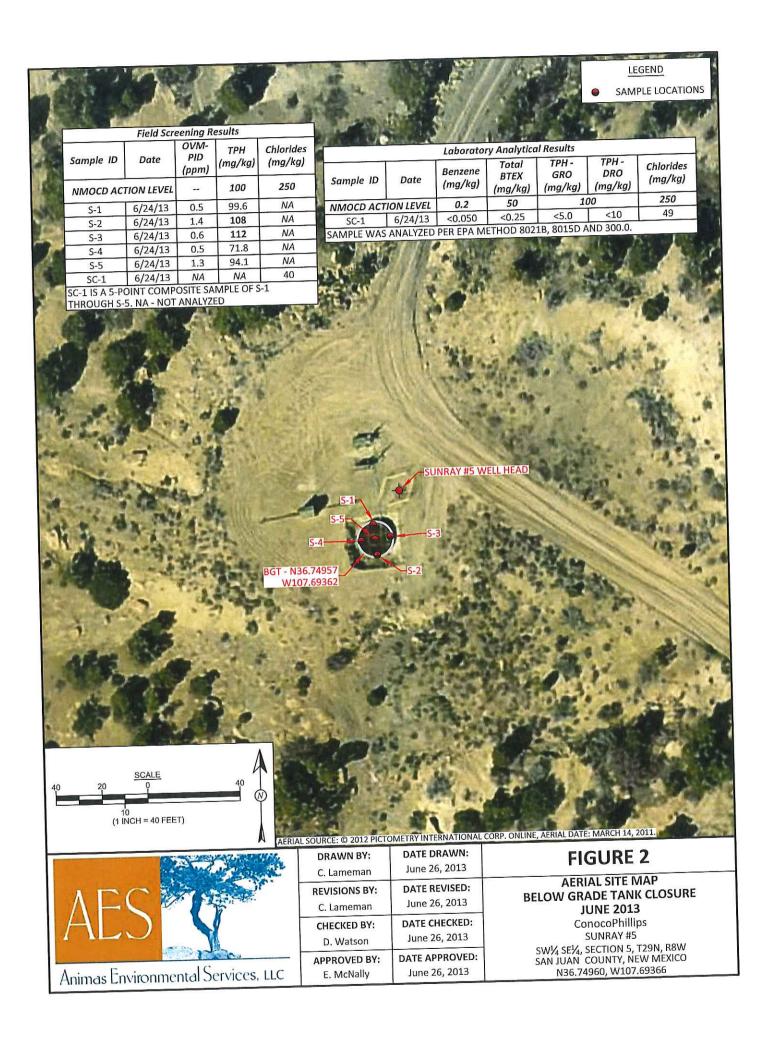

# **AES Field Screening Report**

Client: ConocoPhillips

624 E. Comanche Farmington, NM 87401 505-564-2281

Animas Environmental Services, LLC

www.animasenvironmental.com

Durango, Colorado 970-403-3084

Project Location: Sunray #5

Date: 6/24/2013

Matrix: Soil

		Time of			Field	Field TPH				TPH
	uoi‡oolloo	Sample	Sample	MVO	Chloride	Analysis	Field TPH*	TPH PQL		Analysts
Clolumcs	Date	Collection	Location	(mdd)	(mg/kg)	Time	(mg/kg)	(mg/kg)	DF	Initials
Sample	2,007	14.13	North	0.5	ΑN	15:00	9.66	20.0	П	DAW
N-Z	6/24/2013	OT:+			8	1	7	0 00	,	WAG
5-2	6/24/2013	14:18	South	1.4	NA	15:03	TUS	20.0	4	
1 (	(104/2012	14.22	Fact	9.0	NA	15:05	112	20.0	1	DAW
5-3	CT07/57/9	77.47	1001	)						:
V	6/04/0013	14.24	West	0.5	AN	15:07	71.8	20.0	-1	DAW
V-4	0/24/2013	17:17					1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1			77.4.0
U	6/24/2013	14.28	Center	1.3	AN	15:10	94.1	20.0	+	DAW
0-0	0/27/27/0	)						1		
1 73	6/24/2013	14:35	Composite	NA	40		Not	Not Analyzed for TPH.	PH.	
1-2C	0/44/4010									

Field Chloride - Quantab Chloride Titrators or Drop Count Titration with

Silver Nitrate

Total Petroleum Hydrocarbons - USEPA 418.1

Dilution Factor Not Analyzed NA

Not Detected at the Reporting Limit

Practical Quantitation Limit

POL N N \*Field TPH concentrations recorded may be below PQL.

Analyst:



Hall Environmental Analysis Laboratory 4901 Hawkins NE Albuquerque, NM 87109 TEL: 505-345-3975 FAX: 505-345-4107 Website: www.hallenvironmental.com

June 27, 2013

Debbie Watson Animas Environmental 624 East Comanche

Farmington, NM 87401 TEL: (505) 486-4071

FAX

RE: CoP Sunray # 5

OrderNo.: 1306A24

### Dear Debbie Watson:

Hall Environmental Analysis Laboratory received 1 sample(s) on 6/25/2013 for the analyses presented in the following report.

These were analyzed according to EPA procedures or equivalent. To access our accredited tests please go to <a href="www.hallenvironmental.com">www.hallenvironmental.com</a> or the state specific web sites. In order to properly interpret your results it is imperative that you review this report in its entirety. See the sample checklist and/or the Chain of Custody for information regarding the sample receipt temperature and preservation. Data qualifiers or a narrative will be provided if the sample analysis or analytical quality control parameters require a flag. When necessary, data qualifers are provided on both the sample analysis report and the QC summary report, both sections should be reviewed. All samples are reported, as received, unless otherwise indicated. Lab measurement of analytes considered field parameters that require analysis within 15 minutes of sampling such as pH and residual chlorine are qualified as being analyzed outside of the recommended holding time.

Please don't hesitate to contact HEAL for any additional information or clarifications.

Sincerely,

Andy Freeman

Laboratory Manager

andyl

4901 Hawkins NE

Albuquerque, NM 87109

## Analytical Report Lab Order 1306A24

Date Reported: 6/27/2013

# Hall Environmental Analysis Laboratory, Inc.

CLIENT: Animas Environmental

CoP Sunray # 5

1306A24-001 Lab ID:

Project:

Client Sample ID: SC-1

Collection Date: 6/24/2013 2:35:00 PM

Received Date: 6/25/2013 10:00:00 AM Matrix: MEOH (SOIL)

		DI O	al Units	DE	Date Analyzed	Batch
Analyses	Result	KL Qu	ai Units	-		
EPA METHOD 8015D: DIESEL RAN	GE ORGANICS				Analyst:	
Diesel Range Organics (DRO)	ND	10	mg/Kg	1	6/25/2013 11:51:57 AM	
Surr: DNOP	95.7	63-147	%REC	1	6/25/2013 11:51:57 AM	8095
	ANCE				Analyst	NSB
EPA METHOD 8015D: GASOLINE R		5.0	mg/Kg	1	6/25/2013 12:48:15 PM	R11540
Gasoline Range Organics (GRO)	ND 92.7	80-120	%REC	1	6/25/2013 12:48:15 PM	
Surr: BFB	92.7	80-120	701123		Analyst	NSB
EPA METHOD 8021B: VOLATILES			50/03	20	3:25:56	
Benzene	ND	0.050	mg/Kg	1	6/25/2013 12:48:15 PM 6/25/2013 12:48:15 PM	
Toluene	ND	0.050	mg/Kg	1	6/25/2013 12:48:15 PM	
Ethylbenzene	ND	0.050	mg/Kg	1	6/25/2013 12:48:15 PM	
Xylenes, Total	ND	0.10	mg/Kg	1	6/25/2013 12:48:15 PM	
Surr: 4-Bromofluorobenzene	102	80-120	%REC	1		
EPA METHOD 300.0: ANIONS					Analyst	:: JRR
	49	30	mg/Kg	20	6/25/2013 12:41:40 PM	8092
Chloride	-10		20 GBO NE 1			

Refer to the QC Summary report and sample login checklist for flagged QC data and preservation information.

### Qualifiers:

- Value exceeds Maximum Contaminant Level.
- Value above quantitation range E
- Analyte detected below quantitation limits
- RSD is greater than RSDlimit 0
- RPD outside accepted recovery limits

- Analyte detected in the associated Method Blank
- Holding times for preparation or analysis exceeded Η
- Not Detected at the Reporting Limit ND
- Sample pH greater than 2 for VOA and TOC only. P
- RL Reporting Detection Limit

# Hall Environmental Analysis Laboratory, Inc.

WO#: 1306A24

27-Jun-13

Client:

Animas Environmental

Project:

CoP Sunray # 5

Sample ID MB-8092

SampType: MBLK

TestCode: EPA Method 300.0: Anions

Client ID: PBS

Batch ID: 8092

RunNo: 11560

Prep Date:

SeqNo: 327531

Units: mg/Kg

%RPD

%RPD

Analyte

6/25/2013

Analysis Date: 6/25/2013 PQL

%REC LowLimit

HighLimit

**RPDLimit** 

Qual

Chloride

ND 1.5

SampType: LCS

TestCode: EPA Method 300.0: Anions

Client ID: LCSS

Sample ID LCS-8092

Batch ID: 8092

RunNo: 11560

6/25/2013

Prep Date:

SegNo: 327532

Units: mg/Kg

Analysis Date: 6/25/2013

PQL

1.5

%REC

Analyte Chloride

Result 14

Result

SPK value SPK Ref Val 15.00

SPK value SPK Ref Val

92.8

HighLimit LowLimit 90 110 **RPDLimit** 

Qual

Sample ID 1306A03-001AMS

6/25/2013

BatchQC

SampType: MS

TestCode: EPA Method 300.0: Anions

BatchQC Client ID:

Analysis Date: 6/25/2013

Batch ID: 8092

RunNo: 11560 SeqNo: 327534

Units: mg/Kg

Qual

Analyte Chloride

Prep Date:

PQL Result 15.00 7.5 14

SPK value SPK Ref Val

%REC LowLimit 58.8 95.1

HighLimit 109 %RPD **RPDLimit** 

Client ID:

Prep Date:

SampType: MSD Sample ID 1306A03-001AMSD

Result

14

TestCode: EPA Method 300.0: Anions

Batch ID: 8092

RunNo: 11560 SeqNo: 327535

Units: mg/Kg

Qual

Analyte Chloride

6/25/2013

Analysis Date: 6/25/2013

PQL

7.5

15.00

SPK value SPK Ref Val %REC

LowLimit 94.2

58.8

%RPD HighLimit 0.951 109

20

**RPDLimit** 

Qualifiers:

J

Value exceeds Maximum Contaminant Level.

Value above quantitation range E Analyte detected below quantitation limits

RSD is greater than RSDlimit 0 RPD outside accepted recovery limits

Analyte detected in the associated Method Blank B

Holding times for preparation or analysis exceeded H

Not Detected at the Reporting Limit ND Sample pH greater than 2 for VOA and TOC only.

Reporting Detection Limit

P

Page 2 of 6

# Hall Environmental Analysis Laboratory, Inc.

WO#:

1306A24 27-Jun-13

Client:

Animas Environmental

Project: CoP	Sunray # 5	
Sample ID MB-8095	SampType: MBLK TestCode:	e: EPA Method 8015D: Diesel Range Organics
Client ID: PBS	Batch ID: 8095 RunNo:	p: 11523
Prep Date: 6/25/2013	Analysis Date: 6/25/2013 SeqNo:	o: 326782 Units: mg/Kg
and vestory	Result PQL SPK value SPK Ref Val %RE	EC LowLimit HighLimit %RPD RPDLimit Qual
Analyte Diesel Range Organics (DRO)	ND 10	
Surr: DNOP		35.3 63 147
Sample ID LCS-8095	SampType: LCS TestCode:	e: EPA Method 8015D: Diesel Range Organics
Client ID: LCSS	Batch ID: 8095 RunNo	o: 11523
	Analysis Date: 6/25/2013 SeqNo	o: 326783 Units: mg/Kg
Prep Date: 6/25/2013	CDK D-f\/al_ P/DE	REC LowLimit HighLimit %RPD RPDLimit Qual
Analyte	Result 1 QL Of Results	92.1 77.1 128
Diesel Range Organics (DRO)	40 10	88.3 63 147
Surr: DNOP	7.7	Located Bongo Organics
Sample ID MB-8058	Sumpripe: III——	de: EPA Method 8015D: Diesel Range Organics
Client ID: PBS	Batch ID: 8058 RunNo	No: 11523
Prep Date: 6/21/2013	Analysis Date: 6/25/2013 SeqNo	No: 327121 Units: %REC
* = 0	Result PQL SPK value SPK Ref Val %RI	REC LowLimit HighLimit %RPD RPDLimit Qual
Analyte Surr: DNOP		89.0 63 147
	SampType: LCS TestCode	de: EPA Method 8015D: Diesel Range Organics
Sample ID LCS-8058	Cump types 200	No: 11523
Client ID: LCSS	Balcii ID. 6030	No: 327122 Units: %REC
Prep Date: 6/21/2013	Analysis Date. 6/20/2010	area area popularit Qual
Analyte	Result FQL of R value of Fire	REC LOWLITH HIGHLITH AND TO BELLINE
Surr: DNOP	4.7 5.000	93.0 63 147

### Qualifiers:

- Value exceeds Maximum Contaminant Level.
- Value above quantitation range
- Analyte detected below quantitation limits J
- RSD is greater than RSDlimit 0
- RPD outside accepted recovery limits R

- Analyte detected in the associated Method Blank В
- Holding times for preparation or analysis exceeded H
- Not Detected at the Reporting Limit ND
- Sample pH greater than 2 for VOA and TOC only. P
- Reporting Detection Limit RL

Page 3 of 6

## Hall Environmental Analysis Laboratory, Inc.

WO#: 1306A24

27-Jun-13

Client:

Animas Environmental

Client: Project:	CoP Sunr	ay # 5	aı													
Sample ID	MB-8070	SampTy	pe: ME	BLK	Test	Code: El	PA Method	8015D: Gaso	line Rang	е						
Client ID:	PBS	Batch	ID: <b>R1</b>	1540	RunNo: 11540											
Prep Date:	6/24/2013	Analysis Da	te: 6/	25/2013	S	SeqNo: 3	27402	Units: mg/K	g							
Analyte		Result	PQL	SPK value	SPK Ref Val	%REC	LowLimit	HighLimit	%RPD	RPDLimit	Qual					
Gasoline Rang Surr: BFB	e Organics (GRO)	ND 910	5.0	1000		90.7	80	120								
Sample ID	LCS-8070	SampTy	pe: LC	S	Tes	tCode: El	PA Method	8015D: Gaso	line Rang	е						
Client ID:	LCSS	Batch	ID: <b>R1</b>	1540	F	RunNo: 1	1540									
Prep Date:	6/24/2013	Analysis Da	te: 6/	25/2013	S	SeqNo: 3	27404	Units: mg/K	g							
Analyte		Result	PQL	SPK value	SPK Ref Val	%REC	LowLimit	HighLimit	%RPD	RPDLimit	Qual					
Gasoline Rang	e Organics (GRO)	23	5.0	25.00	0	91.5	62.6	136								
Surr: BFB		970		1000		96.8	80	120								
Sample ID	MB-8070	SampTy	pe: ME	BLK	Tes	tCode: El	PA Method	8015D: Gaso	line Rang	е						
Client ID:	PBS	Batch	ID: 80	70	RunNo: 11540											
Prep Date:	6/24/2013	Analysis Da	te: 6/	25/2013	S	SeqNo: 3	27416	Units: %RE0	С							
Analyte		Result	PQL	SPK value	SPK Ref Val	%REC	LowLimit	HighLimit	%RPD	RPDLimit	Qual					
Surr: BFB		910		1000		90.7	80	120								
Sample ID	LCS-8070	SampTy	pe: LC	s	Tes	tCode: E	PA Method	8015D: Gaso	line Rang	е						
Client ID:	LCSS	Batch	ID: <b>80</b>	70	RunNo: 11540											
Prep Date:	6/24/2013	Analysis Da	ite: 6/	25/2013	SeqNo: 327419 Units: %REC											
Analyte		Result	PQL	SPK value	SPK Ref Val	%REC	LowLimit	HighLimit	%RPD	RPDLimit	Qual					
Surr: BFB		970		1000		96.8	80	120								
Sample ID	1306931-001AMS	SampTy	pe: MS	3	Tes	tCode: E	PA Method	8015D: Gaso	line Rang	e						
Client ID:	BatchQC		ID: 80		F	RunNo: 1	1540									
	6/24/2013	Analysis Da			S	SeqNo: 3	27429	Units: %RE	С							
Analyte		Result	PQL	SPK value	SPK Ref Val	%REC	LowLimit	HighLimit	%RPD	RPDLimit	Qual					
Surr: BFB		950		964.3		98.6	80	120								
Sample ID	1306931-001AMSI	) SampTy	pe: MS	SD	Tes	tCode: E	PA Method	8015D: Gaso	line Rang	е						
Client ID:	BatchQC		ID: <b>80</b>		Ē	RunNo: 1	1540									
E100100-2510-2511 (2012-17)	6/24/2013	Analysis Da	ite: 6/	/25/2013	5	SeqNo: 3	27430	Units: %RE	С							
Analyte		Result	PQL	SPK value	SPK Ref Val	%REC	LowLimit	HighLimit	%RPD	RPDLimit	Qual					
O DED		OFO		063.4		00.0	80	120	0	0						

### Qualifiers:

Surr: BFB

\* Value exceeds Maximum Contaminant Level.

950

963.4

- E Value above quantitation range
- J Analyte detected below quantitation limits
- O RSD is greater than RSDlimit
- R RPD outside accepted recovery limits

B Analyte detected in the associated Method Blank

80

- H Holding times for preparation or analysis exceeded
- ND Not Detected at the Reporting Limit

99.0

- P Sample pH greater than 2 for VOA and TOC only.
- RL Reporting Detection Limit

Page 4 of 6

0

0

120

# Hall Environmental Analysis Laboratory, Inc.

WO#: 1306A24

27-Jun-13

Client:

Animas Environmental

CoP Sunray # 5

Project:	CoP Sunray # 5														
Sample ID MB-807	0 Sa	mpType:	МВІ	LK	Test	Code: EF	A Method 8	3021B: Volatil	es						
Client ID: PBS		Batch ID:	R11	540	RunNo: 11540										
Prep Date: 6/24/2	013 Analys	sis Date:	6/2	5/2013	S	eqNo: 32	27452	Units: mg/Kg							
i sak s					SPK Ref Val	%REC	LowLimit	HighLimit	%RPD	RPDLimit	Qual				
Analyte Benzene	5000000		_		MAN A STATE OF THE SECOND										
Toluene	N	ID 0.0	)50												
Ethylbenzene	N	D 0.0	)50												
Xylenes, Total	N	1D 0	.10				2.2	400							
Surr: 4-Bromofluorobe	nzene 1	.0		1.000		101	80	120							
Sample ID LCS-80	70 Sa	ampType:	LCS	S	Tes	Code: El	PA Method	8021B: Volati	les						
					F	RunNo: 1	1540								
Client ID: LCSS					5	SeqNo: 3	27453	Units: mg/K	g						
Prep Date: 6/24/2					CDV Dof Val	%REC	Lowl imit	HighLimit	%RPD	RPDLimit	Qual				
Analyte	5 1 1 1 W (1911)	(2.00)	_				11101	120							
Benzene					10.5		80	120							
Toluene		380			0	96.4	80	120							
Ethylbenzene		1787 IN			0	97.9	80	120							
Xylenes, Total Surr: 4-Bromofluorobe		-000000 FG		1.000		109	80	120							
Sull. 4-Diolilolidologo					Т.,	ACada: E	DA Mothod	8021B: Volat	iles						
Sample ID MB-80	70 S	ampType	: ME	BLK											
Client ID: PBS								Units: %REC							
Prep Date: 6/24/	2013 Analy	ysis Date	: 6/	25/2013	74	SeqNo: 3	327472			pppl:::#	Ougl				
Analyte	Res	sult P	QL		SPK Ref Val	390000000000			%RPD	RPDLIMIT	Qual				
Surr: 4-Bromofluorob	enzene	1.0		1.000		101	80	120							
Sample ID LCS-8	070 S	SampType	e: LC	cs	Tes	stCode: E	PA Method	i 8021B: Vola	tiles						
Client ID: LCSS		Batch ID	: 80	70		RunNo:	11540								
DESTRUMENT NAME OF THE PROPERTY OF THE PROPERT	anaa Anal	ACTION AND DESCRIPTION OF THE PARTY OF THE P				SeqNo:	327473	Units: %RE	C						
Prep Date: 6/24/		(A)			SDK Dof Val	%RFC	LowLimit	HighLimit	%RPD	RPDLimit	Qual				
Analyte		W. EKOD.	-QL												
Surr: 4-Bromofluorob	enzene	1.1				00020000		1 0004D. Vala	Ailes						
Sample ID 13069	30-001AMS	Batch ID: R11540 RunNo: 11540  alysis Date: 6/25/2013 SeqNo: 327452 Units: mg/Kg  Basult PQL SPK value SPK Ref Val %REC LowLimit HighLimit %RPD RPDLimit Qual  ND 0.050 ND 0.050 ND 0.050 ND 0.050 ND 0.050 ND 0.100 ND 0.1000													
Client ID: Batch	QC	Batch ID	): 80	070		18.18.8888									
Prep Date: 6/24	/2013 Ana	lysis Date	e: <b>6</b>	1/25/2013		SeqNo:	327475	Units: %RE	±G						
Analyte		esult l	PQL	SPK value	SPK Ref Va				%RPD	RPDLimit	Qual				
Surr: 4-Bromofluorol				0.9628	j	106	6 80	) 120							

### Qualifiers:

Value exceeds Maximum Contaminant Level.

E Value above quantitation range

J Analyte detected below quantitation limits

O RSD is greater than RSDlimit

R RPD outside accepted recovery limits

B Analyte detected in the associated Method Blank

H Holding times for preparation or analysis exceeded

ND Not Detected at the Reporting Limit

P Sample pH greater than 2 for VOA and TOC only.

RL Reporting Detection Limit

Page 5 of 6

# Hall Environmental Analysis Laboratory, Inc.

WO#: 1306A24

27-Jun-13

Client:

Animas Environmental

Project:

CoP Sunray # 5

Sample ID 1306930-001AMSD

6/24/2013

SampType: MSD

TestCode: EPA Method 8021B: Volatiles

Client ID: BatchQC

Batch ID: 8070

RunNo: 11540

Analysis Date: 6/25/2013

SeqNo: 327476

Units: %REC

Analyte

Result

SPK value SPK Ref Val %REC

LowLimit

HighLimit

%RPD

**RPDLimit** 

Qual

Surr: 4-Bromofluorobenzene

104

1.0

80

0.9634

120

Prep Date:

Qualifiers:

Value exceeds Maximum Contaminant Level.

Value above quantitation range Е

Analyte detected below quantitation limits

RPD outside accepted recovery limits

RSD is greater than RSDlimit 0

Analyte detected in the associated Method Blank В

Holding times for preparation or analysis exceeded Η

ND Not Detected at the Reporting Limit

Sample pH greater than 2 for VOA and TOC only.

RL Reporting Detection Limit Page 6 of 6



Hall Environmental Analysis Laboratory 4901 Hawkins NE Albuquerque, NM 87105

TEL: 505-345-3975 FAX: 505-345-4107 Website: www.hallenvironmental.com

# Sample Log-In Check List

Client Name: Animas Environmental Work Order Num	ber: 1306A24		RcptNo: 1	
Received by/date: Cl 25/3  Logged By: Lindsay Mangin 6/25/2013 10:00:00  Completed By: Lindsay Mangin 6/25/2018 10:18:5  Reviewed By: Cl 25/2018 10:18:5	,	Sombiy Hladigo Sombiy Hladigo	×	
Chain of Custody  1. Custody seals intact on sample bottles?  2. Is Chain of Custody complete?  3. How was the sample delivered?	Yes ☑ Yes ☑ Courler	No 🗆	Not Present ✓ Not Present □	
Log In  4. Was an attempt made to cool the samples?	Yes 🗹	No □	NA □	
<ul><li>5. Were all samples received at a temperature of &gt;0° C to 6.0°C</li><li>6. Sample(s) in proper container(s)?</li></ul>	Yes 🗹	No □	na 🗌	
<ul><li>7. Sufficient sample volume for indicated test(s)?</li><li>8. Are samples (except VOA and ONG) properly preserved?</li><li>9. Was preservative added to bottles?</li></ul>	Yes 🗹	No □ No □ No ☑	. NA 🗆	9
10.VOA vials have zero headspace?  11. Were any sample containers received broken?	Yes ☐ Yes ☐	No □ No ☑	# of preserved bottles checked	
<ul><li>12.Does paperwork match bottle labels? (Note discrepancies on chain of custody)</li><li>13. Are matrices correctly identified on Chain of Custody?</li><li>14. Is it clear what analyses were requested?</li></ul>	Yes V	No 🗆 No 🗆	for pH: (<2 or Adjusted?	>12 unless noted)
15. Were all holding times able to be met?  (If no, notify customer for authorization.)	Yes 🗹	No 🗆	Checked by:	
Special Handling (if applicable)  16. Was client notified of all discrepancies with this order?	Yes 🗆	No 🗆	NA ☑	
Pelson Notined.	Oate: Via: ☐ eMail ☐	Phone  Fax	☐ In Person	
17. Additional remarks:  18. Cooler Information  Cooler No Temp C Condition Seal Intact Seal  1 1.0 Good Yes	No Seal Date	Signed By	<u> </u>	<b> = =</b> _ =

	ANALYSIS LABORATORY	www.hallenvironmental.com	4901 Hawkins NE - Albuquerque, NM 87109	Tel. 505-345-3975 Fax 505-345-4107	Analysis Request	SO <sup>†</sup> )	S PCB's	H9T + TPH (1.81) (1.81) (1.81) (1.90) (1.808) (2.00) (2.00) (3.00) (4.00)	SEE (GE)	BTEX + MTB  BTEX + MTB  PAH's (8310  RORA 8 Meb  RORA					Date Time Remarks: Pall to Congradibility	1/2 1734	te Time Arka: 5					
Turn-Around Time:	□ Standard Kush SQUYQ	lame:	Cot Sunray " >	Project #:		Project Manager:	D. Watson	Sampler: D Walson	Sample/Temperature	Container Preservative Type and # Type	1-4026/665 Medit						W		Received by:		by:	1X 0 5 18 17
Chain-of-Custody Record			Smanche		-	-ax#:	QA/QC Package: □ Level 4 (Full Validation)	Cther	□ EDD (Type)	Matrix Sample Request ID	6.24-13 1435 Soil SC-1								Doto: Time: Relinanished by:	1734 Of 12 11/1, T.	Time: Relinquished by:	412/13/1758 11. Muster 1 Jacks

