1625 N French Dr., Hobbs, NM 88240 <u>District III</u> 1301 W Grand Avenue, Artesia, NM 88210 <u>District IIII</u> 1000 Rio Brazos Road, Aztec, NM 87410 District IV 1220 S. St. Francis Dr , Santa Fe, NM 87505

State of New Mexico Energy Minerals and Natural Resources Department Oil Conservation Division 1220 South St. Francis Dr. Santa Fe, NM 87505

For temporary pits, closed-loop systems, and below-grade tanks, submit to the appropriate NMOCD District Office.

For permanent pits and exceptions submit to the Santa Fe Environmental Bureau office and provide a copy to the appropriate NMOCD District Office.

716	8
-----	---

Pit, Closed-Loop System, Below-Grade Tank, or Proposed Alternative Method Permit or Closure Plan Application

Toposed Attendative Method Fermit of Closure Flan Application
Type of action: Permit of a pit, closed-loop system, below-grade tank, or proposed alternative method Closure of a pit, closed-loop system, below-grade tank, or proposed alternative method Modification to an existing permit Closure plan only submitted for an existing permitted or non-permitted pit, closed-loop system, below-grade tank, or proposed alternative method
Instructions: Please submit one application (Form C-144) per individual pit, closed-loop system, below-grade tank or alternative request
Please be advised that approval of this request does not relieve the operator of liability should operations result in pollution of surface water, ground water or the
environment. Nor does approval relieve the operator of its responsibility to comply with any other applicable governmental authority's rules, regulations or ordinances.
i. Operator:WILLIAMS PRODUCTION COMPANY, LLC OGRID #:120782
Address: PO Box 640 Aztec, NM 87410
Facility or well name: ROSA UNIT #022
API Number: 3003907971 OCD Permit Number:
Section18A Township31N Range05W CountyRIO ARRIBA
Latitude: 36.90482999999997 Longitude 107.39703 NAD: 1983, Surface Owner: FEDERAL
2.
Pit: Subsection F or G of 19.15.17.11 NMAC
Temporary: Drilling Workover
Permanent Emergency Cavitation P&A
Lined Unlined Liner type: Thickness mil LLDPE HDPE PVC Other
☐ String-Reinforced
Liner Seams: Welded Factory Other Volume: bbl Dimensions: L x W x D
Closed-loop System: Subsection H of 19.15.17.11 NMAC Type of Operation: P&A Drilling a new well Workover or Drilling (Applies to activities which require prior approval of a permit or notice of intent) Drying Pad Above Ground Steel Tanks Haul-off Bins Other Lined Unlined Liner type: Thickness mil LLDPE HDPE PVC Other Liner Seams: Welded Factory Other RECEIVED RECEIVED Applies to activities which require prior approval of a permit or notice of intent)
Below-grade tank: Subsection I of 19.15.17.11 NMAC OIL CONS. DIV DIST. 3
Volume: 120 bbl Type of fluid: PRODUCED WATER \\
Tank Construction material: FIBERGLASS TANK w/BANDED 20-mil HDPE SECONDARY LINER Secondary containment with leak detection □ Visible sidewalls, liner, 6-inch lift and automatic overflow shut-off
Secondary containment with leak detection Visible sidewalls, liner, 6-inch lift and automatic overflow shut-off
☐ Visible sidewalls and liner ☐ Visible sidewalls only ☐ Other
Liner type: Thickness mil
5.
Alternative Method:
Submittal of an exception request is required. Exceptions must be submitted to the Santa Fe Environmental Bureau office for consideration of approval.

Fencing: Subsection D of 19.15.17.11 NMAC (Applies to permanent pits, temporary pits, and below-grade tanks)	
☐ Chain link, six feet in height, two strands of barbed wire at top (Required if located within 1000 feet of a permanent residence, school, institution or church)	hospital,
☐ Four foot height, four strands of barbed wire evenly spaced between one and four feet	
Alternate. Please specify	
7.	
Netting: Subsection E of 19.15.17.11 NMAC (Applies to permanent pits and permanent open top tanks)	
Screen □ Netting □ Other	
Monthly inspections (If netting or screening is not physically feasible)	
8. Signs: Subsection C of 19.15.17.11 NMAC	
12"x 24", 2" lettering, providing Operator's name, site location, and emergency telephone numbers	
⊠ Signed in compliance with 19.15.3.103 NMAC	
9.	
Administrative Approvals and Exceptions: Justifications and/or demonstrations of equivalency are required. Please refer to 19.15.17 NMAC for guidance.	
Please check a box if one or more of the following is requested, if not leave blank:	67 6
Administrative approval(s): Requests must be submitted to the appropriate division district or the Santa Fe Environmental Bureau consideration of approval.	office for
Exception(s): Requests must be submitted to the Santa Fe Environmental Bureau office for consideration of approval.	
Siting Criteria (regarding permitting): 19.15.17.10 NMAC Instructions: The applicant must demonstrate compliance for each siting criteria below in the application. Recommendations of accematerial are provided below. Requests regarding changes to certain siting criteria may require administrative approval from the appropriate or may be considered an exception which must be submitted to the Santa Fe Environmental Bureau office for consideration of Applicant must attach justification for request. Please refer to 19.15.17.10 NMAC for guidance. Siting criteria does not apply to dry above-grade tanks associated with a closed-loop system.	opriate district approval.
Ground water is less than 50 feet below the bottom of the temporary pit, permanent pit, or below-grade tank. - NM Office of the State Engineer - iWATERS database search; USGS; Data obtained from nearby wells	Yes No
Within 300 feet of a continuously flowing watercourse, or 200 feet of any other significant watercourse or lakebed, sinkhole, or playa lake (measured from the ordinary high-water mark). - Topographic map; Visual inspection (certification) of the proposed site	Yes No
Within 300 feet from a permanent residence, school, hospital, institution, or church in existence at the time of initial application. (Applies to temporary, emergency, or cavitation pits and below-grade tanks) - Visual inspection (certification) of the proposed site; Aerial photo; Satellite image	Yes No
Within 1000 feet from a permanent residence, school, hospital, institution, or church in existence at the time of initial application. (Applies to permanent pits)	☐ Yes ☐ No ☐ NA
- Visual inspection (certification) of the proposed site; Aerial photo; Satellite image	☐ Yes ☐ No
Within 500 horizontal feet of a private, domestic fresh water well or spring that less than five households use for domestic or stock watering purposes, or within 1000 horizontal feet of any other fresh water well or spring, in existence at the time of initial application. - NM Office of the State Engineer - iWATERS database search; Visual inspection (certification) of the proposed site	Tes 🗀 No
Within incorporated municipal boundaries or within a defined municipal fresh water well field covered under a municipal ordinance adopted pursuant to NMSA 1978, Section 3-27-3, as amended. - Written confirmation or verification from the municipality; Written approval obtained from the municipality	☐ Yes ☐ No
Within 500 feet of a wetland. - US Fish and Wildlife Wetland Identification map; Topographic map; Visual inspection (certification) of the proposed site	☐ Yes ☐ No
Within the area overlying a subsurface mine Written confirmation or verification or map from the NM EMNRD-Mining and Mineral Division	☐ Yes ☐ No
Within an unstable area. - Engineering measures incorporated into the design; NM Bureau of Geology & Mineral Resources; USGS; NM Geological Society; Topographic map	☐ Yes ☐ No
Within a 100-year floodplain FEMA map	☐ Yes ☐ No

Temporary Pits, Emergency Pits, and Below-grade Tanks Permit Application Attachment Checklist: Instructions: Each of the following items must be attached to the application. Please indicate, by a checklist.	
 attached. Hydrogeologic Report (Below-grade Tanks) - based upon the requirements of Paragraph (4) of Subsethydrogeologic Data (Temporary and Emergency Pits) - based upon the requirements of Paragraph (2 Siting Criteria Compliance Demonstrations - based upon the appropriate requirements of 19.15.17.10 Design Plan - based upon the appropriate requirements of 19.15.17.11 NMAC Operating and Maintenance Plan - based upon the appropriate requirements of 19.15.17.12 NMAC 	2) of Subsection B of 19.15.17.9 NMAC
☐ Closure Plan (Please complete Boxes 14 through 18, if applicable) - based upon the appropriate requiand 19.15.17.13 NMAC	irements of Subsection C of 19.15.17.9 NMAC
Previously Approved Design (attach copy of design) API Number: or	Permit Number:
Closed-loop Systems Permit Application Attachment Checklist: Subsection B of 19.15.17.9 NMAC Instructions: Each of the following items must be attached to the application. Please indicate, by a check attached. Geologic and Hydrogeologic Data (only for on-site closure) - based upon the requirements of Paragr. Siting Criteria Compliance Demonstrations (only for on-site closure) - based upon the appropriate requirements of 19.15.17.11 NMAC Operating and Maintenance Plan - based upon the appropriate requirements of 19.15.17.12 NMAC Closure Plan (Please complete Boxes 14 through 18, if applicable) - based upon the appropriate requirements of 19.15.17.13 NMAC Previously Approved Design (attach copy of design) API Number: Previously Approved Operating and Maintenance Plan API Number:	raph (3) of Subsection B of 19.15.17.9 equirements of 19.15.17.10 NMAC surrements of Subsection C of 19.15.17.9 NMAC
above ground steel tanks or haul-off bins and propose to implement waste removal for closure)	
Permanent Pits Permit Application Checklist: Subsection B of 19.15.17.9 NMAC Instructions: Each of the following items must be attached to the application. Please indicate, by a checatached. Hydrogeologic Report - based upon the requirements of Paragraph (1) of Subsection B of 19.15.17.19 Siting Criteria Compliance Demonstrations - based upon the appropriate requirements of 19.15.17.19 Climatological Factors Assessment Certified Engineering Design Plans - based upon the appropriate requirements of 19.15.17.11 NMAC Dike Protection and Structural Integrity Design - based upon the appropriate requirements of 19.15.17.11 NMAC Leak Detection Design - based upon the appropriate requirements of 19.15.17.11 NMAC Liner Specifications and Compatibility Assessment - based upon the appropriate requirements of 19.15.17.11 NMAC Quality Control/Quality Assurance Construction and Installation Plan Operating and Maintenance Plan - based upon the appropriate requirements of 19.15.17.12 NMAC Freeboard and Overtopping Prevention Plan - based upon the appropriate requirements of 19.15.17.1 Nuisance or Hazardous Odors, including H ₂ S, Prevention Plan Emergency Response Plan Oil Field Waste Stream Characterization Monitoring and Inspection Plan Erosion Control Plan Closure Plan - based upon the appropriate requirements of Subsection C of 19.15.17.9 NMAC and	O NMAC 0 NMAC C 17.11 NMAC .15.17.11 NMAC
Proposed Closure: 19.15.17.13 NMAC Instructions: Please complete the applicable boxes, Boxes 14 through 18, in regards to the proposed closure. Type: Drilling Workover Emergency Cavitation P&A Permanent Pit Below-Alternative Proposed Closure Method: Waste Excavation and Removal Waste Removal (Closed-loop systems only) On-site Closure Method (Only for temporary pits and closed-loop systems In-place Burial On-site Trench Burial Alternative Closure Method (Exceptions must be submitted to the Santa Fe	grade Tank
Waste Excavation and Removal Closure Plan Checklist: (19.15.17.13 NMAC) Instructions: Each of closure plan. Please indicate, by a check mark in the box, that the documents are attached. □ Protocols and Procedures - based upon the appropriate requirements of 19.15.17.13 NMAC □ Confirmation Sampling Plan (if applicable) - based upon the appropriate requirements of Subsection □ Disposal Facility Name and Permit Number (for liquids, drilling fluids and drill cuttings) □ Soil Backfill and Cover Design Specifications - based upon the appropriate requirements of Subsect □ Re-vegetation Plan - based upon the appropriate requirements of Subsection I of 19.15.17.13 NMAC □ Site Reclamation Plan - based upon the appropriate requirements of Subsection G of 19.15.17.13 NMAC	ion H of 19.15.17.13 NMAC

Waste Removal Closure For Closed-loop Systems That Utilize Above Ground Structions: Please indentify the facility or facilities for the disposal of liquids, a facilities are required.		
Disposal Facility Name:	Disposal Facility Permit Number:	
Disposal Facility Name:	Disposal Facility Permit Number:	
Will any of the proposed closed-loop system operations and associated activities oc ☐ Yes (If yes, please provide the information below) ☐ No	cur on or in areas that will not be used for future serv	vice and operations?
Required for impacted areas which will not be used for future service and operation Soil Backfill and Cover Design Specifications based upon the appropriate Re-vegetation Plan - based upon the appropriate requirements of Subsection Site Reclamation Plan - based upon the appropriate requirements of Subsection	requirements of Subsection H of 19.15.17.13 NMAC I of 19.15.17.13 NMAC	C
Siting Criteria (regarding on-site closure methods only): 19.15.17.10 NMAC Instructions: Each siting criteria requires a demonstration of compliance in the provided below. Requests regarding changes to certain siting criteria may require considered an exception which must be submitted to the Santa Fe Environmental demonstrations of equivalency are required. Please refer to 19.15.17.10 NMAC for	e administrative approval from the appropriate disti Bureau office for consideration of approval. Justi	rict office or may be
Ground water is less than 50 feet below the bottom of the buried waste. - NM Office of the State Engineer - iWATERS database search; USGS; Data	obtained from nearby wells	☐ Yes ☑ No ☐ NA
Ground water is between 50 and 100 feet below the bottom of the buried waste - NM Office of the State Engineer - iWATERS database search; USGS; Data	obtained from nearby wells	☐ Yes ⊠ No ☐ NA
Ground water is more than 100 feet below the bottom of the buried waste. - NM Office of the State Engineer - iWATERS database search; USGS; Data	obtained from nearby wells	☐ Yes ☐ No ☑ NA
Within 300 feet of a continuously flowing watercourse, or 200 feet of any other signlake (measured from the ordinary high-water mark). - Topographic map; Visual inspection (certification) of the proposed site	nificant watercourse or lakebed, sinkhole, or playa	☐ Yes ☑ No
Within 300 feet from a permanent residence, school, hospital, institution, or church - Visual inspection (certification) of the proposed site; Aerial photo; Satellite		☐ Yes ☑ No
Within 500 horizontal feet of a private, domestic fresh water well or spring that less watering purposes, or within 1000 horizontal feet of any other fresh water well or spring that less watering purposes, or within 1000 horizontal feet of any other fresh water well or spring that less watering purposes, or within 1000 horizontal feet of any other fresh water well or spring that less watering purposes, or within 1000 horizontal feet of any other fresh water well or spring that less watering purposes, or within 1000 horizontal feet of any other fresh water well or spring that less watering purposes, or within 1000 horizontal feet of any other fresh water well or spring that less watering purposes, or within 1000 horizontal feet of any other fresh water well or spring that less watering purposes, or within 1000 horizontal feet of any other fresh water well or spring that less water well o	oring, in existence at the time of initial application.	☐ Yes ☐ No
Within incorporated municipal boundaries or within a defined municipal fresh water adopted pursuant to NMSA 1978, Section 3-27-3, as amended. - Written confirmation or verification from the municipality; Written approve	·	☐ Yes ⊠ No
Within 500 feet of a wetland US Fish and Wildlife Wetland Identification map; Topographic map; Visua	l inspection (certification) of the proposed site	☐ Yes ⊠ No
Within the area overlying a subsurface mine. - Written confirmation or verification or map from the NM EMNRD-Mining	and Mineral Division	☐ Yes ⊠ No
 Within an unstable area. Engineering measures incorporated into the design; NM Bureau of Geology Society; Topographic map 	& Mineral Resources; USGS; NM Geological	☐ Yes ⊠ No
Within a 100-year floodplain FEMA map		☐ Yes ⊠ No
On-Site Closure Plan Checklist: (19.15.17.13 NMAC) Instructions: Each of the by a check mark in the box, that the documents are attached. Siting Criteria Compliance Demonstrations - based upon the appropriate requirements of Construction/Design Plan of Burial Trench (if applicable) based upon the ap Construction/Design Plan of Temporary Pit (for in-place burial of a drying property Protocols and Procedures - based upon the appropriate requirements of 19.15 Confirmation Sampling Plan (if applicable) - based upon the appropriate requirements of Disposal Facility Name and Permit Number (for liquids, drilling fluids and d Soil Cover Design - based upon the appropriate requirements of Subsection Re-vegetation Plan - based upon the appropriate requirements of Subsection Site Reclamation Plan - based upon the appropriate requirements of Subsection	nirements of 19.15.17.10 NMAC Subsection F of 19.15.17.13 NMAC propriate requirements of 19.15.17.11 NMAC ad) - based upon the appropriate requirements of 19. 17.13 NMAC nirements of Subsection F of 19.15.17.13 NMAC Subsection F of 19.15.17.13 NMAC rill cuttings or in case on-site closure standards cannot of 19.15.17.13 NMAC I of 19.15.17.13 NMAC	15.17.11 NMAC

195 2 Operator Application Certification:			
I hereby certify that the information submitted with this appli-	ication is true, accurate	and complete to the best of m	y knowledge and belief.
Name (Print):	Title:		
Signature:	Date:		
e-mail address:	Telephone:		
20.			
OCD Approval: Permit Application (including closure p	1 / NII		
OCD Representative Signature:	Kelly	Appro	oval Date: <u>8/30/20(/</u>
Title: Conflicurce Office		OCD Permit Number:	
Closure Report (required within 60 days of closure completed Instructions: Operators are required to obtain an approved The closure report is required to be submitted to the division section of the form until an approved closure plan has been Closure Completion Date: 3/10/10 Dis	closure plan prior to i within 60 days of the obtained and the closi	implementing any closure acti completion of the closure acti ure activities have been compl	ivities. Please do not complete this leted.
22. Closure Method: ☐ Waste Excavation and Removal ☐ On-Site Closure Method: ☐ If different from approved plan, please explain.	ethod	ve Closure Method Waste	Removal (Closed-loop systems only)
23. Closure Report Regarding Waste Removal Closure For Cl Instructions: Please indentify the facility or facilities for wh two facilities were utilized.	losed-loop Systems T here the liquids, drillin	hat Utilize Above Ground St g fluids and drill cuttings wer	eel Tanks or Haul-off Bins Only: re disposed. Use attachment if more than
Disposal Facility Name:		Disposal Facility Permit Numb	er:
Disposal Facility Name:		Disposal Facility Permit Numb	
Were the closed-loop system operations and associated activit Yes (If yes, please demonstrate compliance to the items	ties performed on or in	areas that will not be used for	future service and operations?
Required for impacted areas which will not be used for future	service and operation	S.	
☐ Site Reclamation (Photo Documentation) ☐ Soil Backfilling and Cover Installation			
Re-vegetation Application Rates and Seeding Technique	ıe		
24. Closure Report Attachment Checklist: Instructions: Each	h of the following item	s must be attached to the clos	ure report. Please indicate, by a check
mark in the box, that the documents are attached. Proof of Closure Notice (surface owner and division)			
Proof of Deed Notice (required for on-site closure)			
Plot Plan (for on-site closures and temporary pits)			
☐ Confirmation Sampling Analytical Results (if applicabl ☐ Waste Material Sampling Analytical Results (required)			
Disposal Facility Name and Permit Number	for on-site closure;		
Soil Backfilling and Cover Installation			
Re-vegetation Application Rates and Seeding Techniqu	ıe		
Site Reclamation (Photo Documentation) On-site Closure Location: Latitude	Longitud	e	NAD: □1927 □ 1983
25.			
Operator Closure Certification:			
I hereby certify that the information and attachments submitte belief. I also certify that the closure complies with all applica-			
Name (Print): Vanessa Fields		Title: _EH&S Coordinator	
Signature:	I	Date:10-12-10	
e-mail address:vanessa.fields@williams.com	Telepho	one:505-634-4209	



Exploration & Production FO Box 640 Aziec NM 81137 505/634 4219 505/634 4214 Fox

March 10, 2009

Mr. Mark Kelly Bureau of Land Management Farmington Field Office 1235 La Plata Hwy Farmington, NM 87401

Sent via Certified Mail

RE Notification of Production Pit Closure

Rule 19 15.17 13 NMAC

Production Pits associated Natural Gas Development

Operated by Williams Production Co, LLC

Pursuant to Rule 19.15.17 13 NMAC, this correspondence is to notify the Bureau of Land Management, Farmington Field Office, of Williams Production LLC's (Williams) intent to clean close all production pits on the attached list of wells operated with the District in San Juan County and Rio Arriba County, New Mexico. Closure will follow the plan included with this correspondence.

Thank you for your consideration—If there are any questions or additional information is requested, please contact me at (505) 634-4209

Respectfully submitted.

Holly C Perkins EH&S Specialist

Encl Williams Production Pit Inventory List (Federal wells)

San Juan Basin - New Mexico Assets: Below-Grade Tank Closure Plan

cc Environmental File

Below-Grade Tank Removal Closure Flan

In accordance with Role 19.15.17.13 NMAC, the following plan describes the general closure requirements of below grade tanks (RGT) on Williams Production Co. LEC. (WPX) locations in the San Juan Basin of New Mexico. This is WPX's standard closure procedure for all BGTs regulated under Rule 19.15.17 NMAC and operated by WPX. For those closures which do not conform to this standard closure plan, a separate well/pit specific closure plan will be developed and utilized.

Closure Conditions and Timing:

Pursuant to 19.15.17.13 (A) NMAC. WPX will initiate closure of any BG1 should any one of these conditions occur.

- The Division requires closure because of imminent danger to fresh water, public health or the
 environment.
- The integrity of the BGI fails. Notification will be within 48 hours to the Division and closure will be schedule as specified in 19 15.17.12 (A)(5) NMAC.
- WFX chooses to take the BGT out-of service due to operational needs. Closure under these conditions will be closed within 60 days of cessation of the BGT's operation.
- BGTs installed prior to June 16, 2008 that do not meet the requirements under 19,15,17 ±11(6).
 NMAC, and WPX chooses not to retrofit or upgrade. Closuro under these conditions will be completed within five years (by June 16, 2013).

General Plan Requirements:

- From to initiating any BGT Closure except in the case of an emergency. WPX will review County Tax Records for the current surface owner of record. The surface owner of record will be notified of the intent to close the EGT by certified mail and a copy of this notification will be included in the closure report. In the case of an emergency, the surface owner of record will be notified as soon as practical.
- 2 Notice of Closure will be given to the Aztec District office between 72 hours and one week of the scheduled closure via email or phone. The notification of closure will include the following:
 - a Operators Name (WPX)
 - b. Well Name and API Number
 - c Location (USTR)
- 3. All piping will be rerouted to an alternative produced water storage/disposal location (e.g. surface tanks, temporary frac tank ...). The well will be temporarily shut in until the rerouting is completed.
- All produced water will be removed from the BG1 following discharge-pipe rerouting Produced water will be disposed at one of the following NMOCD approved facilities depending on the proximity of the BG1 site. Rosa Unit SWD #1 (Order SWD-916, API, 30-039-27055), Rosa Unit #94 (Order SWD-3RP-1003-0. API 30-039-23035), Jillson Fed. SWD #001 (Order R10168/R10168A, API, 30-039-25465), Middle Mesa SWD #001 (Order SWD-350.0, API 30-045-27004) and/or Basin Disposal (Permit. NM-01-0005).

Solias and studges will be shoveled and 701 vacuumed out for disposal at Envirotech (Permit Number 14M-01-001)

Who will obtain prior approval from NMOC this aispose necrule nease or reclaim the BGT and provide documentation of the disposition of the BGT in the closure report. Siese materials will be recycled or reused as approved by the Division. Fiberglass tanks will be empty, cut up or stredaed, and EPA creaned for disposal as solio waste. Tiper materials will

be cleaned without soils or contaminated material for disposal as solid waste. Fiberglass tanks and liner materials will meet the conditions of paragraph 1 subsection D of 19,15,9,712 NMAC. Disposal will be at a licensed disposal facility, presently San Juan Regional Landfill operated by Waste Management under NMED Permit SWM 052426.

- Any equipment associated with the BGI that is no longer required for some other purpose following the closure will be removed from the location
- I ollowing removal of the tank and any liner material, a five point composite sample will be taken of the excavation and tested per 19.15.17.13(F)(4) NMAC as identified in Table 1. Grab samples will be collected from any area that is wet, discolored or showing other evidence of a release. Results will be report to the Division following receipt from the lab on Form C-141.

Table 1. Closure Criteria for BG1s

Components	Testing Methods	Closure Limits (mg/Kg)
Benzene	EPA SW-846 Method 8021B or 8260B	0.2
BILX	EPA SW-846 Method 8021B or 8260B	50
IFH	EPA SW-846 Method 418 1(1)	100
Chlorides	EPA SW-846 Method 300 1111	250(2)

[&]quot; Method modified for solid waste

- 9 If the Division and/or WFX determine there is a release. WPX will comply with 19.15.3 He NMAC and 19.15.1.19 NMAC.
- Upon completion of the tank removal, the excavation will be backfilled with non-waste earthen material compacted and covered with a minimum of one foot of top soil or background thickness whichever is greater and to existing grade. The surface will be recontoured to match the native grade and prevent ponding
- For those portions of the former pit area no longer required for production activities. WPX will seed the disturbed areas the first growing season after the pit is covered. Seeding will be accomplished via drilling on the contour whenever practical, or by other Division-approved methods. Vegetative cover will equal 70% of the native perennial vegetative cover (un impacted) consisting of at least three native plant species, including at least one grass, but not including noxious weeds, and maintained that cover through two successive growing seasons. Repeat seeding or planting will be continued until successful vegetative growth occurs. Note—If a surface owner agreement requires reseeding or other surface restoration that do not meet re-vegetation requirements of 19.15.17.13.LNMAC then WPX will submit the proposed alternative with written documentation that the surface owner agrees to the afternative for Division approval.
- 12 For those portions of the former pit area required for production activities reseeding will be done at well abandonment, and following the procedure noted above.

Closure Report

All closure activities will include proper accumentation and will be submitted to OCD within 60 days of the BG1 closure on a Closure Report using Division Form C-144. The Report will include the tollowing.

- Froot of Closure Notice Horace owner (NMOCE
- Boothing & Coveringtonal :
- Stie Diobroth with coordinate.
- Available trapection report

- · Confirmation Sampling Engineeral Reson.
- Disposal facility trainers and Lemm trainberts.
- Application Rate & Security technique
- Photo Decementation of Reciamate:

If background concentration of Chlorides greater than 250 mg/kg, their higher concentration will be used for closure.

WELLS W/FEDERAL SURF MGT API FM1 SEC TWN RNG PIT TYPE CONSTRUCTION MATERIAL COX CANYON UNIT #001 BLANCO MV 3004511397 16N 32N 1.1\\/ BG1 DBL WALL STEEL FIBERGLASS TANK W/BANDED 20-nut HIDPE SECONDARY LINER COX CANYON UNIT #001A 3004522086 **PLANCO MV** 16C 3211 11W BGT FIBERGLASS TANK w/BANDED 20-mil-HDPE SECONDARY LINER COX CANYON UNIT #001B BLANCO MV 161 BGI 3004530791 32N 1.1VV COX CANYON UNIT #001C 3004532023 BLANCO MV 16E 32N 11W BG1 DBL WALL STEEL FIBERGLASS TANK w/BANDED 20-mil HDPE SECONDARY LINER COX CANYON UNIT #003 BLANCO MV BGT 3004511495 91 32N 1.1VJ COX CANYON UNIT #003A 3004522088 BLANCO MV 9P 32N 11W BGI DBL WALL STEEL COX CANYON UNIT #003B **BLANCO MV** 9JRGT DBL WALL STEEL 3004530871 32N 11W COX CANYON UNIT #004 3004511368 BLANCO MV 21A 32N 11W **BGT** DBL WALL STEEL COX CANYON UNIT #004A BLANCO MV 21P 32N BG1 DBL WALL STEEL 3004522093 11W COX CANYON UNIT #004B 3004532186 **BLANCO MV** 21F 32N 11W **BGT** DBI WALL STEEL BLANCO MV 32N BG1 DBI WALL STEEL COX CANYON UNIT #005 3004511326 21K 111/4 COX CANYON UNIT #005A 3004522094 BLANCO MV 210 32N 11VV BGT DBL WALL STEEL BASIN DK / COX CANYON UNIT #005B **BLANCO MV** 32N 11W BGT DBL WALL STEEL 3004532142 21N COX CANYON UNIT #005C **BLANCO MV** 21F 32N 11VV BGI DBI WALL STEEL 3004533493 COX CANYON UNIT #006 3004511463 BLANCO MV 16A 32N 11W BGT DBL WALL STEEL COX CANYON UNIT #006A BLANCO MV 161 32N BGT DBL WALL STEEL 11W 3004522095 COX CANYON UNIT #006B BLANCO MV 16B 32N 11W BGT DBL WALL STEEL 3004532693 BGI DBL WALL STEEL COX CANYON UNIT #006C 3004532733 BLANCO MV 160 32N 11W COX CANYON UNIT #007 3004511455 BLANCO MV 17G 32N 11W FGP DBL WALL STEEL 32N 11W BG1 DBL WALL STEEL COX CANYON UNIT #007A 3004522091 BLANCO MV 17() BG1 DBL WALL STEEL COX CANYON UNIT #007C 3004533018 BASIN DK 17K 32N 11VV FIBERGLASS TANK W/BANDED 20-mil COX CANYON UNIT #008 BLANCO MV 81 32N 11W BG1 HDPE SECONDARY LINER 3004511492 COX CANYON UNIT #008A 3004522096 BLANCO MV 17H3 32N 11W BG₁ DBL WALL STEEL FIBERGLASS TANK W/BANDED 20-mil COX CANYON UNIT #008B 3004532080 BLANCO MV 8P 32N 11W BGT HDPE SECONDARY LINER FIBERGLASS TANK w/BANDED 20-mil-COX CANYON UNIT #008C **BLANCO MV** 17P 32N 11W BGI HDPE SECONDARY LINER 3004531187 COX CANYON UNIT #009A FIBERGLASS TANK w/BANDED 20-mil 20D 32N HDPE SECONDARY LINER COM 11W BGI 3004522092 BLANCO MV COX CANYON UNIT #009B BASIN DK / BG₁ **DBL WALL STEEL** COM BLANCO MV 20B 32N 11W 3004533926 BASIN DK / DBL WALL STEEL COX CANYON UNIT #009C 3003933851 BLANCO MV 20F 32N 11W BG1 FIBERGLASS TANK w/BANDED 20-mil-11W HDPE SECONDARY LINER COX CANYON UNIT #013 20A BGT BLANCO PC 32N 3004521489

WELLS W/FEDERAL		anne ar fer propadien sample internas et men printeriorer leit en agrece e. a					
SURF MGT	API	FMT	SEC	TWN	RNG	PIT TYPE	CONSTRUCTION MATERIAL
COX CANYON UNIT #023							FIBERGLASS TANK W/BANDED 20-mil
COM	3004522537	BLANCO PC	17C	32N	11W	BG1	HDPE SECONDARY LINER
							FIBERGLASS TANK W/BANDED 20-mil
COX CANYON UNIT #025	3004522572	BLANCO PC	90	32N	111//	BG1	HDPE SECONDARY LINER
							FIBERGLASS TANK W/BANDED 20-mil
COX CANYON UNIT #200	3004527878	BASIN FTC	91	3211	11VV	BGT	HDPE SECONDARY LINER
İ							FIBERGLASS TANK W/BANDED 20-mil
COX CANYON UNIT #200A	3004532126	BASIN F1C	9()	3211	1 1 VV	BG1	HDPE SECONDARY LINER
							FIBERGLASS TANK w/BANDED 20-mil
COX CANYON UNIT #203	3004527872	BASINFIC	17A	3214	11W	BGT	HDPE SECONDARY LINER
MADDOX #001	3004511487	BLANCO MV	10N	32N	11W	BGT	DBL WALL STEEL
MADDOX #001A.	3004523539	BLANCO MV	10F)	32N	11W	BGT	DBL WALL STEEL
NM 32-11 #001	3004511309	BLANCO MV	20O	3214	1 1 VV	BGT	DBL WALL STEEL
NIN 00 11 10015 0011		BASIN DK /	4.4.1				CONTRACTOR OF STATE
NM 32-11 #001B COM	3004532024	BLANCO MV	20J	32N	1 1 W	BGT	DBL WALL STEEL
NBA 20 44 #004C CON	0004500004	BASIN DK /	no.	2011	4.4161	0.03	ENERGY AND A CORE CO.
NM 32 11 #001C COM	3004532804	BLANCO MV	201.	32N	11W ;	BG1	DBL WALL STEEL FIBERGLASS TANK W/BANDED 20-mil
NM 32-11 #002 COM	3004511380	BLANCO MV	19A	32N	11W	BG1	HDPE SECONDARY LINER
1144 32-1 #002 GOM	5004011500	DLAINCO MV	IBA	3214	1100	D (3)	THE SECONDARY TIMER
NM 32-11 #002A COM	3004529017	BLANCO MV	190	32N	11W	BGT	DBL WALL STEEL
	3004023011	ER MICH IN	100	CIZIN	, (• •	CiCit	DOC WALL STEEL
NM 32-11 #002B COM	3004532670	BLANCO MV	191	3211	11W	BGT	DBI WALL STEEL
	000002010	ESET II VES CO III V			,	1,01	
NM 32-11 #002C COM	3004533077	BLANCO MV	19G	32N	11W	BG1	DBL WALL STEEL
ROSA UNIT #001 SWD	3003927055	SWD	231	31N	06VV	BGT	DBL WALL STEEL
		BASIN DK /					FIBERGLASS TANK w/BANDED 20 mil
ROSA UNIT #001E	3003925411	BLANCO MV	11P	31N	06W	BGT	HDPE SECONDARY LINER
		BLANCO MV /					
ROSA UNIT #005A	3003925407	ROSA PC	26P	31N	OGVV	BGT	DBL WALL STEEL
		BASIN DK /					
ROSA UNIT #005B	3003926927	BLANCO MV	26B	3114	06W	BGT	DBL WALL STEET
DOCALIANT BOOK	000000000000	DI ANICOLONIA	6) ())	0.44		5.07	FIBERGLASS TANK W/BANDED 20-mil
ROSA UNIT #005Y	3003926078	BLANCO MV	26H	31N	OGW	BGT	HDPE SECONDARY LINER
ROSA UNIT #008	2002007044	BLANCO MV / ROSA PC	26M	2461	()("IAI	דיים	FIBERGLASS TANK w/BANDED 20-mil HDPE SECONDARY LINER
NOSA ONEL #006	3003907944	BLANCO MV /	2010	31N	OGW	BGT	FIBERGLASS TANK W/BANDED 20-mil
ROSA UNIT #008	3003907944	ROSA PC	26M	31N	06W	BG1	HDPE SECONDARY LINER
	00000000	BLANCO MV /	2.010	(7)114	0000	501	FIBERGLASS TANK W/BANDED 20-mil
ROSA UNIT #008A	3003925430	ROSA PC	26D	31N	06W	BG1	HDPE SECONDARY LINER
							FIBERGLASS TANK W/BANDED 20-mil
ROSA UNIT #008C	3003926944	BLANCO MV	26N	31N	06W	BG1	HDPE SECONDARY LINER
							FIBERGLASS TANK w/BANDED 20-mil
ROSA UNIT #009	3003907975	BLANCO MV	11K	31N	06W	BGT	HDPE SECONDARY LINER
		BASIN DK /					
ROSA UNIT #009A	3003925584	BLANCO MV	11C	31N	06W	BGT	DBL WALL STEEL
							FIBERGLASS TANK w/BANDED 20-mil
10SA UNIT #009B	3003927042	BLANCO MV	11E	3111	OGVV	BG1	HDPE SECONDARY LINER
OCA HAIL WOLLD		DI 44.000				<u></u> -	FIBERGLASS TANK W/BANDED 20 mil
:OSA UNIT #010B	3003926556	BLANCO MV	13N	31N	06W	BG1	HDPE SECONDARY LINER
MEATINET HOTAL	000000000	OLANCO IN	4081	241	00111	m ^~	DDI MALL CTET!
OSA UNIT #010C	3003926918	BLANCO MV	13N	31N	06W	BGT	DBL WALL STEEL
OSA UNIT #0100	3003926556	BI ANCO MV	13N	31N	ORIM	BG1	ORI WALL STEEL
CONTRAINE	3003820330	DI VIACO IMA	1317	STIN	06W	100	DBL WALL STEEL

ι

WELLS W/FEDERAL						·	in an arrang angga arrang an an ang apangpangan di salah 1888 di banapa dan Marinaga (ang ang ang ang ang angga ang an ang
SURF MG1	API	FMT	SEC	TWN	RNG	PITTYPE	CONSTRUCTION MATERIAL
		BLANCO MV /					
ROSA UNIT #012A	3003925900	ROSA PC	15J	3114	OGW	BG1	DBL WALL STEEL
E.C.C. A. LIBUT. 40400	00.00000	BASIN DK /					FIBERGLASS TANK W/BANDED 20-mil
ROSA UNIT #012B	3003926555	BLANCO MV	15P	3111	06W	BGT	HDPE SECONDARY LINER
ROSA UNIT #012C	3003929486	BLANCO MV	15A	31N	061/0	SG1	SINGLE WALL STEEL
	COOCUE DO	176711112271117	****	2114	(70)	CA,J	FIBERGLASS TANK W/BANDED 20-mil
ROSA UNIT #013	3003907936	BLANCO MV	31G	31N	05W	BG1	HDPE SECONDARY LINER
					-		FIBERGLASS TANK w/BANDED 20-mil
ROSA UNIT #013A	3003926298	BLANCO MV	31F	31N	05VV	BGT	HDPE SECONDARY LINER
		BASIN DK /					
ROSA UNIT #013B COM	3003929834	BLANCO MV	31A	31N	05Vv		DBL WALL STEEL
DOO A LINUT HOLA	2002007070	DI ANICO MIL	600	0.41	04144		FIBERGLASS TANK w/BANDED 20-niil
ROSA UNIT #014	3003907958	BLANCO MV	23B	31N	06W	BG1	HDPE SECONDARY LINER HBERGLASS TANK w/BANDED 20-mil
ROSA UNIT #014A	3003926280	BLANCO MV	23P	31N	06VV	BG1	HDPE SECONDARY LINER
	300302 02 00	BASIN DK /	2 (//		OUV	БОТ	
ROSA UNIT #014C	3003930132	BLANCO MV	23H	31N	06W	BG1	DBL WALL STEEL
							FIBERGLASS TANK w/BANDED 20-mil
ROSA UNIT #015	3003907946	BLANCO MV	29H	31N	05W	BGT	HDPE SECONDARY LINER
							FIBERGLASS TANK w/BANDED 20-mil
ROSA UNIT #016	3003907963	BLANCO MV	14N	3110	06W	BGT	HDPE SECONDARY LINER
DOCA HUIT ADAGA	00000001.400	DI MICONAN				0.00	FIBERGLASS TANK W/BANDED 20-mil
ROSA UNIT #016A	3003925496	BLANCO MV	14C	31N	06W		HDPE SECONDARY LINER FIBERGLASS TANK W/BANDED 20-mil
ROSA UNIT #016B	3003926218	BLANCO MV	1411	31N	06Vv		HDPE SECONDARY LINER
	30000020210	DUMINOU MIN	1711	SHN	OOVV		FIBERGLASS TANK W/BANDED 20-mil
ROSA UNIT #017A	3003926272	BLANCO MV	200	31N	05W		HDPE SECONDARY LINER
		BASIN DK /					FIBERGLASS TANK w/BANDED 20 mit
ROSA UNIT #017B	3003926971	BLANCO MV	20J	31N	05W	BGI	HDPE SECONDARY LINER
		BLANCO MV /					FIBERGLASS TANK W/BANDED 20-mil
ROSA UNIT #018	3003907960	ROSA PC	22H	31N	06W	BGT	HDPE SECONDARY LINER
 ROSA UNIT #018A	2002000420	BLANCO MV /	000	0.414	07.164	0.07	DDI MALL CITTI
ROSA UNIT 40 103	3003925436	ROSA PC	22P	3111	06W	SGT	DBL WALL STEEL
ROSA UNIT #018B	3003927052	BLANCO MV	220	31N	06W	BG1	DBI WALL STEEL
				.,,,			FIBERGLASS TANK W/BANDED 20-mil
ROSA UNIT #019	3003907955	BLANCO MV	24K	31N	06Vv		HDPE SECONDARY LINER
							FIBERGLASS TANK w/BANDED 20-mil
ROSA UNIT #019B	3003926560	BLANCO MV	24L	31N	06W	BGT	HDPE SECONDARY LINER
DOCA LEUT HOTOC	202200000	DI ANGO MI	0.45	0.41.1	()(1) & (507	DDI 1444 L CT [[]
ROSA UNIT #019C	3003929625	BLANCO MV	24D	31N	06W	BGT	DBL WALL STEEL
ROSA UNIT #019C	3003929625	BLANCO MV	24D	31N	06W	BG1	DBL WALL STEEL
	0000020020			.,,,,			FIBERGLASS TANK w/BANDED 20-mil
ROSA UNIT #020	3003907969	BLANCO MV	14G	31N	06W	BG1	HDPE SECONDARY LINER
							FIBERGLASS TANK w/BANDED 20-mil
ROSA UNIT #020A	3003925495	BLANCO MV	140	31N	06W	BGT	HDPE SECONDARY LINER
DOOL LINET GOOD							
ROSA UNIT #020B	3003926220	BLANCO MV	14A	31N	06W		DBL WALL STEEL
ROSA UNIT #020C	3003926221	BLANCO MV	14J	31N	06W		FIBERGLASS TANK w/BANDED 20-mil HDPE SECONDARY LINER
11035 OIVII #020C	3003920221	DLANCO WV	143	2414	OOVV		FIBERGLASS TANK W/BANDED 20-mil
ROSA UNIT #021A	3003926121	BLANCO MV	23G	31N	06W		HDPE SECONDARY LINER
						_ ,	
ROSA UNIT #021B	3003926554	BLANCO MV	23K	31N	06W	BGT	DBL WALL STEEL
,							FIBERGLASS TANK w/BANDE() 20-mil
ROSA UNF-#022	300390797 1	BLANCO MV_	1 <u>8</u> A	<u> </u>	- 05 <u>VV</u>	BGT	HDPE-SECONDARY-LINER,

•

WELLS W/FEDERAL SURF MGT	ADI	EMT	SEC	TIAIAI	PNC	מיי דעם	CONSTRUCTION MATERIAL
JUNT MUI	API	FMT	SEC	TWN	KNG	PIT TYPE	FIBERGLASS TANK W/BANDED 20-mil
ROSA UNIT #022A	2002000000	BLANCO MV	10/2	9 (11	MALL	1)())	HDPE SECONDARY LINER
NOSA ONIT HOZZA	3003926390	DI ANCO MV	18C	31N	05VV	BG1	
ROSA UNIT #023	2002002042	BLANCO MV	12616.8	71 4 8 1	05Vv	BGI	FIBERGLASS TANK WBANDED 20 mil HDPE SECONDARY LINER
ROSA ONT #025	3003907942	BLANCO MV	29M	31N	USVV	B(0.1	FIBERGLASS TANK w/BANDED 20 mil
ROSA UNIT #023B	20020000.662	DI ANICO MA	201	0.161	11516	DCI	HDPE SECONDARY LINER
NOSA ONIT #0230	3003926553	BLANCO MV	29E	31N	05W	BGT	FIBERGLASS TANK W/BANDED 20 mil
ROSA UNIT #023C	3003927609	BASIN DK /	CICIL	0.414	tot M.	D.CO.T.	HDPL SECONDARY LINER
ROSA UNIT #025C	3003927608	BLANCO MV	291	31N	05W	BGT	
ROSA UNIT #024	3003907933	DI ANICO MA	0.014	21.4.6.1	tit it.	007	FIBERGLASS TANK w/BANDED 20-mil HDPE SECONDARY LINER
NOSA ONIT #024	3003901933	BLANCO MV BASIN DK /	32M	31N	05Vv	BGT	FIDE SECONDANT LINES
ROSA UNIT #024A	200 3000 5336		200	0.481	or VI	c ca	DEL MALL CIECL
NOSA ONIT HOZAN	3003925568	BLANCO MV	32E	31N	05VV	SGT	DBL WALL STEEL
ROSA UNIT #024B	0000000000	BASIN DK /	00.41	0.41	()()()	001	FIBERGLASS TANK w/BANDED 20-mill HDPE SECONDARY LINER
ROSA UNIT #0246	3003926630	BLANCO MV	32N	31N	05W	BG1	
ROSA UNIT #024C	0.000000000	BASIN DK /	44.6	0.481	0514	0.023	FIBERGLASS TANK W/BANDED 20-mill- HDPE SECONDARY LINER
ROSA OINT #0240	3003926968	BLANCO MV	32C	31N	05W	BGT	PIDE SECONDARY LINER
ROSA UNIT #026A	00000000000	BASIN DK /	420	0.481	OLIAI	ר לאיז	MEN WALL CTEEL
ROSA UNIT #026A	3003925580	BLANCO MV	32O	31N	05W	SGT	DBI WALL STEEL
ROSA UNIT #026B	3003926788	BASIN DK	32G	31N	05W	SG1	DBL WALL STEEL
TOOK ONLY HOZOD	3003920700	DAGIN DIX	320	2114	USVV	301	FIBERGLASS TANK wBANDED 20-mil
ROSA UNIT #029	2003611126	BLANCO MV	2211	226	06W	BGI	HDPE SECONDARY LINER
TOSA UNIT #029	3004511136	BASIN DK /	32H	32N	UUVV	-	FIBERGLASS TANK w/BANDED 20-mil
POSA UNIT #0298	3004530709	BLANCO MV	32B	2014	06W	BGT	HDPE SECONDARY LINER
TOOM CINIT HOZBE	3004030108	BASIN DK /	SZD	35N	OUVV	D(51	TIDEL SECONDARY LINER
ROSA UNIT #029M	3004529584	BLANCO MV	321	2011	űGW	BGT	DBL WALL STEEL
ROGA GIVE POZERI	5004529564	BASIN DK /	321	3211	CICIAA	001	FIBERGLASS TANK w/BANDED 20-mil
ROSA UNIT #030 COM	2002025470		120	946	OCIAL	per	HDPE SECONDARY LINER
ROSA ONT HOSO COM	3003925570	BLANCO MV	120	31N	0677		FIBERGLASS TANK W/BANDED 20-mil
ROSA UNIT #030A	200.3620000	DI ALICCITAL	4014	0.414	0000		HDPE SECONDARY LINER
ROSA UNIT 4030A	3003926068	BLANCO MV	12M	31N	06W		FIBERGLASS TANK W/BANDED 20-mil
ROSA UNIT #030B	3003926601	BLANCO MV	12N	211	06W		HDPE SECONDARY LINER
NOON UNIT #USED	2003920001	DEVINCE MA	1218	31N	OOVV	100	HBT E SECONDANT EINEN
ROSA UNIT #030C	3003929842	BLANCO MV	12P	31N	06W	BGT	DBL WALL STEEL
	11/00/02/00/12	CE/INOO III	72.1	(///-	(/(/ (FIBERGLASS TANK w/BANDED 20-mil
ROSA UNIT #031	3003926279	BLANCO MV	17C	31N	05Vv		HDPE SECONDARY LINER
	30000020210	CALT THE COUNTY	110	,	0011		FIBERGLASS TANK w/BANDED 20-mil
ROSA UNIT #031A	3003926346	BLANCO MV	17L	31N	05W		HDPE SECONDARY LINER
		BASIN DK /		. ,,,			FIBERGLASS TANK w/BANDED 20-mil
ROSA UNIT #031B	3003926579	BLANCO MV	17D	31N	05W		HDPE SECONDARY LINER
	,						FIBERGLASS TANK w/BANDED 20-mil
ROSA UNIT #031C	3003926578	BLANCO MV	17N	3111	05W	BGT	HDPE SECONDARY LINER
		BLANCO MV /					
ROSA UNIT #032	3003925389	ROSA PC	2111	31N	067/	BG1	DBL WALL STEEL
		BLANCO MV /					
ROSA UNIT #032A	3003925417	ROSA PC	21F	31N	06W	BG1	DBL WALL STEEL
		BASIN DK /					FIBERGLASS TANK W/BANDED 20-mil
ROSA UNIT #032B	3003926771	BLANCO MV	21G	31N	06W	BGT	HDPE SECONDARY LINER
		BASIN DK /					FIBERGLASS TANK W/BANDED 20-mil
ROSA UNIT #032C	3003927240	BLANCO MV	21F	31N	06W		HDPE SECONDARY LINER
				-			FIBERGLASS TANK W/BANDED 20-mil
ROSA UNIT #034	3003907984	BLANCO MV	36B	32N	06W		HDPE SECONDARY LINER
ROSA UNIT #034A	3003926119	BLANCO MV	361	32N	06W	BGT	DBL WALL STEEL
				-			
ROSA UNIT #034A	3003926119	BLANCO MV	361	32N	06W	SG1	DBL WALL STEEL
							FIBERGLASS TANK w/BANDED 20-mil
		BLANCO MV	36J	32N	06W	BG1	HDPE SECONDARY LINER

WELLS W/FEDERAL SURF MGT	API	FMT	SEC	TWN	RNG	PIT TYPE	
ROSA UNIT #034C	3003926969	BLANCO MV	36H	32N	06W	8G1	FIBERGLASS TANK W/BANDED 20-r HDPE SECONDARY LINER
ROSA UNIT #035X	3004510996	BLANCO MV	5K	3111	0617v	BG1	DBI, WALL STEEL FIBERGLASS TANK W/BANDED 20-r
ROSA UNIT #036	3003907977	BLANCO MV	1111	31N	06VV	BG1	HDPE SECONDARY LINER FIBERGLASS TANK WBANDED 20-1
ROSA UNIT #036C	3003930182	BLANCO MV	11G	3111	06W	BGT	HDPE SECONDARY LINER FIBERGLASS TANK WBANDED 20-1
ROSA UNIT #041	3003907981	BLANCO MV BASIN DK /	5K	31N	05W	BGT	HDPE SECONDARY LINER FIBERGLASS TANK W/BANDED 20-
ROSA UNIT #041B	3003927014	BLANCO MV	6P	31N	05W	BGT	HDPE SECONDARY LINER
ROSA UNIT #044	3003925873	BI ANCO MV	35K	32N	06W	BG1	DBI WALL STEEL
ROSA UNIT #044A	3003926161	BI ANCO MV	35E	32N	06W	SGI	SINGLE WALL STEEL
ROSA UNIT #044A	3003926161	BI ANCO MV	35E	32N	06W	SGI	DBL WALL STEEL FIBERGLASS TANK WBANDED 20 (
ROSA UNIT #044B	3003926685	BLANCO MV	35C	32N	06W	BG1	HDPE SECONDARY LINER FIBERGLASS TANK WIBANDED 20-
ROSA UNIT #045	3003923013	BLANCO MV BASIN DK /	Me	31N	05W	BG1	HDPE SECONDARY LINER FIBERGLASS TANK W/BANDED 20-
OSA UNIT #046A	3003926986	BLANCO MV	80	31N	05W	BGI	HDPE SECONDARY LINER
ROSA UNIT #051	3003920289	BASIN DK	23C	31N	06W	BGT	DBL WALL STEEL FIBERGLASS TANK WBANDED 20-
ROSA UNIT #053	3003920293	BASIN DK	88	31N	05W	BGT	HDPE SECONDARY LINER FIBERGLASS TANK WBANDED 20-
ROSA UNIT #055	3003920923	BASIN DK	341	31N	05W	BGT	HDPE SECONDARY LINER
IOSA UNIT #059 DK	3003923270	BASIN DK	25N	3114	06W	BG1	DBL WALL STEEL FIBERGLASS TANK WBANDED 20-1
ROSA UNIT #059 GL	3003923270	UNDES GL	2511	31N	06VV		HDPE SECONDARY LINER FIBERGLASS TANK WBANDED 20-1
POSA UNIT #060	3004529798	BLANCO MV	41	31N	()6Vv		HDPE SECONDARY LINER
OSA UNIT #064	3003921703	BASIN DK	29A	31N	05W	BGT	DBL WALL STEEL
OSA UNIT #064	3003921703	BASIN DK BASIN DK /	29A	31N	05W	SGT	DBI WALL STEEL
OSA UNIT #064M	3003925563	BLANCO MV	29F	31N	05W	-	DBL WALL STEEL FIBERGLASS TANK WBANDED 20-1
OSA UNIT #065	3003921702	BASIN DK	17A	31N	(15VV	•	HDPE SECONDARY LINER FIBERGLASS TANK W/BANDED 20-1
OSA UNIT #066	3003921758	BASIN DK BASIN DK /	13L	31N	06VV		HDPE SECONDARY LINER FIBERGLASS TANK WBANDED 20-1
OSA UNIT #066M	3003925747	BLANCO MV	13F	31N	06W		HDPE SECONDARY LINER FIBERGLASS TANK WBANDED 20-1
OSA UNIT #072	3003925509	BLANCO MV	Gl	31N	05W		HDPE SECONDARY LINER FIBERGLASS TANK W/BANDED 20-1
OSA UNIT #072A	3003925795	BI ANCO MV	6K	31N	05W	BG7	HDPE SECONDARY LINER FIBERGLASS TANK WBANDED 20-1
OSA UNIT #075	3004529895	BLANCO MV	101	31N	06VV	BGT	HDPE SECONDARY LINER FIBERGLASS TANK W/BANDED 20-1
OSA UNIT #075A	3004529854	BLANCO MV DK/UNDES	40	31N	06W	BGT	HDPE SECONDARY LINER FIBERGLASS TANK W/BANDED 20-1
OSA UNIT #07 ²	3003922538	GL/BLANCO	33L	31N	05W		HDPE SECONDARY LINER

WELLS W/FEDERAL SURF MGT	API	FMT	SEC	TWN	RNG	PIT TYPE	CONSTRUCTION MATERIAL
	The Angles is the Community of the Commu	BASIN DK /			·		
ROSA UNIT #079	3003922539	BLANCO MV BASIN DK /	22K	3111	06W	BG1	DBL WALL STEEL
ROSA UNIT #079	3003922539	BLANCO MV /	22K	31N	06W	SGT	DBL WALL STEEL
ROSA UNIT #079A	3003925412	ROSA PC BASIN DK /	22E	3114	VVAU	BG1	DBI WALI STEEL
ROSA UNIT #079B	3003926920	BLANCO MV	22C	31N	06W	BGT	DBI WALL STEEL
ROSA UNIT #079C	3003929902	BLANCO MV BASIN DK /	31P	3111	05W		DBL WALL STEEL FIBERGLASS TANK W/BANDED 20-m
ROSA UNIT #080	3003922537	BLANCO MV	8K	31N	05W	BG1	HDPE SECONDARY LINER FIBERGLASS TANK WBANDED 20-m
ROSA UNIT #080A	3003926413	BLANCO MV	8F	31N	05W	BGT	HDPE SECONDARY LINER FIBERGLASS TANK WBANDED 20-11
ROSA UNIT #085	3003922778	BASIN DK	20A	31N	05W	BGT	HDPE SECONDARY LINER FIBERGLASS TANK W/BANDED 20-m
ROSA UNIT #085	3003922778	BLANCO MV	20A	31N	05VV	BGT	HDPE SECONDARY LINER FIBERGLASS TANK W/BANDED 20-m
ROSA UNIT #085A	3003926314	BLANCO MV	20C	3111	05W		HDPE SECONDARY LINER
ROSA UNIT #085B	3003930130	BLANCO MV	20D	3111	05 V V	BG1	DBI WALL STEEL
708A UNIT #086	3003922766	UNDES GL BLANCO MV /	12W	31N	04W	SG1	SINGLE WALL STEEL
ROSA UNIT #088	3004525140	ROSA PC	8E	31N	06W		DBL WALL STEEL FIBERGLASS TANK w/BANDED 20 ir
ROSA UNIT #089	3003922782	BLANCO MV	34A	32N	06VV	BG1	HDPE SECONDARY LINER FIBERGLASS TANK w/BANDED 20 m
ROSA UNIT #089A	3003925512	BLANCO MV	340	32N	06W		HDPE SECONDARY LINER
ROSA UNIT #089B	3003926851	BLANCO MV	341	32N	06W	BGT	DBI WALL STEEL
ROSA UNIT #089C	3003926674	BLANCO MV	34G	3211	06W		SINGLE WALL STEEL FIBERGLASS TANK WBANDED 20-m
ROSA UNIT #090 COM	3004525370	BI ANCO MV	33G	32N	06VV		HDPE SECONDARY LINER
ROSA UNIT #090A COM	3004529259	BLANCO MV	33G	3514	06\4		DBL WALL STEEL FIBERGLASS TANK w/BANDED 20-m
ROSA UNIT #091	3003922780	BLANCO MV	35H	32N	W80		HDPE SECONDARY LINER
KOSA UNIT #091A	3003925790	BLANCO MV -	35O	32N	06W	SG1	DBI WALL STEEL
ROSA UNIT #091B	3003926684	BLANCO MV	35P	32N	W90		DBL WALL STEEL FIBERGLASS TANK WBANDED 20-n
ROSA UNIT #091C	3003926991	BLANCO MV	35G	3211	06W	BGT	HDPE SECONDARY LINER FIBERGLASS TANK W/BANDED 20-m
ROSA UNIT #098	3003923265	BASIN DK / GL BASIN DK /	231.	31N	06W		HDPE SECONDARY LINER
ROSA UNIT #100B	3003929547	BLANCO MV	210	31N	06W	BGT	DBL WALL STEEL
ROSA UNIT #100C	3003929851	BLANCO MV BLANCO MV /	21K	31N	W60	BGT	DBL WALL STEEL
ROSA UNIT #100E	3003925135	ROSA PC	211	31N	06W	SG1	SINGLE WALL STEEL
MIGHT FIND AROS	3003925577	BLANCO MV	24F	31N	06W		DBL WALL STEEL FIBERGLASS TANK w/BANDED 20-n
OSA UNIT #105	3003923506	BASIN DK / GL	7G	3111	05W		HDPE SECONDARY LINER

WELLS W/FEDERAL SURF MG1	API	FM1	SEC	TWN	RNG	PIT TYPE	CONSTRUCTION MATERIAL
ROSA UNII #119	3003925143	BASIN DK	18N	31N	0517	BG1	DBL WALL STEEL FIBERGLASS TANK w/BANDED 20-n
ROSA UNIT #125	3003925144	BLANCO MV	13B	3111	06W	BGT	HDPE SECONDARY LINER
ROSA UNIT #125C	3003929843	BLANCO MV BASIN DK /	13G	31N	061/7	BG1	DBL WALL STEEL FIBERGLASS TANK WBANDED 20 n
ROSA UNIT #125E	3003925526	BLANCO MV	13.1	31N	06//	BGI	HDPE SECONDARY LINER
ROSA UNIT #129	3003926304	BLANCO MV	34E	32N	06W	BGI	DBL WALL STEEL
ROSA UNIT #129A	3003926297	BLANCO MV	34K	32N	06W	BGT	DBL WALL STEEL FIBERGLASS TANK W/BANDED 20-n
ROSA UNIT #137	3003925410	BLANCO MV BLANCO MV /	31K	31N	05W	BG1	HDPE SECONDARY LINER
ROSA UNIT #137A	3003926129	ROSA PC	311	31N	05W	BG1	DBL WALL STEFL
ROSA UNIT #137B	3003927002	BLANCO MV	31P	31N	05VV	BG1	FIBERGLASS TANK W/BANDED 20-n HDPE SECONDARY LINER FIBERGLASS TANK W/BANDED 20-n
ROSA UNIT #138	3004529147	BLANCO MV / ROSA PC BLANCO MV /	171	31N	06VV	BGT	HDPE SECONDARY LINER
ROSA UNIT #138A	3004529134	ROSA PC	1714	3111	06W	BG1	DBI WALL STEEL
ROSA UNIT #138B	3004532168	BLANCO MV	1 <i>î</i> H	3111	06VV	BGT	DBI WALL STEFL
ROSA UNIT #139A	3004529600	BLANCO MV	17M	31N	06W	BG1	DBI WALL STEEL
ROSA UNIT #140	3003925435	ROSA PC	22K	31N	06W	BGT	DBL WALL STEEL
ROSA UNIT #144	3003925421	ROSA PC	26A	3111	06W	BG1	DBI WALL STEEL
ROSA UNIT #145C	3004533086	BLANCO MV	16F	31N	06W	·-	DBI, WALL STEEL FIBERGLASS TANK w/BANDED 20-m
ROSA UNIT #146A	3003925513	BLANCO MV	28N	31N	05W		HDPE SECONDARY LINER
ROSA UNIT #146C	3003930187	BLANCO MV	28B	31N	05W	BG1	DBI WALL STEEL
ROSA UNIT #148	3003925493	BASIN DK	20	31N	06W	BG1	DBL WALL STEEL
ROSA UNIT #148A	3003925776	BLANCO MV	214	31N	06W		DBL WALL STEEL FIBERGLASS TANK w/BANDED 20 m
ROSA UNIT #148B	3003926985	BLANCO MV	2P	31N	06W	BG1	HDPE SECONDARY LINER FIBERGLASS TANK W/BANDED 20-n
ROSA UNIT #149	3003925501	BLANCO MV	12G	31N	0674		HDPE SECONDARY LINER
ROSA UNIT #149A	3003925807	BLANCO MV BASIN DK /	12F	31N	06W		DBI, WALL STEEL FIBERGLASS TANK w/BANDED 20-n
ROSA UNIT #149B	3003926599	BLANCO MV	12E	31N	06W	BG1	HDPE SECONDARY LINER FIBERGLASS TANK W/BANDED 20-n
ROSA UNIT #150	3004529229	BLANCO MV	32F	32N	06W		HDPE SECONDARY LINER
ROSA UNIT #150A	3004529592	BLANCO MV	32M	32N	06W	BG1	DBI WALL STEEL
ROSA UNIT #150B	3004530874	BASIN DK / BLANCO MV	32D	3211	06W	BG1	DBL WALL STEEL
ROSA UNIT #150C	3004532157	BLANCO MV	32K	32N	06W	BGT	DBI WALL STEEL
ROSA UNIT #15.	3004529267	BLANCO MV	33C	32N	06W	BG1	DBL WALL STEEL

WELLS W/FEDERAL SURF MGT	API	FMT	SEC	TWN	RNG	PIT TYPE	CONSTRUCTION MATERIAL
ROSA UNIT #151A	3004529631	BLANCO MV	33L	32N	06W	BGI	DBL WALL STEEL
ROSA UNIT #151C	3004532196	BLANCO MV	3314	32N	06W	BG1	DBL WALL STEEL FIBERGLASS TANK W/BANDED 20-m
ROSA UNIT #152	3003925494	BLANCO MV	36E	32N	U6W	BG1	HDPE SECONDARY LINER
ROSA UNIT #152A	3003925695	BLANCO MV	36N	3214	06W	BGT	DBL WALL STEEL
ROSA UNIT #152B	3003926631	BI ANCO MV	36C	32N	06W	** **	DBL WALL STEEL FIBERGLASS TANK W/BANDED 20-n
ROSA UNIT #152C	3003927635	BLANCO MV	361	32N	06W		HDPE SECONDARY LINER FIBERGLASS TANK WBANDED 20-n
ROSA UNIT #153	3003925524	BI ANCO MV	170	31N	05VV	BG1	HDPF SECONDARY LINER FIBERGLASS TANK WBANDED 20-n
ROSA UNIT #153A	3003926329	BLANCO MV BASIN DK /	17A	31N	05W	BGT	HDPE SECONDARY LINER FIBERGLASS TANK W/BANDED 20-m
ROSA UNIT #153B	3003927603	BLANCO MV	171	31N	05W	BGT	HDPE SECONDARY LINER
ROSA UNIT #154	3003925893	BLANCO MV	7N	31N	05V/	BGT	DBL WALL STEEL FIBERGLASS TANK WBANDED 20-n
ROSA UNIT #154A	3003926274	BLANCO MV	7P	3111	05W		HDPE SECONDARY LINER FIBERGLASS TANK WBANDED 20 n
ROSA UNIT #156	3004529661	BLANCO MV	9A	3111	06W	BG1	HDPE SECONDARY LINER FIBERGLASS TANK WIBANDED 20-n
ROSA UNIT #156A	3004529640	BLANCO MV BASIN DK /	91	31N	(16W		HDPE SECONDARY LINER
ROSA UNIT #159 COM	3003925583	BLANCO MV	190	31N	05W		DBL WALL STEEL. FIBERGLASS TANK W/BANDED 20 m
ROSA UNIT #159A	3003926273	BLANCO MV	19N	3111	0574	BG1	HDPE SECONDARY LINER FIBERGLASS TANK W/BANDED 20-m
ROSA UNIT #15C	3003930111	BLANCO MV BLANCO MV /	29G	31N	05VV		HDPE SECONDARY LINER
ROSA UNIT #160	3003925890	ROSA PC	250	31N	06V4	BG1	DBL WALL STEEL
ROSA UNIT #160A	3003925818	BLANCO MV BASIN DK /	25N	31N	06W		DBL WALL STEEL FIBERGLASS TANK w/BANDED 20-m
ROSA UNIT #160B	3003926962	BLANCO MV	25L	31N	06/4		HDPE SECONDARY LINER
ROSA UNIT #160C	3003929778	BLANCO MV	25J	31N	06Vv		DBL WALL STEEL FIBERGLASS TANK w/BANDED 20-m
ROSA UNIT #162	3003926069	BLANCO MV	30K	31N	05W	BGT	HDPE SECONDARY LINER
ROSA UNIT #162B	3003929845	BLANCO MV	30P	31N	05W		DBL WALL STEEL FIBERGLASS TANK W/BANDED 20 n
ROSA UNIT #163	3003926345	BLANCO MV	24G	31N	06W		HDPE SECONDARY LINER FIBERGLASS TANK W/BANDED 20-m
ROSA UNIT #163A	3003926336	BLANC() MV	24()	31N	06W		HDPE SECONDARY LINER
ROSA UNIT #163B	3003929921	BLANCO MV	24B	31N	06W	SGI	DBL WALL STEEL
ROSA UNIT #163C	3003929611	BLANCO MV BASIN DK /	24J	31N	06W		SINGLE WALL STEEL FIBERGLASS TANK w/BANDED 20-m
ROSA UNIT #164	3003926151	BLANCO MV	1J	31N	06W	BGT	HDPE SECONDARY LINER FIBERGLASS TANK W/BANDED 20-m
ROSA UNIT #164A	3003926080	BLANCO MV BASIN DK /	1J	31N	06W	BGT	HDPE SECONDARY LINER FIBERGLASS TANK W/BANDED 20-m
ROSA UNIT #164E	3003927242	BLANCO MV	1 J	3111	06W		HDPE SECONDARY LINER

,

.

WELLS w/FEDERAL SURF MGT	API	FM1	SEC	TWN	RNG	PIT TYPE	CONSTRUCTION MATERIAL
		BLANCO MV /					
ROSA UNIT #165	3003926070	ROSA PC	25F	31N	06W	BGT	DBL WALL STEEL FIBERGLASS TANK W/BANDED 20-n
ROSA UNIT #165A	3003926150	BLANCO MV BASIN DK /	25B	31N	06VV	BG1	HDPE SECONDARY LINER
ROSA UNIT #165B	3003926557	BLANCO MV BASIN DK /	25E	31N	06Vv	EG1	DBI WALL STEEL
ROSA UNIT #165C	3003926961	BLANCO MV	25G	31N	06W	BG1	DBL WALL STEEL FIBERGLASS TANK W/BANDED 20-m
ROSA UNIT #166	3003926275	BLANCO MV	30A	31N	05W	BGT	HDPE SECONDARY LINER FIBERGLASS TANK W/BANDED 20 m
ROSA UNIT #166A	3003926282	BLANCO MV	30F	31N	05W	BG1	HDFE SECONDARY LINER FIBERGLASS TANK W/BANDED 20-m
ROSA UNIT #167A	3004529886	BLANCO MV	A8	3111	06Vv	BG1	HDPF SECONDARY LINER
ROSA UNIT #169	3003926130	BLANCO MV	3J	311/	06W	BG1	DBI WALL STEEL
ROSA UNIT #169A	3003926149	BLANCO MV	3.J	31N	06W		DBL WALL STEEL FIBERGLASS TANK w/BANDED 20-m
ROSA UNIT #169C	3003927717	BLANCO MV	2M	3111	06/4		HDPE SECONDARY LINER
ROSA UNIT #170	3003925851	BLANCO MV	21N	31N	W80	BGT	DBI WALL STEEL
ROSA UNIT #171	3003926286	BLANCO MV	7G	3111	06W		DBL WALL STEEL FIBERGLASS TANK w/BANDED 20-m
ROSA UNIT #171A	3003926389	BLANCO MV	7G	31N	05W	BGT	HDPE SECONDARY LINER FIBERGLASS TANK WBANDED 20 m
ROSA UNIT #171B	3003927013	BLANCO MV	6b	31N	05W	BG1	HDDE SECONDARY LINER FIBERGLASS TANK W/BANDED 20-m
ROSA UNIT #180	3004529898	BLANCO MV	9N	31N	06W		HDPE SECONDARY LINER
ROSA UNIT #180B	3004533134	BLANCO MV	91.	3111	06W	BGI	DBI WALL STEEL
ROSA UNIT #180C	3004533191	BLANCO MV	9E	31N	06W	BGT	DBI WALL STEEL
ROSA UNIT #181	3003926463	BLANCO MV	11K	31N	06W		DBL WALL STEEL FIBERGLASS TANK WBANDED 20-mi
ROSA UNIT #181A ROSA UNIT #181C (shared	3003926312	BLANCO MV	15A	31N	06W	BG1	HDPE SECONDARY LINER FIBERGLASS TANK W/BANDED 20 mi
w/169C)	3003927714	BLANCO MV	2M	3111	06W	BGT	HDPE SECONDARY LINER FIBERGLASS TANK WBANDED 20-mi
ROSA UNIT #182	3003926283	BLANCO MV	18N	31N	05W		HDPE SECONDARY LINER
ROSA UNIT #182A	3003926285	BLANCO MV	18P	31N	05W	BGT	DBL WALL STEEL
ROSA UNIT #182C	3003930180	BLANCO MV	18F	31N	05W		SINGLE WALL STEEL FIBERGLASS TANK WBANDED 20-m
ROSA UNIT #183	3003926387	BLANCO MV	19G	31N	05W	BGT	HDPE SECONDARY LINER FIBERGLASS TANK W/BANDED 20-m
ROSA UNIT #183A	3003926386	BLANCO MV	19F	31N	05W		HDPE SECONDARY LINER
ROSA UNIT #183B	3003930087	BLANCO MV BASIN DK /	19B	31N	05W	BG1	DBL WALL STEEL
ROSA UNIT #185B	3004532734	BLANCO MV	16F	31N	06W	BG1 I	OBL WALL STEEL
ROSA UNIT #185C	3004534484	BLANCO MV	16F	31N	06W	BG1 I	DBL WALL STEEL
ROSA UNIT #18¢	3003930186	BLANCO MV	21G	31N	05W	BG1 I	DBL WALL STEEL

						•	
WELLS W/FEDERAL SURF MG1	API	FMT	SEC	TWN	RNG	PIT TYPE	CONSTRUCTION MATERIAL
ROSA UNIT #231	3003924441	BASIN FTC	31N	3114	05Vv	SGT	SINGLE WALL SIEEL
ROSA UNIT #335A	3003930222	BASINFTC	05J	3111	05 V V	SG1	SINGLE WALL STEEL

.

Fields, Vanessa

From:

Meador, Tasha

Sent:

Monday, August 16, 2010 2:06 PM

To:

Fields, Vanessa

Subject:

FW: Request for Review Pit Closure - Rosa 22, 36, 169C, 149, 149B, 16C

Tasha Meador

EH&S Coordinator Williams Exploration & Production 721 S Main Aztec, NM

Office: 505-634-4200 Direct:505-634-4241 Fax: 505-634-4205

tasha.meador@williams.com

From: Lane, Myke

Sent: Monday, March 01, 2010 7:44 AM

To: 'Jones, Brad A., EMNRD'

Cc: Powell, Brandon, EMNRD; Meador, Tasha; Basye, Matt

Subject: Request for Review Pit Closure - Rosa 22, 36, 169C, 149, 149B, 16C

Brad:

We need to take the following below grade tanks out of service, and we would like to close this existing BGTs. We request your review to allow closure.

WELLSITE	API	FMT	SEC	TWN	RNG
Rosa #022	3003907971	-BLANCO MV	- 18A	31N	05W 7
Rosa #036	3003907977	BLANCO PC	11H	31N	06W
Rosa #169C	3003927717	BLANCO MV	02M	31N	06W
Rosa #149	3003925501	BLANCO MV	12G	31N	06W
Rosa #149B	3003926599	BLANCO MV	12E	31N	06W
		:			
Rosa #016C	3003926219	BLANCO MV	14E	31N	06W

Please contact me if there are any problems or you request additional information. Thanks for your consideration

District 1 1625 N. French Dr., Hobbs, NM 88240 District II District III
1000 Rio Brazos Road, Aztec, NM 87410
District IV
1000 Rio Brazos Road, Aztec, NM 87410
District IV 1220 S. St Francis Dr., Santa Fe, NM 87505

State of New Mexico Energy Minerals and Natural Resources

Oil Conservation Division 1220 South St. Francis Dr. Santa Fe, NM 87505

Revised October 10, 2003

Form C-141

Final Report

Submit 2 Copies to appropriate District Office in accordance with Rule 116 on back side of form

Release Notification and Corrective Action

OPERATOR

Name of Co	mpany V	WILLIAMS	PRODU	CTION, LLC	(Contact Vanessa Fields							
Address		P.O. BOX 64	10, AZTE	C, NM 87410		Telephone No. (505) 634-4209							
Facility Nan	ne Rosa U	nit #022				Facility Type Well Site							
Surface Own	ner Federa	.l		Mineral O	wner	Lease No.							
				<u> </u>		ON OF RELEASE							
Unit Letter	Section	Township	Range	Feet from the	North/	h/South Line Feet from the East/West Line County							
A	18	31N	05W										
			Latit	ude_36.9048297	'	Longitude	107.39703_						
				NAT	URE	OF RELI							
Type of Relea		ease Detected					Release NA			ecovered NA			
Source of Rel		7				+	our of Occurrence	e Date	and I	lour of Discovery NA			
Was Immedia	te Notice (_	v –	LN MALA		If YES, To	Whom?						
			Yes	No 🛛 Not Re	quirea	NA							
By Whom?						Date and H							
Was a Watero	ourse Reac	ched?	_			1	lume Impacting t	he Watercour	se.				
		Ш	Yes 🛚	No		NA '				i			
If a Watercourse was Impacted, Describe Fully.*													
NA													
										1			
Describe Cau	se of Probl	em and Remed	dial Action	n Taken.*		-							
							•						
										ľ			
37.1													
NA	A CC / 1	1.01		Ψ									
Describe Area	a Affected	and Cleanup A	Action Tak	en.*									
NA							•						
1421													
I hereby certif	fy that the i	nformation gi	ven above	is true and compl	ete to th	ne best of my	knowledge and u	nderstand tha	t pursi	ant to NMOCD rules and			
										ases which may endanger			
										eve the operator of liability			
										surface water, human health			
				tance of a C-141 r	eport de	oes not reliev	e the operator of	responsibility	for co	empliance with any other			
federal, state,	or local lav	ws and/or regu	lations.		1		OH CON	OEDI A TI	O) I	DILUCION			
1	\ .						OIL CON	<u>SERVATI</u>	UN	<u>DIVISION</u>			
Signature:	bur		T.	100									
Signature.	M		<u> </u>	ريحول									
Printed Name: Vanessa Fields						Approved by District Supervisor:							
										N-4			
Title: EH&S	Coordinate)ľ				Approval Date: Expiration			acion L	ı Date:			
E-mail Addre	ee Vanaee	a fieldc@will	iame com			Conditions of	Annroval:						
L-man Addre	oo. vancss	a.neius@will	iaiiio.CUill		\dashv	Conditions of	Approvai.			Attached			
Date: 10-1	2-10		Phone	e: (505) 634-4209									
		ets If Necess		3, 7, 12 1 1202									

^{*} Attach Additional Sheets If Necessary

Below-Grade Tank Removal Closure Plan

In accordance with Rule 19.15.17.13 NMAC, the following plan describes the general closure requirements of below-grade tanks (BGT) on Williams Production Co, LLC (WPX) locations in the San Juan Basin of New Mexico. This is WPX's standard closure procedure for all BGTs regulated under Rule 19.15.17 NMAC and operated by WPX. For those closures which do not conform to this standard closure plan, a separate well/pit specific closure plan will be developed and utilized.

Closure Conditions and Timing:

Pursuant to 19.15.17.13 (A) NMAC, WPX will initiate closure of any BGT should any one of these conditions occur:

- The Division requires closure because of imminent danger to fresh water, public health or the environment.
- The integrity of the BGT fails. Notification will be within 48 hours to the Division and closure will be schedule as specified in 19.15.17.12 (A)(5) NMAC.
- WPX chooses to take the BGT out-of-service due to operational needs. Closure under these conditions will be closed within 60 days of cessation of the BGT's operation.
- BGTs installed prior to June 16, 2008 that do not meet the requirements under 19.15.17.11.1(6) NMAC and WPX chooses not to retrofit or upgrade. Closure under these conditions will be completed within five years (by June 16, 2013).

General Plan Requirements:

- 1. Prior to initiating any BGT Closure except in the case of an emergency, WPX will review County Tax Records for the current surface owner of record. The surface owner of record will be notified of the intent to closure the BGT by certified mail and a copy of this notification will be included in the closure report. In the case of an emergency, the surface owner of record will be notified as soon as practical.
- 2. Notice of Closure will be given to the Aztec District office between 72 hours and one week of the scheduled closure via email or phone. The notification of closure will include the following:
 - a. Operators Name (WPX)
 - b. Well Name and API Number
 - c. Location (USTR)
- 3. All piping will be rerouted to an alternative produced water storage/disposal location (e.g. surface tanks, temporary frac tank, ...). The well will be temporarily shutin until the rerouting is completed.
- 4. All produced water will be removed from the BGT following discharge-pipe rerouting. Produced water will be disposed at one of the following NMOCD approved facilities depending on the proximity of the BGT site: Rosa Unit SWD #1 (Order: SWD-916, API: 30-039-27055), Rosa Unit #94 (Order: SWD-3RP-1003-0, API: 30-039-23035), Jillson Fed. SWD #001 (Order: R10168/R10168A, API: 30-039-25465), Middle Mesa SWD #001 (Order: SWD-350-0, API: 30-045-27004) and/or Basin Disposal (Permit: NM-01-0005).
- 5. Solids and sludges will be shoveled and /or vacuumed out for disposal at Envirotech (Permit Number NM-01-0011).
- 6. WPX will obtain prior approval from NMOCD to dispose, recycle, reuse, or reclaim the BGT and provide documentation of the disposition of the BGT in the closure report. Steel materials will be recycled or reused as approved by the Division. Fiberglass tanks will be empty, cut up or shredded, and EPA cleaned for disposal as solid waste. Liners materials will be cleaned without soils or contaminated material for disposal as

solid waste. Fiberglass tanks and liner materials will meet the conditions of paragraph 1 subsection D of 19.15.9.712 NMAC. Disposal will be at a licensed disposal facility, presently San Juan Regional Landfill operated by Waste Management under NMED Permit SWM-052426.

- 7. Any equipment associated with the BGT that is no longer required for some other purpose, following the closure will be removed from the location.
- 8. Following removal of the tank and any liner material, a five-point composite sample will be taken of the excavation and tested per 19.15.17.13(E)(4) NMAC as identified in Table 1. Grab samples will be collected from any area that is wet, discolored or showing other evidence of a release. Results will be report to the Division following receipt from the lab on Form C-141.

Table 1: Closure Criteria for BGTs

Components	Testing Methods	Glosvie limiis (mg/kg)
Benzene	EPA SW-846 Method 8021B or 8260B	- 0.2
BTEX	EPA SW-846 Method 8021B or 8260B	50
TPH	EPA SW-846 Method 418.1(1)	100
Chlorides	EPA SW-846 Method 300.1(1)	250(2)

- (1) Method modified for solid waste.
- $^{(2)}$ If background concentration of Chlorides greater than 250 mg/Kg, then higher concentration will be used for closure.
- 9. If the Division and/or WPX determine there is a release, WPX will comply with 19.15.3.116 NMAC and 19.15.1.19 NMAC.
- 10. Upon completion of the tank removal, the excavation will be backfilled with non-waste earthen material compacted and covered with a minimum of one foot of top soil or background thickness whichever is greater and to existing grade. The surface will be recontoured to match the native grade and prevent ponding.
- 11. For those portions of the former pit area no longer required for production activities, WPX will seed the disturbed areas the first growing season after the pit is covered. Seeding will be accomplished via drilling on the contour whenever practical, or by other Division-approved methods. Vegetative cover will equal 70% of the native perennial vegetative cover (un-impacted) consisting of at least three native plant species, including at least one grass, but not including noxious weeds, and maintained that cover through two successive growing seasons. Repeat seeding or planting will be continued until successful vegetative growth occurs. Note: If a surface owner agreement requires reseeding or other surface restoration that do not meet the revegetation requirements of 19.15.17.13.1 NMAC then WPX will submit the proposed alternative with written documentation that the surface owner agrees to the alternative, for Division approval.
- 12. For those portions of the former pit area required for production activities, reseeding will be done at well abandonment, and following the procedure noted above.

Closure Report:

All closure activities will include proper documentation and will be submitted to OCD within 60 days of the BGT closure on a Closure Report using Division Form C-144. The Report will include the following:

- Proof of Closure Notice (surface owner & NMOCD)
- Backfilling & Cover Installation
- Site Diagram with coordinates
- Available Inspection reports
- Confirmation Sampling Analytical Results
- Disposal Facility Name(s) and Permit Number(s)
- Application Rate & Seeding techniques
- Photo Documentation of Reclamation

Production Pit: Fiberglass Below-Grade Tank

Although these tanks have performed well to protect the public health, welfare and environment, in accordance with Rule 19.15.17.13.A (4) NMAC, Williams will removed all BGTs constructed of fiberglass by June 16, 2013. These tanks do not meet the construction/design standards specified in 19.15.17.11 (1-4). The following plans describes the general design and construction (D&C) and Operations and Maintenance (O&M)of these production pits used on Williams Production Co, LLC (WPX) locations in the San Juan Basin of New Mexico.

Design and Construction Plan

The pit is located as close as possible to the well and associated production/process equipment to minimize surface disturbance. The excavation bottom and sidewalls were compacted prior to installation of the pit. The BGT consisted of single-wall fiberglass tank following appropriate API and industry codes, placed in a 20-mil High-Strength Polyethylene resin (Permeability Rating – 0.041 USPerms), and the liner banded to the tanks. A 2" Sch-40 PVC riser was placed between the tank and liner as a leak-detection inspection port. See the attached Schematic and liner spec sheet. The pit is protected from runon by the construction of a compacted earthen berm. Fencing is constructed to protect livestock/wildlife as specified by the federal Surface Management Agency or, if not federal land/minerals requirements. WPX posts a well sign in accordance with the federal Surface Management Agency and rule 19.15.3.103.

Operations and Maintenance Plan

- 1. WPX only allows produced liquids meeting the RCRA exemption for O&G wastes to be stored in the SGT. WPX will not discharge or store any hazardous waste as defined under RCRA 40CFR 261 and 19.15.1.7.W(3) NMAC in any temporary pit. Produced water is disposed by evaporation or transport any of the following NMOCD approved facilities depending on the well location: Basin Disposal, Inc in Bloomfield, New Mexico (Permit # NM-01-005), Williams Rosa SWD#1 (Permit # SWD-916), Williams Rosa #94 (Permit # SWD-758), Burlington Resources Jillson SWD#1 (Permit #R10168A), or other NMOCD approved water disposal facilities. WPX maintains sufficient freeboard for to prevent overtopping. Discharges to the pit will be shutoff if the liquid level does not provided sufficient free-board and liquid removal can not be scheduled in a timely manner. Any oil or hydrocarbon collecting on the pit is removed. Saleable condensate is returned to the sales tank. Slop oil from compression is recycled with Safety Kleen, Farmington, NM or Hydropure, Aztec, NM (No Permit Required).
- 2. If the tank integrity is compromised:
 - a. All discharges will be shut off to the pit.
 - b. All liquids will be removed as soon as possible but no more that within 24 hours of discovery
 - c. WPX will notify and report to NMOCD as follows:
 - i. If the release is less than 25 bbls, the Aztec District Office by phone or email within 48-hours of discovery and repair.
 - ii. If the release is suspected to be greater than 25 bbls, the Aztec District Office and the Environmental Bureau Chief by phone for immediate verbal notification pursuant to 19.15.3.116.B (1)(d).
 - d. Written Spill/Release reports will be submitted on Form C-141 per 19.15.3.116.C NMAC within 15 days to the Aztec District Office.
- 3. Berms around the perimeter of the pit, shall be maintained as protection from run-on.
- 4. WPX will inspect the BGT pit monthly. Electronic copies of the inspections will be kept at the WPX San Juan Basin office for a minimum of five years following completion. Copies of the inspections will be available to NMOCD upon request.

Production Pit: Below-Grade Tank

Closure Plan

In accordance with Rule 19.15.17.13 NMAC, the following plan describes the general closure requirements of below-grade tanks (BGT) on Williams Production Co, LLC (WPX) locations in the San Juan Basin of New Mexico. This is WPX's standard procedure for all out-of-service BGTs used to store produced liquids during production operations at gas wells operated by WPX.

For those closures which do not conform to this standard closure plan, a separate well/pit specific closure plan will be developed and utilized. All closure activities will include proper documentation and will be submitted to OCD within 60 days of the pit closure on a Closure Report using Division Form C-144. The Report will include the following:

- Plot Plan (Pit Diagram)
- Available Inspection reports

- Sampling Results
- Waste disposal documentation

General Plan Requirements:

- 1. All piping will be rerouted to an alternative produced water storage/disposal location (e.g. surface tanks, temporary frac tank ...). The well will be temporarily shut in until the rerouting is completed.
- 2. All produced water will be removed from the BGT following discharge-pipe rerouting. Produced water will be disposed of by injection at one of the Williams Production Rosa Unit Salt Water Disposal wells: Rosa SWD #1 (API: 30-039-27055) I-23-31N-06W Permit SWD-916 or Rosa Unit #94 (API: 30-039-23035) K-16-31N-05W, Permit SWD-758.
- 3. Notice of Closure will be given to the landowner or SMA, and the Aztec District office between 72 hours and one week of the scheduled closure via email or phone. The notification of closure will include the following:
 - a. Operators Name (WPX)
 - b. Well Name and API Number
 - c. Location (USTR)
- 4. The BGT and all associated materials will be removed, and recycled, reused, or disposed, of in a Division-approved facility. All materials that can not be recycled or reused will be treated a solid waste and will be disposed of at a licensed disposal facility (probably San Juan Regional Landfill operated by Waste Management under NMED Permit SWM-052426).
- 5. Following removal of the tank and any liner material, a five-point composite sample will be taken of the excavation and tested per 19.15.17.13(B)(1)(b) NMAC. In the event that the criteria are not met (See Table 1), a release will be reported following Rule 116 and impacted soils will be excavated and hauled to Envirotech Landfarm near Bloomfield, NM (NMOCD Permit NM-01-0011). Approval to haul will be requested of the Aztec District office prior to initiation.

Table 1: Closure Criteria for BGTs

Components:	Jesting Methods	Closure:kimits.(mg/kg)							
Benzene	EPA SW-846 Method 8021B or 8260B	0.2							
BTEX	EPA SW-846 Method 8021B or 8260B	50							
TPH	EPA SW-846 Method 8015 M(Full Range)*	100							
	or Method 418.1								
Chlorides	EPA SW-846 Method 300.1	250							

^{*} Preferred method

- 6. Upon completion of the tank removal and any necessary soil remediation, the excavation will be backfilled with non-waste earthen material compacted to native and covered with a minimum of one foot of top soil. The surface will be re-contoured to match the native grade.
- 7. For those portions of the former pit area no longer required for production activities, WPX will seed the disturbed areas the first growing season after the pit is covered. Seeding will be accomplished via drilling on the contour whenever practical, or by other Division-approved methods. Vegetative cover will equal 70% of the native perennial vegetative cover (un-impacted) consisting of at least three native plant species, including at least one grass, but not including noxious weeds, and maintained that cover through two successive growing seasons. Repeat seeding or planting will be continued until successful vegetative growth occurs. Note: WPX assumes the seeding stipulations including mix and seeding methods specified by the Surface Management Agency (BLM, BOR, USFS, Tribal, etc.) or Land owner as part of a surface use agreement or APD are Division-approved methods unless notified by the Division of their unacceptability.
- 8. For those portions of the former pit area required for production activities, re-seeding will be done at well abandonment, and following the procedure noted above.

Production Pit: Fiberglass Below-Grade Tank

Although these tanks have performed well to protect the public health, welfare and environment, in accordance with Rule 19.15.17.13.A (4) NMAC, Williams will removed all BGTs constructed of fiberglass by June 16, 2013. These tanks do not meet the construction/design standards specified in 19.15.17.11 (1-4). The following plans describes the general design and construction (D&C) and Operations and Maintenance (O&M)of these production pits used on Williams Production Co, LLC (WPX) locations in the San Juan Basin of New Mexico.

Design and Construction Plan

The pit is located as close as possible to the well and associated production/process equipment to minimize surface disturbance. The excavation bottom and sidewalls were compacted prior to installation of the pit. The BGT consisted of single-wall fiberglass tank following appropriate API and industry codes, placed in a 20-mil High-Strength Polyethylene resin (Permeability Rating – 0.041 USPerms), and the liner banded to the tanks. A 2" Sch-40 PVC riser was placed between the tank and liner as a leak-detection inspection port. See the attached Schematic and liner spec sheet. The pit is protected from runon by the construction of a compacted earthen berm. Fencing is constructed to protect livestock/wildlife as specified by the federal Surface Management Agency or, if not federal land/minerals requirements. WPX posts a well sign in accordance with the federal Surface Management Agency and rule 19.15.3.103.

Operations and Maintenance Plan

- 1. WPX only allows produced liquids meeting the RCRA exemption for O&G wastes to be stored in the SGT. WPX will not discharge or store any hazardous waste as defined under RCRA 40CFR 261 and 19.15.1.7.W(3) NMAC in any temporary pit. Produced water is disposed by evaporation or transport any of the following NMOCD approved facilities depending on the well location: Basin-Disposal, Inc in Bloomfield, New Mexico (Permit # NM-01-005), Williams Rosa SWD#1 (Permit # SWD-916), Williams Rosa #94 (Permit # SWD-758), Burlington Resources Jillson SWD#1 (Permit #R10168A), or other NMOCD approved water disposal facilities. WPX maintains sufficient freeboard for to prevent overtopping. Discharges to the pit will be shutoff if the liquid level does not provided sufficient free-board and liquid removal can not be scheduled in a timely manner. Any oil or hydrocarbon collecting on the pit is removed. Saleable condensate is returned to the sales tank. Slop oil from compression is recycled with Safety Kleen, Farmington, NM or Hydropure, Aztec, NM (No Permit Required).
- 2. If the tank integrity is compromised:
 - a. All discharges will be shut off to the pit.
 - b. All liquids will be removed as soon as possible but no more that within 24 hours of discovery
 - c. WPX will notify and report to NMOCD as follows:
 - i. If the release is less than 25 bbls, the Aztec District Office by phone or email within 48-hours of discovery and repair.
 - ii. If the release is suspected to be greater than 25 bbls, the Aztec District Office and the Environmental Bureau Chief by phone for immediate verbal notification pursuant to 19.15.3.116.B (1)(d).
 - d. Written Spill/Release reports will be submitted on Form C-141 per 19.15.3.116.C NMAC within 15 days to the Aztec District Office.
- 3. Berms around the perimeter of the pit, shall be maintained as protection from run-on.
- 4. WPX will inspect the BGT pit monthly. Electronic copies of the inspections will be kept at the WPX San Juan Basin office for a minimum of five years following completion. Copies of the inspections will be available to NMOCD upon request.

Production Pit: Below-Grade Tank Closure Plan

In accordance with Rule 19.15.17.13 NMAC, the following plan describes the general closure requirements of below-grade tanks (BGT) on Williams Production Co, LLC (WPX) locations in the San Juan Basin of New Mexico. This is WPX's standard procedure for all out-of-service BGTs used to store produced liquids during production operations at gas wells operated by WPX.

For those closures which do not conform to this standard closure plan, a separate well/pit specific closure plan will be developed and utilized. All closure activities will include proper documentation and will be submitted to OCD within 60 days of the pit closure on a Closure Report using Division Form C-144. The Report will include the following:

- Plot Plan (Pit Diagram)
- Available Inspection reports

- Sampling Results
- Waste disposal documentation

General Plan Requirements:

- 1. All piping will be rerouted to an alternative produced water storage/disposal location (e.g. surface tanks, temporary frac tank ...). The well will be temporarily shut in until the rerouting is completed.
- 2. All produced water will be removed from the BGT following discharge-pipe rerouting. Produced water will be disposed of by injection at one of the Williams Production Rosa Unit Salt Water Disposal wells: Rosa SWD #1 (API: 30-039-27055) I-23-31N-06W Permit SWD-916 or Rosa Unit #94 (API: 30-039-23035) K-16-31N-05W, Permit SWD-758.
- 3. Notice of Closure will be given to the landowner or SMA, and the Aztec District office between 72 hours and one week of the scheduled closure via email or phone. The notification of closure will include the following:
 - a. Operators Name (WPX)
 - b. Well Name and API Number
 - c. Location (USTR)
- 4. The BGT and all associated materials will be removed, and recycled, reused, or disposed, of in a Division-approved facility. All materials that can not be recycled or reused will be treated a solid waste and will be disposed of at a licensed disposal facility (probably San Juan Regional Landfill operated by Waste Management under NMED Permit SWM-052426).
- 5. Following removal of the tank and any liner material, a five-point composite sample will be taken of the excavation and tested per 19.15.17.13(B)(1)(b) NMAC. In the event that the criteria are not met (See Table 1), a release will be reported following Rule 116 and impacted soils will be excavated and hauled to Envirotech Landfarm near Bloomfield, NM (NMOCD Permit NM-01-0011). Approval to haul will be requested of the Aztec District office prior to initiation.

Table 1: Closure Criteria for BGTs

Table II Closere Circula lei Pe is									
Components	alesting Wethords.	Glosve Limits (mg/kg)							
Benzene	EPA SW-846 Method 8021B or 8260B	0.2							
BTEX	EPA SW-846 Method 8021B or 8260B	50							
TPH	EPA SW-846 Method 8015 M(Full Range)*	100							
	or Method 418.1								
Chlorides	EPA SW-846 Method 300.1	250							

^{*} Preferred method

- 6. Upon completion of the tank removal and any necessary soil remediation, the excavation will be backfilled with non-waste earthen material compacted to native and covered with a minimum of one foot of top soil. The surface will be re-contoured to match the native grade.
- 7. For those portions of the former pit area no longer required for production activities, WPX will seed the disturbed areas the first growing season after the pit is covered. Seeding will be accomplished via drilling on the contour whenever practical, or by other Division-approved methods. Vegetative cover will equal 70% of the native perennial vegetative cover (un-impacted) consisting of at least three native plant species, including at least one grass, but not including noxious weeds, and maintained that cover through two successive growing seasons. Repeat seeding or planting will be continued until successful vegetative growth occurs. Note: WPX assumes the seeding stipulations including mix and seeding methods specified by the Surface Management Agency (BLM, BOR, USFS, Tribal, etc.) or Land owner as part of a surface use agreement or APD are Division-appröved methods unless notified by the Division of their unacceptability.
- 8. For those portions of the former pit area required for production activities, re-seeding will be done at well abandonment, and following the procedure noted above.

Below-Grade Tank Removal Closure Plan

In accordance with Rule 19.15.17.13 NMAC, the following plan describes the general closure requirements of below-grade tanks (BGT) on Williams Production Co, LLC (WPX) locations in the San Juan Basin of New Mexico. This is WPX's standard closure procedure for all BGTs regulated under Rule 19.15.17 NMAC and operated by WPX. For those closures which do not conform to this standard closure plan, a separate well/pit specific closure plan will be developed and utilized.

Closure Conditions and Timing:

Pursuant to 19.15.17.13 (A) NMAC, WPX will initiate closure of any BGT should any one of these conditions occur:

- The Division requires closure because of imminent danger to fresh water, public health or the environment.
- The integrity of the BGT fails. Notification will be within 48 hours to the Division and closure will be schedule as specified in 19.15.17.12 (A)(5) NMAC.
- WPX chooses to take the BGT out-of-service due to operational needs. Closure
 under these conditions will be closed within 60 days of cessation of the BGT's
 operation.
- BGTs installed prior to June 16, 2008 that do not meet the requirements under 19.15.17.11.1(6) NMAC and WPX chooses not to retrofit or upgrade. Closure under these conditions will be completed within five years (by June 16, 2013).

General Plan Requirements:

- 1. Prior to initiating any BGT Closure except in the case of an emergency, WPX will review County Tax Records for the current surface owner of record. The surface owner of record will be notified of the intent to closure the BGT by certified mail and a copy of this notification will be included in the closure report. In the case of an emergency, the surface owner of record will be notified as soon as practical.
- 2. Notice of Closure will be given to the Aztec District office between 72 hours and one week of the scheduled closure via email or phone. The notification of closure will include the following:
 - a. Operators Name (WPX)
 - b. Well Name and API Number
 - c. Location (USTR)
- 3. All piping will be rerouted to an alternative produced water storage/disposal location (e.g. surface tanks, temporary frac tank, ...). The well will be temporarily shutin until the rerouting is completed.
- 4. All produced water will be removed from the BGT following discharge-pipe rerouting. Produced water will be disposed at one of the following NMOCD approved facilities depending on the proximity of the BGT site: Rosa Unit SWD #1 (Order: SWD-916, API: 30-039-27055), Rosa Unit #94 (Order: SWD-3RP-1003-0, API: 30-039-23035), Jillson Fed. SWD #001 (Order: R10168/R10168A, API: 30-039-25465), Middle Mesa SWD #001 (Order: SWD-350-0, API: 30-045-27004) and/or Basin Disposal (Permit: NM-01-0005).
- 5. Solids and sludges will be shoveled and /or vacuumed out for disposal at Envirotech (Permit Number NM-01-0011).
- 6. WPX will obtain prior approval from NMOCD to dispose, recycle, reuse, or reclaim the BGT and provide documentation of the disposition of the BGT in the closure report. Steel materials will be recycled or reused as approved by the Division. Fiberglass tanks will be empty, cut up or shredded, and EPA cleaned for disposal as solid waste. Liners materials will be cleaned without soils or contaminated material for disposal as

solid waste. Fiberglass tanks and liner materials will meet the conditions of paragraph 1 subsection D of 19.15.9.712 NMAC. Disposal will be at a licensed disposal facility, presently San Juan Regional Landfill operated by Waste Management under NMED Permit SWM-052426.

- 7. Any equipment associated with the BGT that is no longer required for some other purpose, following the closure will be removed from the location.
- 8. Following removal of the tank and any liner material, a five-point composite sample will be taken of the excavation and tested per 19.15.17.13(E)(4) NMAC as identified in Table 1. Grab samples will be collected from any area that is wet, discolored or showing other evidence of a release. Results will be report to the Division following receipt from the lab on Form C-141.

Table 1: Closure Criteria for BGTs

Components	Testing Methods	Closure Limits (mg/kg)
Benzene	EPA SW-846 Method 8021B or 8260B	- 0.2
BTEX	EPA SW-846 Method 8021B or 8260B	50
TPH	EPA SW-846 Method 418.1(1)	100
Chlorides	EPA SW-846 Method 300.1(1)	250(2)

⁽¹⁾ Method modified for solid waste.

- 9. If the Division and/or WPX determine there is a release, WPX will comply with 19.15.3.116 NMAC and 19.15.1.19 NMAC.
- 10. Upon completion of the tank removal, the excavation will be backfilled with non-waste earthen material compacted and covered with a minimum of one foot of top soil or background thickness whichever is greater and to existing grade. The surface will be recontoured to match the native grade and prevent ponding.
- 11. For those portions of the former pit area no longer required for production activities, WPX will seed the disturbed areas the first growing season after the pit is covered. Seeding will be accomplished via drilling on the contour whenever practical, or by other Division-approved methods. Vegetative cover will equal 70% of the native perennial vegetative cover (un-impacted) consisting of at least three native plant species, including at least one grass, but not including noxious weeds, and maintained that cover through two successive growing seasons. Repeat seeding or planting will be continued until successful vegetative growth occurs. Note: If a surface owner agreement requires reseeding or other surface restoration that do not meet the revegetation requirements of 19.15.17.13.1 NMAC then WPX will submit the proposed alternative with written documentation that the surface owner agrees to the alternative, for Division approval.
- 12. For those portions of the former pit area required for production activities, reseeding will be done at well abandonment, and following the procedure noted above.


Closure Report:


All closure activities will include proper documentation and will be submitted to OCD within 60 days of the BGT closure on a Closure Report using Division Form C-144. The Report will include the following:

- Proof of Closure Notice (surface owner & NMOCD)
- Backfilling & Cover Installation
- Site Diagram with coordinates
- Available Inspection reports


- Confirmation Sampling Analytical Results
- Disposal Facility Name(s) and Permit Number(s)
- Application Rate & Seeding techniques
- Photo Documentation of Reclamation

⁽²⁾ If background concentration of Chlorides greater than 250 mg/Kg, then higher concentration will be used for closure.

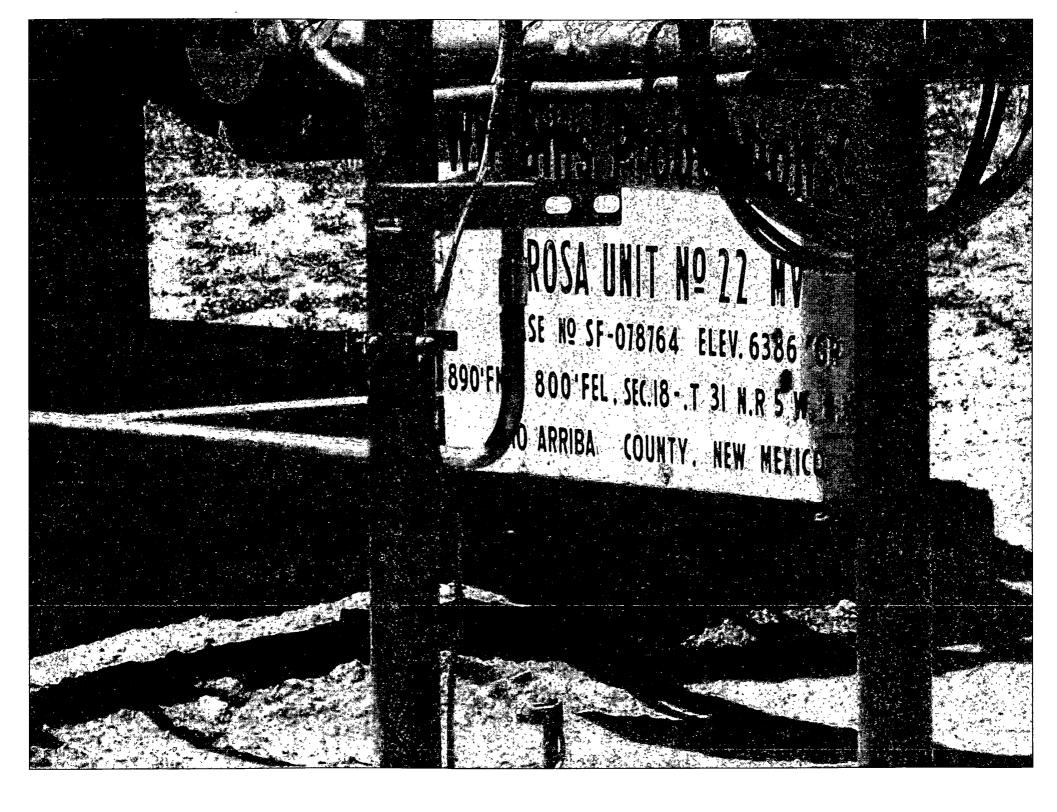

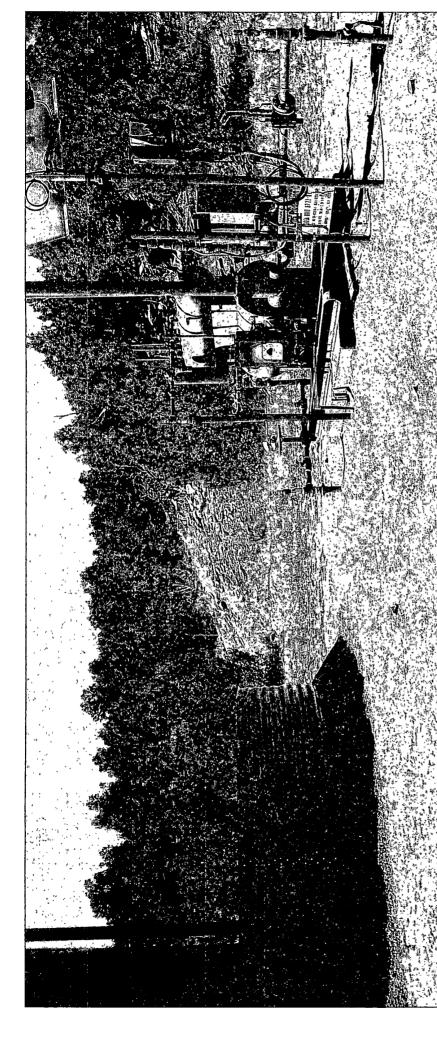

Williams production Rosa 22 Mesaverde Sec 18 T 31 N R 6 W

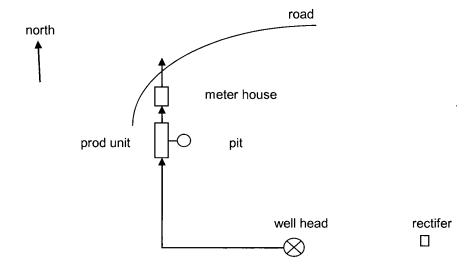

					Liner			Pit		
Date	WellName	Run	Formation	Construction	SGT. BGT, Above	Banded Plastic liner, Double Wall Steel, Bottom Plastic Liner	Y/N	level	level	Comments / Repairs needed
A 00	ROSA UNIT #022	04-61	Mesa Verde	FIBERGLASS	BGT					
Aug-08	ROSA	04-01	iviesa verde	FIBERGLASS	ВСТ	Banded				
9/22/2008	UNIT #022	04-61	Mesa Verde	FIBERGLASS	BGT	Plastic liner	у	1.5"	2"	possible, will monitor
10/31/2008	ROSA	04-61	Mesa Verde	FIBERGLASS	BGT	Banded Plastic liner	У	1.5"	2"	possible, will monitor
10/31/2008	ROSA UNIT #022	04-61	Mesa Verde	FIBERGLASS	BGT	Banded Plastic liner		1.5"	2"	possible, will monitor
1/2/2009	ROSA UNIT #022	04-61	Mesa Verde	FIBERGLASS	BGT	Banded Plastic liner	У	7"	5"	
1/26/2009	ROSA UNIT #022	04-61	Mesa Verde	FIBERGLASS	BGT	Banded Plastic liner	У	7"	5"	
2/2/2009	ROSA UNIT #022	04-61	Mesa Verde	FIBERGLASS	BGT	Banded Plastic liner	у			
3/2/2009	ROSA UNIT #022	04-61	Mesa Verde	FIBERGLASS	BGT	Banded Plastic liner	у			
7/30/2009	Rosa Unit 22	04-61	Mesa Verde	FIBERGLASS	BGT		YES	5.5"	2"	
8/1/2009	Rosa Unit 22	04-61	Mesa Verde	FIBERGLASS	BGT		YES	5"	3"	
9/1/2009	Rosa Unit 22	04-61	Mesa Verde	FIBERGLASS	BGT		YES	5"	7.5"	
10/5/2009	Rosa Unit 22	04-61	Mesa Verde	FIBERGLASS	BGT		YES	5"	5.5"	
11/10/2009	Rosa Unit 22	04-61	Mesa Verde	FIBERGLASS	BGT		YES	5"	5.5"	

04-61

									Pit	
Date	WellName	Run	Formation	Construction	SGT. BGT, Above	Banded Plastic liner, Double Wall Steel, Bottom Plastic Liner	Y/N	level	level	Comments / Repairs
	Rosa Unit					Banded	1,110	10.0		
12/11/2009	l	04-61	Mesa Verde	FIBERGLASS	BGT	Plastic liner	NO	YES	5"	6.5"
	Rosa Unit					banded				
1/5/2010	22	04-61	Mesa Verde	FIBERGLASS	BGT	Plastic liner	NO	YES	4 1/2"	7 1/2"
	Rosa Unit					banded			,	
2/3/2010	22	04-61	Mesa Verde	FIBERGLASS	BGT	Plastic liner	NO	YES	4.5"	10.25"
	Rosa Unit					banded				
3/10/2010	22	04-61	Mesa Verde	FIBERGLASS	BGT	Plastic liner	NO	YES	5.25"	14"
	Rosa Unit					banded				
4/1/2010	22	04-61	Mesa Verde	FIBERGLASS	BGT	Plastic liner	NO	YES	5"	14"



EPA METHOD 8015 Modified Nonhalogenated Volatile Organics Total Petroleum Hydrocarbons

Client:	WPX	Project #:	04108-0136
Sample ID:	BGT	Date Reported:	06-04-10
Laboratory Number:	54506	Date Sampled:	05-25-10
Chain of Custody No:	9503	Date Received:	06-01-10
Sample Matrix:	Soil	Date Extracted:	06-03-10
Preservative:		Date Analyzed:	06-03-10
Condition:	Intact	Analysis Requested:	8015 TPH

Parameter	Concentration (mg/Kg)	Det. Limit (mg/Kg)
Gasoline Range (C5 - C10)	· ND	0.2
Diesel Range (C10 - C28)	2.4	0.1
Total Petroleum Hydrocarbons	2.4	0.2

ND - Parameter not detected at the stated detection limit.

References:

Method 8015B, Nonhalogenated Volatile Organics, Test Methods for Evaluating Solid Waste,

SW-846, USEPA, December 1996.

Comments:

Rosa22 - BGT

Analyst



EPA Method 8015 Modified Nonhalogenated Volatile Organics Total Petroleum Hydrocarbons

Quality Assurance Report

Client:	QA/QC	Project #:	N/A
Sample ID:	06-03-10 QA/QC	Date Reported:	06-04-10
Laboratory Number:	54518	Date Sampled:	N/A
Sample Matrix:	Methylene Chloride	Date Received:	N/A
Preservative:	N/A	Date Analyzed:	06-03-10
Condition:	N/A	Analysis Requested:	TPH

	W-Cal Dale	as JaCaliRia	(C) Cal R	% Difference	Accept Range
Gasoline Range C5 - C10	05-07-07	1.0336E+003	1.0340E+003	0.04%	0 - 15%
Diesel Range C10 - C28	05-07-07	1.0751E+003	1.0756E+003	0.04%	0 - 15%

Blank Cone (mg/l=>mg/Kg)	Concentration	Detection Limit
Gasoline Range C5 - C10	ND	0.2
Diesel Range C10 - C28	ND	0.1
Total Petroleum Hydrocarbons	ND	0.2

@ublicatexecotox(mg/kg)	Sample :	្សាស្រី (គ្រប់ ខ្មែរ	Walering territor	Accept Pange
Gasoline Range C5 - C10	0.6	0.7	16.7%	0 - 30%
Diesel Range C10 - C28	61.4	62.3	1.5%	0 - 30%

Spike Conc. (mg/kg)	e (Sample)	Spike Attided	e pire Republic	% Recovery	Accept Range
Gasoline Range C5 - C10	0.6	250	258	103%	75 - 125%
Diesel Range C10 - C28	61.4	250	315	101%	75 - 125%

ND - Parameter not detected at the stated detection limit.

References: Method 8015B, Nonhalogenated Volatile Organics, Test Methods for Evaluating Solid Waste,

SW-846, USEPA, December 1996.

Comments: QA/QC for Samples 54503, 54504, 54506, 54515, 54517-54521.



EPA METHOD 8021 AROMATIC VOLATILE ORGANICS

Client:	WPX	Project #:	04108-0136
Sample ID:	BGT	Date Reported:	06-04-10
Laboratory Number:	54506	Date Sampled:	05-25-10
Chain of Custody:	9503	Date Received:	06-01-10
Sample Matrix:	Soil	Date Analyzed:	06-03-10
Preservative:		Date Extracted:	06-03-10
Condition:	Intact	Analysis Requested:	BTEX

Parameter	Concentration (ug/Kg)	Det. Limit (ug/Kg)
Benzene	5.6	0.9
Toluene	3.6 3.2	1.0
Ethylbenzene	ND	1.0
p,m-Xylene	4.5	1.2
o-Xylene	3.2	0.9
Total BTEX	16.5	

ND - Parameter not detected at the stated detection limit.

Surrogate Recoveries:	Parameter	Percent Recovery
	Fluorobenzene	102 %
	1,4-difluorobenzene	120 %
	Bromochlorobenzene	105 %

References:

Method 5030B, Purge-and-Trap, Test Methods for Evaluating Solid Waste, SW-846, USEPA,

December 1996.

Method 8021B, Aromatic Volatile Organics, Test Methods for Evaluating Solid Waste, SW-846,

USEPA, December 1996.

Comments:

Rosa 22- BGT

Analyst



EPA METHOD 8021 AROMATIC VOLATILE ORGANICS

Client:	N/A	Project #:	N/A
Sample ID:	0603blank QA/QC	Date Reported:	06-04-10
Laboratory Number:	54503	Date Sampled:	N/A
Sample Matrix:	Soil	Date Received:	N/A
Preservative:	N/A	Date Analyzed:	06-03-10
Condition:	N/A	Analysis:	BTEX

Calibration and Detection Limits (ug/	i i i i i i i i i i i i i i i i i i i	C Calific Accept Ran			Detect Limit
Benzene	1.4666E+006	1.4696E+006	0.2%	ND	0.1
Toluene	1.3613E+006	1.3640E+006	0.2%	ND	0.1
Ethylbenzene	1.2053E+006	1.2077E+006	0.2%	ND	0.1
p,m-Xylene	3.0685E+006	3.0747E+006	0.2%	ND	0.1
o-Xylene	1.1577E+006	1.1600E+006	0.2%	ND	0.1

Duplicate Conc. (ug/Kg)	Sample (1990)	0)[63](6)	:	Accept Range	Detect Limit
Benzene	ND	ND	0.0%	0 - 30%	0.9
Toluene	2.4	2.0	16.7%	0 - 30%	1.0
Ethylbenzene	ND	ND	0.0%	0 - 30%	1.0
p,m-Xylene	1.6	1.2	25.0%	0 - 30%	1.2
o-Xylene	3.0	2.4	20.0%	0 - 30%	0.9

Spike Conc. (ug/Kg)	Semple // /Amo	iunt Spilked - Spil	ed Sample	%IRecovery	= Accept Range
Benzene	ND	50.0	50.1	100%	39 - 150
Toluene [']	2.4	50.0	50.2	95.8%	46 - 148
Ethylbenzene	ND	50.0	48.4	96.8%	32 - 160
p,m-Xylene	1.6	100	98.2	96.7%	46 - 148
o-Xylene	3.0	50.0	50.9	96.0%	46 - 148

ND - Parameter not detected at the stated detection limit.

References: Method 5030B, Purge-and-Trap, Test Methods for Evaluating Solid Waste, SW-846, USEPA,

December 1996.

Method 8021B, Aromatic and Halogenated Volatiles by Gas Chromatography Using

Photoionization and/or Electrolytic Conductivity Detectors, SW-846, USEPA December 1996.

Comments: QA/QC for Samples 54519-54521, 54503, 54504, 54506, 54515-54518.

Analyst

EPA METHOD 418.1 TOTAL PETROLEUM HYDROCARBONS

Client:	WPX	Project #:	04108-0136
Sample ID:	BGT	Date Reported:	06-04-10
Laboratory Number:	54506	Date Sampled:	05-25-10
Chain of Custody No:	9503	Date Received:	06-01-10
Sample Matrix:	Soil	Date Extracted:	06-03-10
Preservative:		Date Analyzed:	06-03-10
Condition:	Intact	Analysis Needed:	TPH-418.1

		Det.
	Concentration	Limit
Parameter	(mg/kg)	(mg/kg)

Total Petroleum Hydrocarbons

21.6

13.5

ND = Parameter not detected at the stated detection limit.

References:

Method 418.1, Petroleum Hydrocarbons, Total Recoverable, Chemical Analysis of Water

and Waste, USEPA Storet No. 4551, 1978.

Comments:

Rosa 22-BGT



EPA METHOD 418.1 TOTAL PETROLEUM HYROCARBONS QUALITY ASSURANCE REPORT

Client:

QA/QC

Project #:

N/A

Sample ID:

QA/QC

Date Reported:

06-04-10

Laboratory Number:

06-03-TPH.QA/QC 54503

Date Sampled:

N/A

Sample Matrix:

Freon-113

06-03-10

Date Analyzed:

06-03-10

Preservative:

N/A N/A Date Extracted: Analysis Needed:

06-03-10 **TPH**

Condition:

Calibration I-Cal Date

C-Cal Date I-Cal RF:

C-Cal RF: % Difference Accept Range

06-03-10

1,686

1,770

5.0%

+/- 10%

Blank Conc. (mg/Kg)

- Concentration

Detection Limit

TPH

ND

13.5

Duplicate Conc. (mg/Kg)

Sample

Duplicate :

% Difference

Accept. Range

TPH

TPH

104

109

5.2%

+/- 30%

Spike Conc. (mg/kg)

Sample 104

Spike Added Spike Result % Recovery Accept Range 2,000

2,020

96.0%

80 - 120%

ND = Parameter not detected at the stated detection limit.

References:

Method 418.1, Petroleum Hydrocarbons, Total Recoverable, Chemical Analysis of Water

and Waste, USEPA Storet No. 4551, 1978.

Comments:

QA/QC for Samples 54503-54506, 54515, 54519-54521.

Ph (505) 632-0615 Fr (800) 362-1879 Fx (505) 632-1865 lab@envirotech-inc.com envirotech-inc com



Chloride

Client:	WPX	Project #:	04108-0136
Sample ID:	BGT	Date Reported:	06-04-10
Lab ID#:	54506	Date Sampled:	05-25-10
Sample Matrix:	Soil	Date Received:	06-01-10
Preservative:		Date Analyzed:	06-04-10
Condition:	Intact	Chain of Custody:	9503

Parameter

Concentration (mg/Kg)

Total Chloride

15

Reference:

U.S.E.P.A., 4500B, "Methods for Chemical Analysis of Water and Wastes", 1983. Standard Methods For The Examination of Water And Waste Water", 18th ed., 1992.

Comments:

Rosa 22-BGT

CHAIN OF CUSTODY RECORD

09503

Client:			Project Name / L	ocation	:		**		ANALYSIS / PARAMETERS													
×4W·			SazoSI	ROSA 22 - BGT												. , ,						
Client Address:			Sampler Name:						5)	21)	6										Ţ	
			C.	<u>·</u>					801	88	826	<u>0</u>	_		0						İ	
Client Phone No.:			Client No.: 04108				TPH (Method 8015)	BTEX (Method 8021)	VOC (Method 8260)	RCRA 8 Metals	Cation / Anion		TCLP with H/P		TPH (418.1)	CHLORIDE			Sample Cool	Sample Intact		
Sample No./	Sample		e Lab No		ample	No./Volume				ద	0	Ä	ţi	_	مَ ا	I	Į,	ᅙ			ם	ğ
Identification	Date	Time		·	Matrix	of Containers	HgCl ₂	на	<u> E</u>	H	8	8	පි	<u> </u>	12	PAH	上	ㅎ			Sa	Sa
BGT	5/25	1500	54506		Sludge Aqueous	1			·	c							~	~			_	4
				Soil Solid	Sludge Aqueous																	
				Soll Solid	Sludge Aqueous																	
				Soil Solid	Sludge Aqueous																	
				Soil Solld	Sludge Aqueous																	
				Soil Solid	Sludge Aqueous																	
				Soil Solid	Sludge Aqueous																	
				Soil Solid	Sludge Aqueous	-																
				Soil Solid	Sludge Aqueous								_									
				Soil Solid	Sludge Aqueous																	\exists
Relinquished by: (Sign	ature)				Date	Time	-	eceiv	ed by:	(Sign	ature)		l.,	,	<u> </u>		l			ate /	Tin	- 1
		<u> </u>	20	-	6/1/10	1500	<u> </u>				<u>Z</u>	~		/	<u> </u>		\geq	>	 6/1	110	15	90
Relinquished by: (Signa	ature)						R	eceiv	ed b¥;	(Sign	ature	,					0					
Relinquished by: (Signa	ature)	**************************************		•			Re	eceivo	ed by:	(Sign	ature)	ı		-		·····						
	envirotech Analytical Laboratory 5796 US Highway 64 • Farmington, NM 87401 • 505-632-0615 • lab@envirotech-inc.com																					

WM of NM - San Juan County 78 County Road 3140 -Aztec, MM, 87410 Ph: (505) 334-1121

Original Ticket# 1276668

Customer Name WILLIAMSPRO WILLIAMS PRODUCTI Carrier 05/21/2010 Ticket Date Payment Type Credit Account

Manual Ticket# Hauling Ticket# Route

State Waste Code Manifest Destination

Profile ()

Generator

Time

05/21/2010 07:05:46 In Dut 05/21/2010 07:43:37

Scale

Inbound 301

MMORGAN Outbound 302 MMORGAN

VAUGIL VAUGHN DILFIELD, SERVICES P INC

Volume

0000114

Container Driver Check#

Vehicle#

Billing #

Gen EPA ID

Grid

Operator

JUN 0 1 2010

Inbound

Gross Tare Net

45640 1b 38920 lb 6720 15

Tona

3.36

Comments 9 PITS

Prod	luct	 LD%	Oty.	UOM	Rate	Tax	Amount	Origin
i	MLY-MSW-Loose-		28.00	Yards	5. 51	9, 55		RICARRIBA

Rosa 22,22A,36B,36, 9,9B,148B,149B,181C

Total Tax Total Ticket

\$9.55 \$1**63.8**3

Driver's Signature

403WM

Below-Grade Tank Removal Closure Report

> Well: API No:

(Rosa Unit# 022) 30-03907871

Location: A-S18-T31N-R05W, NMPM



In accordance with Rule 19.15.17.13 NMAC, the following report describes the general closure of the referenced below-grade tanks (BGT) on Williams Production Co, LLC (WPX) location in the San Juan Basin of New Mexico. The closure follows this WPX's standard closure procedure for all BGTs regulated under Rule 19.15.17 NMAC and operated by WPX. For those closures which do not conform to the standard closure plan, a separate well/pit specific closure plan will be developed and utilized.

Closure Conditions and Timing:

Pursuant to 19.15.17.13 (A) NMAC, WPX will initiate closure of any BGT should any one of these conditions occur:

- The Division requires closure because of imminent danger to fresh water, public health or the environment.
- The integrity of the BGT fails. Notification will be within 48 hours to the Division and closure will be schedule as specified in 19.15.17.12 (A) (5) NMAC.
- WPX chooses to take the BGT out-of-service due to operational needs. Closure under these conditions will be initiated within 60 days of cessation of the BGT's operation.
- BGTs installed prior to June 16, 2008 that do not meet the requirements under 19.15.17.11.I(6) NMAC and WPX chooses not to retrofit or upgrade. Closure under these conditions will be completed within five years (by June 16, 2013).

General Plan Requirements:

1. Prior to initiating any BGT Closure except in the case of an emergency, WPX will review County Tax Records for the current landowner of record. The landowner of record will be notified of the intent to closure the BGT by certified mail and a copy of this notification will be included in the closure report. In the case of an emergency, the landowner of record will be notified as soon as practical.

Williams notified the SMA of its intent to clean close the BGT via Certified Mail on March 10, 2009 see attached. No return receipt required per BLM:FFO/NMOCD MOU dated <u>5/4/09.</u>

- 2. Notice of Closure will be given to the Aztec District office between 72 hours and one week of the scheduled closure via email or phone. The notification of closure will include the following:
 - a. Operators Name (WPX)
 - b. Well Name and API Number
 - c. Location (USTR)

Aztec District office was notified of Williams E&P intent to close on (03/01/2010). Email attached.

3. All piping will be rerouted to an alternative produced water storage/disposal location (e.g. surface tanks, temporary frac tank, ...). The well will be temporarily shut-in until the rerouting is completed.

Williams closed the BGT used by the Rosa Unit# 022 separator and piped all liquids to the Produced Water Storage Tank.

4. All produced water will be removed from the BGT following discharge-pipe rerouting. Produced water will be disposed at one of the following NMOCD approved facilities depending on the proximity of the BGT site: Rosa Unit SWD #1 (Order: SWD-916, API: 30-039-27055), Rosa Unit #94 (Order: SWD-3RP-1003-0, API: 30-039-23035), Jillson Fed. SWD #001 (Order: R10168/R10168A, API: 30-039-25465), Middle Mesa SWD #001 (Order: SWD-350-0, API: 30-045-27004) and/or Basin Disposal (Permit: NM-01-0005).

<u>Produced water in the BGT prior to closures was removed by vacuum truck and hauled</u> to the <u>Rosa Unit disposal wells listed</u>.

5. Solids and sludges will be shoveled and /or vacuumed out for disposal at Envirotech (Permit Number NM-01-0011).

No solids or sludge required removal prior to excavation and removal of the tank.

6. Williams will obtain prior approval from NMOCD to dispose, recycle, reuse, or reclaim the BGT and provide documentation of the disposition of the BGT in the closure report. Steel materials will be recycled or reused as approved by the Division. Fiberglass tanks will be empty, cut up or shredded, and EPA cleaned for disposal as solid waste. Liners materials will be cleaned without soils or contaminated material for disposal as solid waste. Fiberglass tanks and liner materials will meet the conditions of paragraph 1 subsection D or 19.15.9.712 NMAC. Disposal will be at a licensed disposal facility, presently San Juan Regional Landfill operated by Waste Management under NMED Permit SWM-052426.

The fiberglass tank and plastic liner was disposed of at the San Juan Regional Landfill.

- 7. Any equipment associated with the BGT that is no longer required for some other purpose, following the closure will be removed from the location.

 The fiberglass tank and plastic liner were removed offsite. All other piping and equipment remains in use. See attached photo.
- 8. Following removal of the tank and any liner material, a five-point composite sample will be taken of the excavation and tested per 19.15.17.13(E)(4) NMAC as identified in Table 1. Grab samples will be collected from any area that is wet, discolored or showing other evidence of a release. Results will be report to the Division following receipt from the lab on Form C-141.

Table 1: Closure Criteria for BGTs

Components	, Testing Methods	Closure Limits (mg/Kg)	Sample Results (mg/Kg)
Benzene	EPA SW-846 Method 8021B or 8260B	0.2	0.006
BTEX	EPA SW-846 Method 8021B or 8260B	50	0.017
TPH	EPA SW-846 Method 418.1(1)	100	21.6
Chlorides	EPA SW-846 Method 300.1(1)	250(2)	15

⁽¹⁾ Method modified for solid waste.

9. If the Division and/or Williams determine there is a release, Williams will comply with 19.15.3.116 NMAC and 19.15.1.19 NMAC.

No release detected.

10. Upon completion of the tank removal, and any necessary soil remediation, the excavation will be backfilled with non-waste earthen material compacted to native and covered with a minimum of one foot of top soil or background thickness. The surface will be recontoured to match the native grade.

<u>Pit area backfilled with clean earthen material following sample results. No contaminated soil taken off site.</u> Backfill compacted to avoid settling and pit area remains in use for production operations.

⁽²⁾ If background concentration of Chlorides greater than 250 mg/Kg, then higher concentration will be used for closure.

11. For those portions of the former pit area no longer required for production activities, WPX will seed the disturbed areas the first growing season after the pit is covered. Seeding will be accomplished via drilling on the contour whenever practical, or by other Division-approved methods. Vegetative cover will equal 70% of the native perennial vegetative cover (un-impacted) consisting of at least three native plant species, including at least one grass, but not including noxious weeds, and maintained that cover through two successive growing seasons. Repeat seeding or planting will be continued until successful vegetative growth occurs. Note: WPX assumes the seeding stipulations including mix and seeding methods specified by the Surface Management Agency (BLM, BOR, USFS, Tribal, etc.) APD are Division-approved methods unless notified by the Division of their unacceptability. If a landowner agreement requires reseeding or other surface restoration that does not meet the revegetation requirements of 19.15.17.13., I then WPX will submit the proposed alternative with written documentation that the landowner agrees to the alternative, for Division approval.

Pit area along with unused portions of well pad interim reclaimed and following P&A entire location to be reclaimed and recontoured in accordance with Surface Management Agency requirements in APD-COAs and per BLM:FFO/NMOCD MOU dated 5/4/09.

12. For those portions of the former pit area required for production activities, reseeding will be done at well abandonment, and following the procedure noted above. See above notes.

Closure Report:

All closure activities will include proper documentation and will be submitted to OCD within 60 days of the BGT closure on a Closure Report using Division Form C-144. The Report will include the following:

- Proof of Closure Notice (surface owner & NMOCD)
- Backfilling & Cover Installation
- Site Diagram with coordinates
- Available Inspection reports

- Confirmation Sampling Analytical Results
- Disposal Facility Name(s) and Permit Number(s)
- Re-vegetation Application Rate & Seeding techniques
- Photo Documentation of Reclamation