District I

1625 N French Dr , Hobbs, NM 88240

District II

1301 W Grand Ave Artesia, NM 88210

District III

1000 Rio Brazos Rd , Aztec, NM 87410

District IV

1220 S St Francis Dr , Santa Fe, NM 87505

State of New Mexico Energy Minerals and Natural Resources

> Department Oil Conservation Division 1220 South St. Francis Dr. Santa Fe, NM 87505

Form C-144 July 21, 2008

For temporary pits, closed-loop sytems, and below-grade tanks, submit to the appropriate NMOCD District Office

For permanent pits and exceptions submit to the Santa Fe Environmental Bureau office and provide a copy to the appropriate NMOCD District Office

Pit, Closed-Loop System, Below-Grade Tank, or Proposed Alternative Method Permit or Closure Plan Application Type

of action:	Permit of a pit, closed-loop system, below-grade tank, or proposed alternative method
	X Closure of a pit, closed-loop system, below-grade tank, or proposed alternative method
	Modification to an existing permit
	Closure plan only submitted for an existing permitted or non-permitted pit, closed-loop system,
	below-grade tank, or proposed alternative method

Instructions: Please submit one application (Form C-144) per individual pit, closed-loop system, below-grade tank or alternative request

Please be advised that approval of this request does not relieve the operator of liability should operations result in pollution of surface

**	elieve the operator of its responsibility to comply w		•
Operator Burlington Resources	Oil & Gas Company, LP	OGRID#.	14538
Address. P.O. Box 4289, Farmin	ngton, NM 87499		
Facility or well name SAN JUA	N 30-6 UNIT 101M	,	
API Number:	30-039-30756	OCD Permit Number	
U/L or Qtr/Qtr H(SE/NE) Sec	etion. 35 Township: 30N	Range: 7W Cou	nty. Rio Arriba
Center of Proposed Design: Latitu	ide: 36.771065 °N	Longitude. 107.534523	°W NAD: ☐1927X 1983
Surface Owner X Federal	State Private T	ribal Trust or Indian Allotment	
_ =	Factory Other	X LLDPE HDPE PV	C Other
Type of Operation P&A Drying Pad Above G	ection H of 19 15 17 11 NMAC Drilling a new well Workover of notice of intround Steel Tanks Haul-off Bins aner type Thickness mil	tent) Other	h require prior approval of a permit or D Other RECEIVED
4 Below-grade tank: Subsection Volume Tank Construction material Secondary containment with leak Visible sidewalls and liner Liner Type Thickness	bbl Type of fluid detection Visible sidewalls, line	er, 6-inch lift and automatic overflow ther	OIL CONS. DIV. DIST. 3
Submittal of an exception request is	required Exceptions must be submitted to	the Santa Fe Environmental Bureau	office for consideration of approval

Fencing: Subsection D of 19 15 17 11 NMAC (Applies to permanent pit, temporary pits, and below-grade tanks)		
Chain link, six feet in height, two strands of barbed wire at top (Required if located within 1000 feet of a permanent residence, school, hospital, institu	ition on observab	,
Four foot height, four strands of barbed wire evenly spaced between one and four feet	tion or church	,
Alternate Please specify		
7		
Netting: Subsection E of 19 15 17 11 NMAC (Applies to permanent pits and permanent open top tanks)		
Screen Netting Other Monthly inspections (If netting or screening is not physically feasible)		
8 Signs: Subsection C of 19 15 17 11 NMAC		
12" X 24", 2" lettering, providing Operator's name, site location, and emergency telephone numbers		:
X Signed in compliance with 19 15 3 103 NMAC		
9 Administrative Approvals and Exceptions:		
Justifications and/or demonstrations of equivalency are required Please refer to 19 15 17 NMAC for guidance		
Please check a box if one or more of the following is requested, if not leave blank: Administrative approval(s) Requests must be submitted to the appropriate division district of the Santa Fe Environmental Bureau office for considerable provided in the santa Fe Environmental Bureau office for considerable provided in the santa Fe Environmental Bureau office for considerable provided in the santa Fe Environmental Bureau office for considerable provided in the santa Fe Environmental Bureau office for considerable provided in the santa Fe Environmental Bureau office for considerable provided in the santa Fe Environmental Bureau office for considerable provided in the santa Fe Environmental Bureau office for considerable provided in the santa Fe Environmental Bureau office for considerable provided in the santa Fe Environmental Bureau office for considerable provided in the santa Fe Environmental Bureau office for considerable provided in the santa Fe Environmental Bureau office for considerable provided in the santa Fe Environmental Bureau office for considerable provided in the santa Fe Environmental Bureau office for considerable provided in the santa Fe Environmental Bureau office for considerable provided in the santa Fe Environmental Bureau office for considerable provided in the santa Fe Environmental Bureau office for considerable provided in the santa Fe Environmental Bureau office for t	leration of ann	roval
(Fencing/BGT Liner)	cration of appi	iovai.
Exception(s) Requests must be submitted to the Santa Fe Environmental Bureau office for consideration of approval		
10		
Siting Criteria (regarding permitting) 19.15.17 10 NMAC Instructions: The applicant must demonstrate compliance for each siting criteria below in the application. Recommendations of acceptable		
source material are provided below. Requests regarding changes to certain siting criteria may require administrative approval from the		
appropriate district office or may be considered an exception which must be submitted to the Santa Fe Environmental Bureau Office for consideration of approval. Applicant must attach justification for request. Please refer to 19.15.17.10 NMAC for guidance. Siting criteria		
does not apply to drying pads or above grade-tanks associated with a closed-loop system.		
Ground water is less than 50 feet below the bottom of the temporary pit, permanent pit, or below-grade tank. - NM Office of the State Engineer - 1WATERS database search; USGS; Data obtained from nearby wells	Yes	No
Within 300 feet of a continuously flowing watercourse, or 200 feet of any other watercourse, lakebed, sinkhole, or playa lake	Yes	□No
(measured from the ordinary high-water mark). - Topographic map, Visual inspection (certification) of the proposed site		
Within 300 feet from a permanent residence, school, hospital, institution, or church in existence at the time of initial	Yes	□No
application. (Applies to temporary, emergency, or cavitation pits and below-grade tanks)		
- Visual inspection (certification) of the proposed site; Aerial photo, Satellite image	∐NA	
Within 1000 feet from a permanent residence, school, hospital, institution, or church in existence at the time of initial application.	Yes	No
(Applied to permanent pits)	□NA	_
- Visual inspection (certification) of the proposed site, Aerial photo; Satellite image	· .	
Within 500 horizonal feet of a private, domestic fresh water well or spring that less than five households use for domestic or stock watering purposes, or within 1000 horizontal feet of any other fresh water well or spring, in existence at the time of initial application.	Yes	∐No
- NM Office of the State Engineer - 1WATERS database search; Visual inspection (certification) of the proposed site.		
Within incorporated municipal boundaries or within a defined municipal fresh water well field covered under a municipal ordinance adopted pursuant to NMSA 1978, Section 3-27-3, as amended	Yes	No
 Written confirmation or verification from the municipality, Written approval obtained from the municipality Within 500 feet of a wetland. 	∏Yes	□No
- US Fish and Wildlife Wetland Identification map; Topographic map, Visual inspection (certification) of the proposed site		<u> —</u>
Within the area overlying a subsurface mine Written confirmation or verification or map from the NM EMNRD - Mining and Mineral Division	Yes	∐No
Within an unstable area.	Yes	No
- Engineering measures incorporated into the design; NM Bureau of Geology & Mineral Resources; USGS; NM Geological Society; Topographic map		•
Within a 100-year floodplain - FEMA map	Yes	No

Form C-144 Oil Conservation Division Page 2 of 5

Temporary Pits, Emergency Pits and Below-grade Tanks Permit Application Attachment Checklist Subsection B of 19 15 17 9 NMAC
Instructions Each of the following items must be attached to the application Please indicate, by a check mark in the box, that the documents are attached
Hydrogeologic Report (Below-grade Tanks) - based upon the requirements of Paragraph (4) of Subsection B of 19 15 17 9 NMAC
Hydrogeologic Data (Temporary and Emergency Pits) - based upon the requirements of Paragraph (2) of Subsection B of 19 15 17 9
Siting Criteria Compliance Demonstrations - based upon the appropriate requirements of 19 15 17 10 NMAC
Design Plan - based upon the appropriate requirements of 19 15 17 11 NMAC
Operating and Maintenance Plan - based upon the appropriate requirements of 19 15 17 12 NMAC
Closure Plan (Please complete Boxes 14 through 18, if applicable) - based upon the appropriate requirements of Subsection C of
19 15 17 9 NMAC and 19 15 17 13 NMAC
Previously Approved Design (attach copy of design) API or Permit
Closed-loop Systems Permit Application Attachment Checklist: Subsection B of 19 15 17 9 NMAC Instructions Each of the following items must be attached to the application Please indicate, by a check mark in the box, that the documents are attached Geologic and Hydrogeologic Data (only for on-site closure) - based upon the requirements of Paragraph (3) of Subsection B of 19 15 17 9
Siting Criteria Compliance Demonstrations (only for on-site closure) - based upon the appropriate requirements of 19 15 17 10 NMAC
Design Plan - based upon the appropriate requirements of 19 15 17 11 NMAC
Operating and Maintenance Plan - based upon the appropriate requirements of 19 15 17 12 NMAC
Closure Plan (Please complete Boxes 14 through 18, if applicable) - based upon the appropriate requirements of Subsection C of 19.15 17 9 NMAC and 19 15 17 13 NMAC
Previously Approved Design (attach copy of design) API
Previously Approved Operating and Maintenance Plan API
Previously Approved Operating and Maintenance Plan API
13
Permanent Pits Permit Application Checklist: Subsection B of 19 15 17 9 NMAC
Instructions: Each of the following items must be attached to the application. Please indicate, by a check mark in the box, that the documents are attached.
Hydrogeologic Report - based upon the requirements of Paragraph (I) of Subsection B of 19 15 17 9 NMAC
Siting Criteria Compliance Demonstrations - based upon the appropriate requirements of 19 15 17 10 NMAC
Climatological Factors Assessment
Certified Engineering Design Plans - based upon the appropriate requirements of 19 15 17 11 NMAC
Dike Protection and Structural Integrity Design based upon the appropriate requirements of 19 15 17 11 NMAC
Leak Detection Design - based upon the appropriate requirements of 19 15 17 11 NMAC
Liner Specifications and Compatibility Assessment - based upon the appropriate requirements of 19 15 17 11 NMAC
Quality Control/Quality Assurance Construction and Installation Plan
Operating and Maintenance Plan - based upon the appropriate requirements of 19 15 17 12 NMAC
Freeboard and Overtopping Prevention Plan - based upon the appropriate requirements of 19 15 17 11 NMAC
Nuisance or Hazardous Odors, including H2S, Prevention Plan
Emergency Response Plan
Oil Field Waste Stream Characterization
Monitoring and Inspection Plan
Erosion Control Plan
Closure Plan - based upon the appropriate requirements of Subsection C of 19 15 17 9 NMAC and 19.15.17 13 NMAC
14
Proposed Closure: 19 15 17 13 NMAC
Instructions: Please complete the applicable boxes, Boxes 14 through 18, in regards to the proposed closure plan.
Type Drilling Workover Emergency Cavitation P&A Permanent Pit Below-grade Tank Closed-loop System Alternative
Proposed Closure Method Waste Excavation and Removal
Waste Removal (Closed-loop systems only)
On-site Closure Method (only for temporary pits and closed-loop systems)
In-place Burial On-site Trench
Alternative Closure Method (Exceptions must be submitted to the Santa Fe Environmental Bureau for consideration)
15
Waste Excavation and Removal Closure Plan Checklist (19 15 17 13 NMAC) Instructions: Each of the following items must be attached to the closure plan. Please indicate, by a check mark in the box, that the documents are attached.
Protocols and Procedures - based upon the appropriate requirements of 19 15 17 13 NMAC
Confirmation Sampling Plan (if applicable) - based upon the appropriate requirements of Subsection F of 19 15 17 13 NMAC
Disposal Facility Name and Permit Number (for liquids, drilling fluids and drill cuttings)
Soil Backfill and Cover Design Specifications - based upon the appropriate requirements of Subsection H of 19 15 17 13 NMAC
Re-vegetation Plan - based upon the appropriate requirements of Subsection I of 19 15.17 13 NMAC
Site Reclamation Plan - based upon the appropriate requirements of Subsection G of 19 15 17 13 NMAC

Form C-144 Oil Conservation Division Page 3 of 5

Waste Removal Closure For Closed-loop Systems That Utilize Above Ground Steel Tanks or Haul-off Bins Only (19 15 17 13 D NMAC)					
Disposal Facility Name					
Disposal Facility Name					
Will any of the proposed closed-loop system operations and associated activities occur on or in areas that will nbe used for future service and					
Yes (If yes, please provide the information No No Required for impacted areas which will not be used for future service and operations Soil Backfill and Cover Design Specification - based upon the appropriate requirements of Subsection I of 19 15 17 13 NMAC Re-vegetation Plan - based upon the appropriate requirements of Subsection G of 19 15 17 13 NMAC Site Reclamation Plan - based upon the appropriate requirements of Subsection G of 19 15 17 13 NMAC Siting Criteria (Regarding on-site closure methods only: 19 15 17 10 NMAC Instructions Each siting criteria requires a demonstration of compiliance in the closure plan Recommendations of acceptable source material are provided below. Requests regarding changes to certain sting criteria may require administrative approval from the appropriate district office or may be considered an exception which must be submitted to the Santa Fe Environmental Bureau office for consideration of approval. Justifications and/or demonstrations of equivalency are required. Please refer to 19 15 17 10 NMAC for guidance. Ground water is less than 50 feet below the bottom of the buried waste Yes No N/A Ground water is between 50 and 100 feet below the bottom of the buried waste Yes No N/A Ground water is between 50 and 100 feet below the bottom of the buried waste Yes No N/A Ground water is more than 100 feet below the bottom of the buried waste Yes No N/A Ground water is more than 100 feet below the bottom of the buried waste Yes No N/A Ground water is more than 100 feet below the bottom of the buried waste Yes No N/A					
Soil Backfill and Cover Design Specification - based upon the appropriate requirements of Subsection H of 19 15 17 13 NMAC Re-vegetation Plan - based upon the appropriate requirements of Subsection G of 19 15 17 13 NMAC Site Reclamation Plan - based upon the appropriate requirements of Subsection G of 19 15 17 13 NMAC Site Reclamation Plan - based upon the appropriate requirements of Subsection G of 19 15 17 13 NMAC Site Reclamation Plan - based upon the appropriate requirements of Subsection G of 19 15 17 13 NMAC Site Reclamation Plan - based upon the appropriate requirements of Subsection G of 19 15 17 13 NMAC Instructions Each sting criteria requires a demonstration of compliance in the closure plan Recommendations of acceptable source material are provided below Requests regarding changes to certain siting criteria may require administrative approval from the appropriate district office or may be considered an exception which must be submitted to the Santa Fe Environmental Bureau office for consideration of approval Justifications and/or demonstrations of equivalency are required Please refer to 19 15 17 10 NMAC for guidance Ground water is less than 50 feet below the bottom of the buried waste NM Office of the State Engineer - iWATERS database search, USGS Data obtained from nearby wells Ground water is between 50 and 100 feet below the bottom of the buried waste NM Office of the State Engineer - iWATERS database search, USGS, Data obtained from nearby wells Ground water is more than 100 feet below the bottom of the buried waste NM Office of the State Engineer - iWATERS database search, USGS, Data obtained from nearby wells					
Re-vegetation Plan - based upon the appropriate requirements of Subsection I of 19 15 17 13 NMAC Site Reclamation Plan - based upon the appropriate requirements of Subsection G of 19 15 17 13 NMAC Siting Criteria (Regarding on-site closure methods only: 19 15 17 10 NMAC Instructions Each siting criteria requires a demonstration of compliance in the closure plan Recommendations of acceptable source material are provided below. Requests regarding changes to certain siting criteria may require administrative approval from the appropriate district office or may be considered an exception which must be submitted to the Santa Fe Environmental Bureau office for consideration of approval. Justifications and/or demonstrations of equivalency are required. Please refer to 19 15 17 10 NMAC for guidance. Ground water is less than 50 feet below the bottom of the buried waste NM Office of the State Engineer - iWATERS database search, USGS Data obtained from nearby wells. N/A					
Siting Criteria (Regarding on-site closure methods only: 19 15 17 10 NMAC Instructions Each siting criteria requires a demonstration of compliance in the closure plan Recommendations of acceptable source material are provided below Requests regarding changes to certain siting criteria may require administrative approval from the appropriate district office or may be considered an exception which must be submitted to the Santa Fe Environmental Bureau office for consideration of approval Justifications and/or demonstrations of equivalency are required Please refer to 19 15 17 10 NMAC for guidance Ground water is less than 50 feet below the bottom of the buried waste - NM Office of the State Engineer - iWATERS database search, USGS Data obtained from nearby wells Ground water is between 50 and 100 feet below the bottom of the buried waste - NM Office of the State Engineer - iWATERS database search, USGS, Data obtained from nearby wells Ground water is more than 100 feet below the bottom of the buried waste - NM Office of the State Engineer - iWATERS database search, USGS, Data obtained from nearby wells Ground water is more than 100 feet below the bottom of the buried waste - NM Office of the State Engineer - iWATERS database search, USGS, Data obtained from nearby wells					
Siting Criteria (Regarding on-site closure methods only: 19 15 17 10 NMAC Instructions Each siting criteria requires a demonstration of compliance in the closure plan Recommendations of acceptable source material are provided below Requests regarding changes to certain siting criteria may require administrative approval from the appropriate district office or may be considered an exception which must be submitted to the Santa Fe Environmental Bureau office for consideration of approval Justifications and/or demonstrations of equivalency are required Please refer to 19 15 17 10 NMAC for guidance Ground water is less than 50 feet below the bottom of the buried waste - NM Office of the State Engineer - iWATERS database search, USGS Data obtained from nearby wells Ground water is between 50 and 100 feet below the bottom of the buried waste - NM Office of the State Engineer - iWATERS database search, USGS, Data obtained from nearby wells Ground water is more than 100 feet below the bottom of the buried waste - NM Office of the State Engineer - iWATERS database search, USGS, Data obtained from nearby wells Ground water is more than 100 feet below the bottom of the buried waste - NM Office of the State Engineer - iWATERS database search, USGS, Data obtained from nearby wells					
- NM Office of the State Engineer - IWATERS database search, USGS Data obtained from nearby wells Ground water is between 50 and 100 feet below the bottom of the buried waste - NM Office of the State Engineer - IWATERS database search, USGS, Data obtained from nearby wells Ground water is more than 100 feet below the bottom of the buried waste - NM Office of the State Engineer - IWATERS database search, USGS, Data obtained from nearby wells N/A Yes No N/A					
Ground water is between 50 and 100 feet below the bottom of the buried waste - NM Office of the State Engineer - iWATERS database search, USGS, Data obtained from nearby wells Ground water is more than 100 feet below the bottom of the buried waste - NM Office of the State Engineer - iWATERS database search, USGS, Data obtained from nearby wells N/A					
- NM Office of the State Engineer - iWATERS database search, USGS, Data obtained from nearby wells Ground water is more than 100 feet below the bottom of the buried waste - NM Office of the State Engineer - iWATERS database search, USGS, Data obtained from nearby wells N/A					
Ground water is more than 100 feet below the bottom of the buried waste - NM Office of the State Engineer - iWATERS database search, USGS, Data obtained from nearby wells N/A					
- NM Office of the State Engineer - 1WATERS database search, USGS, Data obtained from nearby wells					
Within 300 feet of a continuously flowing watercourse, or 200 feet of any other significant watercourse or lakebed, sinkhole, or playa lake (measured from the ordinary high-water mark)					
- Topographic map, Visual inspection (certification) of the proposed site					
Within 300 feet from a permanent residence, school, hospital, institution, or church in existence at the time of initial application - Visual inspection (certification) of the proposed site, Aerial photo, satellite image					
Within 500 horizontal feet of a private, domestic fresh water well or spring that less than five households use for domestic or stock watering purposes, or within 1000 horizontal fee of any other fresh water well or spring, in existence at the time of the initial application					
- NM Office of the State Engineer - iWATERS database, Visual inspection (certification) of the proposed site					
Within incorporated municipal boundaries or within a defined municipal fresh water well field covered under a municipal ordinance adopted pursuant to NMSA 1978. Section 3-27-3, as amended - Written confirmation or verification from the municipality, Written approval obtained from the municipality					
Within 500 feet of a wetland					
- US Fish and Wildlife Wetland Identification map, Topographic map, Visual inspection (certification) of the proposed site					
Within the area overlying a subsurface mine Within confirmation on the NIM FANIRO Marine and Marine Division.					
- Written confiramtion or verification or map from the NM EMNRD-Mining and Mineral Division Within an unstable area					
- Engineering measures incorporated into the design, NM Bureau of Geology & Mineral Resources, USGS, NM Geological Society.					
Topographic map Within a 100-year floodplain Yes No					
- FEMA map					
18 On-Site Closure Plan Checklist: (19 15 17 13 NMAC) Instructions: Each of the following items must bee attached to the closure plan. Please indicate,					
by a check mark in the box, that the documents are attached. Siting Criteria Compliance Demonstrations - based upon the appropriate requirements of 19 15.17.10 NMAC					
Proof of Surface Owner Notice - based upon the appropriate requirements of Subsection F of 19 15 17 13 NMAC					
Construction/Design Plan of Burial Trench (if applicable) based upon the appropriate requirements of 19.15.17.11 NMAC					
Construction/Design Plan of Temporary Pit (for in place burial of a drying pad) - based upon the appropriate requirements of 19.15.17.11 NMAC					
Protocols and Procedures - based upon the appropriate requirements of 19 15.17 13 NMAC					
Confirmation Sampling Plan (if applicable) - based upon the appropriate requirements of Subsection F of 19 15 17 13 NMAC					
Waste Material Sampling Plan - based upon the appropriate requirements of Subsection F of 19 15 17 13 NMAC					
Disposal Facility Name and Permit Number (for liquids, drilling fluids and drill cuttings or in case on-site closure standards cannot be achieved)					
Soil Cover Design - based upon the appropriate requirements of Subsection H of 19 15 17 13 NMAC					
Re-vegetation Plan - based upon the appropriate requirements of Subsection I of 19 15 17 13 NMAC Site Reclamation Plan - based upon the appropriate requirements of Subsection G of 19 15 17 13 NMAC					

19
Operator Application Certification:
I hereby certify that the information submitted with this application is true, accurate and complete to the best of my knowledge and belief Name (Print) Title
_
e-mail address Telephone
20
OCD Approval: Permit Application (including closure plan) Closure Plan (only) OCD Conditions (see attachment)
OCD Representative Signature: 257201 (
Title: Compliance Officer OCD Permit Number:
Title: OMPlance Office OCD Permit Number:
21
Closure Report (required within 60 days of closure completion): Subsection K of 19 15 17 13 NMAC
Instructions Operators are required to obtain an approved closure plan prior to implementing any closure activities and submitting the closure report. The closure report is required to be submitted to the division within 60 days of the completion of the closure activities. Please do not complete this section of the form until an
approved closure plan has been obtained and the closure activities have been completed
X Closure Completion Date: 8/312010
Closure Method:
Waste Excavation and Removal X On-site Closure Method Alternative Closure Method Waste Removal (Closed-loop systems only)
If different from approved plan, please explain
23
Closure Report Regarding Waste Removal Closure For Closed-loop Systems That Utilize Above Ground Steel Tanks or Haul-off Bins Only:
Instructions: Please identify the facility or facilities for where the liquids, drilling fluids and drill cuttings were disposed. Use attachment if more than two facilities
were utilized. Disposal Facility Name Disposal Facility Permit Number
Disposal Facility Name Disposal Facility Permit Number
Were the closed-loop system operations and associated activities performed on or in areas that will not be used for future service and operations?
Yes (If yes, please demonstrate complilane to the items below)
Required for impacted areas which will not be used for future service and operations
Ste Reclamation (Photo Documentation)
Soil Backfilling and Cover Installation
Re-vegetation Application Rates and Seeding Technique
Closure Penent Attachment Checklist, Instruction Field Cilia in Island Attach alarman Plans in Field and Island In
Closure Report Attachment Checklist: Instructions: Each of the following items must be attached to the closure report. Please indicate, by a check mark in the box, that the documents are attached.
X Proof of Closure Notice (surface owner and division)
X Proof of Deed Notice (required for on-site closure)
X Plot Plan (for on-site closures and temporary pits)
X Confirmation Sampling Analytical Results (if applicable)
Waste Material Sampling Analytical Results (if applicable)
X Disposal Facility Name and Permit Number
X Soil Backfilling and Cover Installation
X Re-vegetation Application Rates and Seeding Technique
X Site Reclamation (Photo Documentation) On-site Closure Location
On-site Closure Location Latitude 36.771077 °N Longitude 107.534219 °W NAD 1927 X 1983
25
Operator Closure Certification:
I hereby certify that the information and attachments submitted with this closure report is ture, accurate and complete to the best of my knowledge and belief. I also certify that
the closure complies with all applicable closure requirements and conditions specified in the approved closure plan
Name (Print) Jamie Goodwin Title Regulatory Tech
Signature Canal Signature Date.
organical Company of the Company of
e-mail address / <u>jamie l goowin@conocophillips com</u> Telephone 505-326-9784

Burlington Resources Oil Gas Company, LP San Juan Basin Closure Report

Lease Name: SAN JUAN 30-6 UNIT 101M

API No.: 30-039-30756

In accordance with Rule 19.15.17.13 NMAC the following information describes the closure of the temporary pit referenced above. All proper documentation regarding closure activities is being included with the C-144. The temporary pit for this location was constructed and location drilled before June 16, 2008 (effective date for Rule 19.15.17). While closure of the temporary pit did fall within the rule some dates for submittals are after the rig release date.

- Details on Capping and Covering, where applicable. (See report)
- Plot Plan (Pit Diagram) (Included as an attachment)
- Inspection Reports (Included as an attachment)
- Sampling Results (Included as an attachment)
- C-105 (Included as an attachment)
- Copy of Deed Notice will be filed with County Clerk (Not required on Federal, State, or Tribal land as stated by FAQ dated October 30, 2008)

General Plan:

1. All free standing liquids will be removed at the start of the pit closure process from the pit and disposed of in a division—approved facility or recycle, reuse or reclaim the liquids in a manner that the appropriate division district office approves.

All recovered liquids were disposed of at Basin Disposal (Permit #NM-01-005) and any sludge or soil required to be removed to facilitate closure was hauled to Envirotech Land Farm (Permit #NM-01-011) and JFJ Landfarm % IEI (Permit #NM-01-0010B).

2. The preferred method of closure for all temporary pits will be on-site burial, assuming that all the criteria listed in sub-section (B) of 19.15.17.13 are met.

The pit was closed using onsite burial.

3. The surface owner shall be notified of BR's closing of the temporary pit as per the approved closure plan using certified mail, return receipt requested.

The closure process notification to the landowner was sent via email. (See Attached)(Well located on Federal Land, certified mail is not required for Federal Land per BLM/OCD MOU.)

4. Within 6 months of the Rig Off status occurring BR will ensure that temporary pits are closed, re-contoured, and reseeded.

Provision 4 of the closure plan requirements were not met due to rig move off date as noted on C-105 which was prior to pit rule change. Burlington will ensure compliance with this rule in the future.

- 5. Notice of Closure will be given to the Aztec Division office between 72 hours and one week of closure via email, or verbally. The notification of closure will include the following:
 - i. Operator's name
 - ii. Location by Unit Letter, Section, Township, and Range. Well name and API number.

Notification is attached.

6. Liner of temporary pit shall be removed above "mud level" after stabilization. Removal of liner will consist of manually or mechanically cutting liner at mud level and removing all remaining liner. Care will be taken to remove "All" of the liner i.e., edges of liner entrenched or buried. All excessive liner will be disposed of at a licensed disposal facility.

Liner of temporary pit was removed above "mud level" after stabilization. Removal of the liner consisted of manually cutting liner at mud level and removing all remaining liner. Care was taken to remove "ALL" of the liner i.e., edges of liner entrenched or buried. All excessive liner was disposed of at a licensed disposal facility, (San Juan County Landfill).

7. Pit contents shall be mixed with non-waste containing, earthen material in order to achieve the solidification process. The solidification process will be accomplished using a combination of natural drying and mechanically mixing. Pit contents will be mixed with non-waste, earthen material to a consistency that is deemed a safe and stable. The mixing ratio shall not exceed 3 parts clean soil to 1 part pit contents.

Burlington mixed the Pit contents with non-waste containing, earthen material in order to achieve the solidification process. The solidification process was accomplished by using a combination of natural drying and mechanically mixing. Pit contents were mixed with non-waste, earthen material to a consistency that is deemed as safe and stable. The mixing ratio consisted of approximately 3 parts clean soil to 1 part pit contents.

8. A five point composite sample will be taken of the pit using sampling tools and all samples tested per Subsection B of 19.15.17.13(B)(1)(b). In the event that the criteria are not met, all contents will be handled per Subparagraph (a) of Paragraph (1) of Subsection B of 19.15.17.13 i.e., Dig and haul.

A five point composite sample was taken of the pit using sampling tools and all samples tested per Subsection B of 19.15.17.1 3(B)(1)(b). (Sample results attached).

Components	Tests Method	Limit (mg/Kg)	Results
Benzene	EPA SW-846 8021B or 8260B	0.2	ND ug/kg
BTEX	EPA SW-846 8021B or 8260B	50	2.2 ug/kG
TPH	EPA SW-846 418.1	2500	86.4mg/kg
GRO/DRO	EPA SW-846 8015M	500	ND mg/Kg
Chlorides	EPA 300.1	1000/500	305 mg/L

9. Upon completion of solidification and testing standards being passed, the pit area will be backfilled with compacted, non-waste containing, earthen material. A minimum of four feet of cover shall be achieved and the cover shall include one foot of suitable material to establish vegetation at the site, or the background thickness of topsoil, whichever is greater. If standard testing fails BR will dig and haul all contents pursuant to 19.15.17.13.i.a. After doing such, confirmation sampling will be conducted to ensure a release has not occurred.

The pit material passed solidification and testing standards. The pit area was then backfilled with compacted, non-waste containing, earthen material. More than four feet of cover was achieved and the cover included one foot of suitable material to establish vegetation at the site.

10. During the stabilization process if the liner is ripped by equipment the Aztec OCD office will be notified within 48 hours and the liner will be repaired if possible. If the liner can not be repaired then all contents will be excavated and removed.

The integrity of the liner was not damaged in the pit closure process.

11. Dig and Haul Material will be transported to the Envirotech Land Farm located 16 miles south of Bloomfield on Angel Peak Road, CR 7175. Permit # NM010011

Dig and Haul was not required.

12. Re-contouring of location will match fit, shape, line, form and texture of the surrounding. Re-shaping will include drainage control, prevent ponding, and prevent erosion. Natural drainages will be unimpeded and water bars and/or silt traps will be place in areas where needed to prevent erosion on a large scale. Final recontour shall have a uniform appearance with smooth surface, fitting the natural landscape.

The pit area was re-contoured to match fit, shape, line, form and texture of the surrounding area. Reshaping included drainage control, to prevent ponding and erosion. Natural drainages were unimpeded and water bars and/or silt traps were placed in areas where needed to prevent erosion on a large scale. Final recontour has a uniform appearance with smooth surface, fitting the natural landscape.

13. Notification will be sent to OCD when the reclaimed area is seeded.

Provision 13 was accomplished through complying with BLM seeding requirements as allowed by the BLM/OCD MOU.

14. BR shall seed the disturbed areas the first growing season after the operator closes the pit. Seeding will be accomplished via drilling on the contour whenever practical or by other division-approved methods. BLM or Forest Service stipulated seed mixes will used on federal lands. Vegetative cover will equal 70% of the native perennial vegetative cover (un-impacted) consisting of at least three native plant species, including at least one grass, but not including noxious weeds, and maintain that cover through two successive growing seasons. Repeat seeding or planting will be continued until successful vegetative growth occurs.

Provision 14 was accomplished through complying with BLM seeding requirements as allowed by the BLM/OCD MOU.

15. The temporary pit will be located with a steel marker, no less than four inches in diameter, cemented in a hole three feet deep in the center of the onsite burial upon the abandonment of all the wells on the pad. The marker will be flush with the ground to allow access of the active well pad and for safety concerns. The marker will include a threaded collar to be used for future abandonment. The top of the marker will contain a welded steel 12" square plate that indicates the onsite burial of the temporary pit. The plate will be easily removable and a four foot tall riser will be threaded into the top of the collar marker and welded around the base with the operator's information at the time of all wells on the pad are abandoned. The operator's information will include the following: Operator Name, Lease Name, Well Name and number, Unit Number, Section, Township, Range and an indicator that the marker is an onsite burial location.

Provision 15 was accomplished by installing a steel marker in the temporary pit, no less than four inches in diameter, cemented in a hole three feet deep in the center of the onsite burial. The marker is flush with the ground to allow access of the active well pad and for safety concerns. The top of the marker contains a welded steel 12" square plate that indicates the onsite burial of the temporary pit. The plate contains the following: Operator Name, Lease Name, Well Name and number, Unit Number, Section, Township, Range and an indicator that the marker is an onsite burial location.

The plate will be easily removable and a four foot tall riser will be threaded into the top of the collar marker and welded around the base with the following operator's information at the time of all wells on the pad are abandoned. The riser will be labeled: BR, BLM, SAN JUAN 30-6 UNIT 101M, UL-H, Sec. 35, T 30N, R 7W, API # 30-039-30756

Sessions, Tamra D

From:

Sessions, Tamra D

Sent:

Monday, April 27, 2009 12:30 PM

To: Subject: 'mark_kelly@nm.blm.gov'

Surface Owner Notification

The following wells will have a temporary pit that will be closed on-site. Please let me know if you have any questions.

ALBRIGHT 10S REESE MESA 104S SAN JUAN 30-6 UNIT 101M

Thank you,

Tamra Sessions
Staff Regulatory Technician
CONOCOPHILLIPS COMPANY / SJBU
505-326-9834
Tamra.D.Sessions@conocophillips.com

DISTRICT I
1625 N. French Dr., Hobbs, N.M. 88240
DISTRICT II
1301 W Grand Avenue, Artesia, N.M. 88210
DISTRICT III
1000 Rio Brazos Rd , Aztec, N.M. 87410

1220 S. St. Francis Dr., Santa Fe, N.M. 87505

DISTRICT IV

State of New Mexico Energy, Minerals & Natural Resources Department

OIL CONSERVATION DIVISION 1220 South St. Francis Dr. Santa Fe, N.M. 87505 Form C-102 Revised October 12, 2005 Submit to Appropriate District Office

> State Lease - 4 Copies Fee Lease - 3 Copies

☐ AMENDED REPORT

WELL LOCATION AND ACREAGE DEDICATION PLAT

API Number		Pool Code DAKOTA / MESA V				/ERDE		
Property Code		⁶ Property Name						
	SAN JUAN 30-6 UNIT					IOIM		
OGRID No.	Operator Name						⁹ Elevation	
	BURLING	TON RES	OURCES O	IL & GAS CO	MPANY LP		6858	
			10 Surface	Location				
L or lot no. Section	Township Range	Lot Idn	Feet from the	North/South line	Feet from the	East/West line	County	

30 N 1923 NORTH 945 **EAST** RIO ARRIBA Н ¹¹Bottom Hole Location If Different From Surface UL or lot no. Section Township Lot Idn Feet from the North/South line Feet from the East/West line Range County

UL or lot no. Section Township Range Lot Idn Feet from the North/South line Feet from the East/West line County

1 35 30 N 7 W 2030 SOUTH 830 EAST RIO ARRIBA

18 Dedicated Acres 19 Joint or Infill 14 Consolidation Code 15 Order No.


320.00 (E/2)

NO ALLOWABLE WILL BE ASSIGNED TO THIS COMPLETION UNTIL ALL INTERESTS HAVE BEEN CONSOLIDATED OR A NON-STANDARD UNIT HAS BEEN APPROVED BY THE DIVISION

	ON A NON-SIAN	DARD UNII HAS D				I IIIE DIVISION
16 S 89°42'27" W			1923,	5250.85'	2644.27'	17 OPERATOR CERTIFICATION I hereby certify that the information contained herein is true and complete to the best of my knowledge and belief, and that this organization either owns a working interest or unleased mineral interest in the land including the proposed bottom hole location or has a right to drill this well at this location pursuant to a contract with an owner of such a mineral or working interest, or to a voluntary pooling agreement or a compulsory pooling order heretofore entered by the division.
	SECT	NAD LAT: 36.771065' LONG: 107.534523' NAD LAT: 36°46.2636 LONG: 107°32.0350'	N W 27 (945	S 0º16'09" E	Signature Date Printed Name
		LAT: 36.76743 LONG: 107.534124	D 83 3° N 4° W D 27 6' N	830'		18 SURVEYOR CERTIFICATION I hereby certify that the well location shown on this plat was plotted from field notes of actual surveys made by me or under my supervision, and that the same is true and correct to the best of my belief 8/30/08 Date of Survey Simplify and Seel of Survey
ш 60 00 0 = SURFACE 00 0 = BOTTOM Z S 89°43'58" W	: LOCATION HOLE LOCATION 2640.12'	N 89°57'20 " W		2637.05	S 0°13'53" E	Date of Survey Signature and Seal of Protestional Visites Property 17078 17078 Certificate Number

BURLINGTON RESOURCES OIL & GAS COMPANY LP SAN JUAN 30-6 UNIT 101M - 1923' FNL \$ 945' FEL (SURFACE) 2030' FSL \$ 830' FEL (BOTTOM HOLE LOCATION) SECTION 35, T-30-N, R-7-W, N.M.P.M., RIO ARRIBA COUNTY, N.M. GROUND ELEVATION: 6858 - DATE: AUGUST 30, 2008

- ! RAMP INTO PIT CONSTRUCTED FROM PAD GRADE INTO FLARE AREA AT 5% SLOPE
- APPROXIMATE 13'x75' PIT AREA LINED WITH 12 MIL POLYLINER
- 3 RESERVE PIT DIKE TO BE 8' ABOVE DEEP SIDE (OVERFLOW-3' WIDE AND I' ABOVE SHALLOW SIDE)
- 4 EDGE OF PERMITTED AREA DEFINED IN FIELD W/G' T-POST

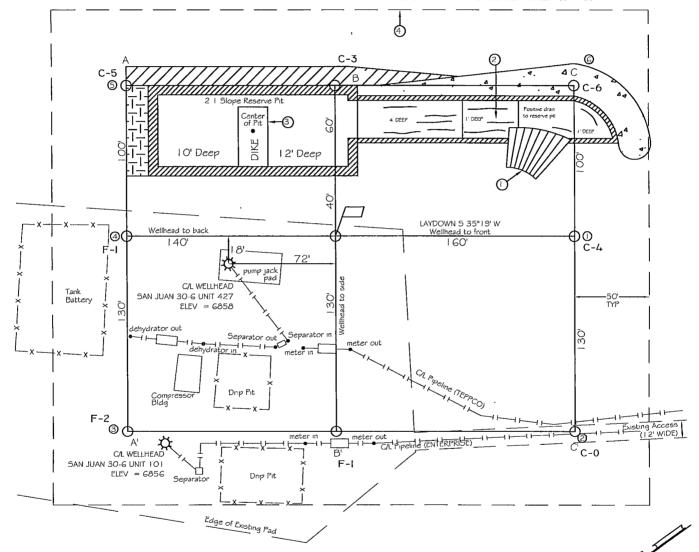

SAN JUAN 30-6 UNIT 101 NAD 83

LATITUDE 36 77 1542° N LONGITUDE 107 534679° W NAD 27

LATITUDE 36°46 2922' N LONGITUDE 107°32 0443' W

SAN JUAN 30-6 UNIT 427

EXISTING WELLPAD = 1 O4 ACRES

TOTAL PERMITTED AREA = 3 03 ACRES

NAD 83 LATITUDE 36 77 | 255° N LONGITUDE 107 534432° W **NAD 27**

LATITUDE 36°46 2749' N LONGITUDE 107°32 0295' W

SAN JUAN 30-6 UNIT 101M

NAD 83 LATITUDE 36 77 I 065° N LONGITUDE 107 534523° W

NAD 27 LATITUDE 36°46 2636' N LONGITUDE 107°32 0350' W

CENTER OF PIT

NAD 83 LATITUDE 36 771077° N LONGITUDE 107 534219° W

LATITUDE 36°46 2643' N LONGITUDE 107°32 0168' W ELEV 6846



NOTES

- I) CONTRACTOR SHOULD CALL "ONE-CALL" FOR LOCATION OF ANY MARKED OR UNMARKED BURIED PIPELINES OR CABLES ON WELLPAD AND OR ACCESS ROAD AT LEAST TWO (2) WORKING DAYS PRIOR TO CONST
- 2) UNITED FIELD SERVICES, INC IS NOT LIABLE FOR UNDERGROUND UTILITIES OR PIPELINES

9	SURVEYED:	8/30/08	REV.	DATE:	2/10/09	APP. BY	M.W.L.
	DRAWN BY:	H,S,	DATE	DRAWN:	9/03/08	FILE NAM	E: 8712L02



P.O. BOX 3651 FARMINGTON, NM 87499 OFFICE: (505)334-0408



EPA METHOD 8015 Modified Nonhalogenated Volatile Organics Total Petroleum Hydrocarbons

Client:	ConocoPhillips	Project #:	96052-1706
Sample ID.	Reserve Pit	Date Reported:	08-05-10
Laboratory Number:	55410	Date Sampled:	08-03-10
Chain of Custody No:	10087	Date Received:	08-03-10
Sample Matrix:	Soil	Date Extracted:	08-04-10
Preservative:	Cool	Date Analyzed:	08-05-10
Condition.	Intact	Analysis Requested:	8015 TPH

Parameter	Concentration (mg/Kg)	Det. Limit (mg/Kg)
Gasoline Range (C5 - C10)	ND	0.2
Diesel Range (C10 - C28)	ND	0.1
Total Petroleum Hydrocarbons	ND	0.2

ND - Parameter not detected at the stated detection limit.

References:

Method 8015B, Nonhalogenated Volatile Organics, Test Methods for Evaluating Solid Waste,

SW-846, USEPA, December 1996.

Comments:

S.J. 30-6 #101M

Analyst

Revie

Ph (505) 632-0615 Fr (800) 362-1879 Fx (505) 632-1865 lab@envirotech-inc.com envirotech-inc.com



EPA METHOD 8015 Modified Nonhalogenated Volatile Organics **Total Petroleum Hydrocarbons**

Client:	ConocoPhillips	Project #:	96052-1706
Sample ID:	Back Ground	Date Reported:	08-05-10
Laboratory Number:	55411	Date Sampled:	08-03-10
Chain of Custody No:	10087	Date Received:	08-03-10
Sample Matrix:	Soil	Date Extracted:	08-04-10
Preservative.	Cool	Date Analyzed.	08-05-10
Condition:	Intact	Analysis Requested:	8015 TPH

Parameter	Concentration (mg/Kg)	Det. Limit (mg/Kg)
Gasoline Range (C5 - C10)	ND	0.2
Diesel Range (C10 - C28)	ND	0.1
Total Petroleum Hydrocarbons	ND	0.2

ND - Parameter not detected at the stated detection limit.

References: Method 8015B, Nonhalogenated Volatile Organics, Test Methods for Evaluating Solid Waste,

SW-846, USEPA, December 1996.

Comments: S.J. 30-6 #101M



EPA Method 8015 Modified Nonhalogenated Volatile Organics Total Petroleum Hydrocarbons

Quality Assurance Report

Client:	QA/QC		Project #:		N/A
Sample ID:	08-05-10 QA/	QC	Date Reported:		08-05-10
Laboratory Number:	55425		Date Sampled:		N/A
Sample Matrix:	Methylene Chlo	ride	Date Received:		N/A
Preservative:	N/A		Date Analyzed:		08-05-10
Condition:	N/A		Analysis Reque		TPH
	I-Cal Date	I-Cal RF:	C-Cal RF:	% Difference	Accept. Range
Gasoline Range C5 - C10	05-07-07	9.9960E+002	1.0000E+003	0.04%	0 - 15%
Diesel Range C10 - C28	05-07-07	9.9960E+002	1.0000E+003	0.04%	0 - 15%
Blank Conc. (mg/L - mg/Kg)		Concentration		Detection Limit	
Gasoline Range C5 - C10	A 4 4	ND		0.2	
Diesel Range C10 - C28		ND		0.1	
Total Petroleum Hydrocarbons		ND		0.2	
Duplicate Conc. (mg/Kg)	Sample	Duplicate	% Difference	Accept. Range	
Gasoline Range C5 - C10	ND	ND	0.0%	0 - 30%	
Diesel Range C10 - C28	ND	ND	0.0%	0 - 30%	
Spike Conc. (mg/Kg)	Sample	Spike Added	Spike Result	% Recovery	Accept. Range
Gasoline Range C5 - C10	ND	250	258	103%	75 - 125%
Diesel Range C10 - C28	· ND	250	253	101%	75 - 125%

ND - Parameter not detected at the stated detection limit.

References:

Method 8015B, Nonhalogenated Volatile Organics, Test Methods for Evaluating Solid Waste,

SW-846, USEPA, December 1996.

Comments:

QA/QC for Samples 55393-55397, 55410-55411, 55425, 55428 and 55431

Ánalvst



EPA METHOD 8021 AROMATIC VOLATILE ORGANICS

Client:	ConocoPhillips	Project #:	96052-1706
Sample ID:	Reserve Pit	Date Reported:	08-05-10
Laboratory Number:	55410	Date Sampled:	08-03-10
Chain of Custody:	10087	Date Received:	08-03-10
Sample Matrix:	Soil	Date Analyzed:	08-05-10
Preservative.	Cool	Date Extracted:	08-04-10
Condition:	intact	Analysis Requested:	BTEX

Parameter	Concentration (ug/Kg)	Det. Limit (ug/Kg)	
Benzene	ND	0.9	
Toluene	ND	1.0	
Ethylbenzene	2.2	1.0	
p,m-Xylene	ND	1.2	
o-Xylene	ND	0.9	
Total BTEX	2.2		

ND - Parameter not detected at the stated detection limit.

Surrogate Recoveries:	Parameter	Percent Recovery
	Fluorobenzene	97.9 %
	1,4-difluorobenzene	98.3 %
	Bromochlorobenzene	100 %

References:

Method 5030B, Purge-and-Trap, Test Methods for Evaluating Solid Waste, SW-846, USEPA,

December 1996.

Method 8021B, Aromatic Volatile Organics, Test Methods for Evaluating Solid Waste, SW-846,

USEPA, December 1996.

Comments:

S.J. 30-6 #101M

Analyst



EPA METHOD 8021 AROMATIC VOLATILE ORGANICS

Client:	ConocoPhillips	Project #:	96052-1706
Sample ID:	Back Ground	Date Reported.	08-05-10
Laboratory Number:	55411	Date Sampled:	08-03-10
Chain of Custody:	10087	Date Received:	08-03-10
Sample Matrix:	Soil	Date Analyzed:	08-05-10
Preservative:	Cool	Date Extracted:	08-04-10
Condition:	Intact	Analysis Requested:	BTEX

Parameter	Concentration (ug/Kg)	Det. Limit (ug/Kg)	
_			
Benzene	ND	0.9	
Toluene	ND	1.0	
Ethylbenzene	ND	1.0	
p,m-Xylene	ND	1.2	
o-Xylene	ND	0.9	
Total BTEX	ND		

ND - Parameter not detected at the stated detection limit.

Surrogate Recoveries:	Parameter	Percent Recovery	
	Fluorobenzene	99.7 %	
	1,4-difluorobenzene	99.6 %	
	Bromochlorobenzene	96.8 %	

References:

Method 5030B, Purge-and-Trap, Test Methods for Evaluating Solid Waste, SW-846, USEPA,

December 1996.

Method 8021B, Aromatic Volatile Organics, Test Methods for Evaluating Solid Waste, SW-846,

USEPA, December 1996.

Comments:

S.J. 30-6 #101M

Analyst

Revie



EPA METHOD 8021 AROMATIC VOLATILE ORGANICS

Client: Sample ID:	N/A 0805BBLK QA/QC		Project #:		N/A 08-05-10
Laboratory Number	55393		Date Reported: Date Sampled:		08-05-10 N/A
Sample Matrix	Soil		Date Received:		N/A
Preservative:	N/A		Date Analyzed:		08-05-10
Condition:	N/A		Analysis:	ĺ	BTEX
Calibration and	I-Cal RF:	C-Cal RF:	%Diff,	Blank	Detect.
Detection Limits (ug/L)	,	Accept. Ran	ge 0 - 15%	Conc	Limit
Benzene	1.0839E+006	1.0861E+006	0.2%	ND	0.1
Toluene	1 2145E+006	1.2169E+006	0.2%	ND	0.1
Ethylbenzene	1.0890E+006	1.0912E+006	0.2%	ND	0.1
p,m-Xylene	2 7702E+006	2.7757E+006	0.2%	ND	0.1
o-Xylene	9.8493E+005	9.8690E+005	0.2%	ND	0.1
Duplicate Conc. (ug/Kg)	Sample	Duplicate	%Diff.	Accept Range	Detect. Limit
Benzene	ND	ND	0.0%	0 - 30%	0.9
Toluene	ND	ND	0.0%	0 - 30%	1.0
Ethylbenzene	ND	ND	0.0%	0 - 30%	1.0
p,m-Xylene	ND	ND	0.0%	0 - 30%	1.2
o-Xylene	ND	ND	0.0%	0 - 30%	0.9
Spike Conc. (ug/Kg)	Sample	Amount Spiked	Spiked Sample	% Recovery	Accept Range
Benzene	ND	50.0	50.5	101%	39 - 150
Toluene	ND	50.0	50.3	101%	46 - 148
Ethylbenzene	ND	50.0	49.4	98.8%	32 - 160
p,m-Xylene	ND	100	99.4	99.4%	46 - 148
o-Xylene	ND	50.0	48.8	97.7%	46 - 148

ND - Parameter not detected at the stated detection limit.

References: Method 5030B, Purge-and-Trap, Test Methods for Evaluating Solid Waste, SW-846, USEPA,

December 1996.

Method 8021B, Aromatic and Halogenated Volatiles by Gas Chromatography Using Photoionization and/or Electrolytic Conductivity Detectors, SW-846, USEPA December 1996

QA/QC for Samples 55393-55397, 55410-55411, 55428 and 55431 Comments:

Analyst



EPA METHOD 418.1 TOTAL PETROLEUM HYDROCARBONS

Client:	ConocoPhillips	Project #:	96052-1706
Sample ID:	Reserve Pit	Date Reported:	08-05-10
Laboratory Number.	55410	Date Sampled:	08-03-10
Chain of Custody No:	10087	Date Received:	08-03-10
Sample Matrix.	Soil	Date Extracted:	08-04-10
Preservative:	Cool	Date Analyzed:	08-04-10
Condition:	Intact	Analysis Needed:	TPH-418.1

		Det.
	Concentration	Limit
Parameter	(mg/kg)	(mg/kg)

Total Petroleum Hydrocarbons

86.4

8.9

ND = Parameter not detected at the stated detection limit.

References:

Method 418.1, Petroleum Hydrocarbons, Total Recoverable, Chemical Analysis of Water

and Waste, USEPA Storet No. 4551, 1978.

Comments:

S.J. 30-6 #101M



EPA METHOD 418.1 TOTAL PETROLEUM HYDROCARBONS

Client:	ConocoPhillips	Project #:	96052-1706
Sample ID:	Back Ground	Date Reported:	08-05-10
Laboratory Number:	55411	Date Sampled:	08-03-10
Chain of Custody No:	10087	Date Received:	08-03-10
Sample Matrix	Soil	Date Extracted:	08-04-10
Preservative:	Cool	Date Analyzed:	08-04-10
Condition:	Intact	Analysis Needed:	TPH-418.1

		Det.
	Concentration	Limit
Parameter	(mg/kg)	(mg/kg)

Total Petroleum Hydrocarbons

28.3

8.9

ND = Parameter not detected at the stated detection limit.

References:

Method 418.1, Petroleum Hydrocarbons, Total Recoverable, Chemical Analysis of Water

and Waste, USEPA Storet No. 4551, 1978.

Comments:

S.J. 30-6 #101M



Blank Conc. (mg/Kg)

TPH

TPH

EPA METHOD 418.1 TOTAL PETROLEUM HYROCARBONS QUALITY ASSURANCE REPORT

Detection Limit

80 - 120%

8.9

98.0%

2,010

Client:	QA/QC	Project #:	N/A
Sample ID:	QA/QC	Date Reported:	08-04-10
Laboratory Number:	08-04-TPH.QA/QC 55382	Date Sampled:	N/A
Sample Matrix	Freon-113	Date Analyzed:	08-04-10
Preservative:	N/A	Date Extracted:	08-04-10
Condition:	N/A	Analysis Needed:	TPH

Calibration	I-Cal Date	C-Cal Date	I-Cal RF:	C-Cal RF:	% Difference	Accept. Range
	07-29-10	08-04-10	1,860	1,770	4.8%	+/- 10%

Concentration

2,000

ND

Duplicate Conc. (mg/Kg) TPH		Sample 50.6	Duplicate 52.1	% Difference 3.0%	Accept. Range +/- 30%
Spike Conc. (mg/Kg)	Sample	Spike Added	Spike Result	% Recovery	Accept Range

50.6

ND = Parameter not detected at the stated detection limit

Method 418.1, Petroleum Hydrocarbons, Total Recoverable, Chemical Analysis of Water References.

and Waste, USEPA Storet No. 4551, 1978.

Comments: QA/QC for Samples 55382, 55377, 55405, 55408-55411, 55424 and 55428



Chloride

Client: ConocoPhillips Project #: 96052-1706 Sample ID: Reserve Pit Date Reported: 08-05-10 Lab ID#: 55410 Date Sampled: 08-03-10 Sample Matrix: Soil Date Received: 08-03-10 Preservative: Cool Date Analyzed. 08-05-10 Condition: Intact Chain of Custody: 10087

Parameter

Concentration (mg/Kg)

Total Chloride

305

Reference:

U.S.E.P.A., 4500B, "Methods for Chemical Analysis of Water and Wastes", 1983.

Standard Methods For The Examination of Water And Waste Water", 18th ed., 1992.

Comments:

S.J. 30-6 #101M

Analyst

Revie



Chloride

Client: ConocoPhillips Project #: 96052-1706 Sample ID: **Back Ground** Date Reported: 08-05-10 Lab ID#: 55411 Date Sampled: 08-03-10 Sample Matrix: Soil Date Received: 08-03-10 Preservative: Cool Date Analyzed: 08-05-10 Condition: Intact Chain of Custody: 10087

Parameter

Concentration (mg/Kg)

Total Chloride

25

Reference:

U.S.E.P.A., 4500B, "Methods for Chemical Analysis of Water and Wastes", 1983.

Standard Methods For The Examination of Water And Waste Water", 18th ed., 1992.

Comments:

S.J. 30-6 #101M

Analyst

Review

Submit To Appropri	iate District	t Offic	e				State of No									rm C-1				
District I 1625 N French Dr	Hobbs, NI	M 882	40	ļ	Ene	ergy, I	Minerals an	d Na	tural Re	eso	ources	-	1. WELL	API	NO			J	uly 17, 20)08
District II 1301 W Grand Ave	•					O:I	l Canaamia	+i	Diniaia	~ 44			30-039-30		110					
District III 1000 Rio Brazos Ro		•					l Conserva						2 Type of L					n /11 ln 1		
District IV 1220 S St Francis					1220 South St. Francis Dr. Santa Fe, NM 87505							\mid	STATE FEE FED/INDIAN 3 State Oil & Gas Lease No							
1220 S St Francis	Dr , Santa i	re, NN	VI 87303				Jama I C, I	INIVI	01303				SF - 07938	3						
		_ET	ION C	RR	ECC	MPL	ETION RE	POF	RT AND) L	_OG	Tak San	AT 7.12							
4 Reason for file	ng												5 Lease Nam SAN JUAN			_	nent Nan	ne		
☐ COMPLETI	ON REP	ORT	(Fill in b	oxes #	1 throu	gh #31	for State and Fe	e wells	only)			ľ	6 Well Num				,			
C-144 CLOS #33, attach this ar											d #32 and/o	ır	101M							
7 Type of Comp	letion	1 w.c	DRKOVE!	RП	DEEDE	NING	□PLUGBAC	кП	DIFFERE	NT	RESERVO	ΝR	OTHER							
8 Name of Opera	itor						Пъсовис	Ш	DITTERE		RESERVE		9 OGRID							
Burlington R		es Oi	il Gas (Com	pany,	LP						-	14538 11 Pool name	or W	/ıldcət					
PO Box 4298, Fa		NM	87499												nucat					
12 Location	Unit Ltr	-	Section		Towns	hıp	Range	Lot		F	eet from the	e	N/S Line	Fee	t from	the	E/W Lu	ne	County	
Surface:		_								┞		4		ļ						
BH: 13 Date Spudded	1 14 De	nte T	D Reach		115.0	Note Dig	Released		16	Dr	ate Comple	ted	(Ready to Prod	luca)		l 17	Elevatio	me (DE	and RKB,	
13 Date Spudded	14 1/2	ate i	D Reacin	cu		/2010	Released		10	D	ate Comple	ica	(Ready to Floo	iuce)			GR, etc		anu KKD,	
18 Total Measure	ed Depth (of We	ell		19 F	Plug Bac	k Measured De	pth	20	W	Vas Directio	onal	Survey Made)	21	Туре	Electric	and Ot	her Logs R	un
22 Producing Int	erval(s), o	f this	completi	on - T	op, Bot	tom, Na	ame								•					
23	1,					CAS	ING REC	ORI	D (Rep	or	t all stri	ng	gs set in w	ell)			,			
CASING SIZ	ZE	V	WEIGHT	LB/F	Т		DEPTH SET		НС	DLE	ESIZE		CEMENTIN	IG RE	ECORI)	AM	OUNT	PULLED	
																\perp				
								1								Ť				
													.,							
						LINI	ER RECORD				1.	25	<u> </u>	ELIDI	NG R	ECC	ND D			
SIZE	TOP			BOT	TOM	LIN	SACKS CEN		SCREE	N		SIZ			EPTH			PACKE	ER SET	
26 Perforation	record (ur	iterva	ıl sıze an	d num	her)		<u></u>		27 AC	כווי	SHOT E	D /	ACTURE, CE	ME	NT S	OLIE	EZE E	TC		
20 Terioration	record (ii	iiciva	a, size, an	u nun	iocij						TERVAL	IX.	AMOUNT A							
																				
28								PR	DDUC	Т	ION									
Date First Produc	tion		Pro	oducti	on Met	hod <i>(Fla</i>	owing, gas lift, j						Well Statu	s (Pro	od or S	Shut-				
Date of Test	Hours	Testo	ed	Cho	ke Sıze		Prod'n For Test Period		Oıl - Bb	ol		Gas	s - MCF	"	Vater -	Bbl		Gas - C	ıl Ratıo	
Flow Tubing Press	Casıng	g Pres	ssure	1	ulated?	24-	Oıl - Bbl	-,,	Gas	- N	MCF		Water - Bbl		Oıl	Grav	vity - API	l - (Cori	r)	
29 Disposition of	f Gas <i>(Sol</i>	d, use	ed for fuel	, vent	ed, etc))								30	Test W	/itne:	ssed By			
31 List Attachme	ents													l						
32 If a temporary	pit was ι	ised a	at the well	, attac	h a plat	with th	e location of th	e temp	orary pit											
33 If an on-site b	•				•			•												
			Latitude	36.77	1077°N	Lo:	ngitude 107.53	4219°\	W NAD[<u>]1</u>	927 🛛 198	33					·			
I hereby certif	fy that th	he īn	formati	on st	nown c	on boti	<i>h sides of thi</i> nted	s forn	ı is true	an	id comple	ete	to the best o	of my	knov	vlea	lge and	belief		
Signature	m'	ب	1500x	du	ىلا	→ Nan	ne Jamie G	oodw	in Tit	le [.]	Regula	tor	y Tech.	Dat	e· 8/1	8/2	011			
E-mail Addres	ss jamie	e.l.go	oodwin	@coi	nocop	hillips	.com													

ConocoPhillips

Pit Closure Form:
Date: 8/31/2010
Well Name: <u>\$3.30-6</u> 101 M
Footages: 1923 FNL, 945-FEL Unit Letter: H
Section: 35, T-30-N, R-7-W, County: R.A. State: MM
Contractor Closing Pit: Rither
Construction Inspector: 71 Faver Date: 8/31/2010
nspector Signature:

Revised 4/30/10

Goodwin, Jamie L

From:

Payne, Wendy F

Sent:

Wednesday, August 25, 2010 12 13 PM

To:

(Brandon.Powell@state.nm.us); GRP:SJBU Regulatory; 'tevans48@msn.com'; (bko@digii.net); Mark Kelly, Robert Switzer, Sherrie Landon; Bassing, Kendal R., Berenz (mxberenz@yahoo.com), Elmer Perry, Faver Norman; Fred Martinez; Jared Chavez; Lowe, Terry; Payne, Wendy F; Spearman, Bobby E, 'Steve McGlasson'; Tally, Ethel; Becker, Joey W, Bowker, Terry D; Gordon Chenault; GRP:SJBU Production Leads; Hockett, Christy R; Johnson, Kirk L; Bassing, Kendal R.; Kennedy, Jim R; Lopez, Richard A; O'Nan, Mike J.; Peace, James T; Pierce, Richard M; Poulson, Mark E; Smith, Randall O; Spearman, Bobby E; Stamets, Steve A, Thacker, LARRY; Work, Jim A; 'isaiah@crossfire-llc.com'; Jerid Cabot (jerid@crossfire-llc.com), Blair, Maxwell O; Blakley, Mac; Clark, Joni E; Farrell, Juanita R; Gillette, Steven L (Gray Surface Specialties and Consulting, Ltd.); Greer, David A; Hines, Derek J (Finney Land Co.); Maxwell, Mary Alice; McWilliams, Peggy L; Seabolt, Elmo F,

Stallsmith, Mark R

Cc:

'JDRITT@aol com'

Subject:

Reclamation Notice: San Juan 30-6 Unit 101M

Importance:

High

Attachments:

San Juan 30-6 Unit 101M.pdf

JD Ritter Construction will move a tractor to the **San Juan 30-6 Unit 101M** to start the reclamation process on Tuesday, August 31, 2010

Please contact Norm Faver (320-0670) if you have questions or need further assistance. Driving directions are attached.



San Juan 30-6 Unit 101M.pdf (2...

Burlington Resources Well- Network #: 10256701 - Activity Code D250 (reclamation) & D260 (pit closure)

Rio Arriba County, NM

SAN JUAN 30-6 UNIT 101M- BLM surface / BLM minerals

Twin: San Juan 30-6 Unit 101 & 427 (existing)

1923' FNL, 945' FEL

SEC. 35, T30N, R07W

Unit Letter 'H'

Lease #: SF-079383

Latitude: 36° 46 min 15.83400 sec N (NAD 83)

Longitude: 107° 32 min 04.28280 sec W (NAD83)

Elevation: 6858'

Total Acres Disturbed: 3.03 acres


Access Road: n/a

API#: 30-039-30756


Wendy Payne
ConocoPhillips-SJBU
505-326-9533
Wendy.F.Payne@conocophillips.com


ConocoPhillips

Reclamation Form:
Date: 3/31/2011
Well Name: <u>\$3 30-6 10171</u>
Footages: Unit Letter:
Section:, TN, RW, County: R.A. State: N.M.
Reclamation Contractor: 12: Her
Reclamation Date: 3/7/2011
Road Completion Date: 3/7/ 2011
Seeding Date: 3/8/2011
***PIT MARKER STATUS (): Picture of Marker set needed MARKER PLACED :(DATE) LATATUDE: 36 ~ ~ ~ ~ ~ ~ ~ ~ ~ ~ ~ ~ ~ ~ ~ ~ ~ ~
MARKER PLACED:(DATE) LATATUDE: 36 N6.260
MARKER PLACED :(DATE)
MARKER PLACED: (DATE) LATATUDE: 36 H6,260 LONGITUDE: 107 32.058
MARKER PLACED:

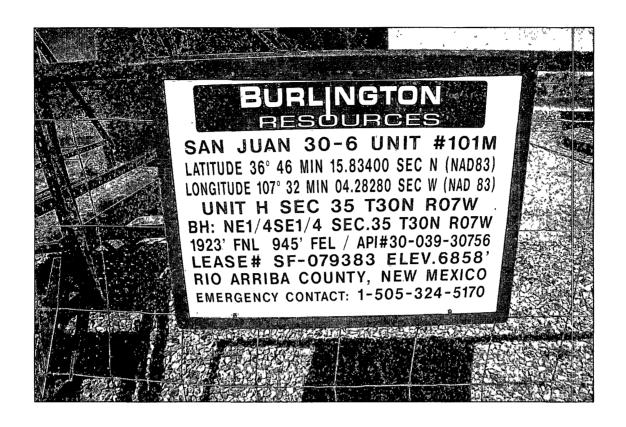



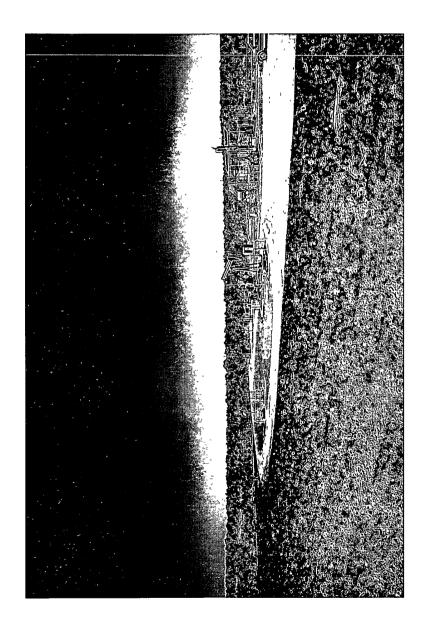

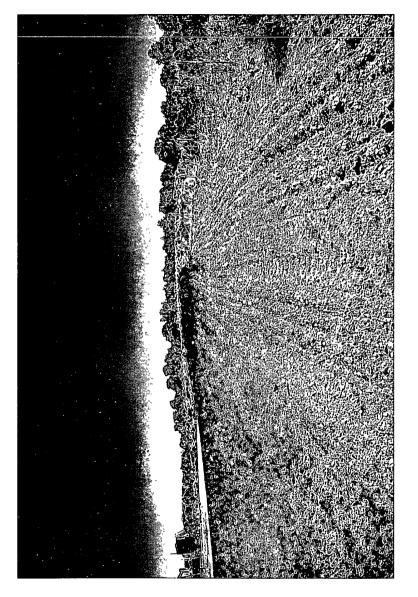

	WELL NAME: S.J.30-6#101m	OPEN P	IT INSPE	ConocoPhillips						
	INSPECTOR DATE		04/29/10	Freddie Mtz 06/22/10						
	*Please request for pit extention after 26 weeks	Week 1	Week 2	Week 3	Week 4	Week 5	Week 6	Week 7	Week 8	Week 9
PIT STATUS		☐ Drilled☐ Completed☐ Clean-Up	☐ Drilled☐ Completed☐ Clean-Up	✓ Drilled ✓ Completed ☐ Clean-Up	☐ Drilled☐ Completed☐ Clean-Up	☐ Drilled ☐ Completed ☐ Clean-Up	☐ Drilled☐ Completed☐ Clean-Up	☐ Drilled ☐ Completed ☐ Clean-Up	☐ Drilled☐ Completed☐ Clean-Up	☐ Drilled ☐ Completed ☐ Clean-Up
LOCATION	Is the location marked with the proper flagging? (Const. Zone, poles, pipelines, etc.)	✓ Yes ☐ No	Yes No	✓ Yes 🗌 No	Yes No	☐ Yes ☐ No	☐ Yes ☐ No	☐ Yes ☐ No	Yes No	☐ Yes ☐ No
/201	Is the temporary well sign on location and visible from access road?	☑ Yes ☐ No	☐ Yes ☐ No	☑ Yes ☐ No	Yes No	☐ Yes ☐ No	☐ Yes ☐ No	Yes No	☐ Yes ☐ No	☐ Yes ☐ No
	Is the access road in good driving condition? (deep ruts, bladed)	✓ Yes 🗌 No	☐ Yes ☐ No	✓ Yes ☐ No	☐ Yes ☐ No	Yes No	Yes No	☐ Yes ☐ No	☐ Yes ☐ No	Yes No
	Are the culverts free from debris or any object preventing flow?	☑ Yes ☐ No	☐ Yes ☐ No	✓ Yes 🗌 No	☐ Yes ☐ No	☐ Yes ☐ No	☐ Yes ☐ No	☐ Yes ☐ No	☐ Yes ☐ No	☐ Yes ☐ No
뽔	Is the top of the location bladed and in good operating condition?	☑ Yes ☐ No	☐ Yes ☐ No	☑ Yes ☐ No	☐ Yes - ☐ No	☐ Yes ☐ No	☐ Yes ☐ No	☐ Yes ☐ No	☐ Yes ☐ No	Yes No
COMPLIANCE	Is the fence stock-proof? (fences tight, barbed wire, fence clips in place?	☑ Yes ☐ No	☐ Yes ☐ No	☑ Yes ☐ No	☐ Yes ☐ No	☐ Yes ☐ No	Yes No	Yes No	☐ Yes ☐ No	Yes No
Ø Ø Ø	Is the pit liner in good operating condition? (no tears, up-rooting corners, etc.)	☑ Yes ☐ No	☐ Yes ☐ No	✓ Yes □ No	Yes No	☐ Yes ☐ No	☐ Yes ☐ No	☐ Yes ☐ No	☐ Yes ☐ No	Yes No
	Is the the location free from trash, oil stains and other materials? (cables, pipe threads, etc.)	☑ Yes ☐ No	☐ Yes ☐ No	☑ Yes ☐ No	☐ Yes ☐ No	☐ Yes ☐ No	☐ Yes ☐ No	☐ Yes ☐ No	☐ Yes ☐ No	Yes No
ENVIRONMENTAL	Does the pit contain two feet of free board? (check the water levels)	☑ Yes ☐ No	☐ Yes ☐ No	☑ Yes ☐ No	☐ Yes ☐ No	☐ Yes ☐ No	☐ Yes ☐ No	☐ Yes ☐ No	☐ Yes ☐ No	Yes No
N K K K	Is there any standing water on the blow pit?	✓ Yes ☐ No	☐ Yes ☐ No	✓ Yes 🗌 No	Yes No	☐ Yes ☐ No	Yes No	☐ Yes ☐ No	☐ Yes ☐ No	Yes No
□	Are the pits free of trash and oil?	☑ Yes ☐ No	☐ Yes ☐ No	✓ Yes ☐ No	☐ Yes ☐ No	☐ Yes ☐ No	Yes No	☐ Yes ☐ No	☐ Yes ☐ No	☐ Yes ☐ No
	Are there diversion ditches around the pits for natural drainage?	☑ Yes ☐ No	☐ Yes ☐ No	✓ Yes 🗌 No	Yes No	☐ Yes ☐ No	☐ Yes ☐ No	☐ Yes ☐ No	☐ Yes ☐ No	☐ Yes ☐ No
	Is the Manifold free of leaks? Are the hoses in good condition?	☑ Yes ☐ No	☐ Yes ☐ No	✓ Yes ☐ No	Yes No	☐ Yes ☐ No	☐ Yes ☐ No	☐ Yes ☐ No	☐ Yes ☐ No	☐ Yes ☐ No
ပ္ပ	Was the OCD contacted?	☐ Yes ☑ No	☐ Yes ☐ No	☐ Yes ☑ No	Yes No	☐ Yes ☐ No	☐ Yes ☐ No	Yes No	Yes No	Yes No
	PICTURE TAKEN	☐ Yes ☑ No	☐ Yes ☐ No	☐ Yes ☑ No	Yes No	☐ Yes ☐ No	☐ Yes ☐ No	☐ Yes ☐ No	Yes No	Yes No
	COMMENTS	Rig on location	RIG ON LOC	Needs tested						

WELL NAME: ConocoPhillips **OPEN PIT INSPECTION FORM** S.J. 30-6#101M INSPECTOR Fred Mtz Fred Mtz Fred Mtz Fred Mtz FRFD MT7 Fred Mtz 07/20/10 DATE 05/20/10 07/07/10 07/13/10 08/03/10 08/10/10 Week 3 Week 4 Week 5 Week 6 Week 7 Week 8 Week 9 Week 1 Week 2 *Please request for pit extention after 26 weeks ☑ Drilled ✓ Drilled Drilled Drilled Drilled ✓ Drilled ✓ Drilled ✓ Drilled ☑ Drilled Completed Completed Completed √ Completed Completed Completed Completed Completed **PIT STATUS** Clean-Up Clean-Up Clean-Up Clean-Up Clean-Up Clean-Up Clean-Up Clean-Lin Clean-Up Is the location marked with the proper flagging? ☐ Yes ☐ No ✓ Yes ☐ No. Yes No Yes No Yes No ✓ Yes ☐ No ☐ Yes ☐ No ✓ Yes ☐ No ✓ Yes ☐ No (Const. Zone, poles, pipelines, etc.) Is the temporary well sign on location and visible ✓ Yes 🗌 No Yes No Yes No ☐ Yes ☐ No ✓ Yes ☐ No ☐ Yes ☐ No Yes No ✓ Yes No ✓ Yes ☐ No from access road? Is the access road in good driving condition? Yes No ☐ Yes ☐ No ☐ Yes ☐ No. ✓ Yes ☐ No ✓ Yes 🗆 No ☐ Yes 🗸 No ☐ Yes ☐ No. Yes No ☐ Yes ☐ No (deep ruts, bladed) Are the culverts free from debris or any object Yes No ✓ Yes □ No ✓ Yes ☐ No ✓ Yes ☐ No Yes No ☐ Yes ☐ No. Yes No ☐ Yes ☐ No. Yes No preventing flow? Is the top of the location bladed and in good ✓ Yes □ No ✓ Yes ☐ No ☐ Yes ☐ No ☐ Yes ☐ No Yes No Yes No ✓ Yes ☐ No ☐ Yes ☐ No Yes No operating condition? Is the fence stock-proof? (fences tight, barbed ✓ Yes ☐ No ✓ Yes ☐ No Yes No Yes No ☐ Yes ☐ No ✓ Yes ☐ No ☐ Yes ☐ No ☐ Yes ☐ No Yes No wire, fence clips in place? Is the pit liner in good operating condition? (no Yes No ☐ Yes ☐ No Yes No ✓ Yes ☐ No ✓ Yes ☐ No ✓ Yes ☐ No Yes No Yes No Yes No tears, up-rooting corners, etc.) Is the the location free from trash, oil stains and ☐ Yes ☐ No Yes No. ✓ Yes ☐ No ✓ Yes ☐ No ✓ Yes □ No ☐ Yes ☐ No. Yes No Yes No Yes No other materials? (cables, pipe threads, etc.) Does the pit contain two feet of free board? (check Yes No ✓ Yes ☐ No Yes No Yes No Yes No ☑ Yes ☐ No ✓ Yes ☐ No Yes No Yes No the water levels) Is there any standing water on the blow pit? Yes No Yes No ☐ Yes ☐ No ✓ Yes 🗀 No ☑ Yes ☐ No ✓ Yes □ No Yes No Yes No Yes No Are the pits free of trash and oil? Yes No ☐ Yes ☐ No ☐ Yes ☐ No ✓ Yes ☐ No ☑ Yes ☐ No ✓ Yes 🗌 No Yes No Yes No Yes No Are there diversion ditches around the pits for ☐ Yes ☐ No ☐ Yes ☐ No ☐ Yes ☐ No ☑ Yes ☐ No ☑ Yes ☐ No ✓ Yes ☐ No Yes No Yes No Yes No Inatural drainaae? Is the Manifold free of leaks? Are the hoses in ☑ Yes ☐ No ☑ Yes ☐ No ✓ Yes □ No Yes No Yes No ☐ Yes ☐ No ☐ Yes ☐ No Yes No Yes No good condition? △ Was the OCD contacted? Yes No Yes No ☐ Yes ☐ No Yes V No ☐ Yes ☑ No Yes V No Yes No Yes No Yes No Yes No ☐ Yes ☐ No Yes No Yes No Yes No ☐ Yes ✓ No ☐ Yes ☑ No Yes V No Yes No PICTURE TAKEN COMMENTS Main road need No repairs bladed contact Manfold needs Kındal Rig on loc Rig on loc Rig on loc pulled up TESTED PIT

WELL NAME: ConocoPhillips **OPEN PIT INSPECTION FORM** S.J. 30-6#101M INSPECTOR Fred Mtz 08/31/19 DATE 05/20/10 07/07/10 07/13/10 07/20/10 08/03/10 08/10/10 08/15/10 08/24/10 Week 7 Week 8 Week 9 Week 2 Week 3 Week 4 Week 5 Week 6 *Please request for pit extention after 26 weeks Week 1 ☑ Drilled ✓ Drilled ✓ Drilled √ Drilled ☑ Drilled ✓ Drilled ☑ Drilled ✓ Drilled ✓ Drilled Completed ✓ Completed ✓ Completed ✓ Completed Completed √ Completed ☑ Completed Completed Completed PIT STATUS Clean-Up Clean-Up Clean-Up Clean-Up Clean-Up Clean-Up Clean-Up Clean-Up Clean-Up Is the location marked with the proper flagging? Yes No ☐ Yes ☐ No ✓ Yes ☐ No ✓ Yes ☐ No ☑ Yes ☐ No ✓ Yes ☐ No ✓ Yes ☐ No Yes No. ✓ Yes ☐ No (Const. Zone, poles, pipelines, etc.) Is the temporary well sign on location and visible Yes No ✓ Yes No ✓ Yes 🗌 No ✓ Yes ☐ No ✓ Yes ☐ No ✓ Yes ☐ No Yes No ✓ Yes ☐ No ☐ Yes ☐ No from access road? Is the access road in good driving condition? ☐ Yes ☑ No ✓ Yes ☐ No ☑ Yes ☐ No Yes No Yes No Yes No ✓ Yes ☐ No ✓ Yes 🗌 No Yes 🗌 No (deep ruts, bladed) Are the culverts free from debris or any object ☑ Yes ☐ No Yes No ☐ Yes ☐ No Yes No ☑ Yes ☐ No ☑ Yes ☐ No ☑ Yes ☐ No ✓ Yes □ No Yes No preventing flow? Is the top of the location bladed and in good ☐ Yes ☐ No ☑ Yes ☐ No ✓ Yes ☐ No ✓ Yes ☐ No ☑ Yes ☐ No Yes No Yes No Yes No ✓ Yes ☐ No operating condition? Is the fence stock-proof? (fences tight, barbed ☐ Yes ☐ No. ✓ Yes ☐ No ✓ Yes ☐ No ✓ Yes ☐ No ✓ Yes ☐ No ☑ Yes ☐ No Yes No Yes No Yes No wire, fence clips in place? Is the pit liner in good operating condition? (no ✓ Yes ☐ No Yes No Yes No ☐ Yes ☐ No ✓ Yes ☐ No ✓ Yes ☐ No ✓ Yes ☐ No ✓ Yes ☐ No ☐ Yes ☐ No tears, up-rooting corners, etc.) is the the location free from trash, oil stains and ✓ Yes ☐ No ✓ Yes ☐ No ☐ Yes ☐ No ☑ Yes ☐ No ✓ Yes ☐ No. Yes No Yes No ☐ Yes ☐ No. ✓ Yes No other materials? (cables, pipe threads, etc.) Does the pit contain two feet of free board? (check ✓ Yes □ No ☐ Yes ☐ No ☐ Yes ☐ No. ☐ Yes ☐ No ☐ Yes ☐ No ✓ Yes ☐ No ☑ Yes ☐ No ✓ Yes ☐ No ✓ Yes ☐ No the water levels) is there any standing water on the blow pit? Yes No ☐ Yes ☐ No. Yes No ✓ Yes ☐ No ✓ Yes ☐ No ✓ Yes ☐ No ✓ Yes ☐ No ✓ Yes 🗌 No Yes No Are the pits free of trash and oil? ✓ Yes 🗆 No Yes No Yes No ☐ Yes ☐ No ☐ Yes ☐ No. ✓ Yes ☐ No. ✓ Yes ☐ No. Yes No ☑ Yes ☐ No Are there diversion ditches around the pits for ✓ Yes 🗌 No ☐ Yes ☐ No ✓ Yes ☐ No ✓ Yes ☐ No ✓ Yes ☐ No Yes No Yes No Yes No ✓ Yes \ \ No natural drainage? Is there a Manifold on location? ☐ Yes ☐ No ☐ Yes ☐ No Yes No Yes No Yes No Yes No ☐ Yes ☐ No ☐ Yes ☐ No Yes No Is the Manifold free of leaks? Are the hoses in ☐ Yes ☐ No ☐ Yes ☐ No Yes No ✓ Yes ☐ No ☑ Yes ☐ No ✓ Yes ☐ No ☑ Yes ☐ No ✓ Yes No Yes No good condition? ☐ Yes ✓ No ☐ Yes ✓ No Yes V No ☐ Yes ✓ No ☐ Yes 🗸 No Yes No △ Was the OCD contacted? Yes No Yes No Yes No ☐ Yes ☑ No ☐ Yes ✓ No ☐ Yes 🔽 No Yes V No Yes No Yes No Yes 🗸 No Yes 🗌 No Yes No PICTURE TAKEN No repairs COMMENTS No repairs Main road need contacted Manfold needs bladed contact acility rew to TESTED PIT Kındal lighten fence Beina reclaimed pulled up Ria on loc Rig on loc Rig on loc