District I

1625 N French Dr , Hobbs, NM 88240

District II

1301 W Grand Ave , Artesia, NM 88210

District III

1000 Rio Brazos Rd, Aztec, NM 87410

District IV

1220 S St Francis Dr , Santa Fe, NM 87505

Type of action:

State of New Mexico
Energy Minerals and Natural Resources

Department
Oil Conservation Division
1220 South St. Francis Dr.
Santa Fe, NM 87505

Form C-144
July 21, 2008

For temporary pits, closed-loop sytems, and below-grade tanks, submit to the appropriate NMOCD District Office

For permanent pits and exceptions submit to the Santa Fe Environmental Bureau office and provide a copy to the appropriate NMOCD District Office

Pit, Closed-Loop System, Below-Grade Tank, or Proposed Alternative Method Permit or Closure Plan Application

| 99b. | 1 |
|------|---|
| | |

Permit of a pit, closed-loop system, below-grade tank, or proposed alternative method

X Closure of a pit, closed-loop system, below-grade tank, or proposed alternative method

Modification to an existing permit

Closure plan only submitted for an existing permitted or non-permitted pit, closed-loop system, below-grade tank, or proposed alternative method

Instructions: Please submit one application (Form C-144) per individual pit, closed-loop system, below-grade tank or alternative request

Please be advised that approval of this request does not relieve the operator of liability should operations result in pollution of surface water, ground water or the environment. Nor does approval relieve the operator of its responsibility to comply with any other applicable governmental authority's rules, regulations or ordinances

| Operator Burlington Resources Oil & Gas Company, LP OGRID#: 14538 |
|--|
| Address: P.O. Box 4289, Farmington, NM 87499 |
| Facility or well name BLANCO COM A 6B |
| API Number OCD Permit Number |
| J/L or Qtr/Qtr J(NW/SE) Section: 36 Township 30N Range. 8W County. SAN JUAN |
| Center of Proposed Design. Latitude. 36.76646 °N Longitude. 107.62292 °W NAD 1927 X 1983 |
| Surface Owner: Federal X State Private Tribal Trust or Indian Allotment |
| X Pit: Subsection F or G of 19 15 17 11 NMAC |
| Closed-loop System: Subsection H of 19 15 17 11 NMAC Type of Operation P&A Drilling a new well Workover or Drilling (Applies to activities which require prior approval of a permit or notice of intent) Drying Pad Above Ground Steel Tanks Haul-off Bins Other Lined Unlined Liner type Thickness mil LLDPE HDPE PVD Other Eliner Seams Welded Factory Other RECEIVED |
| Below-grade tank: Subsection I of 19 15 17 11 NMAC Volume |
| Submittal of an exception request is required Exceptions must be submitted to the Santa Fe Environmental Bureau office for consideration of approval |

| Fencing: Subsection D of 19 15 17 11 NMAC (Applies to permanent pit, temporary pits, and below-grade tanks) Chain link, six feet in height, two strands of barbed wire at top (Required if located within 1000 feet of a permanent residence, school, hospital, institution of the light, four strands of barbed wire evenly spaced between one and four feet Alternate Please specify Netting: Subsection E of 19 15 17 11 NMAC (Applies to permanent pits and permanent open top tanks) | ution or church) |
|---|----------------------|
| Screen Netting Other Monthly inspections (If netting or screening is not physically feasible) | |
| Signs: Subsection C of 19 15 17 11 NMAC 12" X 24", 2" lettering, providing Operator's name, site location, and emergency telephone numbers X Signed in compliance with 19 15 3 103 NMAC | |
| Administrative Approvals and Exceptions: Justifications and/or demonstrations of equivalency are required Please refer to 19 15 17 NMAC for guidance Please check a box if one or more of the following is requested, if not leave blank: Administrative approval(s) Requests must be submitted to the appropriate division district of the Santa Fe Environmental Bureau office for consideration of approval Exception(s) Requests must be submitted to the Santa Fe Environmental Bureau office for consideration of approval | deration of approval |
| Siting Criteria (regarding permitting) 19 15.17.10 NMAC Instructions: The applicant must demonstrate compliance for each siting criteria below in the application. Recommendations of acceptable source material are provided below. Requests regarding changes to certain suing criteria may require administrative approval from the appropriate district office or may be considered an exception which must be submitted to the Santa Fe Environmental Bureau Office for consideration of approval. Applicant must attach justification for request. Please refer to 19.15.17.10 NMAC for guidance. Siting criteria does not apply to drying pads or above grade-tanks associated with a closed-loop system. | |
| Ground water is less than 50 feet below the bottom of the temporary pit, permanent pit, or below-grade tank. - NM Office of the State Engineer - 1WATERS database search, USGS; Data obtained from nearby wells | Yes No |
| Within 300 feet of a continuously flowing watercourse, or 200 feet of any other watercourse, lakebed, sinkhole, or playa lake (measured from the ordinary high-water mark). - Topographic map; Visual inspection (certification) of the proposed site | Yes No |
| Within 300 feet from a permanent residence, school, hospital, institution, or church in existence at the time of initial application. | Yes No |
| (Applies to temporary, emergency, or cavitation pits and below-grade tanks) - Visual inspection (certification) of the proposed site, Aerial photo; Satellite image | NA |
| Within 1000 feet from a permanent residence, school, hospital, institution, or church in existence at the time of initial application. (Applied to permanent pits) - Visual inspection (certification) of the proposed site; Aerial photo; Satellite image | Yes No |
| Within 500 horizonal feet of a private, domestic fresh water well or spring that less than five households use for domestic or stock watering purposes, or within 1000 horizontal feet of any other fresh water well or spring, in existence at the time of initial application. | Yes No |
| - NM Office of the State Engineer - 1WATERS database search; Visual inspection (certification) of the proposed site. | |
| Within incorporated municipal boundaries or within a defined municipal fresh water well field covered under a municipal ordinance adopted pursuant to NMSA 1978, Section 3-27-3, as amended - Written confirmation or verification from the municipality, Written approval obtained from the municipality | Yes No |
| Within 500 feet of a wetland. - US Fish and Wildlife Wetland Identification map; Topographic map; Visual inspection (certification) of the proposed site | Yes No |
| Within the area overlying a subsurface mine Written confirmation or verification or map from the NM EMNRD - Mining and Mineral Division | Yes No |
| Within an unstable area. - Engineering measures incorporated into the design; NM Bureau of Geology & Mineral Resources; USGS, NM Geological Society, Topographic map | Yes No |
| Within a 100-year floodplain - FEMA map | Yes No |

Form C-144 Oil Conservation Division Page 2 of 5

| Temporary Pits, Emergency Pits and Below-grade Tanks Permit Application Attachment ChecklistSubsection B of 19 15 17.9 NMAC |
|---|
| Instructions Each of the following items must be attached to the application Please indicate, by a check mark in the box, that the documents are attached |
| Hydrogeologic Report (Below-grade Tanks) - based upon the requirements of Paragraph (4) of Subsection B of 19 15 17 9 NMAC Hydrogeologic Report (Tomport and Empreon v. Puts) - based upon the requirements of Paragraph (2) of Subsection B of 19 15 17 9 |
| Hydrogeologic Data (Temporary and Emergency Pits) - based upon the requirements of Paragraph (2) of Subsection B of 19 15.17 9 |
| Siting Criteria Compliance Demonstrations - based upon the appropriate requirements of 19.15 17 10 NMAC |
| Design Plan - based upon the appropriate requirements of 19 15 17 11 NMAC |
| Operating and Maintenance Plan - based upon the appropriate requirements of 19.15 17 12 NMAC |
| Closure Plan (Please complete Boxes 14 through 18, if applicable) - based upon the appropriate requirements of Subsection C of 19 15 17 9 NMAC and 19 15 17 13 NMAC |
| Previously Approved Design (attach copy of design) API or Permit |
| |
| Closed-loop Systems Permit Application Attachment Checklist: Subsection B of 19 15 17 9 NMAC Instructions Each of the following items must be attached to the application Please indicate, by a check mark in the box, that the documents are attached Geologic and Hydrogeologic Data (only for on-site closure) - based upon the requirements of Paragraph (3) of Subsection B of 19 15 17 9 |
| Siting Criteria Compliance Demonstrations (only for on-site closure) - based upon the appropriate requirements of 19 15 17 10 NMAC |
| Design Plan - based upon the appropriate requirements of 19 15 17 11 NMAC |
| Operating and Maintenance Plan - based upon the appropriate requirements of 19 15 17 12 NMAC |
| Closure Plan (Please complete Boxes 14 through 18, if applicable) - based upon the appropriate requirements of Subsection C of 19 15 17 9 NMAC and 19 15 17 13 NMAC |
| Previously Approved Design (attach copy of design) API |
| Previously Approved Operating and Maintenance Plan API |
| |
| Permanent Pits Permit Application Checklist: Subsection B of 19 15 17 9 NMAC |
| Instructions: Each of the following items must be attached to the application. Please indicate, by a check mark in the box, that the documents are attached. |
| Hydrogeologic Report - based upon the requirements of Paragraph (I) of Subsection B of 19 15 17 9 NMAC |
| Siting Criteria Compliance Demonstrations - based upon the appropriate requirements of 19 15 17 10 NMAC |
| ☐ Climatological Factors Assessment |
| Certified Engineering Design Plans - based upon the appropriate requirements of 19 15.17 11 NMAC |
| Dike Protection and Structural Integrity Design based upon the appropriate requirements of 19.15.17 11 NMAC |
| Leak Detection Design - based upon the appropriate requirements of 19 15 17 11 NMAC |
| Liner Specifications and Compatibility Assessment - based upon the appropriate requirements of 19 15 17 11 NMAC Quality Control/Quality Assurance Construction and Installation Plan |
| Operating and Maintenance Plan - based upon the appropriate requirements of 19 15 17 12 NMAC |
| Freeboard and Overtopping Prevention Plan - based upon the appropriate requirements of 19 15 17 11 NMAC |
| Nuisance or Hazardous Odors, including H2S, Prevention Plan |
| Emergency Response Plan |
| Oil Field Waste Stream Characterization |
| Monitoring and Inspection Plan |
| Erosion Control Plan |
| Closure Plan - based upon the appropriate requirements of Subsection C of 19 15 17 9 NMAC and 19 15.17 13 NMAC |
| 14 Production of the state of t |
| Proposed Closure: 19 15 17 13 NMAC Instructions: Please complete the applicable boxes, Boxes 14 through 18, in regards to the proposed closure plan. |
| Type Drilling Workover Emergency Cavitation P&A Permanent Pit Below-grade Tank Closed-loop System Alternative |
| Proposed Closure Method Waste Excavation and Removal |
| Waste Removal (Closed-loop systems only) |
| On-site Closure Method (only for temporary pits and closed-loop systems) |
| In-place Burial On-site Trench |
| Alternative Closure Method (Exceptions must be submitted to the Santa Fe Environmental Bureau for consideration) |
| 15 |
| Waste Excavation and Removal Closure Plan Checklist (19 15 17 13 NMAC) Instructions: Each of the following items must be attached to the closure plan. Please indicate, by a check mark in the box, that the documents are attached. |
| Protocols and Procedures - based upon the appropriate requirements of 19 15 17 13 NMAC |
| Confirmation Sampling Plan (if applicable) - based upon the appropriate requirements of Subsection F of 19 15 17 13 NMAC |
| Disposal Facility Name and Permit Number (for liquids, drilling fluids and drill cuttings) |
| Soil Backfill and Cover Design Specifications - based upon the appropriate requirements of Subsection H of 19 15 17 13 NMAC |
| Re-vegetation Plan - based upon the appropriate requirements of Subsection I of 19.15 17 13 NMAC |
| Site Reclamation Plan - based upon the appropriate requirements of Subsection G of 19 15 17 13 NMAC |

Form C-144 Oil Conservation Division Page 3 of 5

| 16 | | | | | | |
|--|--|------------------------------|--|--|--|--|
| Waste Removal Closure For Closed-loop Systems That Utilize Abov Instructions Please identify the facility or facilities for the disposal of la facilities are required | e Ground Steel Tanks or Haul-off Bins Only:(19 15 17 13 D NMAC) quids, drilling fluids and drill cuttings Use attachment if more than two | 9 | | | | |
| Disposal Facility Name | Disposal Facility Permit # | | | | | |
| Disposal Facility Name | | | | | | |
| Will any of the proposed closed-loop system operations and assorting Yes (If yes, please provide the information No | ociated activities occur on or in areas that will nbe used for future | | | | | |
| Required for impacted areas which will not be used for future service an | nd operations n the appropriate requirements of Subsection H of 19 15 17 13 N nts of Subsection I of 19 15 17 13 NMAC | NMAC | | | | |
| 17 <u>Siting Criteria (Regarding on-site closure methods only:</u> 19 13 Instructions Each siting criteria requires a demonstration of compliance in the cocertain siting criteria may require administrative approval from the appropriate of office for consideration of approval Justifications and/or demonstrations of equi | losure plan Recommendations of acceptable source material are provided belov district office or may be considered an exception which must be submitted to the S | | | | | |
| Ground water is less than 50 feet below the bottom of the buried - NM Office of the State Engineer - iWATERS database search, US | | Yes No | | | | |
| - INTO OTHER OF THE STATE ENGINEER - INVITERS GARAGES SEATON, O. | Data obtained from hearby wells | ∐N/A | | | | |
| Ground water is between 50 and 100 feet below the bottom of th - NM Office of the State Engineer - iWATERS database search, US | | Yes No | | | | |
| | · | | | | | |
| Ground water is more than 100 feet below the bottom of the burn - NM Office of the State Engineer - iWATERS database search, US | | Yes No | | | | |
| Within 300 feet of a continuously flowing watercourse, or 200 feet of an | • | Yes No | | | | |
| (measured from the ordinary high-water mark) | | | | | | |
| - Topographic map, Visual inspection (certification) of the proposed | | | | | | |
| Within 300 feet from a permanent residence, school, hospital, institution - Visual inspection (certification) of the proposed site, Aerial photo, | •• | YesNo | | | | |
| Within 500 horizontal feet of a private, domestic fresh water well or sprii purposes, or within 1000 horizontal fee of any other fresh water well or - NM Office of the State Engineer - iWATERS database, Visual insp | spring, in existence at the time of the initial application | Yes No | | | | |
| Within incorporated municipal boundaries or within a defined municipal pursuant to NMSA 1978, Section 3-27-3, as amended | , , , , , , , , , , , , , , , , , , , | Yes No | | | | |
| Written confirmation or verification from the municipality, Writte Within 500 feet of a wetland | n approval obtained from the municipality | ∏Yes ∏No | | | | |
| - US Fish and Wildlife Wetland Identification map, Topographic in | ap, Visual inspection (certification) of the proposed site | | | | | |
| Within the area overlying a subsurface mine | | Yes No | | | | |
| - Written confirantion or verification or map from the NM EMNRD | -Mining and Mineral Division | | | | | |
| Within an unstable area - Engineering measures incorporated into the design, NM Bureau of | Geology & Mineral Resources, USGS, NM Geological Society. | Yes No | | | | |
| Fopographic map Within a 100-year floodplam - FEMA map | | Yes No | | | | |
| On-Site Closure Plan Checklist: (19 15 17 13 NMAC) Instruction by a check mark in the box, that the documents are attached. | ctions: Each of the following items must bee attached to the cl | osure plan. Please indicate, | | | | |
| Siting Criteria Compliance Demonstrations - based upon | the appropriate requirements of 19.15 17 10 NMAC | | | | | |
| Proof of Surface Owner Notice - based upon the appropri | | | | | | |
| |) based upon the appropriate requirements of 19 15 17 11 NMAG | C | | | | |
| | burial of a drying pad) - based upon the appropriate requirement | | | | | |
| Protocols and Procedures - based upon the appropriate re | | - | | | | |
| | the appropriate requirements of Subsection F of 19 15 17 13 NM | ИAC | | | | |
| Waste Material Sampling Plan - based upon the appropria | | | | | | |
| | drilling fluids and drill cuttings or in case on-site closure standar | ds cannot be achieved) | | | | |
| Soil Cover Design - based upon the appropriate requirem | ents of Subsection H of 19 15 17 13 NMAC | -7 | | | | |
| Re-vegetation Plan - based upon the appropriate requirements of Subsection I of 19 15 17 13 NMAC Site Reclamation Plan - based upon the appropriate requirements of Subsection G of 19 15 17 13 NMAC | | | | | | |

| 19 Operator Application Certification: |
|--|
| I hereby certify that the information submitted with this application is true, accurate and complete to the best of my knowledge and belief |
| Name (Print) Title |
| Signature Date |
| e-mail address Telephone |
| OCD Approval: Permit Application (including closure plan) Closure Plan-(only)- OCD Conditions (see attachment) OCD Representative Signature: Approval Date: 8/25/2011 Title: OCD Permit Number: |
| CONTINUE OF THE CONTINUE OF TH |
| Closure Report (required within 60 days of closure completion): Subsection K of 19 15 17 13 NMAC Instructions Operators are required to obtain an approved closure plan prior to implementing any closure activities and submitting the closure report. The closure report is required to be submitted to the division within 60 days of the completion of the closure activities. Please do not complete this section of the form until an approved closure plan has been obtained and the closure activities have been completed. X Closure Completion Date: June 29, 2011 |
| |
| Closure Method: Waste Excavation and Removal X On-site Closure Method Alternative Closure Method Waste Removal (Closed-loop systems only) If different from approved plan, please explain |
| Closure Report Regarding Waste Removal Closure For Closed-loop Systems That Utilize Above Ground Steel Tanks or Haul-off Bins Only: Instructions: Please identify the facility or facilities for where the liquids, drilling fluids and drill cuttings were disposed. Use attachment if more than two facilities were utilized. Disposal Facility Name Disposal Facility Permit Number Were the closed-loop system operations and associated activities performed on or in areas that will not be used for future service and operations? Yes (If yes, please demonstrate compliant to the items below) No Required for impacted areas which will not be used for future service and operations Site Reclamation (Photo Documentation) Soil Backfilling and Cover Installation Re-vegetation Application Rates and Seeding Technique 24 Closure Report Attachment Checklist: Instructions: Each of the following items must be attached to the closure report. Please indicate, by a check mark in the box, that the documents are attached. X Proof of Closure Notice (surface owner and division) |
| X Proof of Deed Notice (required for on-site closure) X Plot Plan (for on-site closures and temporary pits) X Confirmation Sampling Analytical Results (if applicable) Waste Material Sampling Analytical Results (if applicable) X Disposal Facility Name and Permit Number X Soil Backfilling and Cover Installation X Re-vegetation Application Rates and Seeding Technique X Site Reclamation (Photo Documentation) On-site Closure Location Latitude |
| 25 |
| Operator Closure Certification: I hereby certify that the information and attachments submitted with this closure report is ture, accurate and complete to the best of my knowledge and belief. I also certify that the closure complies with all applicable closure requirements and conditions specified in the approved closure plan. |
| Name (Print) Signature Signature Jamie Goødwin Title Regulatory Tech Signature |
| a mail address: Talanhana 505 226 0784 |

Burlington Resources Oil Gas Company, LP San Juan Basin Closure Report

Lease Name: BLANCO COM A 6B

API No.: 30-045-35088

In accordance with Rule 19.15.17.13 NMAC the following information describes the closure of the temporary pit referenced above. All proper documentation regarding closure activities is being included with the C-144. The temporary pit for this location was constructed and location drilled before June 16, 2008 (effective date for Rule 19.15.17). While closure of the temporary pit did fall within the rule some dates for submittals are after the rig release date.

- Details on Capping and Covering, where applicable. (See report)
- Plot Plan (Pit Diagram) (Included as an attachment)
- Inspection Reports (Included as an attachment)
- Sampling Results (Included as an attachment)
- C-105 (Included as an attachment)
- Copy of Deed Notice will be filed with County Clerk (Not required on Federal, State, or Tribal land as stated by FAQ dated October 30, 2008)

General Plan:

1. All free standing liquids will be removed at the start of the pit closure process from the pit and disposed of in a division—approved facility or recycle, reuse or reclaim the liquids in a manner that the appropriate division district office approves.

All recovered liquids were disposed of at Basin Disposal (Permit #NM-01-005) and any sludge or soil required to be removed to facilitate closure was hauled to Envirotech Land Farm (Permit #NM-01-011) and JFJ Landfarm % IEI (Permit #NM-01-0010B).

2. The preferred method of closure for all temporary pits will be on-site burial, assuming that all the criteria listed in sub-section (B) of 19.15.17.13 are met.

The pit was closed using onsite burial.

3. The surface owner shall be notified of BR's closing of the temporary pit as per the approved closure plan using certified mail, return receipt requested.

The closure process notification to the landowner was sent via permit submittal. (See Attached)(Well located on State Land, certified mail is not required for Federal Land per BLM/OCD MOU.)

4. Within 6 months of the Rig Off status occurring BR will ensure that temporary pits are closed, re-contoured, and reseeded.

Provision 4 of the closure plan requirements were not met due to rig move off date as noted on C-105 which was prior to pit rule change. Burlington will ensure compliance with this rule in the future.

- 5. Notice of Closure will be given to the Aztec Division office between 72 hours and one week of closure via email, or verbally. The notification of closure will include the following:
 - i. Operator's name
 - ii. Location by Unit Letter, Section, Township, and Range. Well name and API number.

Notification is attached.

6. Liner of temporary pit shall be removed above "mud level" after stabilization. Removal of liner will consist of manually or mechanically cutting liner at mud level and removing all remaining liner. Care will be taken to remove "All" of the liner i.e., edges of liner entrenched or buried. All excessive liner will be disposed of at a licensed disposal facility.

Liner of temporary pit was removed above "mud level" after stabilization. Removal of the liner consisted of manually cutting liner at mud level and removing all remaining liner. Care was taken to remove "ALL" of the liner i.e., edges of liner entrenched or buried. All excessive liner was disposed of at a licensed disposal facility, (San Juan County Landfill).

7. Pit contents shall be mixed with non-waste containing, earthen material in order to achieve the solidification process. The solidification process will be accomplished using a combination of natural drying and mechanically mixing. Pit contents will be mixed with non-waste, earthen material to a consistency that is deemed a safe and stable. The mixing ratio shall not exceed 3 parts clean soil to 1 part pit contents.

Burlington mixed the Pit contents with non-waste containing, earthen material in order to achieve the solidification process. The solidification process was accomplished by using a combination of natural drying and mechanically mixing. Pit contents were mixed with non-waste, earthen material to a consistency that is deemed as safe and stable. The mixing ratio consisted of approximately 3 parts clean soil to 1 part pit contents.

8. A five point composite sample will be taken of the pit using sampling tools and all samples tested per Subsection B of 19.15.17.13(B)(1)(b). In the event that the criteria are not met, all contents will be handled per Subparagraph (a) of Paragraph (1) of Subsection B of 19.15.17.13 i.e., Dig and haul.

A five point composite sample was taken of the pit using sampling tools and all samples tested per Subsection B of 19.15.17.1 3(B)(1)(b). (Sample results attached).

| Components | Tests Method | Limit (mg/Kg) | Results |
|------------|---------------------------|---------------|------------|
| Benzene | EPA SW-846 8021B or 8260B | 0.2 | ND ug/kg |
| BTEX | EPA SW-846 8021B or 8260B | 50 | 10.0 ug/kG |
| TPH | EPA SW-846 418.1 | 2500 | 69.7mg/kg |
| GRO/DRO | EPA SW-846 8015M | 500 | 4.0 mg/Kg |
| Chlorides | EPA 300.1 | 1000/500 | 150 mg/L |

9. Upon completion of solidification and testing standards being passed, the pit area will be backfilled with compacted, non-waste containing, earthen material. A minimum of four feet of cover shall be achieved and the cover shall include one foot of suitable material to establish vegetation at the site, or the background thickness of topsoil, whichever is greater. If standard testing fails BR will dig and haul all contents pursuant to 19.15.17.13.i.a. After doing such, confirmation sampling will be conducted to ensure a release has not occurred.

The pit material passed solidification and testing standards. The pit area was then backfilled with compacted, non-waste containing, earthen material. More than four feet of cover was achieved and the cover included one foot of suitable material to establish vegetation at the site.

10. During the stabilization process if the liner is ripped by equipment the Aztec OCD office will be notified within 48 hours and the liner will be repaired if possible. If the liner can not be repaired then all contents will be excavated and removed.

The integrity of the liner was not damaged in the pit closure process.

11. Dig and Haul Material will be transported to the Envirotech Land Farm located 16 miles south of Bloomfield on Angel Peak Road, CR 7175. Permit # NM010011

Dig and Haul was not required.

12. Re-contouring of location will match fit, shape, line, form and texture of the surrounding. Re-shaping will include drainage control, prevent ponding, and prevent erosion. Natural drainages will be unimpeded and water bars and/or silt traps will be place in areas where needed to prevent erosion on a large scale. Final recontour shall have a uniform appearance with smooth surface, fitting the natural landscape.

The pit area was re-contoured to match fit, shape, line, form and texture of the surrounding area. Re-shaping included drainage control, to prevent ponding and erosion. Natural drainages were unimpeded and water bars and/or silt traps were placed in areas where needed to prevent erosion on a large scale. Final re-contour has a uniform appearance with smooth surface, fitting the natural landscape.

13. Notification will be sent to OCD when the reclaimed area is seeded.

Provision 13 was accomplished on 7/14/2011 with the following seeding regiment:

| Туре | Variety or Cultivator | PLS/A |
|--------------------------|--------------------------|-------|
| · Western wheatgrass | Arriba | 3.0 |
| Indian ricegrass | Paloma or Rimrock | 3.0 |
| Slender wheatgrass | San Luis | 2.0 |
| Crested wheatgrass | Hy-crest | 3.0 |
| Bottlebrush Squirreltail | Unknown | 2.0 |
| Four-wing Saltbrush | Delar | .25 |

14. BR shall seed the disturbed areas the first growing season after the operator closes the pit. Seeding will be accomplished via drilling on the contour whenever practical or by other division-approved methods. BLM or Forest Service stipulated seed mixes will used on federal lands. Vegetative cover will equal 70% of the native perennial vegetative cover (un-impacted) consisting of at least three native plant species, including at least one grass, but not including noxious weeds, and maintain that cover through two successive growing seasons. Repeat seeding or planting will be continued until successful vegetative growth occurs.

Provision 14 was accomplished on 7/14/2011 with the above seeding regiment. Seeing was accomplished via drilling on the contour whenever practical or by other division-approved methods. The OCD will be notified once two successive growing seasons have been accomplished by submitting a C-103.

15. The temporary pit will be located with a steel marker, no less than four inches in diameter, cemented in a hole three feet deep in the center of the onsite burial upon the abandonment of all the wells on the pad. The marker will be flush with the ground to allow access of the active well pad and for safety concerns. The marker will include a threaded collar to be used for future abandonment. The top of the marker will contain a welded steel 12" square plate that indicates the onsite burial of the temporary pit. The plate will be easily removable and a four foot tall riser will be threaded into the top of the collar marker and welded around the base with the operator's information at the time of all wells on the pad are abandoned. The operator's information will include the following: Operator Name, Lease Name, Well Name and number, Unit Number, Section, Township, Range and an indicator that the marker is an onsite burial location.

Provision 15 was accomplished by installing a steel marker in the temporary pit, no less than four inches in diameter, cemented in a hole three feet deep in the center of the onsite burial. The marker is flush with the ground to allow access of the active well pad and for safety concerns. The top of the marker contains a welded steel 12" square plate that indicates the onsite burial of the temporary pit. The plate contains the following: Operator Name, Lease Name, Well Name and number, Unit Number, Section, Township, Range and an indicator that the marker is an onsite burial location.

The plate will be easily removable and a four foot tall riser will be threaded into the top of the collar marker and welded around the base with the following operator's information at the time of all wells on the pad are abandoned. The riser will be labeled: BR, State, BLANCO COM A 6B, UL-J, Sec. 36, T 30N, R 8W, API # 30-035088

DISTRICT I 1625 N. French Dr., Hobbs, N.M. 88240

State of New Mexico Energy, Minerals & Natural Resources Department

Form C-102 Revised October 12, 2005

DISTRICT II 1301 W. Grand Avenue, Artesia, N.M. 88210

DISTRICT III
1000 Rio Brazos Rd., Aztec, N.M. 87410

OIL CONSERVATION DIVISION 1220 South St. Francis Dr. Santa Fe, NM 87505 Submit to Appropriate District Office State Lease - 4 Copies Fee Lease - 3 Copies

☐ AMENDED REPORT

DISTRICT IV 1220 S. St. Francis Dr., Santa Fe, NM 87506

WELL LOCATION AND ACREAGE DEDICATION PLAT

| ¹ API Number | Pool Code | ⁸ Pool Name | |
|-------------------------|-----------------------|------------------------|------------------------|
| | | BLANCO MESAVERDE / BA | SIN DAKOTA |
| Property Code | Property | y Name | * Well Number |
| | BLANCO | COM A | 6 B |
| OGRID No. | ⁸ Operator | Name | ^o Elevation |
| | BURLINGTON RESOURCES | OIL & GAS COMPANY LP | 6064' |


¹⁰ Surface Location

| UL or lot no. | Section | Township | Range | Lot Idn | Feet from the | North/South line | Feet from the | East/West line | County |
|---------------|---------|----------|-------|---------|---------------|------------------|---------------|----------------|----------|
| J | 36 | 30N | 8W | _ | 1889' | SOUTH | 1357' | EAST | SAN JUAN |

¹¹ Bottom Hole Location If Different From Surface

| | | | ם סינט | offi Hote | TOCACIOII I | Difference Lie | Mir Duriace | | |
|----------------|---------|----------|-------------|-----------|-------------------------------|------------------|---------------|----------------|----------|
| UL or lot no. | Section | Township | Range | Lot Idn | Feet from the | North/South line | Feet from the | East/West line | County |
| J | 36 | 30N | 8W | | 2300' | SOUTH | 1815' | EAST | SAN JUAN |
| Dedicated Acre | 9 | | 28 Joint or | Infill | ¹⁴ Consolidation C | ode | 15 Order No. | | |
| 320.00 AC | RES - | E/2 | | | | | | | |

NO ALLOWABLE WILL BE ASSIGNED TO THIS COMPLETION UNTIL ALL INTERESTS HAVE BEEN CONSOLIDATED OR A NON-STANDARD UNIT HAS BEEN APPROVED BY THE DIVISION

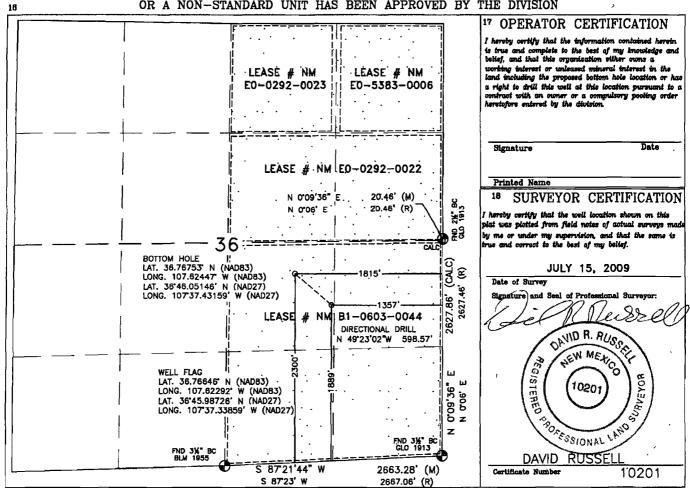

WELL FLAG

LATITUDE 36 76646° N LONGITUDE: 107 62292° W

CENTER OF PIT

LATITUDE: 36 76658° N LONGITUDE: 107 62270° W

ELEVATION 6053 7' DATUM NAD83 & NAVD88

BURLINGTON RESOURCES OIL & GAS COMPANY LP

BLANCO COM A #6 B 1889' FSL & 1357' FEL


LOCATED IN THE NW/4 SE/4 OF SECTION 36,

T30N, R8W, N.M P.M,

SAN JUAN COUNTY, NEW MEXICO GROUND ELEVATION, 6064', NAVD 88

FINISHED PAD ELEVATION. 6065.7', NAVD 88

30' 0 30' 60'

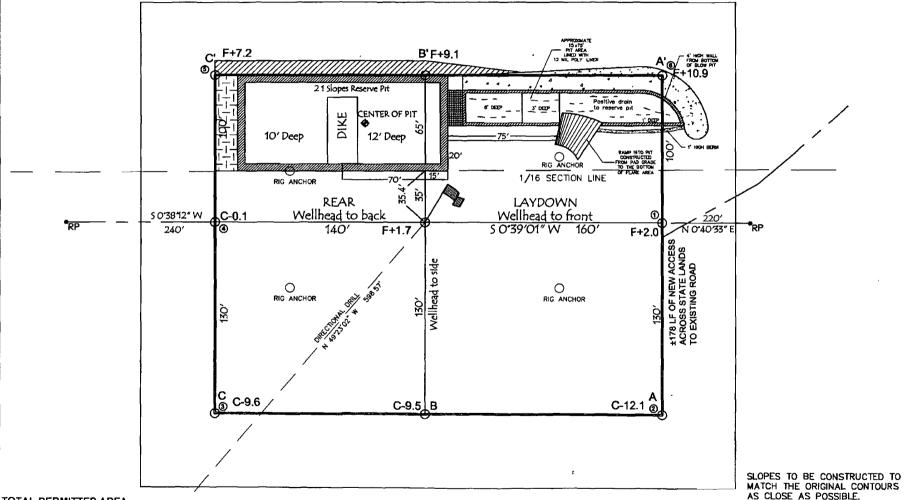

TOTAL PERMITTED AREA 330' x 400' = 3.03 ACRES

SCALE. 1" = 60' JOB No.: COPC331 DATE: 07/20/09 DRAWN BY: TWT NOTE:

RESERVE PIT DIKE: TO BE 8' ABOVE DEEP SIDE (OVERFLOW — 3' WIDE AND 1' ABOVE SHALLOW SIDE).

RUSSELL SURVEYING, INC. IS NOT LIABLE FOR UNDERGROUND UTILITIES OR PIPELINES.

CONTRACTOR SHOULD CALL ONE—CALL FOR LOCATION OF ANY MARKED OR UNMARKED, BURIED PIPELINES OR CABLES ON WELL PAD, IN CONSTRUCTION ZONE AND/OR ACCESS ROAD AT LEAST TWO (2) WORKING DAYS PRIOR TO CONSTRUCTION.



Russell Surveying 1409 W. Aztec Blvd. #2 Aztec, New Mexico 87410 (505) 334-8637



EPA METHOD 8015 Modified Nonhalogenated Volatile Organics Total Petroleum Hydrocarbons

| Client: | ConocoPhillips | Project #: | 96052-1706 |
|----------------------|----------------|---------------------|------------|
| Sample ID: | Back Ground | Date Reported: | 05-26-11 |
| Laboratory Number: | 58298 | Sampled: | 05-25-11 |
| Chain of Custody No: | 11645 | Date Received: | 05-25-11 |
| Sample Matrix: | Soil | Date Extracted: | 05-25-11 |
| Preservative: | Cool | Date Analyzed: | 05-26-11 |
| Condition: | Intact | Analysis Requested: | 8015 TPH |

| Parameter | Concentration (mg/Kg) | Det. Limit (mg/Kg) |
|------------------------------|--------------------------|--------------------------|
| Gasoline Range (C5 - C10) | ND | 0.2 |
| Diesel Range (C10 - C28) | ND | 0.1 |
| Total Petroleum Hydrocarbons | ND | |

ND - Parameter not detected at the stated detection limit.

References:

Method 8015B, Nonhalogenated Volatile Organics, Test Methods for Evaluating Solid

Waste, SW-846, USEPA, December 1996.

Comments:

Blanco Com A #6B

Anatyst



EPA METHOD 8015 Modified Nonhalogenated Volatile Organics Total Petroleum Hydrocarbons

| Client: | ConocoPhillips | Project #: | 96052-1706 |
|----------------------|----------------|---------------------|------------|
| Sample ID: | Reserve Pit | Date Reported: | 05-26-11 |
| Laboratory Number: | 58299 | Sampled: | 05-25-11 |
| Chain of Custody No: | 11645 | Date Received: | 05-25-11 |
| Sample Matrix: | Soil | Date Extracted: | 05-25-11 |
| Preservative: | Cool | Date Analyzed: | 05-26-11 |
| Condition: | Intact | Analysis Requested: | 8015 TPH |

| Parameter | Concentration (mg/Kg) | Det. Limit (mg/Kg) |
|------------------------------|--------------------------|--------------------------|
| Gasoline Range (C5 - C10) | ND | 0.2 |
| Diesel Range (C10 - C28) | 4.0 | 0.1 |
| Total Petroleum Hydrocarbons | 4.0 | |

ND - Parameter not detected at the stated detection limit.

References:

Method 8015B, Nonhalogenated Volatile Organics, Test Methods for Evaluating Solid

Waste, SW-846, USEPA, December 1996.

Comments:

Blanco Com A #6B

Analyst



EPA Method 8015 Modified Nonhalogenated Volatile Organics Total Petroleum Hydrocarbons

Quality Assurance Report

| Client: | QA/QC | Project #: | N/A |
|--------------------|--------------------|---------------------|----------|
| Sample ID: | 05-26-11 QA/QC | Date Reported: | 05-26-11 |
| Laboratory Number: | 58298 | Date Sampled: | N/A |
| Sample Matrix: | Methylene Chloride | Date Received: | N/A |
| Preservative: , | N/A | Date Analyzed: | 05-26-11 |
| Condition: | N/A | Analysis Requested: | TPH |

| | I-Cal Date | I-Cal RF: | C-Cal RF: | % Difference | Accept. Range |
|-------------------------|------------|-----------|-----------|--------------|---------------|
| Gasoline Range C5 - C10 | 05/26/11 | 9.996E+02 | 1.000E+03 | 0.04% | 0 - 15% |
| Diesel Range C10 - C28 | 05/26/11 | 9.996E+02 | 1.000E+03 | 0.04% | 0 - 15% |

| Blank Conc. (mg/L - mg/Kg) | Concentration | Detection Limit |
|----------------------------|---------------|-----------------|
| Gasoline Range C5 - C10 | 5.3 | 0.2 |
| Diesel Range C10 - C28 | 2.1 | 0.1 |

| Duplicate Conc. (mg/Kg) | Sample | Duplicate | % Difference | Range |
|-------------------------|--------|-----------|--------------|---------|
| Gasoline Range C5 - C10 | ND | ND | 0.00% | 0 - 30% |
| Diesel Range C10 - C28 | ND | ND | 0.00% | 0 - 30% |

| Spike Conc. (mg/Kg) | Sample | Spike Added | Spike Result | % Recovery | Accept: Range |
|-------------------------|--------|-------------|--------------|------------|---------------|
| Gasoline Range C5 - C10 | ND | 250 | 246 | 98.2% | 75 - 125% |
| Diesel Range C10 - C28 | ND | 250 | 245 | 98.1% | 75 - 125% |

ND - Parameter not detected at the stated detection limit.

References:

Method 8015B, Nonhalogenated Volatile Organics, Test Methods for Evaluating Solid

Waste,

SW-846, USEPA, December 1996.

Comments:

QA/QC for Samples 58298-58308



EPA METHOD 8021 AROMATIC VOLATILE ORGANICS

| Client: | ConocoPhillips | Project #: | 96052-1706 |
|--------------------|----------------|---------------------|------------|
| Sample ID: | Back Ground | Date Reported: | 05-26-11 |
| Laboratory Number: | 58298 | Date Sampled: | 05-25-11 |
| Chain of Custody: | 11645 | Date Received: | 05-25-11 |
| Sample Matrix: | Soil | Date Analyzed: | 05-26-11 |
| Preservative: | Cool | Date Extracted: | 05-25-11 |
| Condition: | Intact | Analysis Requested: | BTEX |
| | | Dilution: | 10 |

| | | Det. | |
|-----------|---------------|---------|---|
| | Concentration | Limit | |
| Parameter | (ug/Kg) | (ug/Kg) | |
| | | | _ |

| Benzene | ND | 0.9 |
|--------------|-----|-----|
| Toluene | ND | 1.0 |
| Ethylbenzene | ND | 1.0 |
| p,m-Xylene | 2.1 | 1.2 |
| o-Xylene | ND | 0.9 |
| | | |

Total BTEX 2.1

ND - Parameter not detected at the stated detection limit.

| Surrogate Recoveries: | Parameter | Percent Recovery |
|-----------------------|---------------------|------------------|
| | Fluorobenzene | 92.7 % |
| | 1,4-difluorobenzene | 98.6 % |
| | Bromochlorobenzene | 96.6 % |

References:

Method 5030B, Purge-and-Trap, Test Methods for Evaluating Solid Waste, SW-846, USEPA,

December 1996.

Method 8021B, Aromatic Volatile Organics, Test Methods for Evaluating Solid Waste, SW-846,

USEPA, December 1996.

Comments:

Blanco Com A #6B

Analyst



EPA METHOD 8021 AROMATIC VOLATILE ORGANICS

| Client: | ConocoPhillips | Project #: | 96052-1706 |
|--------------------|----------------|---------------------|------------|
| Sample ID: | Reserve Pit | Date Reported: | 05-26-11 |
| Laboratory Number: | 58299 | Date Sampled: | 05-25-11 |
| Chain of Custody: | 11645 | Date Received: | 05-25-11 |
| Sample Matrix: | Soil | Date Analyzed: | 05-26-11 |
| Preservative: | Cool | Date Extracted: | 05-25-11 |
| Condition: | Intact | Analysis Requested: | BTEX |
| | | Dilution: | 10 |

| Parameter | Concentration (ug/Kg) | Det. Limit (ug/Kg) | |
|--------------|--------------------------|--------------------------|--|
| Benzene | ND | 0.0 | |
| Toluene | ND ND | 0.9 1.0 | |
| Ethylbenzene | ND | 1.0 | |
| p,m-Xylene | 5.5 | 1.2 | |
| o-Xylene | 4.6 | 0.9 | |
| Total BTEX | 10.0 | | |

ND - Parameter not detected at the stated detection limit.

| Surrogate Recoveries: | Parameter | Percent Recovery |
|-----------------------|---------------------|------------------|
| | Fluorobenzene | 100 % |
| | 1,4-difluorobenzene | 105 % |
| | Bromochlorobenzene | 102 % |

References:

Method 5030B, Purge-and-Trap, Test Methods for Evaluating Solid Waste, SW-846, USEPA,

December 1996.

Method 8021B, Aromatic Volatile Organics, Test Methods for Evaluating Solid Waste, SW-846,

USEPA, December 1996.

Comments:

Blanco Com A #6B



EPA METHOD 8021 AROMATIC VOLATILE ORGANICS

| Client: | N/A | | Project #: | N/A | | | |
|-------------------------|--|-------------|----------------|-------|----------|--|--|
| Sample ID: | 0526BBLK QA/Q0 | ; | Date Reported: | | 05-26-11 | | |
| Laboratory Number: | 58298 | | Date Sampled: | | N/A | | |
| Sample Matrix: | Soil | | Date Received: | | N/A | | |
| Preservative: | N/A | | Date Analyzed: | | 05-26-11 | | |
| Condition: | N/A | Analysis: | | | BTEX | | |
| | | | Dilution: | | 10 | | |
| Calibration, and | I-Cal RF: | C-Cal RF: | %Diff. | Blank | Detect. | | |
| Detection Limits (ug/L) | ر این در این از این است. در این در این از این است. است. این | Accept. Ra | nge 0 - 15% | Conc | Limit | | |
| Benzene | 3.5967E+006 | 3.6039E+006 | 0.2% | ND | 0.1 | | |
| Toluene | 3.7945E+006 | 3.8021E+006 | 0.2% | ND | 0.1 | | |
| Ethylbenzene | 3.3127E+006 | 3.3193E+008 | 0.2% | ND | 0.1 | | |
| p,m-Xylene | 9.0743E+006 | 9.0925E+006 | 0.2% | ND | 0.1 | | |
| p) >1) 10110 | | | 0.2% | ND | 0.1 | | |

| Duplicate Conc. (ug/Kg) | Sample Du | olicate : | %Diff. | Accept Range | Detect. Limit |
|-------------------------|-----------|-----------|--------|--------------|---------------|
| Benzene | ND | ND | 0.0% | 0 - 30% | 0.9 |
| Toluene | ND | ND | 0.0% | 0 - 30% | 1.0 |
| Ethylbenzene | ND | ND | 0.0% | 0 - 30% | 1.0 |
| p,m-Xylene | 2.1 | 1.8 | 14.3% | 0 - 30% | 1.2 |
| o-Xylene | ND | ND | 0.0% | 0 - 30% | 0.9 |

| Sample Amo | unt Spiked Spil | ked Sample % | Recovery | Accept Range | | |
|------------|-----------------------|--|--|---|--|--|
| ND | 500 | 494 | 98.9% | 39 - 150 | | |
| ND | 500 | 504 | 101% | 46 - 148 | | |
| ND | 500 | 506 | 101% | 32 - 160 | | |
| 2.1 | 1000 | 1,000 | 99.8% | 46 - 148 | | |
| ND | 500 | 506 | 101% | 46 - 148 | | |
| | ND ND ND 2.1 | ND 500 ND 500 ND 500 2.1 1000 | ND 500 494 ND 500 504 ND 500 506 2.1 1000 1,000 | ND 500 494 98.9% ND 500 504 101% ND 500 506 101% 2.1 1000 1,000 99.8% | | |

ND - Parameter not detected at the stated detection limit.

Dilution: Spike and spiked sample concentration represent a dilution proportional to sample dilution.

References:

Method 5030B, Purge-and-Trap, Test Methods for Evaluating Solid Waste, SW-846, USEPA,

December 1996.

Method 8021B, Aromatic and Halogenated Volatiles by Gas Chromatography Using Photoionization and/or Electrolytic Conductivity Detectors, SW-846, USEPA December 1996.

Comments:

QA/QC for Samples 58298-58307



EPA METHOD 418.1 TOTAL PETROLEUM HYDROCARBONS

| Client: | ConocoPhillips | Project #: | 96052-1706 |
|----------------------|----------------|------------------|------------|
| Sample ID: | Back Ground | Date Reported: | 05/26/11 |
| Laboratory Number: | 58298 | Date Sampled: | 05/25/11 |
| Chain of Custody No: | 11645 | Date Received: | 05/25/11 |
| Sample Matrix: | Soil | Date Extracted: | 05/26/11 |
| Preservative: | Cool | Date Analyzed: | 05/26/11 |
| Condition: | Intact | Analysis Needed: | TPH-418.1 |

| | | Det. |
|-----------|---------------|---------|
| | Concentration | Limit |
| Parameter | (mg/kg) | (mg/kg) |

Total Petroleum Hydrocarbons

33.6

19.4

ND = Parameter not detected at the stated detection limit.

References:

Method 418.1, Petroleum Hydrocarbons, Total Recoverable, Chemical Analysis of Water

and Waste, USEPA Storet No. 4551, 1978.

Comments: Blanco Com A #6B

Review

5796 US Highway 64, Farmington, NM 87401

Ph (505) 632-0615 Fr (800) 362-1879 Fx (505) 632-1865 lab@envirotech-inc.com envirotech-inc.com



EPA METHOD 418.1 TOTAL PETROLEUM HYDROCARBONS

| Client: | ConocoPhillips | Project #: | 96052-1706 |
|----------------------|----------------|------------------|------------|
| Sample ID: | Reserve Pit | Date Reported: | 05/26/11 |
| Laboratory Number: | 58299 | Date Sampled: | 05/25/11 |
| Chain of Custody No: | 11645 | Date Received: | 05/25/11 |
| Sample Matrix: | Soil | Date Extracted: | 05/26/11 |
| Preservative: | Cool | Date Analyzed: | 05/26/11 |
| Condition: | Intact | Analysis Needed: | TPH-418.1 |

| , | | Det. |
|-----------|---------------|---------|
| | Concentration | Limit |
| Parameter | (mg/kg) | (mg/kg) |

Total Petroleum Hydrocarbons

69.7

19.4

ND = Parameter not detected at the stated detection limit.

References:

Method 418.1, Petroleum Hydrocarbons, Total Recoverable, Chemical Analysis of Water

and Waste, USEPA Storet No. 4551, 1978.

Comments:

Blanco Com A #6B

Review

5796 US Highway 64, Farmington, NM 87401

Ph (505) 632-0615 Fr (800) 362-1879 Fx (505) 632-1865 lab@envirotech-inc.com envirotech-inc.com



EPA METHOD 418.1 TOTAL PETROLEUM HYDROCARBONS **QUALITY ASSURANCE REPORT**

Client:

QA/QC

Project #:

N/A

Sample ID:

QA/QC

Date Reported:

05/26/11

Laboratory Number:

05-26-TPH.QA/QC 58297

Date Sampled:

N/A

Sample Matrix: Preservative:

Freon-113

Date Analyzed:

05/26/11

Condition:

N/A N/A

Date Extracted: Analysis Needed: 05/26/11 TPH

Calibration

I-Cal Date 05/09/11 C-Cal Date

I-Cal RF:

1.8%

C-Cal RF: % Difference Accept. Range

05/26/11

1,610

1,640

+/- 10%

Blank Conc. (mg/Kg)

Detection Limit

TPH

TPH

TPH

Concentration ND

19.4

Duplicate Conc. (mg/Kg)

Sample 394

Duplicate 452

% Difference 14.8%

Accept. Range +/- 30%

Spike Conc. (mg/Kg)

Sample 394

Spike Added Spike Result % Recovery 2,000

2,520

105%

Accept Range 80 - 120%

ND = Parameter not detected at the stated detection limit.

References:

Method 418.1, Petroleum Hydrocarbons, Total Recoverable, Chemical Analysis of Water

and Waste, USEPA Storet No. 4551, 1978.

Comments:

QA/QC for Samples 58297-58305



Chloride

20

ConocoPhillips Client: Project #: 96052-1706 Sample ID: **Back Ground** Date Reported: 05/26/11 Lab ID#: 58298 Date Sampled: 05/25/11 Date Received: Sample Matrix: Soil 05/25/11 Preservative: Cool Date Analyzed: 05/26/11 Condition: Chain of Custody: Intact 11645

Parameter Concentration (mg/Kg)

Total Chloride

Reference: U.S.E.P.A., 4500B, "Methods for Chemical Analysis of Water and Wastes", 1983.

Standard Methods For The Examination of Water And Waste Water", 18th ed., 1992.

Comments: Blanco Com A #6B

Review

5796 US Highway 64, Farmington, NM 87401

Ph (505) 632-0615 Fr (800) 362-1879 Fx (505) 632-1865 lab@envirotech-inc.com envirotech-inc.com



Chloride

Client: ConocoPhillips Reserve Pit Sample ID: Lab ID#:

58299 Sample Matrix: Soil Cool

Preservative: Condition: Intact Project #: Date Reported:

Date Sampled:

Date Received:

Date Analyzed:

Chain of Custody:

96052-1706

05/26/11 05/25/11

05/25/11

05/26/11 11645

Parameter

Concentration (mg/Kg)

Total Chloride

150

Reference:

U.S.E.P.A., 4500B, "Methods for Chemical Analysis of Water and Wastes", 1983.

Standard Methods For The Examination of Water And Waste Water", 18th ed., 1992.

Comments:

Blanco Com A #6B

| Submit To Appropri Two Copies | nate District (| Office | | State of New Mexico | | | Form C-105 | | | | | | | | |
|-----------------------------------|-----------------|----------------------------|------------------------------|--|---------------------------|------------|-------------------------------|---|-----------|--|----------|-----------|----------|--|-----------------|
| District I 1625 N French Dr | , Hobbs, NM | 88240 | En | Energy, Minerals and Natural Resources | | | July 17, 2008 1. WELL API NO | | | | | | | | |
| District II 1301 W Grand Av | • | | | O: | l Conservat | ion | Divicio | 'n | | 30-045-35088 | | | | | |
| District III 1000 Rio Biazos R | d, Aztec, NM | 1 87410 | | | 20 South St | | | | | 2 Type of Lease ☐ STATE ☐ FEE ☐ FED/INDIAN | | | | | |
| District IV 1220 S St Francis | Dr , Santa Fe | e, NM 87505 | | | Santa Fe, N | | | | | STATE FEE FED/INDIAN 3 State Oil & Gas Lease No | | | | | |
| \\/ELL(| | ETION O | PECC | MIDI | ETION REF | 205 | Τ ΔΝΓ | LOG | | NM - B1 - | | | | en e | 3.7 h Se (4078) |
| 4 Reason for file | | ETIONO | Y KEU | JIVIPL | ETION KER | | (I AINL | LOG | | 5 Lease Nam | | | | | |
| COMPLETI | ION REPO | RT (Fill in bo | xes #1 thro | ugh #31 | for State and Fee | wells | only) | | | BLANCO 6 Well Numl | | M A | | | |
| | | • | | • | | | - | and #32 and | /or | 6B | DCI | | | | |
| #33, attach this a | nd the plat t | | | | | | | | | | | | | | |
| | WELL | WORKOVER | ☐ DEEP | ENING | □PLUGBACK | | DIFFERE | NT RESERV | OIF | | | | | | |
| 8 Name of Opera Burlington R | | Oil Cos C | omnany | I D | | | | | | 9 OGRID 14538 | | | | | |
| 10 Address of O | perator | | ompany | , 111 | , | | | | | 11 Pool name | or W | ıldcat | | | |
| PO Box 4298, Fa | rmington, N | NM 87499 | | | | | | | | | | | | | |
| 12.Location | Unit Ltr | Section | Town | ship | Range | Lot | | Feet from t | he | N/S Line | Fee | t from tl | ne | E/W Line | County |
| Surface: BH: | | | | | | | | | | | | | \dashv | | |
| 13 Date Spudded | 1 14 Date | e T D Reache | 1 15 | Date Ric | Released | | 1 16 | Date Compl | etec | (Ready to Proc | luce) | 1 | 17 | Elevations (DI | and RKB |
| | | | 2/17 | 7/2011 | | | | | | | | | RT | (, GR, etc) | |
| 18 Total Measur | ed Depth of | Well | 19 | Plug Bac | ck Measured Dep | th | 20 | Was Direct | 10na | al Survey Made | 7 | 21 T | ype | Electric and O | ther Logs Run |
| 22 Producing Int | erval(s), of | this completio | n - Top, Bo | ottom, Na | ame | | | | | | | <u> </u> | | | |
| 23 | | | | CAS | ING REC | ORI |) (Ren | ort all str | rin | gs set in w | ell) | | | | |
| CASING SI | ZE | WEIGHT L | B/FT | | DEPTH SET | | | LE SIZE | | CEMENTIN | | CORD | I | AMOUNT | PULLED |
| | | | | | | | | | | | | | + | | |
| | | | | | | | | | | + | | | - | | |
| | | | | | | | | | | | | | Ţ | | |
| 24 | | | | LIN | ER RECORD | | | I | 25 | Т | TURI | NG RE | <u>T</u> | OR D | |
| SIZE | TOP | | BOTTOM | | SACKS CEMI | ENT | SCREEN | 1 | SI | | | EPTH S | | | ER SET |
| | | | | | | | | | | | | | | _ | |
| 26 Perforation | record (into | erval, size, and | number) | | | | 27 AC | ID, SHOT, | FR | ACTURE, CE | <u> </u> | VT, SQ | UE | EEZE, ETC | |
| | | | | | | | DEPTH | INTERVAL | | AMOUNT A | ND I | KIND M | 1AT | ΓERIAL USED | |
| | | | | | | | | | | | | | | _ | |
| | | | | | . 491.40 | | | | | | | | | | |
| 28 | | | - | | | | <u>ODUC'</u> | | | Turns. | -/ | | | | |
| Date First Produc | ction | Pro | duction Me | thod (Fla | owing, gas lift, pi | итріп | g - Size an | d type pump ₎ |) | Well Status | s (Pro | od or Sh | ut-i | in) | |
| Date of Test | Hours 7 | Tested | Choke Sıze | | Prod'n For Test Period | | Oıl - Bbi | · | Ga | as - MCF | w | ater - B | bl | Gas - G | Oil Ratio |
| Flow Tubing Press | Casing | Pressure | Calculated Hour Rate | 24- | Oıl - Bbl | | Gas | - MCF | - | Water - Bbl | ! | Oıl C | }rav | vity - API - (Co | r) |
| 29 Disposition o | f Gas (Sold | used for fuel, | vented, etc |) | | | | | | | 30 | Test Wi | tnes | ssed By | |
| 31 List Attachm | | | - | | | | | | | | | | | | |
| 32 If a temporar | | | _ | | | | | | | | | | | | |
| 33 If an on-site l | ourial was u | | = | | | | | 027 571000 | , | | | | | | |
| I hereby certi | fy that the | Latitude 3 e informatio | <u>6.76658°N</u> n-shown, | on boti | | o™ form | NAD ∐1 1 IS true | 921 <u> </u> | s lete | to the best o | of my | know | lea | lge and belie | f |
| Signature | ami | u Ga | dw | | nted ne Jamie Go | odwi | in Tıtl | e: Regula | ato | ry Tech. | Date | e: 8/19 |)/2(| 011 | |
| E-mail Addre | ss jamie. | l.goodwin@ | conocop | hıllips | .com | | | | | | | | | _ | |

ConocoPhillips

| Pit Closure Form: | |
|--|----------------------|
| Date: <u>6/29/11</u> | |
| Well Name: BLANCO COM A GB | - |
| Footages: 1889 FSL., 1357 FEL_ | Unit Letter: |
| Section: <u>36</u> , T- <u>36</u> -N, R- <u>8</u> -W, County: <u>SAN</u> | Juan State: NM |
| Contractor Closing Pit: AZTEC EXCAVA | TION |
| Construction Inspector: JARED CHAVEZ Inspector Signature: | Date: <u>6/29/11</u> |
| Revised 11/4/10 Office Use Only: Subtask | |
| DSM | |

Goodwin, Jamie L

From: Sent:

Payne, Wendy F

Monday, June 20, 2011 10:44 AM

(Brandon.Powell@state.nm us); GRP SJBU Regulatory; Eli (Cimarron) To:

(eliv@qwestoffice.net); James (Cimarron) (jwood@cimarronsvc.com); Mark Kelly; Randy

McKee; Robert Switzer; Sherrie Landon; Bassing, Kendal R.; Berenz

(mxberenz@yahoo.com), Elmer Perry; Faver Norman; Fred Martinez; Jared Chavez; Lowe, Terry; Payne, Wendy F; Spearman, Bobby E; Steve McGlasson; Tally, Ethel; Becker, Joey W,

Bowker, Terry D; Frost, Ryan M; Goosey, Paul P; Gordon Chenault; Green, Cary J; GRP SJBU Production Leads; Hockett, Christy R; Johnson, Kirk L; Bassing, Kendal R.; Kennedy, Jim R; Lopez, Richard A, Nelson, Garry D; O'Nan, Mike J.; Peace, James T; Pierce,

Richard M; Poulson, Mark E; Schaaphok, Bill; Smith, Randall O; Souther, Tappan G;

Spearman, Bobby E; Stamets, Steve A; Thacker, LARRY; Thibodeaux, Gordon A; Work, Jim A; Corey Alfandre; 'isaiah@crossfire-llc.com'; Jerid Cabot (jerid@crossfire-llc.com); Blair, Maxwell O; Blakley, Mac; Farrell, Juanita R; Gillette, Steven L (PAC); Hines, Derek J; Maxwell, Mary Alice; McWilliams, Peggy L; Saiz, Kooper (Finney Land Co.); Seabolt, Elmo F; Thayer,

Ashley A; Thompson, Trey E (Finney Land Co.)

Cc:

'Aztec Excavation'

Subject:

Reclamation Notice: Blanco Com A 6B (Area 5 * Run 511)

Importance:

High

Attachments:

BLANCO COM A 6B.pdf

Aztec Excavation will move a tractor to the **Blanco Com A 6B** to start the reclamation process on Thursday, June 23,2011 Please contact Jared Chavez (793-7912) if you have any questions or need further assistance



BLANCO COM A 6B.pdf (17 KB)

Burlington Resources Well - Network # 10295632 - Activity Code D250 (reclamation) & D260 (pit closure) (PO: Kaitlw) San Juan County, NM

Blanco Com A 6B - State surface/ State minerals

Onsited n/a Twin n/a 1889' FSL, 1357' FEL Sec.36, T30N, R8W Unit Letter "J" Lease # NM-B!-0603-0044 BH·NWSE,Sec.36, T30N,R8W Latitude: 36° 45' 59" N (NAD 27) Longitude. 107° 37' 23" W (NAD 27)

Elevation: 6064'

Total Acres Disturbed: 3 19 acres

Access Road 178 feet API # 30-045-35088 Within City Limits: NO

Pit Lined: YES

NOTE: Arch Monitoring IS required for this location. (Aztec Arch 334-6675)

Wendy Payne ConocoPhillips-SJBU 505-326-9533


Wendy.F.Payne@conocophillips.com


ConocoPhillips

| Reclamation Form: | |
|--|---|
| Date: <u> </u> | |
| Well Name: BLANCO | COM A GB |
| Footages: <u>/889 F</u> | SL, 1357 FEL Unit Letter: J |
| Section: <u>3</u> , T-30 | -N, R & -W, County: San Juan State: NM |
| | AZTEC EXCAVATION |
| Reclamation Date: | 9/29/11 |
| Road Completion Date: | 7/7/11 |
| | 7/14/11 |
| MARKER PLACED : | (1996): Picture of Marker set needed 7/7/11 |
| LONGITUDE: | 1/07, 62277 |
| Pit Manifold removed | G/22/11 (DATE) |
| Construction Inspector: | JARED CHAVEZ Date: 8/15/11 |
| Inspector Signature: | |
| Office Use Only: Subtask DSM Folder Pictures Revised 11/4/10 | - |





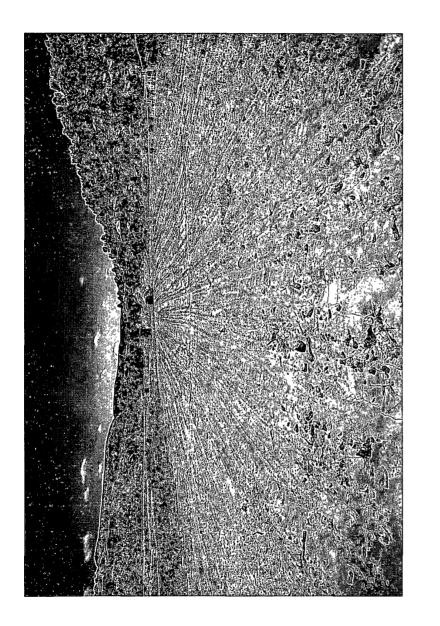

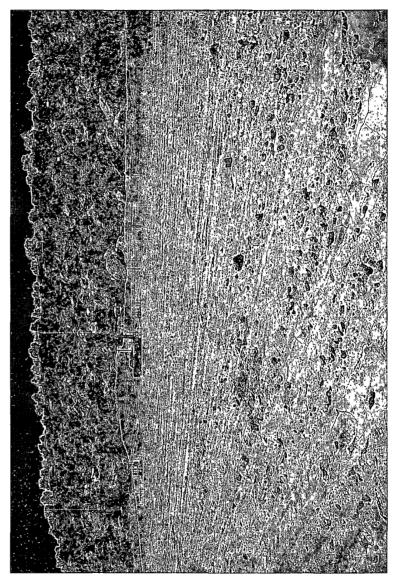

WELL NAME: ConocoPhillips OPEN PIT INSPECTION FORM Blanco Com A 6B INSPECTOR S. McGlasson S. McGlasson S. McGlasson S. McGlasson S. McGlasson Fred Mtz Fred Mtz Fred Mtz Fred Mtz DATE 01/17/11 01/27/11 02/09/11 02/16/11 02/22/11 03/02/11 03/08/11 03/16/11 03/23/11 Week 8 Week 1 Week 2 Week 3 Week 4 Week 5 Week 6 Week 7 Week 9 *Please request for pit extention after 26 weeks ☑ Dniled ☑ Dolled ☑ Drilled ☑ Drilled ☑ Drilled ✓ Drilled ✓ Drilled Drilled Drilled Completed Completed Completed Completed Completed ☐ Completed Completed Completed PIT STATUS Completed Clean-Up Clean-Up Clean-Up Clean-Up Clean-Up Clean-Up Clean-Up Clean-Up Clean-Up is the location marked with the proper flagging? ☑ Yes ☐ No ☑ Yes ☐ No ✓ Yes ☐ No Yes No ☐ Yes ☐ No. ✓ Yes ☐ No. ✓ Yes ☐ No. ☐ Yes ☐ No. ✓ Yes ☐ No. (Const. Zone, poles, pipelines, etc.) Is the temporary well sign on location and visible ✓ Yes ☐ No ☑ Yes ☐ No ☐ Yes ☐ No Yes No ✓ Yes ☐ No ✓ Yes ☐ No ✓ Yes ☐ No. ✓ Yes ☐ No ✓ Yes 🗆 No from access road? Is the access road in good driving condition? ✓ Yes ☐ No. ✓ Yes ☐ No ☐ Yes ☐ No ✓ Yes ☐ No ☐ Yes ✓ No ✓ Yes ☐ No ☐ Yes 🗸 No Yes No ☑ Yes ☐ No (deep ruts, bladed) Are the culverts free from debris or any object ✓ Yes ☐ No ✓ Yes ☐ No ☐ Yes ☐ No Yes No ☑ Yes ☐ No ☑ Yes ☐ No ✓ Yes 🗌 No ✓ Yes 🗌 No ✓ Yes ☐ No preventing flow? Is the top of the location bladed and in good ✓ Yes □ No ☑ Yes ☐ No ☐ Yes ☐ No ☐ Yes ☐ No ☑ Yes ☐ No ✓ Yes ☐ No ☐ Yes ✓ No ✓ Yes 🗀 No ✓ Yes ☐ No operating condition? Is the fence stock-proof? (fences tight, barbed ☑ Yes ☐ No. ☑ Yes ☐ No ☐ Yes ☐ No ☐ Yes ☐ No ☑ Yes ☐ No wire, fence clips in place? Is the pit liner in good operating condition? (no ✓ Yes No ☐ Yes ☐ No ☐ Yes ☐ No ✓ Yes ☐ No ☑ Yes ☐ No ✓ Yes ☐ No ✓ Yes ☐ No ✓ Yes ☐ No ✓ Yes ☐ No tears, up-rooting corners, etc.) Is the the location free from trash, oil stains and ✓ Yes ☐ No ☐ Yes ☐ No ☐ Yes ☐ No ✓ Yes ☐ No ☑ Yes ☐ No ✓ Yes ☐ No ☐ Yes ☐ No ☑ Yes ☐ No ☑ Yes ☐ No other materials? (cables, pipe threads, etc.) ENVIRONMENTAL Does the pit contain two feet of free board? (check ✓ Yes □ No ☐ Yes ☐ No ☑ Yes ☐ No ✓ Yes ☐ No. ✓ Yes ☐ No ☑ Yes ☐ No ✓ Yes ☐ No ☐ Yes ☐ No ✓ Yes ☐ No the water levels) Is there any standing water on the blow pit? ☐ Yes ✓ No Yes No ☐ Yes ☐ No Yes No ☐ Yes 🗸 No ☑ Yes ☐ No ✓ Yes ☐ No ✓ Yes ☐ No ☑ Yes ☐ No Are the pits free of trash and oil? ✓ Yes ☐ No ☐ Yes ☐ No ☐ Yes ☐ No ☑ Yes ☐ No ☑ Yes ☐ No ✓ Yes ☐ No ✓ Yes 🗆 No ☑ Yes ☐ No ✓ Yes ☐ No Are there diversion ditches ground the pits for ☐ Yes ☐ No ☑ Yes ☐ No ☑ Yes ☐ No ☑ Yes ☐ No ☐ Yes ☑ No ✓ Yes ☐ No ☐ Yes ☐ No ✓ Yes ☐ No ✓ Yes ☐ No natural drainaae? Is there a Manifold on location? ✓ Yes ☐ No. ☐ Yes ☐ No. ✓ Yes ☐ No ☑ Yes ☐ No ✓ Yes ☐ No ✓ Yes 🗌 No ✓ Yes ☐ No ☐ Yes ☐ No ✓ Yes ☐ No is the Manifold free of leaks? Are the hoses in ☑ Yes ☐ No ☑ Yes ☐ No Yes No Yes No ✓ Yes 🗌 No ✓ Yes ☐ No ✓ Yes 🗌 No ✓ Yes ☐ No ☑ Yes ☐ No good condition? \bigcirc \bigcirc Was the OCD contacted? ☐ Yes ✓ No Yes V No Yes No ☐ Yes ☐ No ☐ Yes 🗸 No ☐ Yes ✓ No ☐ Yes ✓ No ☐ Yes 🗸 No Yes V No Yes V No Yes No ☐ Yes ☐ No ☐ Yes 🗸 No ☐ Yes 🗸 No Yes V No Yes V No ☐ Yes ✓ No Yes V No PICTURE TAKEN AWS 730 off location COMMENTS Surface set, but Surface set, but Location bladed. Road and No repairs tighten AWS 730 movina fence road entire not drilled entire not drilled AWS730 on diversion ditches No repairs tighter location need No repairs road Awaitina AWS 730 Awaiting AWS 730 onto location ocation up fence bladed needs bladed needs bladed cut

| | WELL NAME: | | • | | | | | | | , |
|---------------|---|----------------------------------|--|---|--|--|--|----------------------------------|----------------------------------|----------------------------------|
| | Blanco Com A 6B | | | | | | | | | |
| - | INSPECTOR DATE | Fred Mtz 03/30/11 | Fred Mtz 04/06/11 | Fred Mtz 04/12/11 | Fred Mtz 04/19/11 | Fred Mtz 05/10/11 | Fred Mtz 05/17/11 | Fred Mtz 05/25/11 | Fred Mtz 06/01/11 | Fred Mtz. 06/08/11 |
| | *Please request for pit extention after 26 weeks | Week 10 | Week 11 | Week 12 | Week 13 | Week 14 | Week 15 | Week 16 | Week 17 | Week 18 |
| | PIT STATUS | ☑ Drilled ☐ Completed ☐ Clean-Up | ☑ Drilled ☐ Completed ☐ Clean-Up | ☑ Drilled ☑ Completed ☐ Clean-Up | ☑ Drilled ☐ Completed ☐ Clean-Up | ☑ Drilled ☐ Completed ☐ Clean-Up | ☑ Drilled ☐ Completed ☐ Clean-Up | ☑ Drilled ☐ Completed ☐ Clean-Up | ✓ Drilled ✓ Completed ☐ Clean-Up | ☑ Drilled ☑ Completed ☐ Clean-Up |
| ATION | Is the location marked with the proper flagging? (Const. Zone, poles, pipelines, etc.) | Yes No | ☑ Yes ☐ No | ✓ Yes 🗌 No | ✓ Yes 🗌 No | ☑ Yes ☐ No | ✓ Yes 🗌 No | ☐ Yes ☐ No | ✓ Yes 🗌 No | ☑ Yes ☐ No |
| 7001 | Is the temporary well sign on location and visible from access road? | ☐ Yes ☐ No | ✓ Yes 🗌 No | ✓ Yes 🗌 No | ✓ Yes 🗌 No | ☑ Yes ☐ No | ✓ Yes 🗌 No | Yes No | ✓ Yes 🗌 No | ✓ Yes 🗌 No |
| | Is the access road in good driving condition? (deep ruts, bladed) | Yes No | ☐ Yes ☑ No | ☐ Yes ☑ No | ☑ Yes ☐ No | ✓ Yes □ No | ✓ Yes ☐ No | ☐ Yes ☐ No | ✓ Yes 🗌 No | ✓ Yes ☐ No |
| | Are the culverts free from debris or any object preventing flow? | ☐ Yes ☐ No | ✓ Yes 🗌 No | ✓ Yes 🗌 No | ☑ Yes ☐ No | ✓ Yes 🗌 No | ✓ Yes ☐ No | ☐ Yes ☐ No | Yes No | ✓ Yes 🗌 No |
| | Is the top of the location bladed and in good operating condition? | ☐ Yes ☐ No | ☑ Yes ☐ No | ☑ Yes ☐ No | ✓ Yes 🗌 No | ☐ Yes ☑ No | ☐ Yes ☑ No | ☐ Yes ☑ No | ☑ Yes ☐ No | ☑ Yes ☐ No |
| NCE | Is the fence stock-proof? (fences tight, barbed wire, fence clips in place? | ☐ Yes ☐ No | ☐ Yes ☑ No | ☑ Yes ☐ No | ☑ Yes ☐ No | ✓ Yes 🗌 No | ☑ Yes ☐ No | ☐ Yes ☐ No | ✓ Yes ☐ No | ☑ Yes ☐ No |
| MPLIAN | Is the pit liner in good operating condition? (no tears, up-rooting corners, etc.) | ☐ Yes ☐ No | ✓ Yes 🗌 No | ☑ Yes ☐ No | ✓ Yes ☐ No | ✓ Yes 🗌 No | ☑ Yes ☐ No | ☐ Yes ☐ No | ☑ Yes ☐ No | ✓ Yes □ No |
| 00 7 | Is the the location free from trash, oil stains and other materials? (cables, pipe threads, etc.) | ☐ Yes ☐ No | ✓ Yes ☐ No | ☑ Yes ☐ No | ✓ Yes □ No | ✓ Yes 🗌 No | ☑ Yes ☐ No | ☐ Yes ☐ No | ☑ Yes ☐ No | ☑ Yes ☐ No |
| ENVIRONMENTAL | Does the pit contain two feet of free board? (check the water levels) | ☐ Yes ☐ No | ✓ Yes ☐ No | ✓ Yes 🗌 No | ☑ Yes ☐ No | ✓ Yes □ No | ✓ Yes 🗌 No | ☐ Yes ☐ No | ☑ Yes ☐ No | ☑ Yes ☐ No |
| RON | Is there any standing water on the blow pit? | ☐ Yes ☐ No | ✓ Yes ☐ No | ✓ Yes 🗌 No | ✓ Yes ☐ No | ☑ Yes ☐ No | ☑ Yes ☐ No | ☐ Yes ☐ No | ✓ Yes 🗌 No | ☑ Yes ☐ No |
| EN | Are the pits free of trash and oil? | Yes No | ✓ Yes ☐ No | ✓ Yes 🗌 No | ✓ Yes □ No | ✓ Yes 🗌 No | ☑ Yes ☐ No | ☐ Yes ☐ No | ✓ Yes 🗌 No | ☑ Yes ☐ No |
| | Are there diversion ditches around the pits for natural drainage? | Yes No | ✓ Yes 🗌 No | ✓ Yes 🗌 No | ✓ Yes ☐ No | ☑ Yes ☐ No | ☐ Yes ☑ No | ☐ Yes ☐ No | ✓ Yes ☐ No | ☑ Yes ☐ No |
| | Is there a Manifold on location? | Yes No | ✓ Yes ☐ No | ✓ Yes ☐ No | ✓ Yes □ No | ☑ Yes ☐ No | ✓ Yes □ No | ☐ Yes ☐ No | ✓ Yes 🗌 No | ✓ Yes 🗌 No |
| | Is the Manifold free of leaks? Are the hoses in good condition? | Yes No | ☑ Yes 🗌 No | ☑ Yes ☐ No | ☑ Yes ☐ No | ☑ Yes ☐ No | ☑ Yes ☐ No | ☐ Yes ☐ No | ☑ Yes ☐ No | ☑ Yes 🗌 No |
| ပ္ပ င | Was the OCD contacted? | Yes 🗸 No | ☐ Yes ☑ No | ☐ Yes ☑ No | ☐ Yes ☑ No | ☐ Yes ☑ No | ☐ Yes ☑ No | ☐ Yes ☐ No | ☐ Yes ☑ No | ☐ Yes ☑ No |
| ă | PICTURE TAKEN | Yes 🗸 No | ☐ Yes ☑ No | ☐ Yes ☑ No | ☐ Yes ☑ No | ☐ Yes ☑ No | ☐ Yes ☑ No | ☐ Yes ☐ No | ☐ Yes ☑ No | ☐ Yes ☑ No |
| | COMMENTS | Flow back crew on location | Contact cross fire to fix fence | No repans contact Dawn to pull pit road needs bladed | | No repairs location needs bladed | Location needs bladed pit has hole | Tested pit | no repairs | No repairs |

| | WELL NAME: | | | | | | | | | |
|--------------------------|--|-------------|--------------------|------------|------------|------------|------------|------------|------------|------------|
| | Blanco Com A 6B | | | | * * | | y e | • | | • |
| | INSPECTOR | Fred Mtz | F,MTZ | 1 | | 1 | I | | | |
| | DATE | 06/21/11 | | <u> </u> | | | | | | |
| L | *Please request for pit extention after 26 weeks | Week 19 | Week 20 | Week 21 | Week 22 | Week 23 | Week 24 | Week 25 | *Week 26* | Week 27 |
| | | ☑ Drilled | ☐ Drilled | Drilled | Drilled | Drilled | ☐ Drilled | ☐ Drilled | ☐ Drilled | ☐ Drilled |
| | PIT STATUS | ✓ Completed | Completed | Completed | Completed | Completed | Completed | Completed | Completed | |
| L | | Clean-Up | Clean-Up | ☐ Clean-Up | ☐ Clean-Up | ☐ Clean-Up | Clean-Up | Clean-Up | Clean-Up | Clean-Up |
| | Is the location marked with the proper flagging? (Const. Zone, poles, pipelines, etc.) Is the temporary well sign on location and visible | ✓ Yes ☐ No | ☐ Yes ☐ No | Yes No | ☐ Yes ☐ No | ☐ Yes ☐ No | ☐ Yes ☐ No | Yes No | ☐ Yes ☐ No | ☐ Yes ☐ No |
| 7001 | Is the temporary well sign on location and visible from access road? | ✓ Yes ☐ No | Yes No | Yes No | Yes No | Yes No | Yes No | ☐ Yes ☐ No | Yes No | Yes No |
| ENVIRONMENTAL COMPLIANCE | Is the access road in good driving condition? (deep ruts, bladed) | ✓ Yes 🗌 No | ☐ Yes ☐ No | Yes No | Yes No | Yes No | Yes No | Yes No | ☐ Yes ☐ No | ☐ Yes ☐ No |
| | Are the culverts free from debris or any object preventing flow? | ✓ Yes □ No | ☐ Yes ☐ No | ☐ Yes ☐ No | Yes No | Yes No | Yes No | Yes No | ☐ Yes ☐ No | Yes No |
| | Is the top of the location bladed and in good operating condition? | ✓ Yes ☐ No | Yes No | ☐ Yes ☐ No | ☐ Yes ☐ No | Yes No | ☐ Yes ☐ No | Yes No | ☐ Yes ☐ No | Yes No |
| | Is the fence stock-proof? (fences tight, barbed wire, fence clips in place? | ✓ Yes ☐ No | ☐ Yes ☐ No | ☐ Yes ☐ No | ☐ Yes ☐ No | ☐ Yes ☐ No | ☐ Yes ☐ No | ☐ Yes ☐ No | ☐ Yes ☐ No | ☐ Yes ☐ No |
| | Is the pit liner in good operating condition? (no tears, up-rooting corners, etc.) | ✓ Yes □ No | ☐ Yes ☐ No | ☐ Yes ☐ No | ☐ Yes ☐ No | ☐ Yes ☐ No | ☐ Yes ☐ No | Yes No | ☐ Yes ☐ No | ☐ Yes ☐ No |
| | | ✓ Yes □ No | ☐ Yes ☐ No | ☐ Yes ☐ No | ☐ Yes ☐ No | ☐ Yes ☐ No | ☐ Yes ☐ No | ☐ Yes ☐ No | Yes No | ☐ Yes ☐ No |
| | Does the pit contain two feet of free board? (check the water levels) | ☑ Yes ☐ No | ☐ Yes ☐ No | ☐ Yes ☐ No | ☐ Yes ☐ No | ☐ Yes ☐ No | Yes No | ☐ Yes ☐ No | Yes No | ☐ Yes ☐ No |
| | Does the pit contain two feet of free board? (check the water levels) Is there any standing water on the blow pit? Are the pits free of trash and oil? | ✓ Yes □ No | ☐ Yes ☐ No | ☐ Yes ☐ No | ☐ Yes ☐ No | Yes No | Yes No | ☐ Yes ☐ No | ☐ Yes ☐ No | ☐ Yes ☐ No |
| | Are the pits free of trash and oil? | ☑ Yes ☐ No | ☐ Yes ☐ No | ☐ Yes ☐ No | Yes No | ☐ Yes ☐ No | Yes No | ☐ Yes ☐ No | Yes No | ☐ Yes ☐ No |
| | Are there diversion ditches around the pits for natural drainage? | ✓ Yes □ No | ☐ Yes ☐ No | ☐ Yes ☐ No | Yes No | Yes No | ☐ Yes ☐ No | Yes No | ☐ Yes ☐ No | ☐ Yes ☐ No |
| | Is there a Manifold on location? | ✓ Yes □ No | ☐ Yes ☐ No | Yes No | Yes No | Yes No | ☐ Yes ☐ No | ☐ Yes ☐ No | Yes No | Yes No |
| | Is the Manifold free of leaks? Are the hoses in good condition? | ☑ Yes ☐ No | ☐ Yes ☐ No | Yes No | ☐ Yes ☐ No | ☐ Yes ☐ No | ☐ Yes ☐ No | ☐ Yes ☐ No | ☐ Yes ☐ No | ☐ Yes ☐ No |
| ၁၀ | △ Was the OCD contacted? | ☐ Yes ☑ No | Yes No | ☐ Yes ☐ No | Yes No | ☐ Yes ☐ No | Yes No | Yes No | Yes No | Yes No |
| | PICTURE TAKEN | Yes No | ☐ Yes ☐ No | Yes No | Yes No | Yes No | Yes No | Yes No | Yes No | Yes No |
| | COMMENTS | No Repairs | BEING RECLAIMED | | | | | | | |