District I 1625 N French Di , Hobbs, NM 88240 District II 1301 W Grand Avenue, Artesia, NM 88210 District III 1000 Rio Brazos Road, Aztec, NM 87410 District IV 1220 S St Francis Di , Santa Fe, NM 87505

# State of New Mexico Energy Minerals and Natural Resources Department Oil Conservation Division 1220 South St. Francis Dr. Santa Fe, NM 87505

For temporary pits, closed-loop systems, and below-grade tanks, submit to the appropriate NMOCD District Office.

For permanent pits and exceptions submit to the Santa Fe Environmental Bureau office and provide a copy to the appropriate NMOCD District Office

0	1	,	5
,	2	/،	,

#### <u>Pit, Closed-Loop System, Below-Grade Tank, or</u> <u>Proposed Alternative Method Permit or Closure Plan Application</u>

Type of action:  Permit of a pit, closed-loop system, below-grade tank, or proposed alternative method  Closure of a pit, closed-loop system, below-grade tank, or proposed alternative method  Modification to an existing permit  Closure plan only submitted for an existing permitted or non-permitted pit, closed-loop system, below-grade tank, or proposed alternative method
Instructions: Please submit one application (Form C-144) per individual pit, closed-loop system, below-grade tank or alternative request
Please be advised that approval of this request does not relieve the operator of liability should operations result in pollution of surface water, ground water or the environment. Nor does approval relieve the operator of its responsibility to comply with any other applicable governmental authority's rules, regulations or ordinances
Operator WILLIAMS PRODUCTION COMPANY, LLC OGRID # 120782
Address PO Box 640 Aztec, NM 87410
Facility or well name: COX CANYON UNIT #025
API Number OCD Permit Number
Section 90 Township 32N Range 11W County SAN JUAN
Latitude 36.99517999999998 Longitude 107 99043 NAD 1983 Surface Owner. <u>FEDERAL</u>
2
Pit: Subsection F or G of 19 15 17 11 NMAC
Temporary.  Drilling  Workover
☐ Permanent ☐ Emergency ☐ Cavitation ☐ P&A
☐ Lined ☐ Unlined Liner type. Thicknessmil ☐ LLDPE ☐ HDPE ☐ PVC ☐ Other
☐ String-Reinforced
Liner Seams
3
Closed-loop System: Subsection H of 19 15 17 11 NMAC
Type of Operation P&A Drilling a new well Workover or Drilling (Applies to activities which require prior approval of a permit or notice of intent)
☐ Drying Pad ☐ Above Ground Steel Tanks ☐ Haul-off Bins ☐ Other
☐ Lined ☐ Unlined Liner type Thicknessmil ☐ LLDPE ☐ HDPE ☐ PVC ☐ Other
Liner Seams
Secondary containment with leak detection   Visible sidewalls and liner   Visible sidewalls and liner   Visible sidewalls only   Other
Secondary containment with leak detection Usible sidewalls, liner, 6-inch lift and automatic overflow shunds
☐ Visible sidewalls and liner ☐ Visible sidewalls only ☐ Other
Liner type: Thickness mil
Alternative Method:
Submittal of an exception request is required Exceptions must be submitted to the Santa Fe Environmental Bureau office for consideration of approval

Fencing: Subsection D of 19 15 17 11 NMAC (Applies to permanent pits, temporary pits, and below-grade tanks)  Chain link, six feet in height, two strands of barbed wire at top (Required if located within 1000 feet of a permanent residence, school,	hospital,					
institution or church)  Four foot height, four strands of barbed wire evenly spaced between one and four feet						
Alternate Please specify						
Netting: Subsection E of 19 15 17 11 NMAC (Applies to permanent pits and permanent open top tanks)						
Screen Netting Other						
☐ Monthly inspections (If netting or screening is not physically feasible)						
8 Signs: Subsection C of 19 15 17 11 NMAC						
12"x 24", 2" lettering, providing Operator's name, site location, and emergency telephone numbers						
☐ Signed in compliance with 19 15 3 103 NMAC						
9 Administrative Approvals and Exceptions:						
Justifications and/or demonstrations of equivalency are required. Please refer to 19.15 17 NMAC for guidance						
Please check a box if one or more of the following is requested, if not leave blank:  Administrative approval(s). Requests must be submitted to the appropriate division district or the Santa Fe Environmental Bureau of the Santa Fe En	office for					
consideration of approval  Exception(s) Requests must be submitted to the Santa Fe Environmental Bureau office for consideration of approval						
Siting Criteria (regarding permitting): 19 15 17 10 NMAC Instructions: The applicant must demonstrate compliance for each siting criteria below in the application. Recommendations of accept material are provided below. Requests regarding changes to certain siting criteria may require administrative approval from the appropriate or may be considered an exception which must be submitted to the Santa Fe Environmental Bureau office for consideration of a Applicant must attach justification for request. Please refer to 19.15.17.10 NMAC for guidance. Siting criteria does not apply to drying above-grade tanks associated with a closed-loop system.	priate district pproval.					
Ground water is less than 50 feet below the bottom of the temporary pit, permanent pit, or below-grade tank.  - NM Office of the State Engineer - iWATERS database search, USGS; Data obtained from nearby wells	☐ Yes ☐ No					
Within 300 feet of a continuously flowing watercourse, or 200 feet of any other significant watercourse or lakebed, sinkhole, or playa lake (measured from the ordinary high-water mark)  - Topographic map, Visual inspection (certification) of the proposed site	Yes No					
Within 300 feet from a permanent residence, school, hospital, institution, or church in existence at the time of initial application.  (Applies to temporary, emergency, or cavitation pits and below-grade tanks)  - Visual inspection (certification) of the proposed site; Aerial photo, Satellite image	Yes No					
Within 1000 feet from a permanent residence, school, hospital, institution, or church in existence at the time of initial application (Applies to permanent pits)	☐ Yes ☐ No ☐ NA					
- Visual inspection (certification) of the proposed site, Aerial photo, Satellite image	☐ Yes ☐ No					
Within 500 horizontal feet of a private, domestic fresh water well or spring that less than five households use for domestic or stock watering purposes, or within 1000 horizontal feet of any other fresh water well or spring, in existence at the time of initial application  - NM Office of the State Engineer - iWATERS database search; Visual inspection (certification) of the proposed site						
Within incorporated municipal boundaries or within a defined municipal fresh water well field covered under a municipal ordinance adopted pursuant to NMSA 1978, Section 3-27-3, as amended.  - Written confirmation or verification from the municipality, Written approval obtained from the municipality	☐ Yes ☐ No					
Within 500 feet of a wetland.  - US Fish and Wildlife Wetland Identification map; Topographic map; Visual inspection (certification) of the proposed site	☐ Yes ☐ No					
Within the area overlying a subsurface mine.  - Written confirmation or verification or map from the NM EMNRD-Mining and Mineral Division	☐ Yes ☐ No					
<ul> <li>Within an unstable area.</li> <li>Engineering measures incorporated into the design, NM Bureau of Geology &amp; Mineral Resources, USGS, NM Geological Society; Topographic map</li> </ul>	☐ Yes ☐ No					
Within a 100-year floodplain - FEMA map	☐ Yes ☐ No					

Temporary Pits, Emergency Pits, and Below-grade Tanks Permit Application Attachment Checklist: Subsection B of 19 15 17 9 NMAC  Instructions: Each of the following items must be attached to the application. Please indicate, by a check mark in the box, that the documents are attached.  Hydrogeologic Report (Below-grade Tanks) - based upon the requirements of Paragraph (4) of Subsection B of 19.15 17 9 NMAC  Hydrogeologic Data (Temporary and Emergency Pits) - based upon the requirements of Paragraph (2) of Subsection B of 19 15 17 9 NMAC  Siting Criteria Compliance Demonstrations - based upon the appropriate requirements of 19 15 17 10 NMAC  Design Plan - based upon the appropriate requirements of 19 15 17 12 NMAC  Operating and Maintenance Plan - based upon the appropriate requirements of 19 15 17 12 NMAC  Closure Plan (Please complete Boxes 14 through 18, if applicable) - based upon the appropriate requirements of Subsection C of 19 15 17 9 NMAC  and 19 15 17 13 NMAC  Previously Approved Design (attach copy of design) API Number
Closed-loop Systems Permit Application Attachment Checklist: Subsection B of 19 15 17 9 NMAC  Instructions: Each of the following items must be attached to the application. Please indicate, by a check mark in the box, that the documents are attached.  Geologic and Hydrogeologic Data (only for on-site closure) - based upon the requirements of Paragraph (3) of Subsection B of 19 15 17 9 Siting Criteria Compliance Demonstrations (only for on-site closure) - based upon the appropriate requirements of 19 15 17 10 NMAC  Design Plan - based upon the appropriate requirements of 19 15 17 11 NMAC  Operating and Maintenance Plan - based upon the appropriate requirements of 19 15 17 12 NMAC  Closure Plan (Please complete Boxes 14 through 18, if applicable) - based upon the appropriate requirements of Subsection C of 19.15 17 9 NMAC and 19.15 17 13 NMAC  Previously Approved Design (attach copy of design) API Number  Previously Approved Operating and Maintenance Plan API Number:  (Applies only to closed-loop system that use above ground steel tanks or haul-off bins and propose to implement waste removal for closure)
Permanent Pits Permit Application Checklist: Subsection B of 19 15 17 9 NMAC  Instructions: Each of the following items must be attached to the application. Please indicate, by a check mark in the box, that the documents are attached.    Hydrogeologic Report - based upon the requirements of Paragraph (1) of Subsection B of 19 15 17 9 NMAC   Siting Criteria Compliance Demonstrations - based upon the appropriate requirements of 19 15 17 10 NMAC   Climatological Factors Assessment   Certified Engineering Design Plans - based upon the appropriate requirements of 19 15 17 11 NMAC   Dike Protection and Structural Integrity Design - based upon the appropriate requirements of 19 15 17 11 NMAC   Leak Detection Design - based upon the appropriate requirements of 19 15 17 11 NMAC   Liner Specifications and Compatibility Assessment - based upon the appropriate requirements of 19 15 17 11 NMAC   Quality Control/Quality Assurance Construction and Installation Plan   Operating and Maintenance Plan - based upon the appropriate requirements of 19 15 17 11 NMAC   Nusance or Hazardous Odors, including H <sub>2</sub> S, Prevention Plan   Emergency Response Plan   Oil Field Waste Stream Characterization   Monitoring and Inspection Plan     Erosion Control Plan   Erosion Control Plan     Closure Plan - based upon the appropriate requirements of Subsection C of 19 15 17 9 NMAC and 19 15 17.13 NMAC
Proposed Closure: 19 15 17 13 NMAC  Instructions: Please complete the applicable boxes, Boxes 14 through 18, in regards to the proposed closure plan.  Type: Drilling Workover Emergency Cavitation P&A Permanent Pit Below-grade Tank Closed-loop System Alternative  Proposed Closure Method Waste Excavation and Removal Waste Removal (Closed-loop systems only) On-site Closure Method (Only for temporary pits and closed-loop systems) In-place Burial On-site Trench Burial Alternative Closure Method (Exceptions must be submitted to the Santa Fe Environmental Bureau for consideration)
Waste Excavation and Removal Closure Plan Checklist: (19 15 17 13 NMAC) Instructions: Each of the following items must be attached to the closure plan. Please indicate, by a check mark in the box, that the documents are attached.  ☐ Protocols and Procedures - based upon the appropriate requirements of 19 15 17 13 NMAC ☐ Confirmation Sampling Plan (if applicable) - based upon the appropriate requirements of Subsection F of 19 15 17 13 NMAC ☐ Disposal Facility Name and Permit Number (for liquids, drilling fluids and drill cuttings) ☐ Soil Backfill and Cover Design Specifications - based upon the appropriate requirements of Subsection H of 19 15 17.13 NMAC ☐ Re-vegetation Plan - based upon the appropriate requirements of Subsection I of 19 15.17.13 NMAC ☐ Site Reclamation Plan - based upon the appropriate requirements of Subsection G of 19 15 17.13 NMAC

Waste Removal Closure For Closed-loop Systems That Utilize Above Ground Instructions: Please indentify the facility or facilities for the disposal of liquids, facilities are required.		
Disposal Facility Name	Disposal Facility Permit Number	
Disposal Facility Name	Disposal Facility Permit Number	
Will any of the proposed closed-loop system operations and associated activities o  ☐ Yes (If yes, please provide the information below) ☐ No		
Required for impacted areas which will not be used for future service and operation  Soil Backfill and Cover Design Specifications based upon the appropriate Re-vegetation Plan - based upon the appropriate requirements of Subsection Site Reclamation Plan - based upon the appropriate requirements of Subsection	e requirements of Subsection H of 19.15.17 13 NMA 11 of 19 15 17.13 NMAC	C
Siting Criteria (regarding on-site closure methods only): 19 15.17 10 NMAC Instructions: Each siting criteria requires a demonstration of compliance in the provided below. Requests regarding changes to certain siting criteria may require considered an exception which must be submitted to the Santa Fe Environmenta demonstrations of equivalency are required. Please refer to 19.15.17.10 NMAC	re administrative approval from the appropriate dist il Bureau office for consideration of approval.  Justi	rict office or may be
Ground water is less than 50 feet below the bottom of the buried waste - NM Office of the State Engineer - iWATERS database search, USGS; Database search, USGS;	ta obtained from nearby wells	☐ Yes ☐ No ☐ NA
Ground water is between 50 and 100 feet below the bottom of the buried waste - NM Office of the State Engineer - iWATERS database search, USGS, Data	ta obtained from nearby wells	☐ Yes ☐ No ☐ NA
Ground water is more than 100 feet below the bottom of the buried waste - NM Office of the State Engineer - iWATERS database search, USGS, Data	ta obtained from nearby wells	☐ Yes ☐ No ☐ NA
Within 300 feet of a continuously flowing watercourse, or 200 feet of any other signake (measured from the ordinary high-water mark).  - Topographic map, Visual inspection (certification) of the proposed site	gnificant watercourse or lakebed, sinkhole, or playa	☐ Yes ☐ No
Within 300 feet from a permanent residence, school, hospital, institution, or church - Visual inspection (certification) of the proposed site, Aerial photo, Satellit		☐ Yes ☐ No
Within 500 horizontal feet of a private, domestic fresh water well or spring that les watering purposes, or within 1000 horizontal feet of any other fresh water well or - NM Office of the State Engineer - iWATERS database, Visual inspection	spring, in existence at the time of initial application	☐ Yes ☐ No
Within incorporated municipal boundaries or within a defined municipal fresh wat adopted pursuant to NMSA 1978, Section 3-27-3, as amended  - Written confirmation or verification from the municipality, Written approx	·	☐ Yes ☐ No
Within 500 feet of a wetland - US Fish and Wildlife Wetland Identification map, Topographic map, Visu	nal inspection (certification) of the proposed site	☐ Yes ☐ No
Within the area overlying a subsurface mine - Written confirmation or verification or map from the NM EMNRD-Minin	g and Mineral Division	☐ Yes ☐ No
<ul> <li>Within an unstable area</li> <li>Engineering measures incorporated into the design, NM Bureau of Geolog Society; Topographic map</li> </ul>	y & Mineral Resources, USGS, NM Geological	☐ Yes ☐ No
Within a 100-year floodplain - FEMA map		☐ Yes ☐ No
On-Site Closure Plan Checklist: (19.15 17 13 NMAC) Instructions: Each of the by a check mark in the box, that the documents are attached.  Siting Criteria Compliance Demonstrations - based upon the appropriate requirements of Construction/Design Plan of Burial Trench (if applicable) based upon the appropriate requirements of Construction/Design Plan of Temporary Pit (for in-place burial of a drying Protocols and Procedures - based upon the appropriate requirements of 19 1 Confirmation Sampling Plan (if applicable) - based upon the appropriate requirements of Disposal Facility Name and Permit Number (for liquids, drilling fluids and Soil Cover Design - based upon the appropriate requirements of Subsection Re-vegetation Plan - based upon the appropriate requirements of Subsection Site Reclamation Plan - based upon the appropriate requirements of Subsection	quirements of 19 15.17.10 NMAC  f Subsection F of 19 15 17 13 NMAC  ppropriate requirements of 19 15 17 11 NMAC  pad) - based upon the appropriate requirements of 19  5 17.13 NMAC  quirements of Subsection F of 19.15.17.13 NMAC  f Subsection F of 19 15.17 13 NMAC  drill cuttings or in case on-site closure standards cann  H of 19.15.17.13 NMAC  1 of 19 15 17 13 NMAC	15 17 11 NMAC

Operator Application Certification:	
I hereby certify that the information submitted with this application is true, accurately	rate and complete to the best of my knowledge and belief.
Name (Print)	Title:
Signature.	Date_
e-mail address	Telephone:
OCD Approval: Permit Application (including closure plan) Closure-F	Approval Date: S/08/201
Title: Compliance Officer	OCD Permit Number:
Closure Report (required within 60 days of closure completion): Subsection Instructions: Operators are required to obtain an approved closure plan prior The closure report is required to be submitted to the division within 60 days of section of the form until an approved closure plan has been obtained and the c	to implementing any closure activities and submitting the closure report. the completion of the closure activities. Please do not complete this losure activities have been completed.
☐ Closure Completion Date:10/12/10 ☐ Closure Comple	etion Date S.J. Regional landfill, NMED Permit SWM-052426
22 Closure Method:  ☐ Waste Excavation and Removal ☐ On-Site Closure Method ☐ Altern ☐ If different from approved plan, please explain	ative Closure Method   Waste Removal (Closed-loop systems only)
Closure Report Regarding Waste Removal Closure For Closed-loop System Instructions: Please indentify the facility or facilities for where the liquids, dri two facilities were utilized.  Disposal Facility Name	lling fluids and drill cuttings were disposed. Use attachment if more than
Disposal Facility Name	
Disposal Facility Name.  Were the closed-loop system operations and associated activities performed on o	
Yes (If yes, please demonstrate compliance to the items below) No	The areas that will not be used for future service and operations
Required for impacted areas which will not be used for future service and operated Site Reclamation (Photo Documentation)  Soil Backfilling and Cover Installation  Re-vegetation Application Rates and Seeding Technique	ions
24 Closure Report Attachment Checklist: Instructions: Each of the following i	toms must be attached to the closure report. Please indicate by a check
mark in the box, that the documents are attached.  Proof of Closure Notice (surface owner and division)  Proof of Deed Notice (required for on-site closure)  Plot Plan (for on-site closures and temporary pits)  Confirmation Sampling Analytical Results (if applicable)  Waste Material Sampling Analytical Results (required for on-site closure)  Disposal Facility Name and Permit Number  Soil Backfilling and Cover Installation  Re-vegetation Application Rates and Seeding Technique  Site Reclamation (Photo Documentation)	
Operator Closure Certification:	
I hereby certify that the information and attachments submitted with this closure belief. I also certify that the closure complies with all applicable closure requires	
Name (Print) Vanessa Fields Title	EH&S Coordinator
Signature 0095	Date11-24-10
a mail address yongso fields@williams.com Tale	nhone 505 634 4200



Exploration & Fraduction FC Bc> 640 Azicc NM 61137 505/624 4219 505/634 4214 fax

March 10, 2009

Mr Mark Kelly Bureau of Land Management Farmington Field Office 1235 La Plata Hwy Farmington, NM 87401

Sent via Certified Mail

RE Notification of Production Pit Closure
Rule 19 15 17 13 NMAC

Production Pits associated Natural Gas Development Operated by Williams Production Co. LLC

Pursuant to Rule 19 15 17 13 NMAC this correspondence is to notify the Bureau of Land Management. Farmington Field Office of Williams Production LLC's (Williams) intent to clean close all production pits on the attached list of wells operated with the District in San Juan County and Rio Arriba County. New Mexico Closure will follow the plan included with this correspondence

Thank you for your consideration. If there are any questions or additional information is requested, please contact me at (505) 634-4209.

Respectfully submitted

Holly C Perkins EH&S Specialist

Encl. Williams Production Pit Inventory List (Federal wells)

San Juan Basin - New Mexico Assets - Below-Grade Tank Closure Plan

cc Environmental Fire

#### Williams Production Co., LLC San Juan Basin: New Mexico Assets

Below Grade Tank Removal Closure Flan

the accordance with Rule 19.15.17.13.NMAC, the following plan describes the general closure requirements of below grade tanks (BC-1) on Williams Froduction Co. LLC (WFX) locations in the San Juan Basin of New Mexico. This is WEX's standard closure procedure for all BGIs regulated under Rule 19.15.17.NMAC, and operated by WEX. For those closures which do not conform to this standard closure plan a separate well/pit specific closure plan will be developed and utilized.

#### Closure Conditions and Timing:

Fuisiont to 19.15.17.13 (A) NMAC. WEX will initiate closure of any BG1 should any one of these conditions occur.

- The Division requires closure because of imminent danger to tresh water public health or the environment.
- The integrity of the RGI fails. Notification will be within 48 hours to the Division and closure will be schedule as specified in 19.15.17.12 (A)(5) NMAC.
- WEX chooses to take the BGT out of service due to operational needs. Closure under these conditions will be closed within 60 days of cessation of the BGT's operation.
- BC-Is installed prior to Tune 16, 2008 that do not meet the requirements under 19.15.17.11.1(*C*).
   RMAC and WPS chooses not to refrofit or upgrade. Closure under these conditions will be completed within five years (by June 16, 2013).

#### General Plan Requirements:

- Friento initiating any BGT Closure except in the case of an emergency, WEX will review County Tax Records for the current surface, owner of record. The surface owner of record will be notified of the intent to close the PGT by certified mail and a copy of this notification will be included in the closure report. In the case, of an emergency, the surface owner of record will be notified as soon as practical.
- Notice of Closure will be given to the Azte Chistilat affice between 72 hours and one week of the scheduled closure via email or phone. The notification of closure will include the following.
  - a Operators Name (WPX)
  - b. Well Nome and All Number
  - c (ocution (USIR)
- All piping will be rerouted to an alternative produced water storage/disposal location (e.g. surface tanks. temporary fractank...). The well will be temporarily shut in until the rerouting is completed.
- All produced water will be removed from the BGT following discharge pipe retouting Froduced water will be disposed at one of the following NMOCD approved facilities depending on the proximity of the BGT site. Rosa Unit SWD #1 (Order SWD 916. API 30.039-27055). Rosa Unit #94 (Order SWD 3RP-1003.0. API 30.039.23035). Jillson Fed. SWD #001 (Order RT0168/RT0168A, AFI 30.039.25465), Middle Mesa SWD #001 (Order SWD 350.0. AFI 30.045.27004). and/or Basin Disposal (Permit. NM.01-0005).

solids and studges will be shoveled and Yor validimed out for disposal at Envirotech (Fermit Non-per NM ()). ((i))

Who will out faint not approval ton 14MOCD to assore it as a clear reason tectain the ECL and provide documentation of the association of the ECL in the closure report. See materials will be recycled or reused as approved by the Englas to the regions tanks will be expensely a tupo or shielded and ELA created for disposal as sollowaste. Their materials will

be cleaned without soils or contaminated material for disposal as solid waste. Firetallass tanks and liner materials will malet the conditions of paragraph 1 subsection D of 19.15.9.712 NMAC. Disposal will be at a licensed disposal facility, presently San Juan Regional randfill operated Ly Waste Management under IMMED Fermit SWM 052426.

- Any equipment associated with the BGI that is no longer required for some other purpose following the closure will be removed from the location.
- tollowing removal of the tank and any liner material, a five point composite sample, will be taken of the excavation and fested per 19.15.17.13(E)(4) NMAC as identified in Table 1. Grab samples will be collected from any area that is wet discolored or showing other evidence of a release. Results will be report to the Division following receipt from the lab on Form C. 141.

Table 1 Closure Criteria for BGTs

	Components	Testing Methods	Closure Limits (mg/Kg)
,	Benzene	FPA SW 846 Method 8021B or 8260B	0.2
1	BTEX	IPA SW-846 Method 8021B or 8260B	50
1	TEH	EFA SW-846 Method 418 1/1	100
i	Chlorides	EPA SW 846 Method 300 111	250%

Method modified for solid waste

If hack provind concentration of CH longes greater than 260 mg, by the religible concentration with  $\epsilon$  are a for also  $\epsilon$ 

- If the Division and/or WEX determine there is a release. WPX will comply with 19.15.3.117. TIMAC and 19.15.1.19 NMAC.
- Upon completion of the tank removal, the excavation will be backfilled with non-waste earthen material compacted and covered with a minimum of one-foot of top soil or background thickness whichever is greater and to existing grade. The suiface will be recontoired to match the native grade and prevent ponding.
- For those portions of the former pit are a no longer required for production activities. Whi will seed the disturbed areas the first growing scason after the pit is covered. Seeding will be accomplished via diffing on the contour whenever practical or by other Division approved methods. Vegetative acressifile equal 70% of the native perennial vegetative cover for impacted) consisting of at least three native plant species including at least one grass 1 of not including nosious weeds and mointained that cover through two successive growing scasons. Repeat seeding or plantling will be continued until successful vegetative growth occurs. The of a surface owner agreement requires reseeding or other surface restoration that an not meet re-vegetation requirements of 15-15-17-13 FNMAC, then Wf X will submit the proposed alternative with written documentation that the surface owner agrees to the alternative, for Division approval.
- For those portions of the former pit area required for production activities reseeding will be done at well abandonment, and following the procedure noted above.

#### Closure Report

All closure activities will include proper accomentation and will be submitted to OCD within 60 days of the BCI closure on a Crosure kernal using Division Fami C 144. The Report will include the tallowing.

- Troop of Chapter Constraints and the contract of the contract of
- · Proceedings & or secretical
- พ.ศ. คนาร์นานา คนาร์นา
- · Avenional name on the terms

- Continuation Sometime Control of the
- · Lacidosco foculo (46%) + Bi confictedo (1914 + 114)
- · // the energial testing testing
- · Fricto Decembera protect Ecophics of

WELLS W/FEDERAL							
SURF MGT	API	FM7	<u>SEC</u>	IWN	RNG	PIT TYP	E CONSTRUCTION MATERIAL
COX CANYON UNIT #001	3004511397	PLANCO MV	16N	32N	111/	BG1	DBL WALL STEEL FIBERGLASS TANK w/BANDED 20 mi
COX CANYON UNIT #001A	3004522086	PLANCO MV	16C	3211	1 1 VV	BG1	HIDDE SECONDARY LINER FIBERGLASS TANK WBANDED 20 nm
COX CANYON UNIT #001B	3004530791	BLANCO MV	16l	32N	11W	BG1	HDPE SECONDARY LINER
COX CANYON UNIT #001C	3004532023	BLANCO MV	16 <b>F</b>	3210	11W	BG1	DBL WALL STEFL FIRERGLASS TANK w/BANDED 20 mil
COX CANYON UNIT #003	3004511495	BLANCO MV	91	32N	11V√	BGT	HDPE SECONDARY LINER
COX CAIN ON UNIT #003A	3004522088	BLANCO MV	9£,	32N	11V/	BGI	DBI WALL STEFF
COX CANYON UNIT #003B	3004530871	BLANCO MV	9J	32N	11W	BG1	DBI WALL STEEL
COX CANYON UNIT #004	3004511368	BLANCO MV	21A	32N	11W	BGT	DBL WALL STEFI
COX CANYON UNIT #004A	3004522093	BLANCO MV	21P	32N	11W	BG1	DBL WALL STEEL
COX CANYON UNIT #004B	3004532186	BLANCO MV	21f	3211	11W	BGT	DBI WALL STEEL
COX CANYON UNIT #005	3004511326	BLANCO MV	21K	32N	1 1 Vv	BGI	DBI WALL STEEL
COX CANYON UNIT #005A	3004522094	BLANCO MV BASIN DK /	211)	32N	11VV	BGT	DBL WALL STEEL
COX CANYON UNIT #005B	3004532142	BI ANCO MV	2111	32N	11W	BGT	DBL WALL STEEL
COX CANYON UNIT #005C	3004533493	BLANCO MV	21f	3214	11W	BG1	DBI WALL STEEL
COX CANYON UNIT #006	3004511463	BLANCO MV	16A	32N	11W	BGT	DBI WALL STEEL
COX CANYON UNIT #006A	3004522095	BLANCO MV	161	3211	11W	BGT	DBL WALL STEEL
COX CANYON UNIT #0068	3004£32693	BLANCO MV	16B	32N	11W	BGT	DBI WALL STEFF
COX CANYON UNIT #006C	3004532733	BLANCO MV	16()	32N	11W	#G1	DBI WALL STEEL
COX CANYON UNIT #007	3004511455	BLANCO MV	176	32N	11W	FGF.	DBL WALL STEEL
COX CANYON UNIT #007A	3004522091	BLANCO MV	170	32N	11W	BGT	DBL WALL STEFL
COX CANYON UNIT #007C	3004533018	BASIN DK	17K	32N	11W		DBL WALL STEEL FIBERGLASS TANK w/BANDED 20-mil
COX CANYON UNIT #008	3004511492	BLANCO MV	18	32N	11Vv		HDPE SECONDARY LINER
COX CANYON UNIT #008A	3004522096	BLANCO MV	1711	32N	11W		DBL WALL STEEL FIBERGLASS TANK w/BANDED 20 mil
COX CANYON UNIT #008B	3004532080	BLANCO MV	8P	32N	11W	BG1	HDPE SECONDARY LINER FIBERGLASS TANK W/BANDED 20 mil
COX CANYON UNIT #008C COX CANYON UNIT #009A	3004531187	BLANCO MV	17F	3211	11W	BGT	HDPE SECONDARY LINER FIBERGLASS TANK W/BANDE() 20 mil
COX CANYON UNIT #009B	3004522092	BLANCO MV BASIN DK /	20D	32N	11W		HDPE SECONDARY LINER
COM	3004533926	BLANCO MV BASIN DK /	20B	32N	11W	BG1	DBL WALL STEEL
COX CANYON UNIT #009C	3003933851	BL ANCO MV	20f	3211	11W		DBL WALL STEEL
COX CANYON UNIT #013	3004521489	BLANCO PC	20A	32N	11W		FIBERGLASS TANK W/BANDFD 20-mil HDPE SECONDARY LINER

WELLS WIFEDERAL SURF MGT	ADI	EAAT	650	T 1 A / A /	DA10	מעז זעם	E CONSTRUCTION MATERIAL
COX CANYON UNIT #023	API	FMT	3EC	IVVN	KNG	PII I YP	FIBERGLASS TANK w/BANDED 20 mil
COM CANYON UNIT #023	3004522537	BLANCO PC	17(	32N	11VV	BG1	HDPE SECONDARY LINER
	5004022007	DI MACCALL	173	57Z IV	1177	DQ I	FIBERGLASS TANK WBANDED-20 mil
COX/CANY ON UNIT#025	3004522572,	RUZKIMA DI	- 90	32N	1 11/4/	, por	HDPE SECONDARY LINER
The state of the s	004027017.	DIAMOOPIC.		3219		- POI	FIBERGLASS TANK WBANDED 20 mil
COX CANYON UNIT #200	3004527878	BASINETC	91	32N	1177	BG1	HDPE SECONDARY LINER
	1007 GZ 7 G7 G	DACTIVE IX	.,,	3214	1111	17(7)	FIBERGLASS TANK W/BANDED 20-mil
COX CANYON UNIT #200A	3004532126	BASINETC	9()	3211	11W	BGT	HOPE SECONDARY LINER
	0004002120	DAGINETIC	,(,	(12.14	1100	1,0,1	FIBERGLASS TANK W/BANDED 20 mil
COX CANYON UNIT #203	3004527872	BASINETC	17A	32N	111/	BGT	HDPE SECONDARY LINER
	3004027072	DAGINETO	116	JZIN	1111	001	
MADDOX #001	3004511487	BLANCO MV	10N	32N	11 <b>V</b> V	BG1	DBI WALL STELL
	3004711407	DI MINOCHIT	1(/14	3214	1100	1001	DOL WALL GILLE
MADDOX #001A	3004523539	BLANCO MV	10F)	32N	11W	BGI	DBI WALL STEEL
THE BOX HOUT	3004323033	DI ANCO MIV	101	SZIV	1144	DOT	DDL WALL STELL
NM 32 11 #001	3004511309	BLANCO MV	200	32N	11W	RGI	DBL WALL STEEL
1	300401 (308	BASIN DK /	200	J214	1174	DOT	
NM 32 11 #001B COM	3004532024	BLANCO MV	203	32N	11W	BGT	DBL WALL STEEL
1 100 10 0011	OUGHOUZUZ4	BASIN DK /	200	DZ IV	1 1 7 7	1501	DDE WAIT OILLE
NM 32 11 #001C COM	3004532804	BLANCO MV	201	32N	1 1 VV	BGT	DBI WALL STEEL
Third of the Com	3004332004	DE THEORY IN	5 (1)	DZIV	1144	LIO1	FIBERGLASS TANK w-BANDED 20 mil
NM 32 11 #002 COM	3004511380	BLANCO MV	19A	32N	1 IW	BG1	HDPE SECONDARY LINER
	3007311300	BI AIROCA KIV	1071	0214	1100	DOT	THE E OF SCHOOL THE T
NM 32 11 #002A COM	3004529017	BLANCO MV	190	3211	111	BGT	DBL WALL STEEL
	0004020077	BI7000 MI	, ,,,,	CZI	1100	(,(,))	DEC WALL CHEEK
NM 32 11 #002B COM	3004532670	BLANCO MV	191	32N	11W	BG1	DBI WALL STEFI
	500,4052010	BEAITOO KII	1,71	1/211	1188	1,01	DDI WALL OTELL
NM 32 11 #002C COM	3004533077	BLANCO MV	19G	32N	11VV	BG1	DBL WALL STEEL
	0.04000011	DI AITOCANIA	100	SZIN	1100	DOT	DDI WALL OTELL
ROSA UNIT #001 SWD	3003927055	SWD	231	31N	06W	BGI	DBL WALL STEEL
	1000027000	BASIN DK /	201	Ç* 11 <b>V</b>	(16)	DOT	FIBERGLASS TANK WEANDED 20 mil
RUSA UNIT #001E	3003925411	BLANCO MV	11P	31N	06₩	BGT	HDPE SECONDARY LINER
	0000020411	BLANCO MV	1 11	0118	OGVV	DOT	
ROSA UNIT #005A	3003925407	ROSA PC	261	31N	06VV	BG1	DBI WALL STEFL
	5000325407	BASIN DK /	2 (7)	JIIV	OUV	DGT	DDI WALL STEEL
ROSA UNIT #0056	3003926927	BLANCO MV	26B	3114	06W	BGT	DBL WALL STEEL
	(MORIZ (MZ)	DITTION IN	2 017	(1114	OOVV	001	FIBERGLASS TANK W/BANDED 20 mil
ROSA UNIT #005Y	300392607B	BLANCO MV	26H	3111	OGW	BG1	HDPE SECONDARY LINER
	300/302 007 0	BLANCO MV /	2(//1	0114	((()))	1,01	FIBERGLASS TANK W/BANDED 20 mil
ROSA UNIT #008	3003907944	ROSA PC	26M	31N	OGW	BG1	HDPE SECONDARY LINER
•	0000007011	BLANCO MV /	* (/(*)	5114	(/(/**	201	FIBERGLASS TANK W/BANDED 20 mil
ROSA UNIT #008	3003907944	ROSA PC	26M	31N	OGW <sup>c</sup>	BGT	HDPE SECONDARY LINER
		BLANCO MV /	• (		0011	2,01	FIBERGLASS TANK W/BANDED 20 mil
ROSA UNIT #008A	3003925430	ROSA PC	26D	31N	06W	BGT	HDPE SECONDARY LINER
	2 3 3 3 5 5 5 6 6					,	FIBERGLASS TANK W/BANDED 20 mil
ROSA UNIT #008C	3003926944	BLANCO MV	26N	31N	06W	BGT	HDPE SECONDARY LINER
	and the second section of the second						FIBERGLASS TANK w/BANDED 20 mil
POSA UNIT #009	3003907975	BLANCO MV	11K	31N	06W	BGT	HDPE SECONDARY LINER
		BASIN DK /		··•			
ROSA UNIT #009A	3003925584	BLANCO MV	11C	31N	06W	BGT	DBL WALL STEEL
							FIBERGLASS TANK W/BANDED 20 mil
:08A UNIT #009B	3003927042	BLANCO MV	11E	31N	06W	BGT	HDPE SECONDARY LINER
		•					FIBERGLASS TANK w/BANDED 20 mil
'OSA UNIT #010B	3003926556	BLANCO MV	13N	31N	06W	BG1	HDPE SECONDARY LINER
				· · · ·	0011	501	
OSA UNIT #010C	3003926918	BLANCO MV	13N	31N	06W	BG7	DBL WALL STEEL
						201	
OSA UNIT #0100	3003926556	BLANCO MV	13N	31N	06W	BGT	DBL WALL STEEL

WELLS W/FEDERAL		· · · · · · · · · · · · · · · · · · ·					
SURF MGT	API	FM1	SEC	TWN	RNG	PITTYP	E CONSTRUCTION MATERIAL
ROSA UNIT #012A	2000001000	BLANCO MV /		2411	111 161	<i>t.</i> (2.1	13173 1444 120
KOSK ONLI HOLYK	3003925900	ROSA PC BASIN DK /	15J	,3114	Willi	F-(3.1	DBL WALL STEEL FIBERGLASS TANK W/BANDED 20 mil
ROSA UNII #012B	300392655!	BLANCO MV	15F	31N	0617	BG1	HDPE SECONDARY LINER
ROSA UNIT #012C	3003929486	BLANCO MV	15A	3114	06W	5(2)	SINGLE WALL STELL
ROSA UNIT #013		DI ALICO MI	1441		414.14	127.2	FIBERGLASS TANK W/BANDED 20 mil HDPE SECONDARY LINER
ROSA ONIT #(13	3003907936	BLANCO MV	31G	3114	05W	BG1	FIBERGLASS TANK W/BANDED 20 mil
ROSA UNIT #013A	3003926298	BLANCO MV	311	31N	05VV	BGT	HDPE SECONDARY LINER
		BASIN DK /					
ROSA UNIT #013B COM	3003929834	BLANCO MV	31A	31N	05Vv	PG1	DBL WALL STEEL
ROSA UNIT #014	200200704	DI ANICO ANI	(.0D	0.41.4	0.4.4.4	0.01	FIBERGLASS TANK w/BANDF() 20 mil
ROSA OINTI HUTA	3003907958	BLANCO MV	23B	31N	06W	BG1	HDPE SECONDARY LINER FIBERGLASS TANK w/BANDED 20 mil
ROSA UNIT #014A	3003926280	BLANCO MV	231	31N	ObVV	BG1	HDPE SECONDARY LINER
		BASIN DK /					
ROSA UNIT #014(.	3003930132	BLANCO MV	23H	31N	06W	HG1	DBI WALL STEEL
ROSA UNIT #015	3003907946	BLANCO MV	2017	2.481	(16.16)	DC I	FIBERGLASS TANK w/BANDED 20-mil HDPF SECONDARY LINER
NOSA (MIT WOTE	3003907940	DI ANCO IVIV	2911	31N	05VV	BGT	FIBERGLASS TANK w/BANDED 20 mil
ROSA UNIT #016	3003907963	BLANCO M\	14N	3411	0674	BGI	HDPE SECONDARY LINER
							FIBERGLASS TANK w/BANDED 20-mil
ROSA UNIT #016A	3003925496	BLANCO MV	14C	31N	06Vv	BGT	HDPE SECONDARY LINER
ROSA UNIT #016B	3003926218	BLANCO MV	141/1	31N	06VV	BGT	FIBERGLASS TANK W/BANDED 20-mil HDPE SECONDARY LINER
TOOK ONLY FORMS	3003920210	DI ANCO MIV	14101	SIIN	UOVV	וכוכו	FIBERGLASS TANK w/BANDED 20 mil
ROSA UNIT #017A	3003926272	BLANCO MV	200	31N	05W	BG1	HDPE SECONDARY LINER
		BASIN DK /					FIBERGLASS TANK w/BANDED 20 mil
ROSA UNIT #017B	3003926971	BLANCO MV	20J	31N	05W	BGI	HDPE SECONDARY LINER
ROSA UNIT #018	3003907960	BLANCO MV / ROSA PC	22H	31N	06W	BGT	FIBERGLASS TANK w/BANDED 20-mil HDPE SECONDARY LINER
	3003307300	BLANCO MV /	2 2.1 1	27174	()() * *	1701	
ROSA UNIT #018A	3003925436	ROSA PC	22F	31N	06VV	SGT	DBI WALL STEEL
DOCA LINIE WOADD							
ROSA UNIT #018B	3003927052	BLANCO MV	220	31N	06W	BGT	DBL WALL STEEL FIBERGLASS TANK W/BANDED 20 mil
ROSA UNIT #019	3003907955	BLANCO MV	24K	31N	06W	661	HDPE SECONDARY LINER
							FIBERGLASS TANK W/BANDED 20 mil
ROSA UNIT #019B	3003926560	BLANCO MV	241	3111	06W	BGI	HDPE SECONDARY LINER
ROSA UNIT #019C	3003929625	BLANCO MV	24D	31N	OCIA.	BGT	DBI WALL STEEL
NOOA DITT WORK	3003929025	DE AINCO IVIV	2417	9111	06W	D(3)	DBI WALLSTEEL
ROSA UNIT #019C	3003929625	BLANCO MV	24D	31N	06W	BG1	DBL WALL STEEL
							FIBERGLASS TANK w/BANDED 20 mil
ROSA UNIT #020	3003907969	BLANCO MV	14G	3111	06W	BG1	HDPE SECONDARY LINER
ROSA UNIT #020A	3003925495	BLANCO MV	14()	31N	06W	BG1	FIBERGLASS TANK W/BANDED 20 mill HDPE SECONDARY LINER
	3000020400	DE MICO MIC	140	3114	OGVV	501	THE SECOND IN THE I
ROSA UNIT #020B	3003926220	BLANCO MV	14A	31N	06W	BGT	DBL WALL STEEL
D004   INT   111000							FIBERGLASS TANK W/BANDED 20 mill
ROSA UNIT #020C	3003926221	BLANCO MV	14J	31N	06W		HDPE SECONDARY LINER
ROSA UNIT #021A	3003926121	BLANCO MV	23C	31N	06W		FIBERGLASS TANK W/BANDED 2()-mil HDPE SECONDARY LINER
	COCCUECTET	50			0011	20,	2 22 22
ROSA UNIT #021B	3003926554	BLANCO MV	23K	31N	06VV	BG1	DBL WALL STEEL
ליטיב נואון במסל		DI ANG 25 5 2 2 2 2 2 2 2 2 2 2 2 2 2 2 2 2 2	40.4		0.514		FIBERGLASS TANK W/BANDED 20-mill
ROSA UNIT #U2L	3003907971	BLANCO MV	18A	31N	05VV	BG1	HDPE SECONDARY LINER

.

WELLS W/FEDERAL SURF MGT	API	FMT	SEC	TWN	RNG	PIT TYPE	CONSTRUCTION MATERIAL
							FIBERGI ASS TANK W'BANDED 20 n
ROSA UNIT #027A	3003926390	BLANCO MV	18C	4111	05Vv	BGT	HOPE SECONDARY LINER
							FIBERGLASS TANK WBANDED 20 n
ROSA UNIT #023	3003907942	BLANCO MV	29M	31N	05Vv	BGT	HDPE SECONDARY LINER
							FIBERGLASS TANK v./BANDED 20 n
ROSA UNIT #023B	3003926553	BLANCO MV	29L	31N	05.00	BG1	HDPE SECONDARY LINER
		BASIN DK /	2 (. 1.	****		• • • •	LIBERGLASS TANK W/BANDED 20 n
ROSA UNIT #023C	3003927609	BLANCO MV	291	31N	05VV	BGI	HDPE SECONDARY LINER
-	CONTROL CONTROL		1.01	0114	0011	17()1	FIBERGLASS TANK W/BANDED 20 m
ROSA UNIT #024	3003907933	BLANCO MV	32M	31N	05Vv	BGI	HDPE SECONDARY LINER
	CONTOCO CONT	BASIN DK /	72 111	Ø 11 <b>▼</b>	(/./ * *	1701	
ROSA UNIT #024A	3003925568	BLANCO MV	32E	31N	05VV	SGI	DBL WALL STEEL
102 17	2003323000		,) <i>Z</i> L	0114	OOVV	3(3)	FIBERGLASS TANK w/BANDED 20 n
ROSA UNIT #024B	200 10060 20	BASIN DK /	ere ki	241	()/ 14/	1107	HDPE SECONDARY LINER
NOSA UNIT #0246	3003926630	BLANCO MV	32N	31N	05W	BGT	
ROSA UNIT #0240		BASIN DK /	(1/1/2)		05144	0.02	FIBERGLASS TANK W/BANDFD 20 n
NOSA UNIT #0240	3003926968	BLANCO MV	32C	31N	05W	BG1	HDPE SECONDARY LINER
DATE A LIMIT HOSEA	1000000000	BASIN DK /	000				PSOU MAIN CAPPA
ROSA UNIT #026A	3003925580	BI ANCO MV	32O	31N	05W	SGT	DBL WALL STEEL
DAS A LINUT HOOVED		0.400.104					
ROSA UNIT #026B	3003926788	BASIN DK	32G	31N	05W	SG1	DBI WALL STEEL
D4.64 + 11.117 + 000							FIBERGLASS TANK W/BANDED 20 n
ROSA UNIT #029	3004511136	BLANCO MV	32H	32N	0644	BG1	HDPE SECONDARY LINER
		BASIN DK /					FIBERGLASS TANK w/BANDED 20 m
POSA UNIT #029B	3004530709	BLANCO MV	32B	32N	06W	BGI	HDPE SECONDARY LINER
		BASIN DK /					
ROSA UNIT #029M	3004529584	BLANCO MV	321	3211	(IOVV	BGT	DBL WALL STEFL
		BASIN DK /					FIBERGLASS TANK W/BANDED 20 m
ROSA UNIT #030 COM	3003925570	BLANCO MV	120	31N	0677	BGI	HDPE SECONDARY LINER
							FIBERGLASS TANK WBANDED 20 m
ROSA UNIT #030A	3003926068	BLANCO MV	12M	31N	06W	BGT	HDPE SECONDARY LINER
							FIBERGLASS TANK W/BANDED 20 m
ROSA UNIT #030P	3003926601	BLANCO MV	12N	3111	06W	BGT	HOPE SECONDARY LINER
ROSA UNIT #030C	3003929842	BLANCO MV	121	31N	06W	BGT	DBL WALL STEEL
							FIBERGLASS TANK w/BANDED 20 m
ROSA UNIT #031	3003926279	BLANCO MV	17C	31N	05VV	BG1	HDPE SECONDARY LINER
							FIBERGLASS TANK W/BANDED 20 ni
ROSA UNIT #031A	3003926346	BLANCO MV	171	31N	05W	BG1	HDPE SECONDARY LINER
		BASIN DK /					FIBERGLASS TANK W.BANDED 20 mi
ROSA UNIT #031E	3003926579	BLANCO MV	17[)	31N	05W	BG1	HDPE SECONDARY LINER
							FIBERGLASS TANK w/BANDED 20 m
ROSA UNIT #031C	3003926578	BLANCO MV	17N	3111	05W	BGT	HDPE SECONDARY LINER
		BLANCO MV /					
ROSA UNIT #032	3003925389	ROSA PC	2111	31N	06VV	BG1	DBL WALL STEEL
		BLANCO MV /					
ROSA UNIT #032A	3003925417	ROSA PC	211	31N	06W	BG1	DBI WALL STEFL
		BASIN DK /					- FIBERGLASS TANK w/BANDED 20 m
ROSA UNIT #032B	3003926771	BLANCO MV	21G	31N	06W	BG1	HDPE SECONDARY LINER
		BASIN DK /					IBERGLASS TANK W/BANDE() 20 m
ROSA UNIT #032(	3003927240	BLANCO MV	21F	31N	(InVV		HDPE SECONDARY LINER
		_,		2111			IBERGLASS TANK W/BANDED 20 m
ROSA UNIT #034	3003907984	BLANCO MV	36B	3211	06W		HDPE SECONDARY LINER
- <del>-</del> -	F00 1000000	DETAIL OF IVE	(ALAE)	0414	OUTT		and the content of the content
ROSA UNIT #034A	3003926119	BLANCO MV	361	32N	06W	BGT I	OBL WALL STEEL
	WOODE 110	DI AROO MIY	2771	JEIN	COVV	וייים ו	DE TALL O'LLL
ROSA UNIT #034A	3003926119	BLANCO MV	361	32N	06W	SG1 (	OBL WALL STEEL
= · · · · · · · · · · · · · · · · · · ·	0000020110	DEFICEO WY	300	SZIN	OOVV		FIBERGLASS TANK W/BANDED 20 m
ROSA UNIT #034E	3003926629	BLANCO MV	36J	32N	06W		HDPE SECONDARY LINER

WELLS W/FEDERAL SURF MG1	API	FMT	SEC	TWN		РІТ ТҮР	E CONSTRUCTION MATERIAL
ROSA UNIT #0340	3003926969	HLANCO MV	36H	32N	()( <sub>&gt;</sub> V <sub>2</sub>	£4C5.1	FIBERGLASS TANK W/BANDED 20 mill HDPL SECONDARY LINER
ROSA UIJIT #035X	3004510996	PLANCO MV	5K	3111	0614	BG1	DBI WALL STEEL FIBERGLASS TANK WBANDED 20 mil
ROSA UNIT #036 .	3003907977	PLANCO MV	1111	311/	oovv	F61	HDPE SECONDARY LINER FIBERGLASS TANK WBANDED 20 mil
ROSA UNIT #0360	3003930182	BLANCO MV	11(7	3111	o6W	BGT	HDPE SECONDARY LINER FIBERGLASS TANK WBANDED 20 mil
ROSA UNIT #041	3003907981	BLANCO MV BASIN DK /	5K	3111	05W	BGT	HDPE SECONDARY LINER FIBERGLASS TANK W/BANDED 20 mil
ROSA UNIT #041B	3003927014	BLANCO MV	6P	31N	0574	BG1	HDP'E SECONDARY LINER
ROSA UNII #044	3003925873	BLANCO MV	, 35K	32N	06W	BG1	DBI WALL STEFI
ROSA UNIT #044A	3003926161	BI ANCO MV	35E	32N	06W	SGI	SINGLE WALL STEEL
ROSA UNIT #044A	3003926161	BLANCO MV	35E	32N	06W	SGI	DBL WALL STEEL FIBERGLASS TANK W/BANDED 20 mil
ROSA UNIT #044B	3003926685	BLANCO MV	35C	32N	(16VV	BGT	HDPF SECONDARY LINER FIBERGLASS TANK W/BANDED 20 mil
ROSA UNIT #045	3003923013	BLANCO MV BASIN DK /	Me	31N	05Vv	BGT	HDPE SECONDARY LINER HBERGLASS TANK W/BANDED 20 mil
ROSA UNIT #046A	3003926986	BLANCO MV	80	31N	05W	BG1	HDPE SECONDARY LINER
ROSA UNIT #051	3003920289	BASIN DK	23C	31N	06 <b>V</b> v	BGT	DBL WALL STEEL FIBERGLASS TANK w/BANDED 20 mil
ROSA UNIT #053	3003920293	BASIN DK	8B	31N	05W	BGT	HDPE SECONDARY LINER FIBERGLASS TANK W/BANDED 20 mil
ROSA UNIT #055	3003920923	BASIN DK	341	31N	()5VV	BGT	HDPE SECONDARY LINER
ROSA UNIT #059 DK	3003923270	BASIN DK	25N	31N	06W	BGT	DBL WALL STEEL FIBERGLASS TANK w/BANDED 20-mil
ROSA UNIT #059 GL	3003923270	UNDES GL	25N	31N	06/v	BGT	HDPE SECONDARY LINER FIBERGLASS TANK W/BANDED 20 mil
ROSA UNIT #060	3004529798	BLANCO MV	41	31N	06Vv	BG1	HDPE SECONDARY LINER
ROSA UNIT #064	3003921703	BASIN DK	29A	31N	05VV	BGT	DBL WALL STEEL
ROSA UNIT #064	3003921703	BASIN DK BASIN DK /	29A	31N	05W	SGI	DBI WALL STEEL
ROSA UNIT #064M	3003925563	BLANCO MV	29F	31N	05W		DBL WALL STEEL FIBERGLASS TANK WBANDED 20-mil
ROSA UNIT #065	3003921702	BASIN DK	17A	31N	05W	BGT	HDPE SECONDARY LINER FIBERGLASS TANK W/BANDED 20 mil
ROSA UNIT #06C	3003921758	BASIN DK BASIN DK /	13L	31N ·	06Vv	BGT	HDPE SECONDARY LINER FIBERGLASS TANK W/BANDED 20-mil
ROSA UNIT #066M	3003925747	BI ANCO MV	13F	31N	06W	BGT	HDPE SECONDARY LINER FIBERGLASS TANK W/BANDE() 2() mil
ROSA UNIT #072	3003925509	BLANCO MV	Gl	31N	05W	BGT	HDPE SECONDARY LINER
ROSA UNIT #072A	3003925795	BI ANCO MV	6K	31N	05W	BG1	FIBERGLASS TANK W/BANDED 20 mil HDPE SECONDARY LINER
ROSA UNIT #075	3004529895	BLANCO MV	101	31N	0677	BGT	FIBERGLASS TANK W/BANDED 20 mil HDPE SECONDARY LINER
ROSA UNIT #075A	3004529854	BLANCO MV	4()	31N	06W	BGT (	FIBERGLASS TANK W/BANDED 20 mil HDPE SECONDARY LINER
ROSA UNIT #07 <sup>±</sup>	3003922538	DK/UNDES GL/BLANCO	33L	31N	05W		IBERGLASS TANK W/BANDED 20 mil IDPE SECONDARY LINER

WELLS W/FEDERAL SURF MG1	API	FMT	SEC.	 TWN	RNG	PIT TYP	E CONSTRUCTION MATERIAL
		BASIN DK /		_ :			
ROSA UNIT #079	3003922539	BLANCO MV BASIN DK	22K	3111	06W	BGT	DBL WALL STEEL
ROSA UNIT #079	3003922539	BLANCO MV /	22K	31N	06W	5G I	DBL WALL STEEL
ROSA UNIT #079A	3003925412	ROSA PC BASIN DK /	221	3111	06W	BG1	DBL WALL STEEL
ROSA UNIT #079B	3003926920	BI ANCO MV	22C	3114	06W	BGT	DBL WALL STEEL
ROSA UNIT #0790	3003929902	BLANCO MV BASIN DK /	315	31N	05W	BGT	DBL WALL STEEL FIBERGLASS TANK w/BANDED 20 mil
ROSA UNIT #080	3003922537	BI ANCO MV	вĸ	31N	05Vv	BG1	HDPE SECONDARY LINER FIBERGLASS TANK W/BANDED 20 mil
ROSA UNIT #080A	3003926413	BLANCO MV	8f	31N	05W	BG1	HDPE SECONDARY LINER FIBERGLASS TANK W/BANDED 20 mil
ROSA UNIT #085	3003922/78	BASIN DK	50V	31N	05W	BGT	HOPE SECONDARY LINER FIBERGLASS TANK WBANDED 20 mil
ROSA UNIT #085	3003922778	BLANCO MV	20A	31N	0517	BG1	HDPE SECONDARY LINER FIBERGLASS TANK W/BANDED 20 mil
ROSA UNIT #085A	3003926314	BLANCO MV	20C	31N	05W	ВоТ	HDPE SECONDARY LINER
ROSA UNIT #085F	3003930130	BLANCO MV	200	1116	05W	BG1	DBI WALL STEEL
ROSA UNIT #086	3003922766	UNDES GI BLANCO MV /	12W	31N	04W	SGT	SINGLE WALL STEEL
ROSA UNIT #088	3004525140	ROSA PC	48	31N	06W	BGT	DBL WALL STEEL FIBERGLASS TANK w/BANDED 20 mil
ROSA UNIT #089	3003922782	BI ANCO MV	34A	32N	06VV	BG1	HDPE SECONDARY LINER FIBERGLASS TANK w BANDED 20 mil
ROSA UNIT #089A	3003925512	BI ANCO MV	34()	32N	06W	FG1	HDPE SECONDARY LINER
ROSA UNIT #(189B	3003926851	PLANCO MV	341	32N	06W	BGI	DBI WALL STEEL
ROSA UNIT #089C	3003926674	BLANCO MV	346	3211	06W	SGI	SINGLE WALL STELL FIBERGLASS TANK WBANDED 20 mil
ROSA UNIT #090 COM	3004525370	BLANCO MV	33G	32N	0674	BGT	HDPE SECONDARY LINER
KOSA UNIT #090A COM	3004529259	BLANCO MV	33G	3211	06\4	BG1	()BL WALL STEEL FIBERGLASS TANK w/BANDE() 20 mil
ROSA UNIT #091	3003922780	BI ANCO MV	3511	32N	06W	BGT	HDPE SECONDARY LINER
KOSA UNIT #091A	3003925790	BLANCO MV -	35O	32N	06W	SG1	DBL WALL STEFL
ROSA UNIT #091B	3003926684	BI ANCO MV	36P	32N	06W	BGT	DBL WALL STEEL FIBERGLASS TANK WBANDED 20 mil
ROSA UNIT #091C	3003926991	BI ANCO MV	35G	32N	06W	BGT	HDPE SECONDARY LINER FIBERGLASS TANK W/BANDED 20 mil
ROSA UNIT #098	3003923265	BASIN DK / GL BASIN DK /	231	31N	06W	BG1	HDPE SECONDARY LINER
ROSA UNIT #100B	3003929547	BI ANCO MV	21()	31N	06W	BGT	DBI WALL STEEL
:0SA UNIT #100C	3003929851	BLANCO MV BLANCO MV /	21K	31N	06W	BG1	DBL WALL STEEL
OSA UNIT #100F	3003925135	ROSA PC	211	31N	06W	SG1	SINGLE WALL STEEL
OSA UNIT #1011/1	3003925577	BLANCO MV	24F	31N	06W	BG1	DBL WALL STEEL FIBERGLASS TANK w/BANDED 20 mil
OSA UNIT #108	3003923506	BASIN DK / GI	7G	3111	05W	BG1	HDPE SECONDARY LINER

WELLS W/FEDERAL SURF MG1	API	FM1	SEC	IWN	RNG	PIT TYP	E CONSTRUCTION MATERIAL
ROSA UNIT #119	3003925145	PASIN DK	16N	31N	ot W	BG1	DBL WALL STEEL FIBERGLASS TANK w/BANDED 20 mil
ROSA UNIT #125	3003925144	BLANCO MV	13B	3111	06W	BGT	HDPL SECONDARY LINER
ROSA UNIT #1250	3003929843	BLANCO MV BASIN DK /	136	3118	(VBV)	BG1	DBL WALL STEEL FIBERGLASS TANK WBANDED 20 mil
ROSA UNIT #125E .	3003925526	BLANCO MV	13.1	3114	06VV	HG1	HOFE SECONDARY LINER
ROSA UNIT #129	3003926304	BLANCO MV	34F	32N	06W	bG1	DBL WALL STEEL
ROSA UNIT #129A	3003926297	BLANCO MV	34K	32N	06W	RGT	DBL WALL STEEL FIBERGLASS TANK w/BANDED 20 mil
ROSA UNIT #137	3003925410	BLANCO MV BLANCO MV /	31K	31N	05W	BG1	HDPE SECONDARY LINER
ROSA UNIT #137A	3003926129	ROSA PC	311	31N	05W	BG1	DBL WALL STEEL FIBERGLASS TANK W/BANDED 20 mil
ROSA UNIT #137B	3003927002	BLANCO MV /	31F	31N	05W	BG1	HDF'E SECONDARY LINER FIBERGLASS TANK W/BANDED 20 mil
ROSA UNIT #138	3004529147	ROSA PC BLANCO MV /	171	31N	06VV	BG1	HDPE SECONDARY LINER
ROSA UNII #138A	3004529134	ROSA PC	1711	3111	06W	BG1	DBI WALL STEEL
ROSA UNIT #138B	3004532168	BLANCO MV	1711	3111	0674	BGT	DBI WALL STEFF
ROSA UNIT #139A	3004529600	BLANCO MV	17M	311	0647	BGT	DPL WALL STEEL
ROSA UNIT #140	3003925435	ROSA PC	22K	31N	06W	BG1	DBL WALL STEEL
ROSA UNIT #144	3003925421	ROSA FC	26A	31N	06W	BG1	DBI WALL STEEL
ROSA UNIT #145C	3004533086	BLANCO MV	16F	3111	06W	861	DBI WALL STEEL FIBERGLASS TANK w/BANDED 20 not
ROSA UNIT #146A	3003925513	BLANCO MV	28N	31N	05W	BG1	HDPE SECONDARY LINER
ROSA UNIT #1460	3003930187	BLANCO MV	28B	31N	05W	BG1	DBI WALL STEFF
ROSA UNIT #148	3003925493	BASIN DK	20	31N	W80	BG1	DBI WALL STEFL
ROSA UNIT #148A	3003925776	BLANCO MV	2N	31N	06W		DBL WALL STEEL FIBERGLASS TANK w/BANDED 20 mil
ROSA UNIT #148B	3003926985	BLANCO MV	2P	31N	06W	BG1	HDPE SECONDARY LINER EIBERGLASS TANK WIBANDED 20 mil
ROSA UNIT #149	3003925501	BLANCO MV	12G	31N	06VV		HDPE SECONDARY LINER
ROSA UNIT #149A	3003925807	BLANCO MV BASIN DK /	128	31N	(16VV		DBI WALL STEEL FIBERGLASS TANK w/BANDED 20 mil
ROSA UNIT #149B	3003926599	BLANCO MV	12E	31N	06W	BG1	HDPE SECONDARY LINER FIBERGLASS TANK W/BANDED 20 mil
ROSA UNIT #150	3004529229	BLANCO MV	32F	32N	06W		HDPE SECONDARY LINER
ROSA UNIT #150A	3004529592	BLANCO MV	32M	32N	06W	BG1	DBI WALL STEEL
ROSA UNIT #150B	3004530874	BASIN DK / BLANCO MV	3217	32N	06W	BG1	DBI WALL STEEL
ROSA UNIT #1500	3004532157	BI ANCO MV	32K	3211	06W	BGT	DBL WALL STEEL
IOSA UNIT #15	3004529267	BLANCO MV	33C	32N	0674	BG1	DBL WALL STEEL

٠, ـ

•

WELLS W/FEDERAL							CONCIDUCTION MATERIAL
SURF MGT	API	FMT	SEC	IWN	RNG	PITTYPE	CONSTRUCTION MATERIAL
ROSA UNIT #151A	3004529631	BLANCO MV	331	32N	V/80	BGI	DBI WALL STEEL .
ROSA UNIT #151C	3004532196	BI ANCO MV	3314	72N	06\/v	EGI	DBI WALL STEEL
ROSA UNIT #152	3003925494	BLANCO MV	ЗбЕ	32N	061/7	EGI	FIBERGLASS TANK WBANDED ZO mil HDPE SECONDARY LINER
ROSA UNIT #152A	3003925695	BLANCO MV	36N	3511	06W	BGT	DBI WALL SIFEL
ROSA UNIT #152B	3003926631	BLANCO MV	360	32N	06W	BGT	DBL WALL STEEL
ROSA UNIT #152C.	3003927635	BLANCO MV	361	32N	06VV	EG1	FIBERGLASS TANK WBANDED 20 mil HDPE SECONDARY LINER
ROSA UNIT #153	3003925524	BI ANCO MV	17()	31N	05VV	BGT	FIBERGLASS TANK W/BANDED 20-mil HDPE SECONDARY LINER
ROSA UNIT #153A	3003926329	BLANCO MV	1//	31N	(15W	BGT	FIBERGLASS TANK W/BANDED 20 mil HDPE SECONDARY LINER
ROSA UNIT #153B	3003927603	BASIN DK / BLANCO MV	171	3114	05W	BG1	FIBERGLASS TANK WIBANDED FORMAL HDPE SECONDARY LINER
ROSA UNIT #154	3003925893	BLANCO MV	7N	31N	05Vv	BGT	DBI WALL STEEL
ROSA UNIT #154A	3003926274	BI ANCO MV	7 <i>F</i> ′	3111	05W	BGI	FIBERGLASS TANK WBANDED 20 mill HDPE SECONDARY LINER
ROSA UNIT #156	3004529661	BLANCO MV	ĄŖ	3114	06W	BGT	HIBERGLASS TANK WBANDED 20 mill HDPE SECONDARY LINER
ROSA UNIT #156A	3004529640	BLANCO MV	91	31N	OoVV	BG1	FIBERGLASS TANK WIBANDED 20 mil HDPE SECONDARY LINER
ROSA UNIT #159 COM	3003925583	BASIN DK /	190	31N	05W	BG1	DBL WALL STEFL
ROSA UNIT #159A	3003926273	BLANCO MV	19N	3114	05Vv	,,,,	FIBERGLASS TANK WBANDED 20 mill HDPE SECONDARY LINER
ROSA UNIT #15C	3003930111	BLANCO MV	29G	31N	O5V₹		FIBERGLASS TANK WBANDED 20 mil HDPE SECONDARY LINER
ROSA UNIT #160	3003925890	BLANCO MV / ROSA PC	250	31N	0644	BG1	DBL WALL STEEL
ROSA UNIT #160A	3003925818	BLANCO MV	25N	31N	()6W		DBL WALL STEEL FIBERGLASS TANK w/BANDED 20 mil
ROSA UNIT #160B	3003926962	BASIN DK / BLANCO MV	25t	31N	06W		HDPE SECONDARY LINER
ROSA UNIT #160C	3003929778	BLANCO MV	25J	31N	06W		DBL WALL STEEL FIBERGLASS TANK w/BANDED 20 mil
ROSA UNIT #162	3003926069	BI ANCO MV	30K	31N	05W		HDPE SECONDARY LINER
ROSA UNIT #162B	3003929845	BLANCO MV	30P	31N	05W	-	DBL WALL STEEL FIBERGLASS TANK W/BANDED 20 mil
ROSA UNIT #163	3003926345	BLANCO MV	24G	31N	06W	BG1	HDPE SECONDARY LINER FIBERGLASS TANK W/BANDE() 20 mil
ROSA UNIT #163A	3003926336	BLANCO MV	240	31N	06W		HDPE SECONDARY LINER
ROSA UNIT #163B	3003929921	BI ANCO MV	24B	31N	06W	SGI	DBL WALL STEEL
ROSA UNIT #163C	3003929611	BLANCO MV BASIN DK /	24J	31N	06W		SINGLE WALL STEEL FIBERGLASS TANK w/BANDE() 20-mil
ROSA UNIT #164	3003926151	BL ANCO MV	1,1	31N	06W	BG1	HDPE SECONDARY LINER FIBERGLASS TANK W/BANDED 20 mil
ROSA UNIT #164A	3003926080	BLANCO MV	1 J	31N	06W	BGT	HDPE SECONDARY LINER
ROSA UNIT #164E	3003927242	BASIN DK / BLANCO MV	1 J	31N	06W		FIBERGLASS TANK W/BANDED 20 mil HDPE SECONDARY LINER

WELLS W/FEDERAL SURF MGT	API	FMT	SEC	TWN	RNG	PIT TYP	E CONSTRUCTION MATERIAL
ROSA UNIT#165	3003926070	BLANCO MV / ROSA PC	251	31N	06W	861	DBL WALL STEEL
ROSA UNIT #165A	3003926150	BLANCO MV	25B	31N	0644	BGT	FIBERGLASS TANK WBANDED ZO n HDFE SECONDARY LINER
305A UNIT #165B	3003926557	BASIN DK / BLANCO MV	251	31N	0674	HG1	DBL WALL STEFT
ROSA UNIT #1650	3003926961	BASIN DK / BLANCO MV	25G	31N	06W	BG1	DBI WALL STEEL
ROSA UNIT #166	3003926275	BLANCO MV	30A	31N	05W	BGT	HBERGLASS TANK WBANDED 20 n HDPE SECONDARY LINER
ROSA UNIT #166A	3003926282	BLANCO MV	301	31N	05W	HGT	FIBERGLASS TANK W/BANDED 20 n HUFE SECONDARY LINER
ROSA UNIT #167A	3004529886	BLANCO MV	88	31N	06Vv	BGT	FIBERGLASS TANK W/BANDFD 20-n HDPE SECONDARY LINER
ROSA UNII #169	3003926130	BLANCO MV	3J	3111	06W	BG1	DBI WALL STEFL
ROSA UNIT #169A	3003926149	BLANCO MV	3.1	31N	06W	BG1	DBI WALL STEEL
ROSA UNIT #1690	3003927717	BLANCO MV	2M	3111	06Vv	BGI	FIBERGLASS TANK WIBANDED 20-m HDFE SECONDARY LINER
ROSA UNII #170	3003925851	BLANCO MV	21N	31N	06W	BG1	DBI WALL STEFT
ROSA UNIT #171	3003926286	BLANCO MV	/G	3111	0£W	RC1	DBI WALL STEEL
ROSA UNIT #171A	3003926389	BLANCO MV	7G	31N	05W	BGT	FIBERGLASS TANK WBANDED 20-n HDPF SECONDARY LINER
ROSA UNIT #171B	3003927013	BLANCO MV	615	31N	05W	BG1	FIBERGLASS TANK WBANDED 20 m HDFE SECONDARY LINER
ROSA UNIT #180	3004529898	BLANCO MV	9N	31N	06W	6GT	FIBERGLASS TANK W/BANDED 20 m HDPE SECONDARY LINER
ROSA UNIT #180E	3004533134	BLANCO MV	91	3114	06W	BGI	DBL WALL STEFF
COSA UNIT #180C	3004533191	BLANCO MV	9E	31N	06W	BG1	DBL WALL STEEL
OSA UNIT #181	3003926463	BLANCO MV	11K	31N	06VV	BG1	DBI WALL STEEL
OSA UNIT #181A	3003926312	BLANCO MV	15A	31 <b>N</b>	06W	BGT	FIBERGLASS TANK W/BANDED 20 m HDPE SECONDARY LINER
OSA UNIT #181C (shared / <mark>169C)</mark>	3003927714	BLANCO MV	2M	31N	06W	BGT	FIBERGLASS TANK WBANDED 20 m HDPF SECONDARY LINER
OSA UNIT #182	3003926283	BLANCO MV	18N	31N	05W	BGI	FIBERGLASS TANK W/BANDED 20-mi HDPE SECONDARY LINER
OSA UNIT #182A	3003926285	BLANCO MV	18P	31N	05W	BG1	UBI MALI STEEL
OSA UNIT #1820	3003930180	BLANCO MV	18F	31N	05W		SINGLE WALL STEFL
OSA UNIT #183	3003926387	BLANCO MV	19G	31N	05W	BGI	HIBERGLASS TANK WBANDED 20 m HDPE SECONDARY LINER
OSA UNIT #183A	3003926386	BI ANCO MV	19f	31N	05W		FIBERGLASS TANK W/BANDED 20 mi HDPE SECONDARY LINER
OSA UNIT #183B	3003930087	BLANCO MV	19B	31N	05W	BGI	UBI WALL STEFL
DSA UNIT #185B	3004532734	BASIN DK / BLANCO MV	16F	31N	06W	BG1	DBL WALL STEFL
OSA UNIT #185C	3004534484	BLANCO MV	16F	31N	06W	BGT	DBI WALL STEEL
OSA UNII #18	3003930186	BLANCO MV	21G	31N	05W	BG1	DBL WALL STEEL

WELLS W/FEDERAL	to an experience of the second second second second second		~			***			
SURF MG1	API	FMT	SEC	IWN	RNG	PIT TYPE	CONSTR	UCTION	MATERIAL
ROSA UNII #231	3003924441	BASINTIC	31N	3111	05W	561	SINGLE WALL	SHII	
ROSA UNIT #335A	3003930222	BASINFIC.	U5J	3111	05Vv	SGT	SINGLE WALL	SHEL	

-

#### Fields, Vanessa

From:

Fields, Vanessa

Sent:

Friday, October 08, 2010 2.26 PM

To:

'Powell, Brandon, EMNRD'

Cc:

Snyder, Walden; Lucero, Christopher, Lane, Myke, Meador, Tasha

Subject:

Notice of Pit Closures (Cox Canyon 023, 025, 200A)

Brandon: Williams tentatively plans to initiate closure of the following BGT later next week, depending on weather and available resources.

Location	API#	<b>Formation</b>	Sec	Twn:	RG:	
Cox Canyon # 023	30-04522537	BLANCO PC	C17	32N	11W	
Cox Canyon # 200A	30-04532126	BASIN FTC	О9	32N	11 <b>W</b>	
Cox Canyon # 025	30-04522572	BLANCO PC	O9	32N	ິ້ 1 <u>1</u> W	- 47

Please contact me if there are any problems or you request additional information. Thanks for your consideration

Thank You, Vanessa

#### Vanessa Fields

EH&S Coordinator Williams Exploration and Production 721 S. Main Aztec, NM 87410 office: 505-634-4200

fax: 505-634-4205

vanessa.fields@williams.com

#### Fields, Vanessa

From:

Fields, Vanessa

Sent:

Monday, September 13, 2010 8:49 AM

To:

'brad.a.jones@state.nm us'

Cc:

Lane, Myke, 'Brandon.Powell@state nm us'; Richardson, Jason

Subject:

Request for review pit closure

#### Brad

We need to take the following below grade tanks out of service, and we would like to close/modify these existing BGTs We request your review and approval to allow closure.

WELLSITE	API	FMT	SEC	TWN
Cox Canyon #200A 9 O	30-04532126	BASIN FTC	32N	11 W
Cox Canyon #025 9 O	30-04522572	BLANCO PC	32N	11 W
Cox Canyon #023 COM \ 17 C	30-04522537	BLANCO PC	32N	11 W
Cox Canyon # 201 ~ 16 B	30-04527750	BASIN FTC	32 N	11 W
Cox Canyon # 203 . 17 A	30-04527872	BASIN FTC	32 N	11 W

Please contact myself or Myke Lane if there are any problems or you request additional information

Thanks for your consideration

Vanessa

#### Vanessa fields

EH&S Coordinator Williams Exploration and Production 721 S. Main Aztec, NM 87410 office: 505-634-4200

fax: 505-634-4205

vanessa.fields@williams.com

• District 1 • 1625 N French Dr., Hobbs, NM 88240 District II 1301 W Grand Avenue, Artesia, NM 88210 District III 1000 Rio Brazos Road, Aztec, NM 87410 District IV 1220 S St. Francis Dr., Santa Fe, NM 87505

#### State of New Mexico Energy Minerals and Natural Resources

Oil Conservation Division 1220 South St. Francis Dr. Santa Fe, NM 87505 Submit 2 Copies to appropriate
District Office in accordance
with Rule 116 on back
side of form

Form C-141

Revised October 10, 2003

#### **Release Notification and Corrective Action**

OPERATOR									Initia	al Report		Final Report
Name of Co	mpany	WILLIAMS	PRODU	CTION, LLC		Contact	Vanessa Fields			•		
Address		P.O BOX 64	0, AZTE	EC, NM 87410	]	Telephone No. (505) 634-4209						
Facility Nan	ne	Cox Canyon	# 025		F	Facility Type Well Site						
Surface Own	ner: Fede	ral		Mineral Ov	wner:				Lease N	lo.		
LOCATION OF RELEASE												
Unit Letter	Section	Township	Range	Feet from the	North/S	South Line	Feet from the	East/W	est Line	County		
0	09	32N	11 <b>W</b>									
. Latitude36.9951798N Longitude107.99043W												
NATURE OF RELEASE												
		ease Occurred				Volume of			Volume F			
Source of Rel							lour of Occurrenc	e	Date and	Hour of Dis	covery	
Was Immedia	ite Notice		Yes [	No ⊠ Not Red	quired	If YES, To	Whom?					
By Whom?						Date and F	lour					
Was a Watero	course Rea	ched?		_			olume Impacting t	he Water	course			
			Yes 🗵	] No								
If a Watercourse was Impacted, Describe Fully.* N/A												
	Describe Cause of Problem and Remedial Action Taken * No action required											
Describe Area	a Affected	and Cleanup A	Action Tak	cen *								
N/A												
I hereby certify that the information given above is true and complete to the best of my knowledge and understand that pursuant to NMOCD rules and regulations all operators are required to report and/or file certain release notifications and perform corrective actions for releases which may endanger public health or the environment. The acceptance of a C-141 report by the NMOCD marked as "Final Report" does not relieve the operator of liability should their operations have failed to adequately investigate and remediate contamination that pose a threat to ground water, surface water, human health or the environment. In addition, NMOCD acceptance of a C-141 report does not relieve the operator of responsibility for compliance with any other federal, state, or local laws and/or regulations.												
							OIL CON	SERVA	ATION	DIVISIO	<u>)N</u>	
Signature	J.		——————————————————————————————————————	•								
	rinted Name Vanessa Fields  Approved by District Supervisor											
Title EH&S	Coordinat	or				Approval Da	te	E	xpiration	Date •		
E-mail Addre	ss Vanes	sa fields@wıll	ams.com		(	Conditions o	f Approval:			Attached		
Date 11-24	-10		Phon	e: (505) 634-4209	,						_	

<sup>\*</sup> Attach Additional Sheets If Necessary

#### Williams Production Co., LLC San Juan Basin: New Mexico Assets

Below-Grade Tank Removal Closure Plan

In accordance with Rule 19.15.17.13 NMAC, the following plan describes the general closure requirements of below-grade tanks (BGT) on Williams Production Co, LLC (WPX) locations in the San Juan Basin of New Mexico. This is WPX's standard closure procedure for all BGTs regulated under Rule 19.15.17 NMAC and operated by WPX. For those closures which do not conform to this standard closure plan, a separate well/pit specific closure plan will be developed and utilized.

#### **Closure Conditions and Timing:**

Pursuant to 19.15.17.13 (A) NMAC, WPX will initiate closure of any BGT should any one of these conditions occur:

- The Division requires closure because of imminent danger to fresh water, public health or the environment.
- The integrity of the BGT fails. Notification will be within 48 hours to the Division and closure will be schedule as specified in 19.15.17.12 (A)(5) NMAC.
- WPX chooses to take the BGT out-of-service due to operational needs. Closure
  under these conditions will be closed within 60 days of cessation of the BGT's
  operation.
- BGTs installed prior to June 16, 2008 that do not meet the requirements under 19.15.17.11.1(6) NMAC and WPX chooses not to retrofit or upgrade. Closure under these conditions will be completed within five years (by June 16, 2013).

#### **General Plan Requirements:**

- Prior to initiating any BGT Closure except in the case of an emergency, WPX will
  review County Tax Records for the current surface owner of record. The surface
  owner of record will be notified of the intent to closure the BGT by certified mail and
  a copy of this notification will be included in the closure report. In the case of an
  emergency, the surface owner of record will be notified as soon as practical.
- 2. Notice of Closure will be given to the Aztec District office between 72 hours and one week of the scheduled closure via email or phone. The notification of closure will include the following:
  - a. Operators Name (WPX)
  - b. Well Name and API Number
  - c. Location (USTR)
- 3. All piping will be rerouted to an alternative produced water storage/disposal location (e.g. surface tanks, temporary frac tank, ...). The well will be temporarily shutin until the rerouting is completed.
- 4. All produced water will be removed from the BGT following discharge-pipe rerouting. Produced water will be disposed at one of the following NMOCD approved facilities depending on the proximity of the BGT site: Rosa Unit SWD #1 (Order: SWD-916, API: 30-039-27055), Rosa Unit #94 (Order: SWD-3RP-1003-0, API: 30-039-23035), Jillson Fed. SWD #001 (Order: R10168/R10168A, API: 30-039-25465), Middle Mesa SWD #001 (Order: SWD-350-0, API: 30-045-27004) and/or Basin Disposal (Permit: NM-01-0005).
- 5. Solids and sludges will be shoveled and /or vacuumed out for disposal at Envirotech (Permit Number NM-01-0011).
- 6. WPX will obtain prior approval from NMOCD to dispose, recycle, reuse, or reclaim the BGT and provide documentation of the disposition of the BGT in the closure report. Steel materials will be recycled or reused as approved by the Division. Fiberglass tanks will be empty, cut up or shredded, and EPA cleaned for disposal as solid waste. Liners materials will be cleaned without soils or contaminated material for disposal as

solid waste. Fiberglass tanks and liner materials will meet the conditions of paragraph 1 subsection D of 19.15.9.712 NMAC. Disposal will be at a licensed disposal facility, presently San Juan Regional Landfill operated by Waste Management under NMED Permit SWM-052426.

- 7. Any equipment associated with the BGT that is no longer required for some other purpose, following the closure will be removed from the location.
- 8. Following removal of the tank and any liner material, a five-point composite sample will be taken of the excavation and tested per 19.15.17.13(E)(4) NMAC as identified in Table 1. Grab samples will be collected from any area that is wet, discolored or showing other evidence of a release. Results will be report to the Division following receipt from the lab on Form C-141.

	_			_	
Table	٦.	Closure	Critoria	for.	RCTc
1 (1) (1)			C 1111 C 111 C 1	10.71	11/2/12

Components	Testing Methods	Closure Limits (mg/Kg)
Benzene	EPA SW-846 Method 8021B or 8260B	0.2
BTEX	EPA SW-846 Method 8021B or 8260B	50
TPH	EPA SW-846 Method 418.1(1)	100
Chlorides	EPA SW-846 Method 300.1(1)	250(2)

<sup>(1)</sup> Method modified for solid waste.

- 9. If the Division and/or WPX determine there is a release, WPX will comply with 19.15.3.116 NMAC and 19.15.1.19 NMAC.
- 10. Upon completion of the tank removal, the excavation will be backfilled with non-waste earthen material compacted and covered with a minimum of one foot of top soil or background thickness whichever is greater and to existing grade. The surface will be recontoured to match the native grade and prevent ponding.
- 11. For those portions of the former pit area no longer required for production activities, WPX will seed the disturbed areas the first growing season after the pit is covered. Seeding will be accomplished via drilling on the contour whenever practical, or by other Division-approved methods. Vegetative cover will equal 70% of the native perennial vegetative cover (un-impacted) consisting of at least three native plant species, including at least one grass, but not including noxious weeds, and maintained that cover through two successive growing seasons. Repeat seeding or planting will be continued until successful vegetative growth occurs. Note: If a surface owner agreement requires reseeding or other surface restoration that do not meet the revegetation requirements of 19.15.17.13.1 NMAC then WPX will submit the proposed alternative with written documentation that the surface owner agrees to the alternative, for Division approval.
- 12. For those portions of the former pit area required for production activities, reseeding will be done at well abandonment, and following the procedure noted above.

#### **Closure Report:**

All closure activities will include proper documentation and will be submitted to OCD within 60 days of the BGT closure on a Closure Report using Division Form C-144. The Report will include the following:

- Proof of Closure Notice (surface owner & NMOCD)
- Backfilling & Cover Installation
- Site Diagram with coordinates
- Available Inspection reports

- Confirmation Sampling Analytical Results
- Disposal Facility Name(s) and Permit Number(s)
- Application Rate & Seeding techniques
- Photo Documentation of Reclamation

 $<sup>^{(2)}</sup>$  If background concentration of Chlorides greater than 250 mg/Kg, then higher concentration will be used for closure.

#### Williams Production Co., LLC San Juan Basin: New Mexico Assets

Production Pit: Below-Grade Tank Closure Plan

In accordance with Rule 19.15.17.13 NMAC, the following plan describes the general closure requirements of below-grade tanks (BGT) on Williams Production Co, LLC (WPX) locations in the San Juan Basin of New Mexico. This is WPX's standard procedure for all out-of-service BGTs used to store produced liquids during production operations at gas wells operated by WPX.

For those closures which do not conform to this standard closure plan, a separate well/pit specific closure plan will be developed and utilized. All closure activities will include proper documentation and will be submitted to OCD within 60 days of the pit closure on a Closure Report using Division Form C-144. The Report will include the following:

- Plot Plan (Pit Diagram)
- Available Inspection reports

- Sampling Results
- Waste disposal documentation

#### General Plan Requirements:


- 1. All piping will be rerouted to an alternative produced water storage/disposal location (e.g. surface tanks, temporary frac tank ...). The well will be temporarily shut in until the rerouting is completed.
- 2. All produced water will be removed from the BGT following discharge-pipe rerouting. Produced water will be disposed of by injection at one of the Williams Production Rosa Unit Salt Water Disposal wells: Rosa SWD #1 (API: 30-039-27055) I-23-31N-06W Permit SWD-916 or Rosa Unit #94 (API: 30-039-23035) K-16-31N-05W, Permit SWD-758.
- 3. Notice of Closure will be given to the landowner or SMA, and the Aztec District office between 72 hours and one week of the scheduled closure via email or phone. The notification of closure will include the following:
  - a. Operators Name (WPX)
  - b. Well Name and API Number
  - c. Location (USTR)
- 4. The BGT and all associated materials will be removed, and recycled, reused, or disposed, of in a Division-approved facility. All materials that can not be recycled or reused will be treated a solid waste and will be disposed of at a licensed disposal facility (probably San Juan Regional Landfill operated by Waste Management under NMED Permit SWM-052426).
- 5. Following removal of the tank and any liner material, a five-point composite sample will be taken of the excavation and tested per 19.15.17.13(B)(1)(b) NMAC. In the event that the criteria are not met (See Table 1), a release will be reported following Rule 116 and impacted soils will be excavated and hauled to Envirotech Landfarm near Bloomfield, NM (NMOCD Permit NM-01-0011). Approval to haul will be requested of the Aztec District office prior to initiation.

Table 1: Closure Criteria for BGTs


Components	Alesting Welhods	Closure/Limits (mg/kg)
Benzene	EPA SW-846 Method 8021B or 8260B	0.2
BTEX	EPA SW-846 Method 8021B or 8260B	50
TPH	EPA SW-846 Method 8015 M(Full Range)*	100
	or Method 418.1	
Chlorides	EPA SW-846 Method 300.1	250

<sup>\*</sup> Preferred method

- 6. Upon completion of the tank removal and any necessary soil remediation, the excavation will be backfilled with non-waste earthen material compacted to native and covered with a minimum of one foot of top soil. The surface will be re-contoured to match the native grade.
- 7. For those portions of the former pit area no longer required for production activities, WPX will seed the disturbed areas the first growing season after the pit is covered. Seeding will be accomplished via drilling on the contour whenever practical, or by other Division-approved methods. Vegetative cover will equal 70% of the native perennial vegetative cover (un-impacted) consisting of at least three native plant species, including at least one grass, but not including noxious weeds, and maintained that cover through two successive growing seasons. Repeat seeding or planting will be continued until successful vegetative growth occurs. Note: WPX assumes the seeding stipulations including mix and seeding methods specified by the Surface Management Agency (BLM, BOR, USFS, Tribal, etc.) or Land owner as part of a surface use agreement or APD are Division-approved methods unless notified by the Division of their unacceptability.
- 8. For those portions of the former pit area required for production activities, re-seeding will be done at well abandonment, and following the procedure noted above.

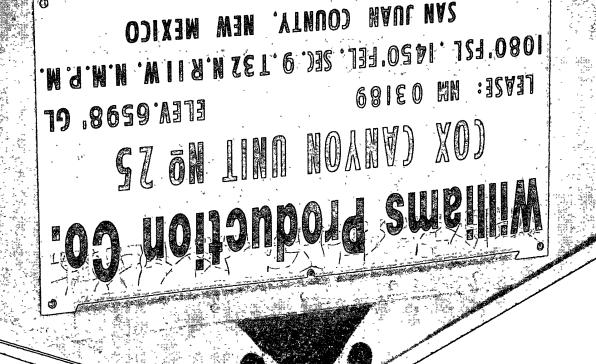



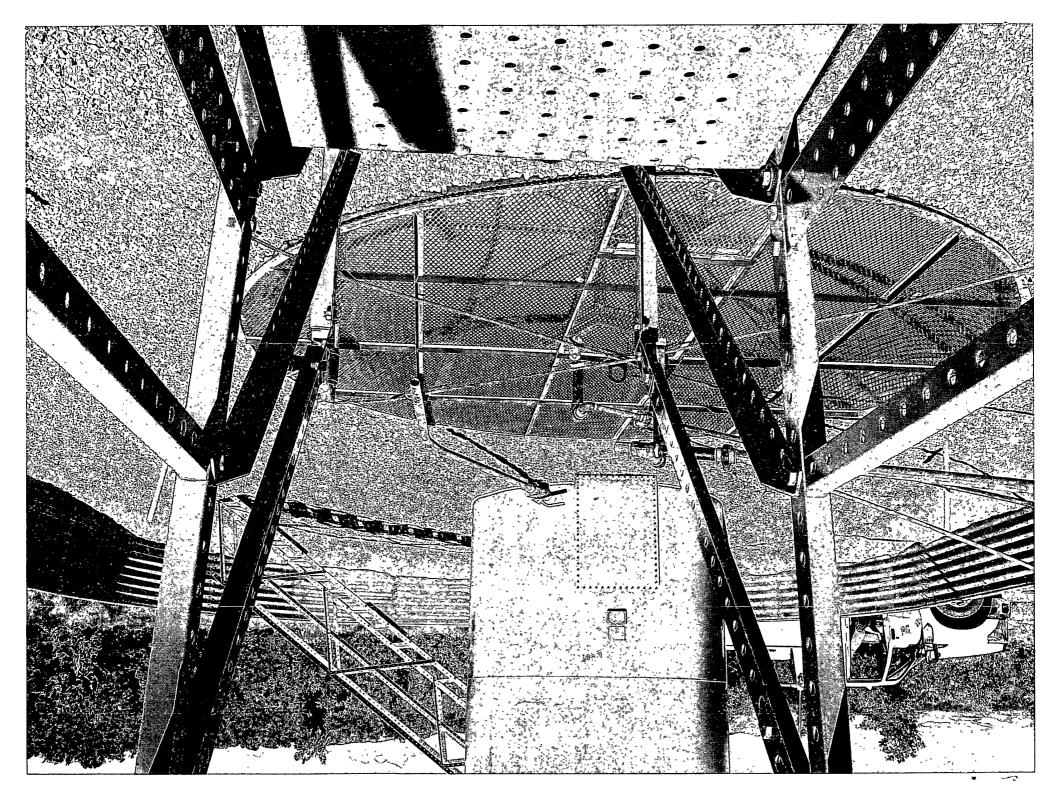



#### EPA METHOD 8015 Modified Nonhalogenated Volatile Organics Total Petroleum Hydrocarbons

Client:	WPX	Project #:	01408-0136
Sample ID:	BGT Removal	Date Reported:	10-13-10
Laboratory Number:	56167	Date Sampled:	10-11 <b>-</b> 10
Chain of Custody No:	10514	Date Received:	10-12-10
Sample Matrix:	Soil	Date Extracted:	10-12-10
Preservative:		Date Analyzed:	10-13-10
Condition:	Intact	Analysis Requested:	8015 TPH

Parameter	Concentration (mg/Kg)	Det. Limit (mg/Kg)
Gasoline Range (C5 - C10)	ND	0.2
Diesel Range (C10 - C28)	ND	0.1
Total Petroleum Hydrocarbons	ND	

ND - Parameter not detected at the stated detection limit.

References:

Method 8015B, Nonhalogenated Volatile Organics, Test Methods for Evaluating Solid Waste,

SW-846, USEPA, December 1996.

Comments:

Cox Cyn #25

Analyst

Review

Ph (505) 632-0615 Fr (800) 362-1879 Fx (505) 632-1865 lab@envirotech-inc.com envirotech-inc.com



### EPA Method 8015 Modified Nonhalogenated Volatile Organics Total Petroleum Hydrocarbons

#### **Quality Assurance Report**

Client: QA/QC Project #: N/A Sample ID: 10-13-10 QA/QC 10-13-10 Date Reported: Laboratory Number: 56145 Date Sampled: N/A Sample Matrix: Methylene Chloride Date Received: N/A N/A Preservative: Date Analyzed: 10-13-10 N/A Condition: Analysis Requested: **TPH** 

Blank Conc. (mg/L-mg/Kg)
Goncentration
Detection Limit
Gasoline Range C5 - C10
ND
0.2
Diesel Range C10 - C28
ND
0.1

Duplicate Conc. (mg/Kg)	Sample	Duplicate	% Difference	Accept Range
Gasoline Range C5 - C10	ND	ND	0.0%	0 - 30%
Diesel Range C10 - C28	ND	ND	0.0%	0 - 30%

Spike/Conc. (mg/Kg)	Sample	Spike Added	Spike Result	%Recovery	Accept Range
Gasoline Range C5 - C10	ND	250	256	103%	75 - 125%
Diesel Range C10 - C28	ND	250	253	101%	75 - 125%

ND - Parameter not detected at the stated detection limit.

References:

Method 8015B, Nonhalogenated Volatile Organics, Test Methods for Evaluating Solid Waste,

SW-846, USEPA, December 1996.

Comments:

Analyst

QA/QC for Samples 56145, 56156-56158, 56120-56121, 56166-56168

Review



#### **EPA METHOD 8021 AROMATIC VOLATILE ORGANICS**

Client:	WPX	Project #:	04108-0136
Sample ID:	BGT Removal	Date Reported:	10-13-10
Laboratory Number:	56167	Date Sampled:	10-11-10
Chain of Custody:	10514	Date Received:	10-12-10
Sample Matrix:	Soil	Date Analyzed:	10-13-10
Preservative:		Date Extracted:	10-12-10
Condition:	Intact	Analysis Requested:	BTEX
		Dilution	10

	Dilution.	10		
Parameter	Concentration neter (ug/Kg)			
Ponzono	ND.	0.0		
Benzene Toluene	ND ND	0.9 1.0		
Ethylbenzene	ND	1.0		
p,m-Xylene	ND	1.2		
o-Xylene	1.2	0.9		
Total BTEX	1.2			

ND - Parameter not detected at the stated detection limit.

Surrogate Recoveries:	Parameter	Percent Recovery
	Fluorobenzene	100 %
	1,4-difluorobenzene	96.5 %
	Bromochlorobenzene	100 %

References:

Method 5030B, Purge-and-Trap, Test Methods for Evaluating Solid Waste, SW-846, USEPA,

December 1996.

Method 8021B, Aromatic Volatile Organics, Test Methods for Evaluating Solid Waste, SW-846,

USEPA, December 1996.

Comments:

Cox Cyn #25

Analyst

Review



#### **EPA METHOD 8021** AROMATIC VOLATILE ORGANICS

Client:	N/A		Project #:		N/A				
Sample ID:	1013BBLK QA/Q	С	Date Reported:		10-13-10				
Laboratory Number:	56156		Date Sampled:		N/A				
Sample Matrix	Soil		Date Received:		N/A				
Preservative:	N/A		Date Analyzed:		10-13-10	10-13-10			
Condition:	N/A		Analysis:		BTEX				
			Dilution <sup>.</sup>		10				
Calibration and	I-Cal/RF	C-Cal RF:	%Diff	Blank	Detected				
Detection Limits (ug/L)		Accept Ra	inge:0 - 15%	-Conc-	Limit				
Benzene	4.7878E+005	4.7974E+005	0.2%	ND	0,1				
Toluene	5 8244E+005	5.8361E+005	0.2%	ND	0.1				
Ethylbenzene	5.3540E+005	5.3648E+005	0.2%	ND	0.1				
p,m-Xylene	1.2801E+006	1.2826E+006	0.2%	ND	0.1				
o-Xviene	4.8462E+005	4.8559E+005	0.2%	ND	0.1				

Duplicate Conc. (ug/Kg)	Sample Buj	olloate	%Diff	AcceptiRange	Detect Limit
Benzene	ND	ND	0.0%	0 - 30%	0.9
Toluene	ND	ND	0.0%	0 - 30%	1.0
Ethylbenzene	ND	ND	0.0%	0 - 30%	1.0
p,m-Xylene	4.2	4.1	2.4%	0 - 30%	1.2
o-Xylene	3.5	3.2	8.6%	0 - 30%	0.9

Spike Conc. (ug/Kg)	Sample Amo	ount Spiked Spi	kediSample %	Recovery	Accept (Range)	į
Benzene	ND	500	503	101%	39 - 150	
Toluene	ND	500	503	101%	46 - 148	
Ethylbenzene	ND	500	514	103%	32 - 160	
p,m-Xylene	4.2	1000	1,020	102%	46 - 148	
o-Xylene	3.5	500	512	102%	46 - 148	

ND - Parameter not detected at the stated detection limit.

Dilution: Spike and spiked sample concentration represent a dilution proportional to sample dilution.

References:

Method 5030B, Purge-and-Trap, Test Methods for Evaluating Solid Waste, SW-846, USEPA,

Method 8021B, Aromatic and Halogenated Volatiles by Gas Chromatography Using

Photoionization and/or Electrolytic Conductivity Detectors, SW-846, USEPA December 1996.

Comments:

QA/QC for Samples 56156-56158, 56166-56168

**Analyst** Review



#### **EPA METHOD 418.1 TOTAL PETROLEUM HYDROCARBONS**

Client:	WPX	Project #:	04108-0136
Sample ID:	BGT Removal	Date Reported:	10-13-10
Laboratory Number:	56167	Date Sampled:	10-11-10
Chain of Custody No:	10514	Date Received:	10-12-10
Sample Matrix:	Soil	Date Extracted:	10-13-10
Preservative:		Date Analyzed:	10-13-10
Condition:	Intact	Analysis Needed:	TPH-418.1

		Det.
	Concentration	Limit
Parameter	(mg/kg)	(mg/kg)

**Total Petroleum Hydrocarbons** 

42.1

14.5

ND = Parameter not detected at the stated detection limit.

References:

Method 418.1, Petroleum Hydrocarbons, Total Recoverable, Chemical Analysis of Water

and Waste, USEPA Storet No. 4551, 1978.

Comments:

Cox Cyn #25

Analyst

Review



## EPA METHOD 418.1 TOTAL PETROLEUM HYROCARBONS QUALITY ASSURANCE REPORT

Client: QA/QC Project #: N/A Sample ID: QA/QC 10-13-10 Date Reported: Laboratory Number: 10-13-TPH.QA/QC 54241 Date Sampled: N/A Sample Matrix: Freon-113 Date Analyzed: 10-13-10 Preservative: N/A Date Extracted: 10-13-10

Condition: N/A Analysis Needed: TPH

 Calibration
 I-Cal Date
 C-Cal Date
 I-Cal RF:
 C-Cal RF:
 % Difference
 Accept. Range

 10-05-10
 10-13-10
 1,640
 1,670
 1.8%
 +/- 10%

Blank Conc. (mg/Kg)

Concentration

Detection Limit

ND

14.5

Duplicate Conc. (mg/Kg)SampleDuplicate% DifferenceAccept. RangeTPH22.323.76.3%+/- 30%

Spike Conc. (mg/Kg)SampleSpike AddedSpike Result% RecoveryAccept RangeTPH22.32,0001,71084.6%80 - 120%

ND = Parameter not detected at the stated detection limit.

References: Method 418.1, Petroleum Hydrocarbons, Total Recoverable, Chemical Analysis of Water

and Waste, USEPA Storet No. 4551, 1978.

Comments: **QA/QC for Samples 56166-56170, 56175** 

Review



#### Chloride

10

Client: **WPX** Project #: 04108-0136 **BGT Removal** Sample ID: Date Reported: 10-13-10 Lab ID#: 56167 Date Sampled: 10-11-10 Sample Matrix: Soil Date Received: 10-12-10 Preservative: Date Analyzed: 10-13-10 Condition: Intact Chain of Custody: 10514

Parameter Concentration (mg/Kg)

Total Chloride

Reference: U.S.E.P.A., 4500B, "Methods for Chemical Analysis of Water and Wastes", 1983.

Standard Methods For The Examination of Water And Waste Water", 18th ed., 1992.

Comments: Cox Cyn #25

Reviéw

5796 US Highway 64 Farmington, NM 87401

Ph (505) 632-0615 Fr (800) 362-1879 Fx (505) 632-1865 lab@envirotech-inc.com envirotech-inc.com

### CHAIN OF CUSTODY RECORD

10514

Client:			Project Name / I	Location	1:					<u>, </u>				ANAL	YSIS	/ PAR	AME	TERS					
			Cox CYN	Cox Cyo #25 Sampler Name:  W. SHYDER Client No.:				X	13/	<del></del>			т	1		<del>\</del>	×	ı	<u> </u>	<del>.</del>	<del></del>		
Client Address:			Sampler Name:	ampler Name:					150	2	(09										,		
MYKE LANE	<u> </u>		W. SHI	W. SHYDER				8	Ø p	8	SE	_		_م								ب	
Client Phone No.:									TPH (Method 8015)	BTEX (Method 8021)	VOC (Method 8260)	RCRA 8 Metals	Cation / Anion		TCLP with H/P		3.1	Щ				00	Sample Intact
			01408-0	1136			,		] Med	Ž	₩ We	18	4 ∕ ر		₹		TPH (418.1)	CHLORIDE				Sample Cool	le lr
Sample No./	Sample	Sampl	l Lab No.	1	Sample	No./Volume of			표	<u> </u>	8	8	atio	泛	문	PAH	표	글				dwa	amp
Identification	Date	Time			Matrix	Containers	HgC <sub>2</sub> I	ia	<del>  E</del>	<u>m</u>	>	Œ	Ö	Œ.	<u> </u>	2		Ö				Ö	Ö
Bat Boars	11/10	-	5lelle7	Solid	Sludge Aqueous			1	2	a-												N	Y
				Soli Solid	Sludge Aqueous																		
				Soil Solid	Sludge Aqueous																		
				Soil Solid	Sludge Aqueous																		
				Soll Solid	Sludge Aqueous																		
				Soil Solid	Sludge Aqueous			T															
				Soil Solid	Sludge Aqueous			$\top$															
				Soil Solid	Sludge Aqueous			1															
		·		Soil Solid	Sludge Aqueous																		
				Soil Solid	Sludge Aqueous			+															
Relinquience by: (Signa	Hore			1000	Date	Time	Re	ceive	ed by:	(Sign:	ature)						<u></u>			Da	ate 2.10	Tir 14	l
Relinquished by: (Signa	iture)						Re	ceive	ed by:	(Signa	ature)				. (*								
Relinquished by: (Signa	iture)						Re	ceive	ed by:	(Signa	ature)												
· Post	ニーニーニーニーニーニーニーニーニーニーニーニーニーニーニーニーニーニーニー				3	env	/ i	I C	) [ (	e (	S	<b>S</b>						•		•			

5796 US Highway 64 • Farmington, NM 87401 • 505-632-0615 • lab@envirotech-inc.com

Cox 04-43 Canyon #

						Liner	Leak detection		Pit	
Date	WellName	Run	Formation	Construction	SGT. BGT, Above	Plastic liner, Double Wall Steel, Bottom Plastic Liner	Y/N	level	level	Comments / Repairs needed
	CANYON UNIT #025	04-43	Pictured Cliffs	FIBERGLASS	BGT			0"	40"	
8/29/2008 10/31/2008	CANYON UNIT #025	04-43	Pictured Cliffs	FIBERGLASS	BGT	NO	Y	0"	19" 12"	
11/30/2008	CANYON UNIT #025	04-43	Pictured Cliffs	FIBERGLASS	BGT	NO	Y	0"	14"	
1/1/2009	CANYON UNIT #025	04-43	Pictured Cliffs	FIBERGLASS	BGT	NO	Υ	0"	26"	
2/1/2009	CANYON UNIT #025	04-43	Pictured Cliffs	FIBERGLASS	BGT	NO	Υ			
3/31/2009	CANYON UNIT #025	04-43	Pictured Cliffs	FIBERGLASS	BGT	NO	Y	0"	26"	
4/1/2009	CANYON UNIT #025	04-43	Pictured Cliffs	FIBERGLASS	BGT	NO	Υ			
5/29/2009	CANYON UNIT #025	04-43	Pictured Cliffs	FIBERGLASS	BGT	NO	Y	0"	20"	
6/30/2009	CANYON UNIT #025	04-43	Pictured Cliffs	FIBERGLASS	BGT	NO	Υ	0"	22"	
7/1/2009	CANYON UNIT #025	04-43	Pictured Cliffs	FIBERGLASS	BGT	NO	Υ	0"	24"	
8/1/2009	CANYON UNIT #025	04-43	Pictured Cliffs	FIBERGLASS	BGT	NO	Υ	0"	25"	

<u>ا</u> ئۆ

9/1/2009	CANYON UNIT #025	04-43	Pictured Cliffs	FIBERGLASS	BGT	NO	Y	0"	25"	
10/1/2009	CANYON UNIT #025	04-43	Pictured Cliffs	FIBERGLASS	BGT	NO	Y	0"	25"	
11/1/2009	CANYON UNIT #025	04-43	Pictured Cliffs	FIBERGLASS	BGT	NO	Υ	0"	27"	
12/1/2009	CANYON UNIT #025	04-43	Pictured Cliffs	FIBERGLASS	BGT	NO	Y	0"	27"	
1/1/2010	CANYON UNIT #025	04-43	Pictured Cliffs	FIBERGLASS	BGT	NO	Y	0"	27"	
2/1/2010	CANYON UNIT #025	04-43	Pictured Cliffs	FIBERGLASS	BGT	NO	Υ	0"	25"	
3/1/2010	CANYON UNIT #025	04-43	Pictured Cliffs	FIBERGLASS	BGT	NO	Y	0"	25"	
4/10/2010	CANYON UNIT #025	04-43	Pictured Cliffs	FIBERGLASS	BGT	NO	Υ			
5/1/2010	CANYON UNIT #025	04-43	Pictured Cliffs	FIBERGLASS	BGT	NO	Y	0"	25"	

J

ر هر

#### Williams Production Co., LLC San Juan Basin: New Mexico Assets

Below-Grade Tank Removal Closure Report

Well:

(Cox Canyon #025)

API No: 30-04522572

Location: O-S09-T32N-R11W, NMPM



In accordance with Rule 19.15.17.13 NMAC, the following report describes the general closure of the referenced below-grade tanks (BGT) on Williams Production Co, LLC (WPX) location in the San Juan Basin of New Mexico. The closure follows this WPX's standard closure procedure for all BGTs regulated under Rule 19.15.17 NMAC and operated by WPX. For those closures which do not conform to the standard closure plan, a separate well/pit specific closure plan will be developed and utilized.

#### **Closure Conditions and Timing:**

Pursuant to 19.15.17.13 (A) NMAC, WPX will initiate closure of any BGT should any one of these conditions occur:

- The Division requires closure because of imminent danger to fresh water, public health or the environment.
- The integrity of the BGT fails. Notification will be within 48 hours to the Division and closure will be schedule as specified in 19.15.17.12 (A) (5) NMAC.
- WPX chooses to take the BGT out-of-service due to operational needs. Closure
  under these conditions will be initiated within 60 days of cessation of the BGT's
  operation.
- BGTs installed prior to June 16, 2008 that do not meet the requirements under 19.15.17.11.1(6) NMAC and WPX chooses not to retrofit or upgrade. Closure under these conditions will be completed within five years (by June 16, 2013).

#### **General Plan Requirements:**

Prior to initiating any BGT Closure except in the case of an emergency, WPX will
review County Tax Records for the current landowner of record. The landowner of
record will be notified of the intent to closure the BGT by certified mail and a copy of
this notification will be included in the closure report. In the case of an emergency,
the landowner of record will be notified as soon as practical.

Williams notified the SMA of its intent to clean close the BGT via Certified Mail on March 10, 2009 see attached. No return receipt required per BLM:FFO/NMOCD MOU dated 5/4/09.

- 2. Notice of Closure will be given to the Aztec District office between 72 hours and one week of the scheduled closure via email or phone. The notification of closure will include the following:
  - a. Operators Name (WPX)
  - b. Well Name and API Number
  - c. Location (USTR)

Aztec District office was notified of Williams E&P intent to close on (10/08/2010). Email attached.

3. All piping will be rerouted to an alternative produced water storage/disposal location (e.g. surface tanks, temporary frac tank, ...). The well will be temporarily shut-in until the rerouting is completed.

Williams closed the BGT used by the Cox Canyon #025 separator and piped all liquids to the Produced Water Storage Tank.

4. All produced water will be removed from the BGT following discharge-pipe rerouting. Produced water will be disposed at one of the following NMOCD approved facilities depending on the proximity of the BGT site: Rosa Unit SWD #1 (Order: SWD-916, API: 30-039-27055), Rosa Unit #94 (Order: SWD-3RP-1003-0, API: 30-039-23035), Jillson Fed. SWD #001 (Order: R10168/R10168A, API: 30-039-25465), Middle Mesa SWD #001 (Order: SWD-350-0, API: 30-045-27004) and/or Basin Disposal (Permit: NM-01-0005).

<u>Produced water in the BGT prior to closures was removed by vacuum truck and hauled to the Rosa Unit disposal wells listed.</u>

5. Solids and sludges will be shoveled and /or vacuumed out for disposal at Envirotech (Permit Number NM-01-0011).

No solids or sludge required removal prior to excavation and removal of the tank.

6. Williams will obtain prior approval from NMOCD to dispose, recycle, reuse, or reclaim the BGT and provide documentation of the disposition of the BGT in the closure report. Steel materials will be recycled or reused as approved by the Division. Fiberglass tanks will be empty, cut up or shredded, and EPA cleaned for disposal as solid waste. Liners materials will be cleaned without soils or contaminated material for disposal as solid waste. Fiberglass tanks and liner materials will meet the conditions of paragraph 1 subsection D or 19.15.9.712 NMAC. Disposal will be at a licensed disposal facility, presently San Juan Regional Landfill operated by Waste Management under NMED Permit SWM-052426.

The fiberglass tank and plastic liner was disposed of at the San Juan Regional Landfill.

- 7. Any equipment associated with the BGT that is no longer required for some other purpose, following the closure will be removed from the location.

  The fiberglass tank and plastic liner were removed offsite. All other piping and equipment remains in use. See attached photo.
- 8. Following removal of the tank and any liner material, a five-point composite sample will be taken of the excavation and tested per 19.15.17.13(E)(4) NMAC as identified in Table 1. Grab samples will be collected from any area that is wet, discolored or showing other evidence of a release. Results will be report to the Division following receipt from the lab on Form C-141.

Table 1: Closure Criteria for BGTs

	Table 1. Closere emena iei b	O 13	
Components	Testing Methods	Closure Limits (mg/Kg)	Sample Results (mg/Kg)
Benzene	EPA SW-846 Method 8021B or 8260B	0.2	ND
BTEX	EPA SW-846 Method 8021B or 8260B	50	ND
TPH	EPA SW-846 Method 418.1(1)	100	33.2
Chlorides	EPA SW-846 Method 300 1(1)	250(2)	5

- (1) Method modified for solid waste.
- $^{(2)}$  If background concentration of Chlorides greater than 250 mg/Kg, then higher concentration will be used for closure
- 9. If the Division and/or Williams determine there is a release, Williams will comply with 19.15.3.116 NMAC and 19.15.1.19 NMAC.

No release detected.

10. Upon completion of the tank removal, and any necessary soil remediation, the excavation will be backfilled with non-waste earthen material compacted to native and covered with a minimum of one foot of top soil or background thickness. The surface will be recontoured to match the native grade.

<u>Pit area backfilled with clean earthen material following sample results. No contaminated soil taken off site. Backfill compacted to avoid settling and pit area remains in use for production operations.</u>

11. For those portions of the former pit area no longer required for production activities, WPX will seed the disturbed areas the first growing season after the pit is covered. Seeding will be accomplished via drilling on the contour whenever practical, or by other Division-approved methods. Vegetative cover will equal 70% of the native perennial vegetative cover (un-impacted) consisting of at least three native plant species, including at least one grass, but not including noxious weeds, and maintained that cover through two successive growing seasons. Repeat seeding or planting will be continued until successful vegetative growth occurs. Note: WPX assumes the seeding stipulations including mix and seeding methods specified by the Surface Management Agency (BLM, BOR, USFS, Tribal, etc.) APD are Division-approved methods unless notified by the Division of their unacceptability. If a landowner agreement requires reseeding or other surface restoration that does not meet the revegetation requirements of 19.15.17.13. ,I then WPX will submit the proposed alternative with written documentation that the landowner agrees to the alternative , for Division approval.

Pit area along with unused portions of well pad interim reclaimed and following P&A entire location to be reclaimed and recontoured in accordance with Surface Management Agency requirements in APD-COAs and per BLM:FFO/NMOCD MOU dated 5/4/09.

12. For those portions of the former pit area required for production activities, reseeding will be done at well abandonment, and following the procedure noted above.

See above notes.

#### **Closure Report:**

All closure activities will include proper documentation and will be submitted to OCD within 60 days of the BGT closure on a Closure Report using Division Form C-144. The Report will include the following:

- Proof of Closure Notice (surface owner & NMOCD)
- Backfilling & Cover Installation
- Site Diagram with coordinates
- Available Inspection reports

- Confirmation Sampling Analytical
   Possults
- Disposal Facility Name(s) and Permit Number(s)
- Re-vegetation Application Rate & Seeding techniques
- Photo Documentation of Reclamation