District I
1625 N French Dr , Hobbs, NM 88240
District II
1301 W Grand Avenue, Artesia, NM 88210
District III
1000 Rio Brazos Road, Aztec, NM 87410
District IV
1220 S St Francis Dr , Santa Fe, NM 87505

State of New Mexico Energy Minerals and Natural Resources Department Oil Conservation Division

Oil Conservation Division 1220 South St. Francis Dr. Santa Fe. NM 87505 For temporary pits, closed-loop systems, and below-grade tanks, submit to the appropriate NMOCD District Office

For permanent pits and exceptions submit to the Santa Fe Environmental Bureau office and provide a copy to the appropriate NMOCD District Office

| District Office |
|--|
| Pit, Closed-Loop System, Below-Grade Tank, or |
| Proposed Alternative Method Permit or Closure Plan Application |
| Type of action: Permit of a pit, closed-loop system, below-grade tank, or proposed alternative method Closure of a pit, closed-loop system, below-grade tank, or proposed alternative method Modification to an existing permit Closure plan only submitted for an existing permitted or non-permitted pit, closed-loop system, below-grade tank, or proposed alternative method |
| Instructions: Please submit one application (Form C-144) per individual pit, closed-loop system, below-grade tank or alternative request |
| lease be advised that approval of this request does not relieve the operator of hability should operations result in pollution of surface water, ground water or the invironment. Nor does approval relieve the operator of its responsibility to comply with any other applicable governmental authority's rules, regulations or ordinances |
| OperatorHuntington Energy, L L C OGRID #208706 |
| Address908 N W 71st St, Oklahoma City, OK 73116 |
| Facility or well nameUte Mountain Ute #103 |
| API Number30-045-35056 OCD Permit Number: |
| U/L or Qtr/Qtr _H_ Section16 Township32N Range14W CountySan Juan |
| Center of Proposed Design. Latitude36 99132 Longitude108 30914 NAD □1927 ☑ 1983 |
| Surface Owner 🗌 Federal 🗌 State 🗎 Private 🔀 Tribal Trust or Indian Allotment |
| 2 |
| ☑ <u>Pit</u> : Subsection F or G of 19.15 17.11 NMAC |
| Temporary. 🛮 Drilling 🔲 Workover |
| Permanent Emergency Cavitation P&A |
| ☑ Lined ☐ Unlined Liner type Thickness20mil ☑ LLDPE ☐ HDPE ☐ PVC ☐ Other |
| String-Reinforced |
| Liner Seams. Welded Factory Other Volume: 4000_bbl Dimensions: L_90'_x W_30'_x D_8'_ |
| |
| ☐ <u>Closed-loop System</u> : Subsection H of 19 15 17 11 NMAC Type of Operation ☐ P&A ☐ Drilling a new well ☐ Workover or Drilling (Applies to activities which require prior approval of a permit or notice of |
| intent) |
| ☐ Drying Pad ☐ Above Ground Steel Tanks ☐ Haul-off Bins ☐ Other |
| Lined Unlined Liner type: Thicknessmil LLDPE HDPE PVC Other |
| □ Drying Pad □ Above Ground Steel Tanks □ Haul-off Bins □ Other □ Lined □ Unlined Liner type: Thickness □ mil □ LLDPE □ HDPE □ PVC □ Other □ Melded □ Factory □ Other □ Other □ DECENTED |
| ୍ଥି RECEIVED ଧ୍ର |
| Below-grade tank: Subsection I of 19 15 17 11 NMAC |
| |
| Tank Construction material |
| Tank Construction material Secondary containment with leak detection Visible sidewalls, liner, 6-inch lift and automatic overflow shut-off Visible sidewalls and liner Visible sidewalls only Other |
| ☐ Visible sidewalls and liner ☐ Visible sidewalls only ☐ Other |
| Liner type: Thicknessmil |
| 5. Alternative Method: |
| I A RECURSIVE INTERNO. |

Submittal of an exception request is required. Exceptions must be submitted to the Santa Fe Environmental Bureau office for consideration of approval.

| Fencing: Subsection D of 19 15.17.11 NMAC (Applies to permanent pits, temporary pits, and below-grade tanks) Chain link, six feet in height, two strands of barbed wire at top (Required if located within 1000 feet of a permanent residence, school, institution or church) Four foot height, four strands of barbed wire evenly spaced between one and four feet Alternate Please specify | hospital, |
|--|-------------------------------|
| Netting: Subsection E of 19 15 17 11 NMAC (Applies to permanent pits and permanent open top tanks) Screen Netting Other Monthly inspections (If netting or screening is not physically feasible) | |
| Signs: Subsection C of 19 15 17 11 NMAC ☐ 12"x 24", 2" lettering, providing Operator's name, site location, and emergency telephone numbers ☐ Signed in compliance with 19 15 3.103 NMAC | |
| Administrative Approvals and Exceptions: Justifications and/or demonstrations of equivalency are required. Please refer to 19 15 17 NMAC for guidance Please check a box if one or more of the following is requested, if not leave blank: Administrative approval(s) Requests must be submitted to the appropriate division district or the Santa Fe Environmental Bureau consideration of approval Exception(s) Requests must be submitted to the Santa Fe Environmental Bureau office for consideration of approval | office for |
| Siting Criteria (regarding permitting): 19 15.17.10 NMAC Instructions: The applicant must demonstrate compliance for each siting criteria below in the application. Recommendations of accept material are provided below. Requests regarding changes to certain siting criteria may require administrative approval from the approoffice or may be considered an exception which must be submitted to the Santa Fe Environmental Bureau office for consideration of a Applicant must attach justification for request. Please refer to 19.15.17.10 NMAC for guidance. Siting criteria does not apply to dry above-grade tanks associated with a closed-loop system. | opriate district approval. |
| Ground water is less than 50 feet below the bottom of the temporary pit, permanent pit, or below-grade tank - NM Office of the State Engineer - iWATERS database search, USGS, Data obtained from nearby wells | Yes No |
| Within 300 feet of a continuously flowing watercourse, or 200 feet of any other significant watercourse or lakebed, sinkhole, or playa lake (measured from the ordinary high-water mark) - Topographic map; Visual inspection (certification) of the proposed site | ☐ Yes ☐ No |
| Within 300 feet from a permanent residence, school, hospital, institution, or church in existence at the time of initial application. (Applies to temporary, emergency, or cavitation pits and below-grade tanks) - Visual inspection (certification) of the proposed site; Aerial photo; Satellite image | Yes No |
| Within 1000 feet from a permanent residence, school, hospital, institution, or church in existence at the time of initial application. (Applies to permanent pits) - Visual inspection (certification) of the proposed site; Aerial photo, Satellite image | ☐ Yes ☐ No ☐ NA |
| Within 500 horizontal feet of a private, domestic fresh water well or spring that less than five households use for domestic or stock watering purposes, or within 1000 horizontal feet of any other fresh water well or spring, in existence at the time of initial application NM Office of the State Engineer - iWATERS database search; Visual inspection (certification) of the proposed site | Yes No |
| Within incorporated municipal boundaries or within a defined municipal fresh water well field covered under a municipal ordinance adopted pursuant to NMSA 1978, Section 3-27-3, as amended. - Written confirmation or verification from the municipality, Written approval obtained from the municipality | ☐ Yes ☐ No |
| Within 500 feet of a wetland. - US Fish and Wildlife Wetland Identification map, Topographic map; Visual inspection (certification) of the proposed site | ☐ Yes ☐ No |
| Within the area overlying a subsurface mine. - Written confirmation or verification or map from the NM EMNRD-Mining and Mineral Division | ☐ Yes ☐ No |
| Within an unstable area - Engineering measures incorporated into the design; NM Bureau of Geology & Mineral Resources; USGS; NM Geological Society, Topographic map | ☐ Yes ☐ No |
| Within a 100-year floodplain FEMA map | ☐ Yes ☐ No |

| Temporary Pits, Emergency Pits, and Below-grade Tanks Permit Application Attachment Checklist: Subsection B of 19.15.17 9 NMAC Instructions: Each of the following items must be attached to the application. Please indicate, by a check mark in the box, that the documents are |
|--|
| attached. Hydrogeologic Report (Below-grade Tanks) - based upon the requirements of Paragraph (4) of Subsection B of 19 15.17 9 NMAC Hydrogeologic Data (Temporary and Emergency Pits) - based upon the requirements of Paragraph (2) of Subsection B of 19 15 17.9 NMAC Siting Criteria Compliance Demonstrations - based upon the appropriate requirements of 19 15 17 10 NMAC Design Plan - based upon the appropriate requirements of 19 15 17 11 NMAC Operating and Maintenance Plan - based upon the appropriate requirements of 19.15.17.12 NMAC Closure Plan (Please complete Boxes 14 through 18, if applicable) - based upon the appropriate requirements of Subsection C of 19 15 17 9 NMAC and 19.15 17.13 NMAC |
| Previously Approved Design (attach copy of design) API Number or Permit Number |
| Closed-loop Systems Permit Application Attachment Checklist: Subsection B of 19 15.17 9 NMAC Instructions: Each of the following items must be attached to the application. Please indicate, by a check mark in the box, that the documents are attached. Geologic and Hydrogeologic Data (only for on-site closure) - based upon the requirements of Paragraph (3) of Subsection B of 19 15.17 9 Siting Criteria Compliance Demonstrations (only for on-site closure) - based upon the appropriate requirements of 19.15 17 10 NMAC Design Plan - based upon the appropriate requirements of 19.15 17 11 NMAC Operating and Maintenance Plan - based upon the appropriate requirements of 19 15 17.12 NMAC Closure Plan (Please complete Boxes 14 through 18, if applicable) - based upon the appropriate requirements of Subsection C of 19 15 17.9 NMAC and 19 15.17 13 NMAC Previously Approved Design (attach copy of design) API Number |
| Previously Approved Operating and Maintenance Plan API Number:(Applies only to closed-loop system that use |
| above ground steel tanks or haul-off bins and propose to implement waste removal for closure) |
| Permanent Pits Permit Application Checklist: Subsection B of 19 15.17 9 NMAC Instructions: Each of the following items must be attached to the application. Please indicate, by a check mark in the box, that the documents are attached. Hydrogeologic Report - based upon the requirements of Paragraph (1) of Subsection B of 19 15 17 9 NMAC Siting Criteria Compliance Demonstrations - based upon the appropriate requirements of 19 15 17 10 NMAC Climatological Factors Assessment Certified Engineering Design Plans - based upon the appropriate requirements of 19.15 17 11 NMAC Dike Protection and Structural Integrity Design - based upon the appropriate requirements of 19.15.17.11 NMAC Leak Detection Design - based upon the appropriate requirements of 19 15 17 11 NMAC Liner Specifications and Compatibility Assessment - based upon the appropriate requirements of 19 15 17 11 NMAC Quality Control/Quality Assurance Construction and Installation Plan Operating and Maintenance Plan - based upon the appropriate requirements of 19.15 17 12 NMAC Freeboard and Overtopping Prevention Plan - based upon the appropriate requirements of 19 15 17.11 NMAC Nuisance or Hazardous Odors, including H ₂ S, Prevention Plan Emergency Response Plan Oil Field Waste Stream Characterization Monttoring and Inspection Plan Erosion Control Plan Erosion Control Plan Erosion Control Plan Erosion Control Plan Closure Plan - based upon the appropriate requirements of Subsection C of 19 15 17 9 NMAC and 19 15 17 13 NMAC |
| Proposed Closure: 19 15 17 13 NMAC Instructions: Please complete the applicable boxes, Boxes 14 through 18, in regards to the proposed closure plan. |
| Type: Drilling Workover Emergency Cavitation P&A Permanent Pit Below-grade Tank Closed-loop System Alternative Proposed Closure Method: Waste Excavation and Removal Waste Removal (Closed-loop systems only) On-site Closure Method (Only for temporary pits and closed-loop systems) In-place Burial On-site Trench Burial Alternative Closure Method (Exceptions must be submitted to the Santa Fe Environmental Bureau for consideration) |
| Waste Excavation and Removal Closure Plan Checklist: (19 15.17 13 NMAC) Instructions: Each of the following items must be attached to the closure plan. Please indicate, by a check mark in the box, that the documents are attached. Protocols and Procedures - based upon the appropriate requirements of 19 15 17 13 NMAC Confirmation Sampling Plan (if applicable) - based upon the appropriate requirements of Subsection F of 19.15.17.13 NMAC Disposal Facility Name and Permit Number (for liquids, drilling fluids and drill cuttings) Soil Backfill and Cover Design Specifications - based upon the appropriate requirements of Subsection H of 19.15.17.13 NMAC Re-vegetation Plan - based upon the appropriate requirements of Subsection G of 19 15.17.13 NMAC |

| Waste Removal Closure For Closed-loop Systems That Utilize Above Ground Instructions: Please indentify the facility or facilities for the disposal of liquids, facilities are required. | Steel Tanks or Haul-off Bins Only: (19 15 17 13 ld drilling fluids and drill cuttings. Use attachment if | D NMAC) more than two |
|--|--|--------------------------|
| Disposal Facility Name: | Disposal Facility Permit Number. | |
| Disposal Facility Name. | | |
| Will any of the proposed closed-loop system operations and associated activities o ☐ Yes (If yes, please provide the information below) ☐ No | | |
| Required for impacted areas which will not be used for future service and operation Soil Backfill and Cover Design Specifications based upon the appropriate Re-vegetation Plan - based upon the appropriate requirements of Subsection Site Reclamation Plan - based upon the appropriate requirements of Subsection | e requirements of Subsection H of 19.15 17 13 NMA I of 19 15 17 13 NMAC | С |
| Siting Criteria (regarding on-site closure methods only): 19 15 17.10 NMAC Instructions: Each siting criteria requires a demonstration of compliance in the provided below. Requests regarding changes to certain siting criteria may requiconsidered an exception which must be submitted to the Santa Fe Environmenta demonstrations of equivalency are required. Please refer to 19.15.17.10 NMAC | re administrative approval from the appropriate dist l Bureau office for consideration of approval. Just | rict office or may be |
| Ground water is less than 50 feet below the bottom of the buried waste - NM Office of the State Engineer - iWATERS database search, USGS, Dat | a obtained from nearby wells | Yes No |
| Ground water is between 50 and 100 feet below the bottom of the buried waste - NM Office of the State Engineer - iWATERS database search, USGS, Dat | a obtained from nearby wells | ☐ Yes ☐ No ☐ NA |
| Ground water is more than 100 feet below the bottom of the buried waste. - NM Office of the State Engineer - iWATERS database search, USGS; Dat | a obtained from nearby wells | Yes No |
| Within 300 feet of a continuously flowing watercourse, or 200 feet of any other signake (measured from the ordinary high-water mark). - Topographic map, Visual inspection (certification) of the proposed site | nificant watercourse or lakebed, sınkhole, or playa | ☐ Yes ☐ No |
| Within 300 feet from a permanent residence, school, hospital, institution, or churcl - Visual inspection (certification) of the proposed site, Aerial photo; Satellit | | ☐ Yes ☐ No |
| Within 500 horizontal feet of a private, domestic fresh water well or spring that les watering purposes, or within 1000 horizontal feet of any other fresh water well or some NM Office of the State Engineer - iWATERS database; Visual inspection | spring, in existence at the time of initial application | ☐ Yes ☐ No |
| Within incorporated municipal boundaries or within a defined municipal fresh wat adopted pursuant to NMSA 1978, Section 3-27-3, as amended - Written confirmation or verification from the municipality, Written approx | • | ☐ Yes ☐ No |
| Within 500 feet of a wetland. - US Fish and Wildlife Wetland Identification map, Topographic map, Visu | al inspection (certification) of the proposed site | ☐ Yes ☐ No |
| Within the area overlying a subsurface mine - Written confirmation or verification or map from the NM EMNRD-Mining | g and Mineral Division | ☐ Yes ☐ No |
| Within an unstable area - Engineering measures incorporated into the design; NM Bureau of Geolog Society, Topographic map | y & Mineral Resources; USGS, NM Geological | ☐ Yes ☐ No |
| Within a 100-year floodplain - FEMA map | | ☐ Yes ☐ No |
| On-Site Closure Plan Checklist: (19 15.17.13 NMAC) Instructions: Each of the by a check mark in the box, that the documents are attached. Siting Criteria Compliance Demonstrations - based upon the appropriate requirements of Construction/Design Plan of Burial Trench (if applicable) based upon the a Construction/Design Plan of Temporary Pit (for in-place burial of a drying protocols and Procedures - based upon the appropriate requirements of 19 1 Confirmation Sampling Plan (if applicable) - based upon the appropriate requirements of Disposal Facility Name and Permit Number (for liquids, drilling fluids and Soil Cover Design - based upon the appropriate requirements of Subsection Re-vegetation Plan - based upon the appropriate requirements of Subsection Site Reclamation Plan - based upon the appropriate requirements of Subsection | uirements of 19 15 17 10 NMAC f Subsection F of 19.15.17.13 NMAC propriate requirements of 19 15 17.11 NMAC pad) - based upon the appropriate requirements of 19 5.17.13 NMAC guirements of Subsection F of 19 15.17 13 NMAC Subsection F of 19.15 17 13 NMAC drill cuttings or in case on-site closure standards cann H of 19.15 17 13 NMAC I of 19.15.17.13 NMAC | 15 17.11 NMAC |

| Operator Application Certification: |
|--|
| I hereby certify that the information submitted with this application is true, accurate and complete to the best of my knowledge and belief |
| Name (Print) Title |
| Signature: Date |
| e-mail address Telephone |
| 20. OCD Approval: Permit Application (including closure plam) X Closure P lan (only) OCD Conditions (see attachment) |
| OCD Representative Signature: Approval Date: 1/08/2011 |
| Title: Compliance Office OCD Permit Number: |
| Closure Report (required within 60 days of closure completion): Subsection K of 19 15.17 13 NMAC Instructions: Operators are required to obtain an approved closure plan prior to implementing any closure activities and submitting the closure report. The closure report is required to be submitted to the division within 60 days of the completion of the closure activities. Please do not complete this section of the form until an approved closure plan has been obtained and the closure activities have been completed. |
| ☐ Closure Completion Date:April 6, 2011 |
| Closure Method: Waste Excavation and Removal On-Site Closure Method Alternative Closure Method Waste Removal (Closed-loop systems only) If different from approved plan, please explain. |
| Closure Report Regarding Waste Removal Closure For Closed-loop Systems That Utilize Above Ground Steel Tanks or Haul-off Bins Only: Instructions: Please indentify the facility or facilities for where the liquids, drilling fluids and drill cuttings were disposed. Use attachment if more than two facilities were utilized. |
| Disposal Facility Name Disposal Facility Permit Number |
| Disposal Facility Name: Disposal Facility Permit Number |
| Were the closed-loop system operations and associated activities performed on or in areas that will not be used for future service and operations? Yes (If yes, please demonstrate compliance to the items below) \(\sigma\) No |
| Required for impacted areas which will not be used for future service and operations Site Reclamation (Photo Documentation) Soil Backfilling and Cover Installation Re-vegetation Application Rates and Seeding Technique |
| 24 Champ Day at Att all and Chamblist Andrews England of Champion 20 and 10 and |
| Closure Report Attachment Checklist: Instructions: Each of the following items must be attached to the closure report. Please indicate, by a check mark in the box, that the documents are attached. Proof of Closure Notice (surface owner and division) Proof of Deed Notice (required for on-site closure) Plot Plan (for on-site closures and temporary pits) Confirmation Sampling Analytical Results (if applicable) Waste Material Sampling Analytical Results (required for on-site closure) Disposal Facility Name and Permit Number Soil Backfilling and Cover Installation Re-vegetation Application Rates and Seeding Technique Site Reclamation (Photo Documentation) |
| On-site Closure Location: Latitude36.99132 N Longitude108.30914 W NAD |
| Operator Closure Certification: I hereby certify that the information and attachments submitted with this closure report is true, accurate and complete to the best of my knowledge and belief I also certify that the closure complies with all applicable closure requirements and conditions specified in the approved closure plan |
| Name (Print):Catherine Smith TitleRegulatory |
| Signature Date 5/2/11 |
| e-mail address:csmith@huntingtonenergy com Telephone405-840-9876 |

Cathy Smith

From: Cathy Smith

Sent: Tuesday, December 28, 2010 4.39 PM

To: 'Powell, Brandon, EMNRD', 'Gordon hammond', 'drabinow@blm gov'

Cc: 'rclackey1@netzero.net', Alan McNally

Subject: Notice of Pit Closure - Ute Mountain Ute #93, #103 & #104

Notice of Pit Closure for the following wells in San Juan Co., NM per the appropriate requirements of Subsection F of 19.15 17 13 NMAC

Huntington plans to close the pits in the next few weeks

Ute Mountain Ute 93. API# 30-045-35053

NE Sec 15-32N-14W, 665' FNL & 665' FEL, San Juan Co., NM

Lat 36 99350 N; Long: 108.28981 W (NAD 83)

Ute Mountain Ute 103: API#. 30-045-35056

NE Sec 16-32N-14W, 1410' FNL & 1070' FEL, San Juan Co., NM

Lat: 36.99132 N; Long. 108.30914 W (NAD 83)


Ute Mountain Ute 104. API# 30-045-35057

SE Sec 15-32N-14W, 1620' FSL & 1675' FEL, San Juan Co., NM

Lat: 36 98514 N; Long: 108.29314 W (NAD 83)

Ute Mountain Ute Lease #: I22IND2772

Thank you. Cathy Smith

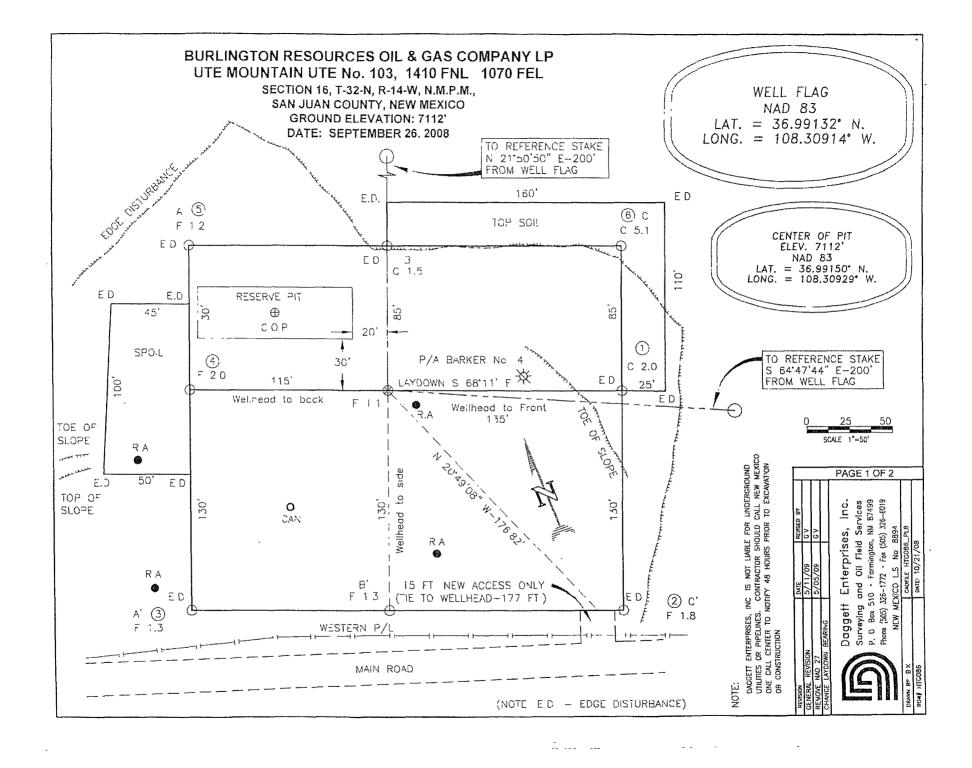



EPA METHOD 8015 Modified Nonhalogenated Volatile Organics Total Petroleum Hydrocarbons

| Client: | Hunnington Energy | | Project #: | 06111-0002 |
|----------------------|-------------------|---|---------------------|------------|
| Sample ID: | 5 Pt Comp | 1 | Date Reported: | 03-11-11 |
| Laboratory Number: | 57536 | | Date Sampled: | 03-07-11 |
| Chain of Custody No: | 11321 | | Date Received: | 03-09-11 |
| Sample Matrix: | Soil | | Date Extracted: | 03-09-11 |
| Preservative: | Cool | | Date Analyzed: | 03-10-11 |
| Condition: | Intact | | Analysis Requested: | 8015 TPH |

| Parameter | Concentration (mg/Kg) | Det. Limit (mg/Kg) |
|------------------------------|--------------------------|--------------------------|
| Gasoline Range (C5 - C10) | 1.7 | 0.2 |
| Diesel Range (C10 - C28) | 4.0 | 0.1 |
| Total Petroleum Hydrocarbons | 5.7 | |

ND - Parameter not detected at the stated detection limit.

References: Method 8015B, Nonhalogenated Volatile Organics, Test Methods for Evaluating Solid Waste,

SW-846, USEPA, December 1996.

Comments: Ute Mountain Ute #103

Analyst

5796 US Highway 64, Farmington, NM 87401

Review

Ph (505) 632-0615 Fr (800) 362-1879 Fx (505) 632-1865 lab@envirotech-inc.com envirotech-inc.com



EPA Method 8015 Modified Nonhalogenated Volatile Organics **Total Petroleum Hydrocarbons**

Quality Assurance Report

| Client: | QA/QC | | Project #: | | N/A |
|--------------------------|-------------------|---------------|---|----------------|-------------------|
| Sample ID: | 03-10-11 QA/Q0 | C | Date Reported: | | 03-11-11 |
| Laboratory Number: | 57534 | | Date Sampled: | | N/A |
| Sample Matrix: | Methylene Chlorid | e | Date Received: | | N/A |
| Preservative: | N/A | | Date Analyzed: | | 03-10-11 |
| Condition: | N/A | | Analysis Reques | sted: | TPH |
| | I-Cal Date. | , I-Cal RF: | C-Cál RF: | % Difference | Accept: Range |
| Gasoline Range C5 - C10 | 03-10-11 | 1.0024E+003 | 1.0028E+003 | 0.04% | 0 - 15% |
| Diesel Range C10 - C28 | 03-10-11 | 1.0042E+003 | 1.0046E+003 | 0.04% | 0 - 15% |
| Blank Conc. (mg/L - mg/K | g) | Concentration | 1 1 - 1 - 1 - 1 - 1 - 1 - 1 - 1 - 1 - 1 | Detection Limi | E |
| Gasoline Range C5 - C10 | | ND | | 0.2 | |
| Diesel Range C10 - C28 | | ND | | 0.1 | |
| Duplicate Conc. (mg/Kg) | Sample : | Duplicate | % Difference | Accept Range | |
| Gasoline Range C5 - C10 | ND | ND | 0.0% | 0 - 30% | |
| Diesei Range C10 - C28 | ND | ND | 0.0% | 0 - 30% | |
| Spike Conc. (mg/Kg) | Sample | Spike Added | Spike Result | % Recovery | Accept Range |
| Gasoline Range C5 - C10 | ND | 250 | 256 | 103% | 75 - 125% |
| Diesel Range C10 - C28 | ND | 250 | 245 | 98.1% | 75 - 125 % |

ND - Parameter not detected at the stated detection limit.

References:

Method 8015B, Nonhalogenated Volatile Organics, Test Methods for Evaluating Solld Waste,

SW-846, USEPA, December 1996.

Comments:

QA/QC for Samples 57495-57504, 57534-57536, 57540-57541



EPA METHOD 8021 AROMATIC VOLATILE ORGANICS

| Parameter | | (ug/Kg) | | (ug/Kg) | |
|--------------------|-------------------|---------------|---------------------|---------|------------------|
| | | Concentration | | Limit | |
| | • | | | Det. | |
| | | | Dilution: | • | 10 |
| Condition: | Intact | | Analysis Requested: | E | BTEX |
| Preservative: | Cool | | Date Extracted: | (|)3-09-1 1 |
| Sample Matrix: | Soil | | Date Analyzed: | (| 3-10-11 |
| Chain of Custody: | 11321 | | Date Received: | (|)3-09-1 1 |
| Laboratory Number: | 57536 | | Date Sampled: | C | 3-07-11 |
| Sample ID: | 5 Pt Comp | | Date Reported: | C | 3-11-11 |
| Client: | Hunnington Energy | | Project #: | C | 6111-0002 |

| Benzene | , ND | 0.9 | |
|--------------|---------|-----|--|
| Toluene | 22.2 | 1.0 | |
| Ethylbenzene | 8.3 | 1.0 | |
| p,m-Xylene | 61.7 | 1.2 | |
| o-Xylene | 16.1 | 0.9 | |
| Total BTEX | 108 | | |

ND - Parameter not detected at the stated detection limit.

| Surrogate Recoveries: | Parameter | Percent Recovery |
|-----------------------|---------------------|------------------|
| | Fluorobenzene | 87.1 % |
| | 1,4-difluorobenzene | 91.1 % |
| | Bromochlorobenzene | 102 % |

References:

Method 5030B, Purge-and-Trap, Test Methods for Evaluating Solid Waste, SW-846, USEPA,

December 1996.

Method 8021B, Aromatic Volatile Organics, Test Methods for Evaluating Solid Waste, SW-846,

USEPA, December 1996.

Comments:

Ute Mountain Ute #103

Analyst

Review



EPA METHOD 8021 AROMATIC VOLATILE ORGANICS

| Client: | N/A | | Project #: | | N/A |
|---|--|---|----------------------|------------------|--------------|
| Sample ID: | 0310BBL3 QA/QC | : | Date Reported: | | 03-11-11 |
| Laboratory Number: | 57534 | | Date Sampled: | | N/A |
| Sample Matrix: | Soil | | Date Received: | | N/A |
| Preservative: | N/A | | Date Analyzed: | | 03-10-11 |
| Condition: | N/A | | Analysis: | | BTEX |
| | | | Dilution; | | 10 |
| | | C-Cal OF | . 4 84 WATTHE 41 2 . | -i°Blook ≥ ` | lotoct. |
| Calibration and Detection Limits (ug/L) | I-Cal RF: | C-Cal RF: Accept. Rar | %Diff ige 015% | Blank | Limit |
| | 1.1420E+005 | 6.4 | | | |
| Detection Limits (ug/L) | A STATE OF THE PROPERTY OF THE | Accept Rar | ige 0 - 15% | Conc | Limit |
| Detection Limits (ug/L) Benzene | 1.1420E+005 | Accept. Rar 1 1443E+005 | ige 0.=15% 0.2% | Conc | Limit 0.1 |
| Detection Limits (ug/L) Benzene Toluene | 1.1420E+005 1.4158E+005 | Accept. Rar 1 1443E+005 1.4187E+005 | 0.2% 0.2% | Conc ND ND | 0.1 0.1 |

| Duplicate Conc. (ug/Kg) | Sample Du | plicate | %Diff: | Accept Range | Detect. Limit |
|-------------------------|-----------|---------|--------|--------------|---------------|
| Benzene | ND | ND | 0.0% | 0 - 30% | 0.9 |
| Toluene | ND | ND | 0.0% | 0 - 30% | 1.0 |
| Ethylbenzene | ND | ND | 0.0% | 0 - 30% | 1.0 |
| p,m-Xylene | 3.1 | 3.1 | 0.0% | 0 - 30% | 1.2 |
| o-Xylene | 6.4 | 6.4 | 0.0% | 0 - 30% | 0.9 |

| Spike Conc. (ug/Kg) | Sample Amou | int Spiked Spi | ked Sample % | Recovery | Accept Range | È |
|---------------------|-------------|----------------|--------------|----------|--------------|---|
| Benzene | ND | 500 | 435 | 87.0% | 39 - 150 | |
| Toluene | ND | 500 | 432 | 86.4% | 46 - 148 | |
| Ethylbenzene | ND | 500 | 510 | 102% | 32 - 160 | |
| p,m-Xylene | 3.1 | 1000 | 1,030 | 103% | 46 - 148 | |
| o-Xylene | 6.4 | 500 | 526 | 104% | 46 - 148 | |

ND - Parameter not detected at the stated detection limit.

Dilution: Spike and spiked sample concentration represent a dilution proportional to sample dilution.

References:

Method 5030B, Purge-and-Trap, Test Methods for Evaluating Solid Waste, SW-846, USEPA,

December 1996.

Method 8021B, Aromatic and Halogenated Volatiles by Gas Chromatography Using Photoionization and/or Electrolytic Conductivity Detectors, SW-846, USEPA December 1996.

Comments:

QA/QC for Samples 57534-57536, 57540-57541, 57492/57494

Analyst

Review



EPA METHOD 418.1 TOTAL PETROLEUM HYDROCARBONS

Project #: 06111-0002 Client: **Hunnington Energy** Date Reported: 03/11/11 Sample ID: 5 Pt Comp Date Sampled: 03/07/11 Laboratory Number: 57536 Date Received: 03/09/11 Chain of Custody No: 11321 Date Extracted: 03/10/11 Sample Matrix: Soil Date Analyzed: 03/10/11 Preservative: Cool Condition: Analysis Needed: TPH-418.1 Intact

| | | Det. |
|-----------|---------------|---------|
| | Concentration | Limit |
| Parameter | (mg/kg) | (mg/kg) |

Total Petroleum Hydrocarbons

932

8.0

ND = Parameter not detected at the stated detection limit.

References:

Method 418.1, Petroleum Hydrocarbons, Total Recoverable, Chemical Analysis of Water

and Waste, USEPA Storet No. 4551, 1978.

Comments: Ute Mountain Ute #103

Analyst

Reviev

Ph (505) 632-0615 Fr (800) 362-1879 Fx (505) 632-1865 lab@envirotech-inc.com envirotech-inc.com



EPA METHOD 418.1 TOTAL PETROLEUM HYDROCARBONS QUALITY ASSURANCE REPORT

Client:

QA/QC

Project #:

N/A

Sample ID:

QA/QC

Date Reported: Date Sampled:

03/11/11 N/A

Laboratory Number: Sample Matrix:

03-10 -TPH.QA/QC 57536

03/10/11

Date Analyzed:

03/10/11

Preservative:

Freon-113 N/A

Date Extracted:

Condition:

N/A

Analysis Needed:

03/10/11 TPH

Calibration

I-Cal Date 03/01/11

C-Cal Date

I-Cal RF: C-Cal RF: % Difference Accept. Range 1,690

1.8%

+/- 10%

Blank Conc. (mg/Kg)

Concentration

1,660

Detection Limit

TPH

ND

8.0

Duplicate Conc. (mg/Kg

Sample

Duplicate

% Difference Accept. Range +/- 30%

TPH

932

932

0.0%

Spike Conc. (mg/Kg) **TPH**

Sample 932

Spike Added Spike Result % Recovery 2,000

2,730

93.1%

Accept Range 80 - 120%

ND = Parameter not detected at the stated detection limit.

M

References:

Method 418.1, Petroleum Hydrocarbons, Total Recoverable, Chemical Analysis of Water

and Waste, USEPA Storet No. 4551, 1978.

Comments:

QA/QC for Samples 57536, 57540-57541

Analyst

Ph (505) 632-0615 Fr (800) 362-1879 Fx (505) 632-1865 lab@envirotech-inc.com envirotech-inc.com



Chloride

Client:

Hunnington Energy

Project #:

06111-0002

Sample ID:

5 Pt Comp

Date Reported:

03/11/11

Lab ID#:

57536

Date Sampled:

03/07/11

Sample Matrix:

Soil

Date Received:

03/09/11

Preservative:

Cool

Date Analyzed:

03/10/11

Condition:

Intact

Chain of Custody:

11321

Parameter

Concentration (mg/Kg)

Total Chloride

140

Reference:

U.S.E.P.A., 4500B, "Methods for Chemical Analysis of Water and Wastes", 1983. Standard Methods For The Examination of Water And Waste Water", 18th ed., 1992.

Comments:

Ute Mountain Ute #103

Analyst

Revie

Ph (505) 632-0615 Fr (800) 362-1879 Fx (505) 632-1865 lab@envirotech-inc.com envirotech-inc.com

5796 US Highway 64, Farmington, NM 87401

CHAIN OF CUSTODY RECORD

11321

| Client: Project Name / Location: HULLIGTON ENERGY UTE MOUNTAIN UTE # 103 Client Address: Sampler Name: GARY LEAUER 505-419-134 | | | | | | | | | | | | ANAL | YSIS | / PAR | AME | TERS | | | | | | | |
|---|------------------|-----------|---------------|---------------|-------------------|------------------|------|---------|--|--------------------|-------------------|---------------|----------------|-------------|---------------|----------|----------------|----------|---|---------------|-----------------|-------------|---------------|
| Haven 600 | 5UER | <u>GY</u> | UTE MOU | <u> </u> | LU W. | E 72/ | نے ک | 3 | _ | -₩ | , | 1 | | | · | | √ —3 | / | | | 1 | | |
| Client Address: | | | Sampler Name: | 3 | | | | | <u>™</u> | BTEX (Method 8024) | (00 | | | | | ' | • | | | | | | |
| | | | (JARY (| LGA | JER C | 505-419 | 1-1 | 340 | TPH (Method 8015) | 8 2 | VOC (Method 8260) | ह | _ | | ட | | | ĺ | | | | | |
| Client Phone No.: | | | Client No.: | | | | | | l bg | 탏 | 1 Pg | RCRA 8 Metals | Cation / Anion | | TCLP with H/P | | £. | Щ | | | | 8 | Sample Intact |
| 505-793 - 7 Sample No./ | 063 | | 0611 | | | | | | _ ĭei ĭgei | Ž | ß (₹ | 18 | 4/1 | | with | | TPH (418.1) | CHLORIDE | | | | Sample Cool | - Se |
| ! | 1 | Sample | Lab No. | 1 | Sample | No./Volume of | | | 표 | <u>ě</u> | 8 | 8 | atio | PC! | 딩 | PAH | 표 | Η̈́ | | | | amb | amb |
| Identification | Date | Time | | Soll | Matrix | of Containers | nyuç | I TO | | m | > | <u> </u> | 0 | <u> </u> | F | <u>a</u> | <u> </u> | C | | | | S | p) |
| 5PT-Comp | 3-711 | 7:00 | 7m57536 | Solid | Sludge Aqueous | | | | \ \rangle | 1 ~ | | | | | | | V | V | | | | | |
| | | | | Soil | Sludge | | | | | | | | | | | | | | | | | | |
| | | | ļ | Solid | Aqueous | | _ | | ļ | <u> </u> | <u> </u> | <u> </u> | | | | | | | | | | _ | |
| | | <u></u> | | Soil Solid | Sludge Aqueous | | | | | | | | | | | | | | | | | | |
| | | | | Soil Solid | Studge Aqueous | | | | | } | | | | | | | | | | | | | |
| | | | | Soil Solid | Sludge Aqueous | | | | | | | | | | | | | | | | | 7 | |
| | | | | Soil | Sludge | | { | | | | | | | | | | | | | | $\neg \uparrow$ | | |
| · | | | | Solid | Aqueous | | | - | | | | - | | | | | | | - | | | | |
| | | | | Solid | Sludge Aqueous | | _ | | | | | | | | | | | | | | | | |
| | | | | Soll Solld | Sludge Aqueous | | | | | | | | | | | | | | | | | | |
| | | | | Soil Solid | Sludge Aqueous | | | | | | | | | | | | _ | | | | | | |
| | | | | Soil Solid | Sludge Aqueous | | | | | | | | . | | | | | | | | | | |
| Reliர்ரிuished by: (Signa | ture) | | | Joha | Date | Time |] R | leceive | d by: | (Signa | atµre) | | 7 | | <u> </u> | } | | | ! | Da | te | Tin | ne |
| \mathcal{A} | | | | | 3-9-11 | 3:25P | ٨ | | | | \sim | | | | 42 | | | | | 3/9 | /,, | 5 | 25 |
| Relinquished by: (Signa | OCC all ture) | <u>)</u> | | | 5-7-11 | 7,20,0 | R | eceive | d by: | (Signa | ature) | | | <u></u> | 7 | | \overline{c} |) | | , رد | ///_ | | |
| | | | | | <u> </u> | ļ | Ļ | | | | | | | | | | | | | <u> </u> | | | |
| Relinquished by: (Signa | ture) | | | | | | | eceive | d by: | (Signa | ature) | | | | | | | | | | | | |
| | | | | | | <u> </u> | | | | | | ···· | | | | | | | | <u> </u> | | | \dashv |
| | | | | | 3 | env | | | | | | | | | | | | | | | | | |
| | | | | 7 | | And | ıly | tica | Lat | ora | tory | 1 | | | | | | | | | | | |
| | | | 5796 US | Highway | 64 • Farmino | aton. NM 8740 |)1 • | 505-63 | 2-0615 | 5 • lab | @envi | irotech | -inc.co | om | | | | | | | | | - 1 |

Huntington Energy, L.L.C. Ute Mountain Ute #103 Sec 16, T32N-R14W San Juan Co., NM

Soil Backfilling and Cover Installation

Upon completion of solidification and testing standards being passed (see attached test results) a minimum of 4 ft of cover is achieved including a suitable layer of material to establish vegetation at the site. All re-contouring of location will match fit shape, line, and texture of the surrounding area.

Re-Vegetation and Seeding Technique


Seeding shall commence on or about April 1st, or the first available growing season barring weather. BLM stipulated seed mixes will be used on federal lands. Vegetative cover will equal 70% of the native perennial vegetative cover consisting of at least three native plant species, including at least one grass, and maintain that cover through two successive growing seasons. Repeated seeding or planting will be continued until successful growth occurs.


Temporary Pit Marker

A steel marker will be placed at the center of the on-site burial. The steel marker will not be less than 4" in diameter and be cemented in a 3' hole. Marker shall extend 4' above ground level. Engraved into the marker will be the operator's name, and legal location. This marker shall not be removed. Note: during active operations, a ground level marker will be employed due to safety concerns; upon abandonment, the 4" x 4' marker will be employed.

Disposal Facility

Facility Name: IEI Permit #: NM-010010B

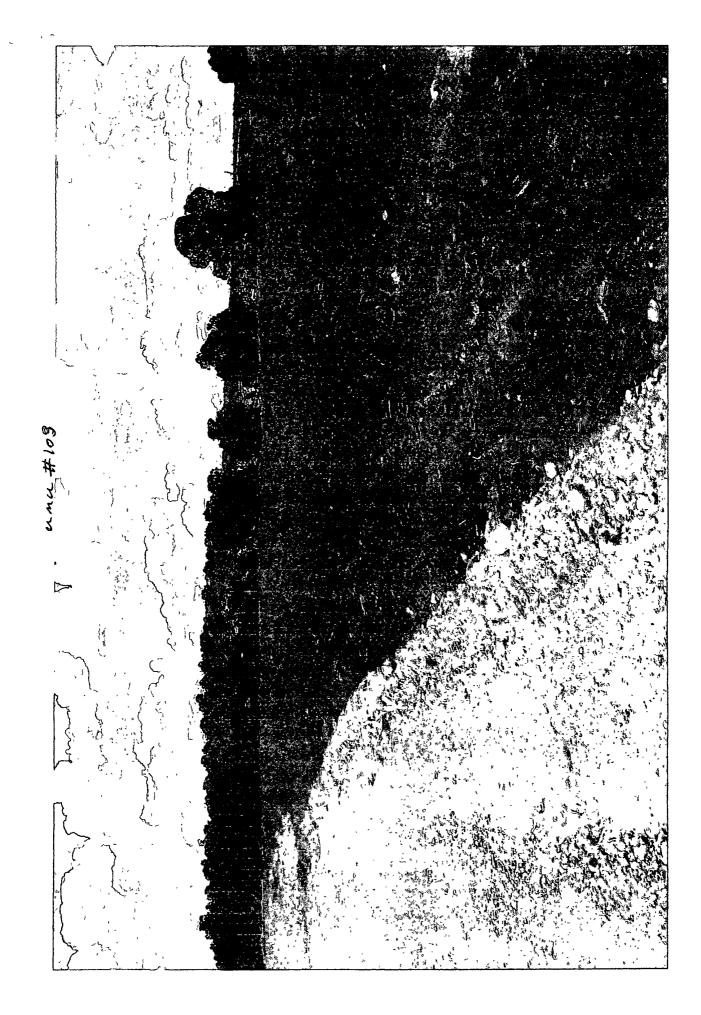

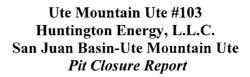



In accordance with Rule 19 15.17 12 NMAC the following information describes the closure requirements of temporary pits on Huntington Energy, L L C (HE) locations. This is HE's standard procedure for all temporary pits. A separate plan will be submitted for any temporary pit which does not conform to this plan.

All closure activities will include proper documentation and be available for review upon request and will be submitted to OCD within 60 days of closure of pit. Closure report will be filed on C-144 and include the following:

- Details on Capping and Covering, where applicable
- Plot Plan (Pit Diagram) <u>Attached</u>
- Inspection Reports Attached
- Sampling Results Envirotech Submitted with C-144 Pit Closure
- C-105 Attached
- Copy of Deed Notice will be filed with County Clerk <u>N/A</u>

General Plan

- 1 All free standing liquids will be removed at the start of the pit closure process from the pit and disposed of in a division-approved facility or recycle, reuse or reclaim the liquids in a manner that the appropriate division district office approves. The facilities to be used for liquids will be IEI NM-010010B & Basin Disposal permit # NM-01-00, and IEI will be used for solids (#01001010B).

 All recovered liquids were disposed of at Basin Disposal and solids were sent to IEI.
- 2. The preferred method of closure for all temporary pits will be on-site burial, assuming that all the criteria listed in sub-section (B) of 19 15 17.13 are met.

Pit was closed using onsite burial.

- 3. The surface owner shall be notified of HE's closing of the temporary pit Not required for Fed.
- Within 6 months of the rig off status occurring, HE will ensure that the temporary pits are closed, re-contoured and reseeded **Compliant with rule.**
- Notice of Closure will be given prior to closure to the Aztec Division office between 72 hours and one week via email, or verbally The notification of closure will include the following:
 - i. Operator's name
 - ii Location by Unit Letter, Section, Township, and Range, Well name and API number. **Notification sent. Filed with C-144 Pit Closure**.
- 6 Liner of temporary pit shall be removed above "mud level" after stabilization. Removal of liner will consist of manually or mechanically cutting liner at mud level and removing all remaining liner Care will be taken to remove all of the liner. All excessive liner will be disposed of at the San Juan County Landfill located on CR 3100 <u>Liner was removed above "mud level". Liner was removed by manually cutting liner at mud level & removing all remaining liner. All excessive liner was disposed of at San juan County Landfill.</u>
- Pit contents shall be mixed with non-waste containing earthen material in order to achieve the solidification process. The solidification process will be accomplished using a combination of natural drying and mechanically mixing. Pit contents will be mixed with non-waste, earthen material to a consistency that is deemed as safe and stable. The mixing ratio shall not exceed 3 parts clean soil to 1 part pit contents. Pit contents were mixed with non-waste, earthen material that is safe & stable. The solidification process used a combination of natural drying and mechanically mixing. The mixing ratio was approximately 3:1.
- A five point composite sample will be taken of the pit using sampling tools and all samples tested per Subsection B of 19 15.17.13(B)(1)(b) In the event that the criteria are not met, all contents will be handled per Subparagraph (a) of Paragraph (1) of Subsection B of 19.15.17.13 i.e., dig and haul. A five point composite sample was taken of the pit using sampling tools. All samples were tested per Subsection B 19.15.17.1 3(B)(1)(b). Results are attached.

| Components | Test Method | Limit (mg/kg) |
|------------|---------------------------|---------------|
| Benzene | EPA SW-846 8021B or 8260B | 0.2 |
| BTEX | EPA SW-846 8021B or 8260B | 50 |
| TPH | EPA SW-846 418 1 | 2500 |
| GRO/DRO | EPA SW-846 8015M | 500 |
| Chlorides | EPA 300.1 | 1000/500 |

- Upon completion of solidification and testing standards being passed, the pit area will be backfilled with compacted, non-waste containing earthen material. A minimum of four feet of cover shall be achieved and the cover shall include one foot of suitable material to establish vegetation at the site, or the background thickness of topsoil, whichever is greater. If standard testing fails, HE will dig and haul all contents pursuant to 19.15.17.13.i.a. After doing so, confirmation sampling will be conducted to ensure a release has not occurred.
 - <u>Pit material past testing standards. The pit was then backfilled with compacted, non-waste containing earthen material.</u>
- 10 During the stabilization process, if the liner is ripped by equipment, the Aztec OCD office will be notified within 48 hours and the liner will be repaired if possible. If the liner can not be repaired, then all contents will be excavated and removed. <u>Liner was not damaged in the pit closure.</u>
- 11 Dig and Haul Material will be transported to IEI (Permit # 010010B). Not required.
- 12. Re-contouring of location will match fit, shape, line, form and texture of the surrounding. Reshaping will include drainage control, prevent ponding, and prevent erosion. Natural drainages will be unimpeded and water bars and/or silt traps will be placed in areas where needed to prevent erosion on a large scale. Final re-contour shall have a uniform appearance with smooth surface, fitting the natural landscape. Pit area was re-contoured to match fit, shape, line form and texture of surrounding. Recontour is uniform in appearance with smooth surface-natural landscape.
- 13. Notification will be sent to the OCD when the reclaimed area is seeded. C-144 Pit Closure
 Notice filed 5/2/11
- 14 HE shall seed the disturbed areas the first growing season after the operator closes the pit. Seeding will be accomplished via drilling on the contour whenever practical or by other division-approved methods BLM stipulated seed mixes will be used on federal lands. Vegetative cover will equal 70% of the native perennial vegetative cover (unimpacted) consisting of at least three native plant species, including at least one grass, but not including noxious weeds, and maintain that cover through two successive growing seasons. Repeated seeding or planting will be continued until successful vegetative growth occurs.

| Type | Variety or Cultivator | PLS/A |
|--------------------------|-----------------------|-------|
| Western Wheatgrass | Arriba | 3 0 |
| Indian Ricegrass | Paloma or Rimrock | 3 0 |
| Slender Wheatgrass | San Luis | 2.0 |
| Crested Wheatgrass | Hy-crest | 3.0 |
| Bottlebrush Squirreltail | Unknown | 2 0 |
| Four-wing Saltbrush | Delar | 0 25 |

Species shall be planted in pounds of pure live seed per acre: Present Pure Live Seed (PLS) = Purity X Germination/100 Two lots of seed can be compared on the basis of PLS as follows:

Source No. One (poor quality)

Purity

50 percent

Germination

40 percent

Percent PLS

20 percent

5 lb bulk seed required to make

Source No. two (better quality)

Purity

80 percent

Germination

63 percent

Percent PLS

50 percent

2 lb bulk seed required to make

1 lb PLS . 1 lb PLS

The seeding above was used in 4/2011. After two successive growing seasons, HE will check for vegetative growth. If not successful, repeated seeding will be done.

15. The temporary pit will be located with a steel marker, no less than four inches in diameter, cemented in a hole three feet deep in the center of the onsite burial upon the abandonment of all the wells on the pad. The marker will be flush with the ground to allow access of the active well pad and for safety concerns. The marker will include a threaded collar to be used for future abandonment. The top of the marker will contain a welded steel 12" square plate that indicates the onsite burial of the temporary pit. The plate will be easily removable and a four foot tall riser will be threaded into the top of the collar marker and welded around the base with the operator's information at the time all wells on the pad are abandoned. The operator's information will include the following: Operator Name, Lease Name, Well Name and Number, Unit Number, Section, Township, Range and an indicator that the marker is an onsite burial location. Steel marker was installed in center as described above with information noted on the plate.

| Submit To Appropr | riate Distri | ct Office | Ī | | | State of Ne | | | | | | | | | , | | rm C-105 | |
|------------------------------------|---|---------------------|-------------------------|----------------------------|----------------|---------------------------|--------------|--------------------------|--|---------------------------------------|------|-------------------------------|-------|------------|------------------------------|--------------|---------------|--|
| District I 1625 N French Dr | District I 1625 N French Dr Hobbs NM 88240 | | | | | Minerals and | d Na | tural | Re | sources | | *** <i>Update V</i> 1. WELL A | | | Revis | sed Aug | gust 1, 2011 | |
| District II 811 S First St, Art | tesia, NM | 88210 | | | Oi | l Conservat | tion | Divi | sin | m | | 30-045-35056 | | | | | | |
| District III 1000 Rio Brazos R | d , Aztec, | NM 87410 | , | 1220 South St. Francis Dr. | | | | | 2 Type of Lease ☐ STATE ☐ FEE ☒ FED/INDIAN | | | | | | | | | |
| District IV 1220 S St Francis | Dr , Santa | Fe, NM 8 | 7505 | | | Santa Fe, N | NM 8 | 8750 | 5 | | ĺ | 3 State Oil & Gas Lease No | | | | | | |
| | _ | LETIC | ON OR | RECC | MPL | ETION RE | POF | RT A | ND | LOG | | | | | | | | |
| 4 Reason for file | ıng | | | | | | | | | | | 5 Lease Nam Ute Mountain | | nıt Agree | ment Na | me | ŀ | |
| COMPLETE | ION RE | PORT (F | ill in boxe | s #1 throu | igh #31 | for State and Fee | e wells | only) | | | | 6 Well Numb | | 103 | **** | | | |
| C-144 CLOS | nd the pla | | | | | | | | | | /or | | | | VD SE IL 301 1 | | J | |
| 7 Type of Comp ✓ NEW | oletion WELL [| ⊒ wor | KOVER [| ☐ DEEPI | ENING | □PLUGBACE | κ 🗆 1 | DIFFE | REN | NT RESERV | OIR | R □ OTHER | | 1 I | il oui: DICI | | ¥' a | |
| 8 Name of Opera | ator Hun | tington E | energy, L L | C | - | | | | | | | 9 OGRID 20 | 8706 | | | | | |
| 10 Address of O | perator 9 | 008 N W | 71 st St , O | klahoma | City, O | K 73116 | | | | | | 11 Pool name | or W | ıldcat | | | | |
| 12.Location | Unit Lti | Se | ction | Towns | hip | Range | Lot | | | Feet from t | he | N/S Line | Feet | from the | E/W L | ıne | County | |
| Surface: | _ | | | | | | | | | | | | | | <u> </u> | | | |
| ВН: | | | | | | | | | | | | | | | | | | |
| 13 Date Spudded | _ | | Reached | | | Released 11/9/ | | | | • | | (Ready to Prod | | R | T, GR, e | tc) | and RKB, | |
| 18 Total Measur | ed Depth | of Well | | 19 1 | 'lug Ba | ck Measured Dep | oth | | 20 | was Directi | iona | l Survey Made? | | 21 1yr | e Electri | c and O | her Logs Run | |
| 22 Producing Int | erval(s), | of this co | mpletion - | · Top, Bo | tom, N | ame | | | | _ | | | | | | | | |
| 23 | | | | | CAS | ING REC | ORI | | | | ing | | | | | | | |
| CASING SI | ZE | WE | EIGHT LB | /FT | | DEPTH SET | | | НО | LE SIZE | | CEMENTIN | G RE | CORD | AM | 4OUNT | PULLED | |
| | | | | | | | | | | | | | | | | | | |
| 1 | _ | | | | | | _ | | | | | | | | | | | |
| | - | | | | | | | | | - | | | | | _ | | | |
| 24. | Teon | | l D/ | OTTEON (| LIN | ER RECORD | EN VE | Lagni | CEX | | 25 | | | NG REC | | D.A.CIV | en err | |
| SIZE | TOP | | BC | OTTOM | | SACKS CEM | ENI | SCRI | EEN | | SIZ | LE | DE | EPTH SE | 1 | PACK | ER SET | |
| | | | | | | | | | | | | | | | | | | |
| 26 Perforation | record (| nterval, s | size, and n | umber) | | | | | | ID, SHOT <u>,</u> INTERVAL | FR. | ACTURE, CE AMOUNT A | | | | | | |
| | | | | | | | | | | | | | | | | | | |
| | | | | | | | | | | | | ļ. <u> </u> | | | | | | |
| 28 | | | - | | | | PRO | DDU | \mathbf{C} | ΓΙΟΝ | | <u> </u> | | | | | | |
| Date First Produc | ction | | Produ | ction Met | hod <i>(Fl</i> | owing, gas lift, p | | | | |) | Well Status | (Proc | d or Shui | t-in) | | | |
| Date of Test | Hour | s Tested | C | hoke Size | | Prod'n For Test Period | | Oıl - | Bbl | | Gas | s - MCF | W | ater - Bbl | 1 | Gas - 0 | Dil Ratio | |
| Flow Tubing Press | Casıı | ng Pressu | | alculated our Rate | 24- | Oıl - Bbl | | | Gas · | - MCF | | Water - Bbl | | Oıl Gra | avity - Al | PI - (Coi | r) | |
| 29 Disposition o | f Gas (Sc | old, used | for fuel, ve | nted, etc |) | I | | | | | | | 30 1 | est Witn | essed By | | | |
| 31 List Attachme | ents | _ | | | | | | | | · · · · · · · · · · · · · · · · · · · | | | | | | | , | |
| 32 If a temporary | y pit was | used at t | he well, at | tach a pla | with th | e location of the | tempo | orary pi | it | | | | | | | | <u></u> | |
| 33 If an on-site b | ourial wa | s used at | the well, re | eport the | exact lo | cation of the on- | site bu | rial | | | | | | | | - | | |
| I hanaha aanti | £, 41 | the a | www.~4. | ala as ···· | om L - ' | Latitude | . f | a in 4. | | and as | late | Longitude | £ | Irm 02 1 - | das | NA d hale | D 1927 1983 | |
| I hereby certij | iy inat i | ne injo | rmation | snown (| | Printed | - | <i>i is tri</i> e Smi | | | | to tne best o gulatory | , my | | age and 9/14/1 | | | |
| E-mail Addre | ss csi | U√ nıth@l | untingto | w onenerg | | | | | | | - | - • | | | | • | | |

INSTRUCTIONS

This form is to be filed with the appropriate District Office of the Division not later than 20 days after the completion of any newly-drilled or deepened well and not later than 60 days after completion of closure. When submitted as a completion report, this shall be accompanied by one copy of all electrical and radio-activity logs run on the well and a summary of all special tests conducted, including drill stem tests. All depths reported shall be measured depths. In the case of directionally drilled wells, true vertical depths shall also be reported. For multiple completions, items 11, 12 and 26-31 shall be reported for each zone.

INDICATE FORMATION TOPS IN CONFORMANCE WITH GEOGRAPHICAL SECTION OF STATE

| Southe | astern New Mexico | Northy | vestern New Mexico |
|--------------------|-------------------|-------------------|--------------------|
| T. Anhy | T. Canyon | T. Ojo Alamo | T. Penn A" |
| T. Salt | T. Strawn | T Kırtland | T. Penn. "B" |
| B Salt_ | T. Atoka | T. Fruitland | T. Penn. "C" |
| T. Yates | T. Miss | T Pictured Cliffs | T. Penn. "D" |
| T. 7 Rivers | T. Devonian | T. Cliff House | T. Leadville |
| T. Queen | T. Silurian | T. Menefee | T. Madison |
| T Grayburg | T. Montoya | T Point Lookout | T. Elbert |
| T San Andres | T. Simpson | T. Mancos | T. McCracken |
| T Glorieta | T. McKee | T. Gallup | T. Ignacio Otzte |
| T Paddock | T. Ellenburger | Base Greenhorn | T.Granite |
| T Blinebry | T. Gr. Wash | T. Dakota | |
| T Tubb | T. Delaware Sand | T. Morrison | |
| T. Drinkard | T. Bone Springs | T.Todilto | |
| T. Abo | T | T Entrada | |
| T. Wolfcamp | T | T. Wingate | |
| T Penn | T. | T. Chinle | |
| T. Cisco (Bough C) | T | T. Permian | |

| | | | SANDS | OR GAS OR ZONES |
|-----------------------------|--------------------------------|--------------------------------|---|--------------------|
| No. 1, from | to | No. 3, from | to | |
| No. 2, from | toto | No. 4, from | to | |
| | IMPOR ⁻ | TANT WATER SANDS | | |
| Include data on rate of war | ter inflow and elevation to wh | ich water rose in hole. | | |
| No. 1, from | to | feet | | |
| No. 2, from | to | feet | • | |
| | | feet | | |
| | I ITHOLOGY PECC | OPD (Attack additional about : | C | |

LITHOLOGY RECORD (Attach additional sheet if necessary)

| From | То | Thickness In Feet | Lithology | From | То | Thickness In Feet | Lithology |
|------|----|----------------------|-----------|------|----|----------------------|-----------|
| | | | | | | | |
| | | | | | | | |
| | | | | | | | |
| | | | | | | | |
| | | | | | | | |
| | | | | | | | |
| į | | | , | | | | |
| | | | | i | | | |
| | | | | | i | | |
| | | | | | | | |
| | | | | | | | |
| | | | | | | | |

DISTRICT I P.O Bex 1980, Hobbs, N.M. 88241-1980

State of New Mexico
Energy, Minerals & Natural Resources Department

Form C-1 Revised October 12, 20 Instructions on ba Submit to Appropriate District Offi

DISTRICT II 1301 W. Grand Avenue, Artoma, N.M. 88210

1220 South St. Francis Dr., Santa Fe, NM 87505

State Lease - 4 Copi Fee Lease - 3 Copi

DISTRICT III 1000 Rio Brazos Rd , Azlec, N.M. 87410

DISTRICT IV

OIL CONSERVATION DIVISION 1220 South St. Francis Dr. Santa Fe, NM 87504-2088

MENDED REPOR

WELL LOCATION AND ACREAGE DEDICATION PLAT

| | | | - | | | | |
|---|---------------------|-----------------------------|-------------|--|--|--|--|
| ¹ API Number 30-045-35056 | *Pool Code 71520 | | | | | | |
| ⁴ Property Code 18725 | | operty Name MOUNTAIN UTE | Well Number | | | | |
| OGRID No | • | erator Name | " Elevation | | | | |
| 208706 | Huntington | Energy, L.L.C. | 7112' | | | | |

¹⁰ Surface Location


| UL or lot no | Section | Township | Range | Loi Jàn | Feet from the | North/South line | Feet from the | East/West line | County |
|---|---------|----------|-------|---------|---------------|------------------|---------------|----------------|----------|
| н | 16 | 32-N | 14-W | | 1410 - | NORTH | 1070 | EAST | SAN JUAN |
| .,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,, | | | 14 | | | | | · | |

¹¹Bottom Hole Location If Different From Surface

| UL or lot no. | Section | Township | Range | Lot Jào | Feet from the | North/South line | Feet from the | East/West line | County |
|------------------|---------|--------------------|-------|-----------------------|---------------|------------------|---------------|----------------|--------|
| "Dedicated Acres | | 15 Joint or Infill | | 14 Consolidation Code | | 16 Order No | | , | |
| NE - 1 | 60 | | | | | | | | |

NO ALLOWABLE WILL BE ASSIGNED TO THIS COMPLETION UNTIL ALL INTERESTS HAVE BEEN CONSOLIDATED OR A NON-STANDARD UNIT HAS BEEN APPROVED BY THE DIVISION

| - | | | | 1 1110 017101014 |
|---|---|--------------|------------------------------|--|
| FD. 3 1/4" AC. 1986 B.L.M. | N 89'59'07" W 5283.04' (M) | | FD. 3 1/4" AC 1985 B.L.M | OPERATOR CERTIFICATION I hereby certify that the information contained herein |
| 3192021 | 22232 | 410, | * | belef, and that this organization either owns a worki |
| STATISTISTISTISTISTISTISTISTISTISTISTISTIST | ED BB | | 00.00'01" \ 39,92' (M) | contract with an owner of such a mineral or working interest, or to a voluntum spectrum |
| E DECT. | 100 20 00 00 00 00 00 00 00 00 00 00 00 0 | | 1070° S 2639. | dwisson. |
| CILLO OIL CONS. | TIN, DIO | | | Signature Date |
| 684994 | 123 | | • | Catherine Smith |
| | 16 -\- | | 1 1 | |
| | , | | FD. 3 1/4" AC. 1986 B.LM. | 18 SURVEYOR CERTIFICATION |
| | SUBSTANT LOCATION | | 1 | I hereby certify that the well location shown on this plat was plotted from field notes of actual surveys made by |
| | <u>SURFACE LOCATION</u> LAT: 36.99132° N. (NAD 83) | 1 | | me or under my supervision, and that the same is true and correct to the best of my knowledge and belief. |
| | LONG: 108.30914 W. (NAD 83) | | | Max-scop |
| | | | 1 | Date of Surveyor A. R. Signature and Sec at Devices |
| | | | | Signature and Sept of Professional Surveyor. |
| , | N. Company | | | Har Town DEV |
| | | | | 01200004 |
| | | | | 0 |
| | | 1 | | Certificate Number |
| | | | | Certificate Number |

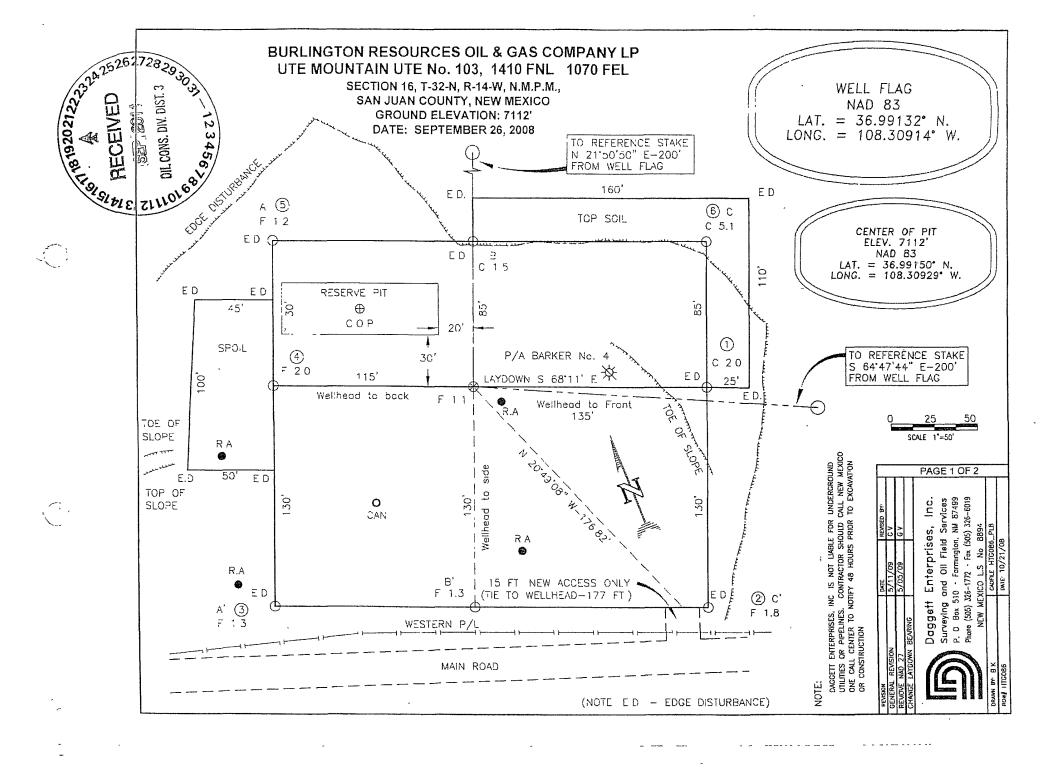

HE Pit Inspection Log:

UMU 103

API#: 30-045-35056

| Date | Visual Inspection |
|-------------------|-------------------|
| Drilling: | |
| 11/03/10-11/09/10 | ОК |
| Weekly Insp | |
| 11/10-11/17 | OK |
| 11/18-11/25 | ОК |
| 11/26-12/3 | ОК |
| 12/4-12/11 | ОК |
| 12/12-12/19 | ОК |
| 12/20-12/27 | OK |
| 12/28-1/04/11 | ОК |
| 1/05-1/12 | ОК |
| 1/1-1/203 | OK |
| 1/21-1/28 | OK |
| 1/29-2/5 | OK |
| 2/6-2/13 | OK |
| 2/14-2/21 | OK |
| 2/22-3/1 | OK |
| 3/2-3/9 | ОК |
| 3/10-3/17 | ОК |
| 3/18-3/25 | ОК |
| 3/26-4/2 | OK |
| 4/3-4/6 | OK |

Closed pit: 4/6/11

David Morales, Huntington Energy







November 3, 2011

New Mexico Oil Conservation Division 1000 Rio Brazos Rd. Aztec, NM 87410

Attn: Jonathan Kelly

Re: Ute Mountain Ute

C-144 Permit Information

Dear Jonathan,

Enclosed are the Ute Mountain Ute Pictures for the C-144s that I have been working with you on completing. I will continue to work on the Canyon Largo Unit well C144 information you need. I hope to have that information done by the end of this week. I have not received the pictures from the field for the Canyon Largo Unit wells. When those are received, I will send them to you.

Thank you!

Cathy Smith

Regulatory

RECEPTED.

GLOSE DE

35 5

