. <u>District I</u> 1625 N. French Dr., Hobbs, NM 88240 District II
1301 W. Grand Avenue, Artesia, NM 88210 District III 1000 Rio Brazos Road, Aztec, NM 87410 District IV 1220 S. St. Francis Dr., Santa Fe, NM 87505

State of New Mexico Energy Minerals and Natural Resources Department Oil Conservation Division 1220 South St. Francis Dr.

For temporary pits, closed-loop systems, and below-grade tanks, submit to the appropriate NMOCD District Office. For permanent pits and exceptions submit to the Santa Fe Environmental Bureau office and provide a copy to the appropriate NMOCD District Office.

12	86	Ц
~~	Da.	

Pit. Closed-Loop System, Below-Grade Tank, or

Santa Fe, NM 87505

Proposed Alternative Method Permit or Closure Plan Application
Proposed Alternative Method Permit or Closure Plan Application Type of action: Permit of a pit, closed-loop system, below-grade tank, or proposed alternative method Closure of a pit, closed-loop system, below-grade tank, or proposed alternative method Modification to an existing permit Closure plan only submitted for an existing permitted or non-permitted pit, closed-loop system, below-grade tank, or proposed alternative method
Instructions: Please submit one application (Form C-144) per individual pit, closed-loop system, below-grade tank or alternative request
lease be advised that approval of this request does not relieve the operator of liability should operations result in pollution of surface water, ground water or the nvironment. Nor does approval relieve the operator of its responsibility to comply with any other applicable governmental authority's rules, regulations or ordinances.
Operator: Williams Production Co, LLC OGRID #: 120782
Address:
Facility or well name: Rosa Unit #059
API Number:
U/L or Qtr/Qtr N_Section 25 Township 31N Range 06W County: Rio Arriba
Center of Proposed Design: Latitude 36.86649 Longitude -107.41785 NAD: ☐1927 ☐ 1983
Surface Owner: Sederal State Private Tribal Trust or Indian Allotment
2. Pit: Subsection F or G of 19.15.17.11 NMAC
Temporary: Drilling Workover
☐ Permanent ☐ Emergency ☐ Cavitation ☐ P&A
Lined Unlined Liner type: Thicknessmil LLDPE HDPE PVC Other
☐ String-Reinforced
Liner Scams: Welded Factory Other Volume: bbl Dimensions: L x W x D
3.
Closed Ioon Systems Subsection H of 1915 17 11 NMAC
Type of Operation: P&A Drilling a new well Workover or Drilling (Applies to activities which require prior application notice of intent) Drying Pad Above Ground Steel Tanks Haul-off Bins Other Lined Unlined Liner type: Thickness mil LLDPE HDPE PVC Other Liner Seams: Welded Factory Other
☐ Drying Pad ☐ Above Ground Steel Tanks ☐ Haul-off Bins ☐ Other
Lined Unlined Liner type: Thickness mil LLDPE HDPE PVC Other
Liner Seams: Welded Factory Other
4. Below-grade tank: Subsection I of 19.15.17.11 NMAC Volume: 120
Below-grade tank: Subsection I of 19.15.17.11 NMAC
Volume: 120 bbl Type of fluid: Produced Water
☐ Secondary containment with leak detection ☐ Visible sidewalls, liner, 6-inch lift and automatic overflow shut-off
☐ Visible sidewalls and liner ☐ Visible sidewalls only ☐ Other
Liner type: Thickness 40 mil HDPE PVC Other LLDPE (See Specs attached)
5.
☐ <u>Alternative Method</u> :
Submittal of an exception request is required. Exceptions must be submitted to the Santa Fe Environmental Bureau office for consideration of approval.

6.	
Fencing: Subsection D of 19 15 17.11 NMAC (Applies to permanent pits, temporary pits, and below-grade tanks)	,
Chain link, six feet in height, two strands of barbed wire at top (Required if located within 1000 feet of a permanent residence, school,	hospual,
institution or church) Four foot height, four strands of barbed wire evenly spaced between one and four feet	
Alternate Please specify Per BLM APD Specifications	
Netting: Subsection E of 19.15 17.11 NMAC (Applies to permanent pits and permanent open top tanks) >	
Screen Notting Other	
Monthly inspections (If netting or screening is not physically feasible)	
8	
Signs: Subsection C of 19.15.17 11 NMAC	
12"x 24", 2" lettering, providing Operator's name, site location, and emergency telephone numbers	
Signed in compliance with 19.15.3.103 NMAC	
9.	
Administrative Approvals and Exceptions: Justifications and/or demonstrations of equivalency are required. Please refer to 19.15.17 NMAC for guidance.	
Please check a box if one or more of the following is requested, if not leave blank:	
Administrative approval(s) Requests must be submitted to the appropriate division district or the Santa Fe Environmental Bureau consideration of approval	office for
Exception(s): Requests must be submitted to the Santa Fe Environmental Bureau office for consideration of approval.	
10. Siting Criteria (regarding permitting): 19 15.17 10 NMAC	
Instructions: The applicant must demonstrate compliance for each siting criteria below in the application. Recommendations of accept	otable source
material are provided below. Requests regarding changes to certain siting criteria may require administrative approval from the appro office or may be considered an exception which must be submitted to the Santa Fe Environmental Bureau office for consideration of a	priate district
Applicant must attach justification for request. Please refer to 19.15.17.10 NMAC for guidance. Siting criteria does not apply to dry	ing pads or
above-grade tanks associated with a closed-loop system.	☐ Yes ☐ No
Ground water is less than 50 feet below the bottom of the temporary pit, permanent pit, or below-grade tank. - NM Office of the State Engineer - iWATERS database search, USGS; Data obtained from nearby wells	
Within 300 feet of a continuously flowing watercourse, or 200 feet of any other significant watercourse or lakebed, sinkhole, or playa lake (measured from the ordinary high-water mark).	∐ Yes ∐ No
- Topographic map, Visual inspection (certification) of the proposed site	
Within 300 feet from a permanent residence, school, hospital, institution, or church in existence at the time of initial application. (Applies to temporary, emergency, or cavitation pits and below-grade tanks)	Yes No
- Visual inspection (certification) of the proposed site; Aerial photo, Satellite image	
Within 1000 feet from a permanent residence, school, hospital, institution, or church in existence at the time of initial application.	Yes No
(Applies to permanent pus) - Visual inspection (certification) of the proposed site; Aerial photo; Satellite image	
Within 500 horizontal feet of a private, domestic fresh water well or spring that less than five households use for domestic or stock	☐ Yes ☐ No
watering purposes, or within 1000 horizontal feet of any other fresh water well or spring, in existence at the time of initial application. - NM Office of the State Engineer - iWATERS database search; Visual inspection (certification) of the proposed site	
Within incorporated municipal boundaries or within a defined municipal fresh water well field covered under a municipal ordinance	Ycs No
adopted pursuant to NMSA 1978, Section 3-27-3, as amended.	
- Written confirmation or verification from the municipality; Written approval obtained from the municipality	
Within 500 feet of a wetland - US Fish and Wildlife Wetland Identification map, Topographic map, Visual inspection (certification) of the proposed site	Yes No
Within the area overlying a subsurface mine. - Written confirmation or verification or map from the NM EMNRD-Mining and Mineral Division	Yes No
Within an unstable area. - Engineering measures incorporated into the design; NM Bureau of Geology & Mineral Resources; USGS: NM Geological	☐ Yes ☐ No
Society, Topographic map	
Within a 100-year floodplain.	Yes No
- FEMA map	

Temporary Pits, Emergency Pits, and Below-grade Tanks Permit Application Attachment Checklist: Subsection B of 19.15 17.9 NMAC Instructions: Each of the following items must be attached to the application. Please indicate, by a check mark in the box, that the documents are attached. Hydrogeologic Report (Below-grade Tanks) - based upon the requirements of Paragraph (4) of Subsection B of 19.15.17.9 NMAC Hydrogeologic Data (Temporary and Emergency Pits) - based upon the requirements of Paragraph (2) of Subsection B of 19.15.17.9 NMAC Siting Criteria Compliance Demonstrations - based upon the appropriate requirements of 19.15.17.10 NMAC Design Plan - based upon the appropriate requirements of 19.15.17.11 NMAC Operating and Maintenance Plan - based upon the appropriate requirements of 19.15.17.12 NMAC Closure Plan (Please complete Boxes 14 through 18, if applicable) - based upon the appropriate requirements of Subsection C of 19.15.17.9 NMAC and 19.15.17.13 NMAC Previously Approved Design (attach copy of design) API Number: or Permit Number:
Closed-loop Systems Permit Application Attachment Checklist: Subsection B of 19 15 17.9 NMAC Instructions: Each of the following items must be attached to the application. Please indicate, by a check mark in the box, that the documents are attached. Geologic and Hydrogeologic Data (only for on-site closure) - based upon the requirements of Paragraph (3) of Subsection B of 19.15.17.9
Siting Criteria Compliance Demonstrations (only for on-site closure) - based upon the appropriate requirements of 19.15.17.10 NMAC Design Plan - based upon the appropriate requirements of 19.15 17.11 NMAC Operating and Maintenance Plan - based upon the appropriate requirements of 19.15.17.12 NMAC Closure Plan (Please complete Boxes 14 through 18, if applicable) - based upon the appropriate requirements of Subsection C of 19.15.17.9 NMAC and 19.15.17.13 NMAC
Previously Approved Design (attach copy of design) API Number:
Previously Approved Operating and Maintenance Plan API Number:(Applies only to closed-loop system that use above ground steel tanks or haul-off bins and propose to implement waste removal for closure)
Permanent Pits Permit Application Checklist: Subsection B of 19.15.17.9 NMAC Instructions: Each of the following items must be attached to the application. Please indicate, by a check mark in the box, that the documents are attached. Hydrogeologic Report - based upon the requirements of Paragraph (1) of Subsection B of 19.15.17.9 NMAC Siting Criteria Compliance Demonstrations - based upon the appropriate requirements of 19.15.17.10 NMAC Climatological Factors Assessment Certified Engineering Design Plans - based upon the appropriate requirements of 19.15.17.11 NMAC Dike Protection and Structural Integrity Design - based upon the appropriate requirements of 19.15.17.11 NMAC Leak Detection Design - based upon the appropriate requirements of 19.15.17.11 NMAC Liner Specifications and Compatibility Assessment - based upon the appropriate requirements of 19.15.17.11 NMAC Quality Control/Quality Assurance Construction and Installation Plan Operating and Maintenance Plan - based upon the appropriate requirements of 19.15.17.12 NMAC Precboard and Overtopping Prevention Plan - based upon the appropriate requirements of 19.15.17.11 NMAC Nuisance or Hazardous Odors, including H ₂ S, Prevention Plan Diffield Waste Stream Characterization Monitoring and Inspection Plan Erosion Control Plan Erosion Control Plan Closure Plan - based upon the appropriate requirements of Subsection C of 19.15.17.9 NMAC and 19.15 17.13 NMAC
Proposed Closure: 19.15.17 13 NMAC Instructions: Please complete the applicable boxes, Boxes 14 through 18, in regards to the proposed closure plan.
Type: Drilling Workover Emergency Cavitation P&A Permanent Pit Below-grade Tank Closed-loop System
Alternative Proposed Closure Method: Waste Excavation and Removal
Waste Removal (Closed-loop systems only)
On-site Closure Method (Only for temporary pits and closed-loop systems) In-place Burial On-site Trench Burial
Alternative Closure Method (Exceptions must be submitted to the Santa Fe Environmental Bureau for consideration)
Waste Excavation and Removal Closure Plan Checklist: (19.15.17.13 NMAC) Instructions: Each of the following items must be attached to the closure plan. Please indicate, by a check mark in the box, that the documents are attached. Protocols and Procedures - based upon the appropriate requirements of 19.15 17 13 NMAC Contirmation Sampling Plan (if applicable) - based upon the appropriate requirements of Subsection F of 19.15.17.13 NMAC Disposal Facility Name and Permit Number (for liquids, drilling fluids and drill cuttings) Soil Backfill and Cover Design Specifications - based upon the appropriate requirements of Subsection H of 19.15.17.13 NMAC Re-vegetation Plan - based upon the appropriate requirements of Subsection G of 19.15.17.13 NMAC

Waste Removal Closure For Closed-loop Systems That Utilize Above Ground Steel Tanks or Haul-off Bins Only: (19 15.17.13.1 Instructions: Please indentify the facility or facilities for the disposal of liquids, drilling fluids and drill cuttings. Use attachment if facilities are required.						
Disposal Facility Name: Disposal Facility Permit Number:						
Disposal Facility Name: Disposal Facility Permit Number:						
Will any of the proposed closed-loop system operations and associated activities occur on or in areas that will not be used for future ser Yes (If yes, please provide the information below) No						
Required for impacted areas which will not be used for future service and operations. Soil Backfill and Cover Design Specifications based upon the appropriate requirements of Subsection H of 19.15 17.13 NMAC Re-vegetation Plan - based upon the appropriate requirements of Subsection I of 19.15 17.13 NMAC Site Reclamation Plan - based upon the appropriate requirements of Subsection G of 19.15.17.13-NMAC	c 					
Siting Criteria (regarding on-site closure methods only): 19.15.17.10 NMAC Instructions: Each siting criteria requires a demonstration of compliance in the closure plan. Recommendations of acceptable sout provided below. Requests regarding changes to certain siting criteria may require administrative approval from the appropriate dist considered an exception which must be submitted to the Santa Fe Environmental Bureau office for consideration of approval. Justic demonstrations of equivalency are required. Please refer to 19.15.17.10 NMAC for guidance.	rict office or may be					
Ground water is less than 50 feet below the bottom of the buried waste. - NM Office of the State Engineer - iWATERS database search; USGS; Data obtained from nearby wells	☐ Yes ☐ No ☐ NA					
Ground water is between 50 and 100 feet below the bottom of the buried waste - NM Office of the State Engineer - iWATERS database search; USGS; Data obtained from nearby wells	☐ Yes ☐ No ☐ NA					
Ground water is more than 100 feet below the bottom of the buried waste. - NM Office of the State Engineer - iWATERS database search, USGS, Data obtained from nearby wells	☐ Yes ☐ No ☐ NA					
Within 300 feet of a continuously flowing watercourse, or 200 feet of any other significant watercourse or lakebed, sinkhole, or playa lake (measured from the ordinary high-water mark). - Topographic map; Visual inspection (certification) of the proposed site	Ycs No					
Within 300 feet from a permanent residence, school, hospital, institution, or church in existence at the time of initial application Visual inspection (certification) of the proposed site; Aerial photo; Satellite image	☐ Yes ☐ No					
Within 500 horizontal feet of a private, domestic fresh water well or spring that less than five households use for domestic or stock watering purposes, or within 1000 horizontal feet of any other fresh water well or spring, in existence at the time of initial application - NM Office of the State Engineer - iWATERS database; Visual inspection (certification) of the proposed site	Yes No					
Within incorporated municipal boundaries or within a defined municipal fresh water well field covered under a municipal ordinance adopted pursuant to NMSA 1978, Section 3-27-3, as amended. - Written confirmation or verification from the municipality; Written approval obtained from the municipality	Yes No					
Within 500 feet of a wetland - US Fish and Wildlife Wetland Identification map; Topographic map; Visual inspection (certification) of the proposed site	☐ Yes ☐ No					
Within the area overlying a subsurface mine - Written confirmation or verification or map from the NM EMNRD-Mining and Mineral Division	☐ Yes ☐ No					
Within an unstable area - Engineering measures incorporated into the design; NM Bureau of Geology & Mineral Resources; USGS; NM Geological Society, Topographic map	☐ Yes ☐ No					
Within a 100-year floodplain - FEMA map	☐ Yes ☐ No					
On-Site Closure Plan Checklist: (19.15.17.13 NMAC) Instructions: Each of the following items must be attached to the closure plan. Please indicate, by a check mark in the box, that the documents are attached. Siting Criteria Compliance Demonstrations - based upon the appropriate requirements of 19.15.17.10 NMAC Proof of Surface Owner Notice - based upon the appropriate requirements of 19.15 17.13 NMAC Construction/Design Plan of Burial Trench (if applicable) based upon the appropriate requirements of 19.15 17.11 NMAC Construction/Design Plan of Temporary Pit (for in-place burial of a drying pad) - based upon the appropriate requirements of 19.15.17.13 NMAC Protocols and Procedures - based upon the appropriate requirements of 19.15.17.13 NMAC Confirmation Sampling Plan (if applicable) - based upon the appropriate requirements of Subsection F of 19.15.17.13 NMAC Waste Material Sampling Plan - based upon the appropriate requirements of Subsection F of 19.15.17.13 NMAC Soil Cover Design - based upon the appropriate requirements of Subsection H of 19.15.17.13 NMAC Re-vegetation Plan - based upon the appropriate requirements of Subsection G of 19.15.17.13 NMAC						

Operato: Application Certification:
I hereby certify that the information submitted with this application is true, accurate and complete to the best of my knowledge and belief
Name (Print): Title
Signature: Date:
e-mail address Telephone:
20. OCD Approval: Permit Application (including closure plan) Closure Plan (only) OCD Conditions (see attachment)
OCD Representative Signature:
Title: Compliance Office OCD Permit Number:
21.
Closure Report (required within 60 days of closure completion): Subsection K of 19.15.17.13 NMAC Instructions: Operators are required to obtain an approved closure plan prior to implementing any closure activities and submitting the closure report. The closure report is required to be submitted to the division within 60 days of the completion of the closure activities. Please do not complete this section of the form until an approved closure plan has been obtained and the closure activities have been completed.
☐ Closure Completion Date: ☐ Disposal Facility name & Permit # S.J. Regional Landfill, NMED Permit SWM-052426
22. Closure Method: Waste Excavation and Removal On-Site Closure Method Alternative Closure Method Waste Removal (Closed-loop systems only) If different from approved plan, please explain.
23. Closure Report Regarding Waste Removal Closure For Closed-loop Systems That Utilize Above Ground Steel Tanks or Haul-off Bins Only: Instructions: Please indentify the facility or facilities for where the liquids, drilling fluids and drill cuttings were disposed. Use attachment if more than two facilities were utilized.
Disposal Facility Name: Disposal Facility Permit Number:
Disposal Facility Name: Disposal Facility Permit Number
Were the closed-loop system operations and associated activities performed on or in areas that will not be used for future service and operations? Yes (If yes, please demonstrate compliance to the items below) No
Required for impacted areas which will not be used for future service and operations. Site Reclamation (Photo Documentation) Soil Backfilling and Cover Installation Re-vegetation Application Rates and Seeding Technique
24. <u>Closure Report Attachment Checklist</u> : <u>Instructions</u> : Each of the following items must be attached to the closure report. Please indicate, by a check
Closure Report Attachment Checklist: Instructions: Each of the following items must be attached to the closure report. Please indicate, by a check mark in the box, that the documents are attached. Proof of Closure Notice (surface owner and division) Proof of Deed Notice (required for on-site closure) Plot Plan (for on-site closures and temporary pits) Confirmation Sampling Analytical Results (if applicable) Waste Material Sampling Analytical Results (required for on-site closure) Disposal Facility Name and Permit Number Soil Backfilling and Cover Installation Re-vegetation Application Rates and Seeding Technique Site Reclamation (Photo Documentation) On-site Closure Location: Latitude 36.86649 Longitude -107.41 88 NAD: 1983
25.
Operator Closure Certification: I hereby certify that the information and attachments submitted with this closure report is true, accurate and complete to the best of my knowledge and heliof. I also satisfy that the allower complies with all configurations and conditions are sifed in the appropriate plan.
belief. I also certify that the closure complies with all applicable closure requirements and conditions specified in the approved closure plan. High Electric Land
Signature: Date 8/4/09
e-mail address: holly perkins@williams.com Telephone: (505) 634-4209

Jones, Brad A., EMNRD

From:

Lane, Myke (E&P) [Myke.Lane@Williams.Com]

Sent:

Thursday, March 12, 2009 4:30 PM

To:

Jones, Brad A., EMNRD

Cc:

Perkins, Holly (E&P), Basye, Matt (E&P); Lepich, Mark (E&P); Powell, Brandon, EMNRD;

Lane, Myke (E&P)

Subject:

Request for approval to initiate pit closures

Importance:

High

Brad.

Due to winter weather we have identified several below grade tanks constructed of fiberglass with banded liners that have cracked and are leaking to the annular space or are vulnerable. As a precaution to avoid a possible release from the liner, we diverting discharges to the pits and we want to initiate closure next week. Closure plans following your approved format were submitted on February 11, 2009, and we understand you may not be able to review and approve them given this short notice.

This correspondence is a request for approval to initiate the pit closures following the procedure approved by your office. Williams will, if necessary, take any other closure stipulations required following your review of the plans.

WELLSITE	API	FMT	SEC	TWN	RNG	CONSTRUCTION MATERIAL
ROSA UNIT #032B	3003926771	BASIN DK / BLANCO MV	21G	31N	06W	FIBERGLASS TANK w/BANDED 20-mil HDPE SECONDARY LINER
ROSA UNIT #041	3003907981	BLANCO MV	5K	31N	05W	FIBERGLASS TANK w/BANDED 20-mil HDPE SECONDARY LINER
ROSA UNIT #041B	3003927014	BASIN DK / BLANCO MV	6P	31N	05W	FIBERGLASS TANK w/BANDED 20-mil HDPE SECONDARY LINER
ROSA UNIT #059 GL	3003923270	UNDES GL	25N	31N	06W	FIBERGLASS TANK w/BANDED 20-mil HDPE SECONDARY LINER
ROSA UNIT #171B	3003927013	BLANCO MV	6P	31N	05W	FIBERGLASS TANK w/BANDED 20-mil HDPE SECONDARY LINER

Please notify us if we need to suspend our plans for these pits until your office can review and accept the plans.

Michael K. (Myke) Lane, PE

EH&S Team Leader - San Juan Basin Operations 724 S. Main/PO Box 640, Aztec, NM 87410 (505) 634-4219(off): -4205(fax); 330-3198(cell)

"The problems we face cannot be resolved at the same level of thinking as that which gave rise to them!"---shared with me by Brent Hale

This inbound email has been scanned by the MessageLabs Email Security System.

RECEIVED

MAR 1 7 2009

WPX


Williams Exploration Production PO Box 640 Aztec, NM 87410 505/634-4200 505/634-4205 fax

Site Sketch

Location: Rosa 59 GL

Prepared by: Maske

Date: 4-3-09

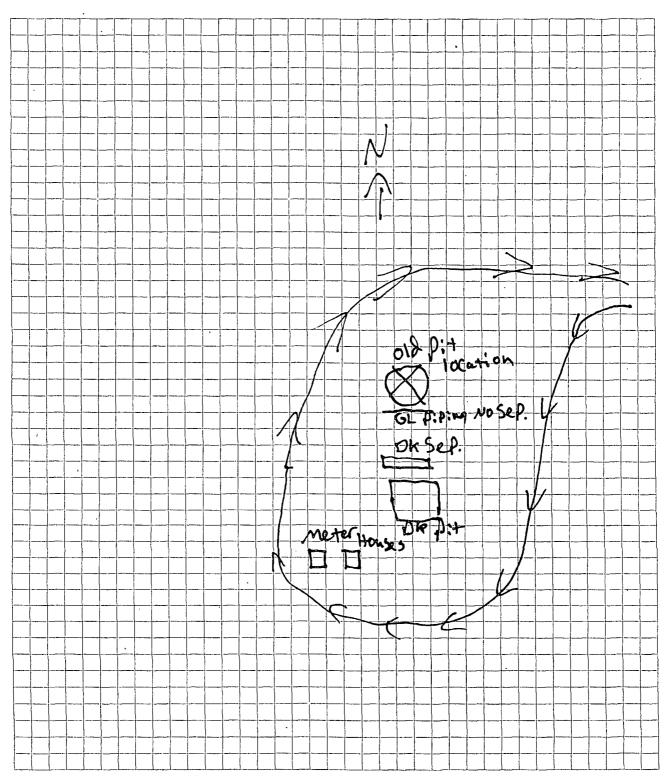

Notes:

- 1) Provide an approximate scale
- 2) Show north direction.
- 3) Include well or other fixed marker.

Perkins, Holly (E&P)

From: Lane, Myke (E&P)

Sent: Friday, March 27, 2009 7:27 AM

To: Powell, Brandon, EMNRD

Cc: Perkins, Holly (E&P); Basye, Matt (E&P)

Subject: Pit Closure Notice

This correspondence is notice of Williams' tentative schedule to initiate the pit closures for the following locations next week. Subsequent notice will be provided should this schedule change

WELLSITE	API	FMT	SEC (Unit)	TWN	RNG	CONSTRUCTION MATERIAL
ROSA UNIT #032B	3003926771	BASIN DK / BLANCO MV	21G	31N	06W	FIBERGLASS TANK w/BANDED 20-mil HDPE SECONDARY LINER
ROSA UNIT #041	3003907981	BLANCO MV	5K	31N	05.W	FIBERGLASS TANK w/BANDED 20-mil HDPE SECONDARY LINER
ROSA UNIT #041B	3003927014	BASIN DK / BLANCO MV	6P	31N	05W	FIBERGLASS TANK w/BANDED 20-mil HDPE SECONDARY LINER
ROSA UNIT #059 GL	3003923270	UNDES GL	25N	31N	06W	FIBERGLASS TANK w/BANDED 20-mil HDPE SECONDARY LINER

Michael K. (Myke) Lane, PE EH&S Team Leader - San Juan Basin Operations 721 S. Main/PO Box 640, Aztec, NM 87410 (505) 634-4219(off); -4205(fax); 330-3198(cell)

[&]quot;The problems we face cannot be resolved at the same level of thinking as that which gave rise to them!"---shared with me by Brent Hale

<u>District I</u> 1625 N. French Dr., Hobbs, NM 88240 District III
1000 Rio Brazos Road, Aztec, NM 87410
District IV
1220 S. St. Francis Di., Santa Fe, NM 87505

State of New Mexico Energy Minerals and Natural Resources

Oil Conservation Division 1220 South St. Francis Dr. Santa Fe, NM 87505

Form C-141

Revised October 10, 2003

Submit 2 Copies to appropriate District Office in accordance with Rule 116 on back side of form

Release Notification and Corrective Action												
						OPERA?	ror		☐ Initia	al Report	\boxtimes	Final Report
Name of Co		WILLIAMS PR					HOLLY C. PERK					
Address				, NM 87410		Telephone N		4219				
Facility Nar	ne Rosa	Unit #059 G	<u> </u>			racility I yp	e Well site					
Surface Ow	ner BLM			Mineral C	wner	BLM			Lease N	lo.		
				LOCA	TION	OF REI	LEASE					
Unit Letter N	Section 25	Township 31N	Range 06W	Feet from the	North/	South Line	Feet from the	East/\	West Line	County	Rio Arr	lba
	<u> </u>	Lat	itude	36.866471		Longitu	lde -107.41	7633	·		·	
						OF RELI						
Type of Rele	ase N/A			1471		Volume of			Volume F	Recovered		
Source of Re	lease						our of Occurrence	e	Date and	Hour of Dis	covery	
Was Immedi	ate Notice (Yes [No Not Re	eouired	If YES, To	Whom?	_				
By Whom?						Date and I-	lour					
Was a Water	course Read	ched?		·····			olume Impacting t	he Wat	ercourse.			
E			Yes [] No								
If a Watercon	irse was Im	pacted, Descri	bc Fully.	*								
Duamile Co	CD1-1		1 1 4	72.1 #								
l .		em and Remedes		n Taken.* o ortable releas	e disco	vered see	attached sam	nle res	ulte			
,							andened Jam	pic ic.	.0113.			
Describe Are	a Affected	and Cleanup A	Action Tal	ken.*			· · · · · · · · · · · · · · · · · · ·		······································			
		·										
									•			
I hereby cert	ify that the	information gi	ven above	e is true and comp	lete to th	ne best of my	knowledge and u	ındersta	nd that pur	suant to NM	IOCD r	ules and
public health	or the envi	ronment. The	acceptane	nd/or file certain r ce of a C-141 repo	ort by the	e NMOCD in	arked as "Final R	ctive act	ions for rei loes not rel	eases which	i may ei crator of	liability
should their	operations l	nave failed to a	dequately	investigate and r	emediate	e contaminat	on that pose a thr	eat to g	round wate	r, surface w	ater, hu	man health
federal state	nment. In a or local la	iddition, NMC ws and/or regu	CD accep	otance of a C-141	report de	oes not reliev	e the operator of	respons	ibility for c	ompliance	with any	y other
rederar, state	, 01 10001 10	wo dilaror rege	-				OIL CON	SERV	ATION	DIVISIO	ON	
S:							315 31.	<u> </u>			<u> </u>	
Signature (1						District Control					
Printed Name: Michael K. Lane Approved by District Supervisor:												
Title: Sr. EH	I&S Specie	alist				Approval Da	te:		Expiration	Date:		
									-лрпаноп			
E-mail Addr	ess myke	.lane@willia	ms.com			Conditions o	f Approval:			Attache	d 🔲	
Date 4/	20/09	?	Phone	: (505) 634-421	9							

* Attach Additional Sheets If Necessary



EPA METHOD 8015 Modified Nonhalogenated Volatile Organics Total Petroleum Hydrocarbons

		•	
Client	Williams E & P	Project #	04108-0003
Sample ID	Rosa 59GL	Date Reported	04-08-09
Laboratory Number	49569	Date Sampled ⁻	04-03-09
Chain of Custody No	6760	Date Received	04-06-09
Sample Matrix	Soil	Date Extracted	04-07-09
Preservative		Date Analyzed	04-07-09
Condition	Intact	Analysis Requested.	8015 TPH

Parameter	Concentration (mg/Kg)	Det. Limit (mg/Kg)
Gasoline Range (C5 - C10)	0.9	0.2
Diesel Range (C10 - C28)	2.5	0.1
Total Petroleum Hydrocarbons	3.4	0.2

ND - Parameter not detected at the stated detection limit.

References Method 8015B, Nonhalogenated Volatile Organics, Test Methods for Evaluating Solid Waste,

SW-846, USEPA, December 1996.

Comments Rosa 32B/Rosa 59GL/Jicarilla 92 #17A

Analyst

Musthen Weters

Ph (505) 632-0615 Fr (800) 362-1879 Fx (505) 632-1865 lab@envirotech-inc.com envirotech-inc.com

EPA METHOD 418.1 TOTAL PETROLEUM HYDROCARBONS

Client:	Williams E&P	Project #:	04108-0003
Sample ID ⁻	Rosa 59 BL	Date Reported:	04-08-09
Laboratory Number:	49569	Date Sampled:	04-03-09
Chain of Custody No.	6760	Date Received.	04-06-09
Sample Matrix	Soil	Date Extracted	04-07-09
Preservative ⁻		Date Analyzed.	04-07-09
Condition:	Intact	Analysis Needed:	TPH-418.1

Parameter	Concentration (mg/kg)	Det. Limit (mg/kg)
Total Petroleum Hydrocarbons	37.4	12.1

ND = Parameter not detected at the stated detection limit.

References:

Method 418 1, Petroleum Hydrocarbons, Total Recoverable, Chemical Analysis of Water

and Waste, USEPA Storet No. 4551, 1978.

Comments:

Analyst

Review Musetlus



EPA METHOD 8021 AROMATIC VOLATILE ORGANICS

'	/		
Client ⁻	Williams E&P	Project #.	04108-0003
Sample ID ⁻	Rosa 59GL	Date Reported.	04-08-09
Laboratory Number	49569	Date Sampled:	04-03-09
Chain of Custody.	6760	Date Received.	04-06-09
Sample Matrix	Soil	Date Analyzed:	04-07-09
Preservative.		Date Extracted.	04-07-09
Condition	Intact	Analysis Requested	BTEX

Parameter	Concentration (ug/Kg)	Det. Limit (ug/Kg)	
Danasana			
Benzene	ND	0.9	
Toluene	3.4	1.0	
Ethylbenzene	1.6	1.0	
p,m-Xylene	5.5	1.2	
o-Xylene	2.5	0.9	
Total BTEX	13.0		

ND - Parameter not detected at the stated detection limit.

Surrogate Recoveries:	Parameter	Percent Recovery
	Fluorobenzene	98.0 %
	1,4-difluorobenzene	98.0 %
	Bromochlorobenzene	98.0 %

References:

Method 5030B, Purge-and-Trap, Test Methods for Evaluating Solid Waste, SW-846, USEPA,

December 1996

Method 8021B, Aromatic Volatile Organics, Test Methods for Evaluating Solid Waste, SW-846,

USEPA, December 1996

Comments:

Rosa 32B/Rosa 59GL/Jicarilla 92 #17A

Analyst

Review



Blank Conc. (mg/Kg)

EPA METHOD 418.1 TOTAL PETROLEUM HYROCARBONS QUALITY ASSURANCE REPORT

Detection Limit

Client.	QA/QC	Project #:	N/A
Sample ID	QA/QC	Date Reported:	04-08-09
Laboratory Number.	04-07-TPH QA/QC 49564	Date Sampled	N/A
Sample Matrix ⁻	Freon-113	Date Analyzed:	04-07-09
Preservative.	N/A	Date Extracted:	04-07-09
Condition	N/A	Analysis Needed ¹	TPH

Calibration	I-Cal Date	C-Cal Date	I-Cal RF:	C-Cal RF.	% Difference	Accept. Range
	04-06-09	04-07-09	1,510	1,590	5.3%	+/- 10%

Concentration.

IPH		ND		12.1	
Duplicate Conc. (mg/Kg) TPH		Sample 127	Duplicate 109	% Difference 14.3%	Accept Range +/- 30%
Spike Conc. (mg/Kg)	Sample 127	Spike Added 2,00 0	Spike Result 1,810	% Recovery 85.1%	Accept Range 80 - 120%

ND = Parameter not detected at the stated detection limit.

References: Method 418 1, Petroleum Hydrocarbons, Total Recoverable, Chemical Analysis of Water

and Waste, USEPA Storet No. 4551, 1978.

Comments: QA/QC for Samples 49564 - 49566 and 49568 - 49570.

Analyst

Mustum Walters



Chloride

Client	Williams E&P	Project #:	04108-0003
Sample ID.	Rosa 56GL	Date Reported:	04-09-09
Lab ID#:	49569	Date Sampled:	04-03-09
Sample Matrix	Soil	Date Received:	04-06-09
Preservative:		Date Analyzed:	04-09-09
Condition,	Intact	Chain of Custody.	6760

Parameter	Concentration	ImalKal
rarameter	Concentration	(mg/ng)
		·

Total Chloride

6 .

Reference

U.S.E P A , 4500B, "Methods for Chemical Analysis of Water and Wastes", 1983 Standard Methods For The Examination of Water And Waste Water", 18th ed., 1992

Comments:

Analyst

Mustle Muce ters Review



EPA Method 8015 Modified Nonhalogenated Volatile Organics Total Petroleum Hydrocarbons

Quality Assurance Report

Client	QA/QC	Project # .	N/A
Sample ID	04-07-09 QA/QC	Date Reported:	04-08-09
Laboratory Number	49550	Date Sampled	N/A
Sample Matrix	Methylene Chloride	Date Received.	N/A
Preservative	N/A	Date Analyzed	04-07-09
Condition	N/A	Analysis Requested	TPH

"我们是一个一个一个一个一个一个一个一个一个一个一个一个一个一个一个一个一个一个一个	Cal Date	1-Cal-RF	C-Cal RF	% Difference	Accept Range
Gasoline Range C5 - C10	05-07-07	9.8989E+002	9 9029E+002	0.04%	0 - 15%
Diesel Range C10 - C28	05-07-07	1 0356E+003	1.0360E+003	0 04%	0 - 15%

Blank Conc (mg/L mg/Kg) Concentration Detection Cimit						
Gasoline Range C5 - C10	ND	0.2				
Diesel Range C10 - C28	ND	0.1				
Total Petroleum Hydrocarbons	ND	0.2				

Duplicate Conc. (mg/Kg)	Sample	Duplicate	% Difference	'Accept Range
Gasoline Range C5 - C10	63.8	60.3	5.5%	0 - 30%
Diesel Range C10 - C28	16.9	15.7	7.1%	0 - 30%

Spike Conc (mg/Kg)	Sample 1: Sp	ike Added Sp	ike Result	Recovery	Accept Range
Gasoline Range C5 - C10	63.8	250	309	98.4%	75 - 125%
Diesel Range C10 - C28	16.9	250	261	97.8%	75 - 125%

ND - Parameter not detected at the stated detection limit

References Method 8015B, Nonhalogenated Volatile Organics, Test Methods for Evaluating Solid Waste,

SW-846, USEPA, December 1996

Comments QA/QC for Samples 49550, 49551, 49561, 49562, 49564 - 49566, and 49568 - 49570.

Analyst



EPA METHOD 8021 AROMATIC VOLATILE ORGANICS

Client '	N/A	Project #	N/A
Sample ID.	04-07-BT QA/QC	Date Reported	04-08-09
Laboratory Number	49550	Date Sampled	N/A
Sample Matrix	Soil	Date Received	N/A
Preservative	N/A	Date Analyzed	04-07-09
Condition,	N/A	Analysis	BTEX

Property Cal RF 5	C Cal RF. 5	###%Diff # ge/0:-15% # 1	Blank jud.	Detect.
7 3103E+006	7 3249E+006	0.2%	ND	0.1
6 7260E+006	6 7394E+006	0.2%	ND	0 1
5 7716E+006	5 7831E+006	0.2%	ND	0.1
1 4794E+007	1 4823E+007	0.2%	ND	0.1
5 4788E+006	5 4898E+006	0.2%	ND	0.1
	6 7260E+006 5 7716E+006 1 4794E+007	6 7260E+006 6 7394E+006 5 7716E+006 5 7831E+006 1 4794E+007 1 4823E+007	6 7260E+006 6 7394E+006 0.2% 5 7716E+006 5 7831E+006 0.2% 1 4794E+007 1 4823E+007 0.2%	6 7260E+006 6 7394E+006 0.2% ND 5 7716E+006 5 7831E+006 0.2% ND 1 4794E+007 1 4823E+007 0.2% ND

Duplicate Conc (ug/Kg)	Sample	olicate w.y.	7.%Diff	Accept Range	Detect Limit 75
Benzene	68.6	67.5	1.6%	0 - 30%	0 9
Toluene	223	214	3.9%	0 - 30%	1.0
Ethylbenzene	260	251	3.7%	0 - 30%	1.0
p,m-Xylene	1,590	1,570	1.3%	0 - 30%	1 2
o-Xylene	<u></u>	254	2.6%	0 - 30%	0 9

Spike Conc (ug/Kg)	Sample, Amo	unt Spiked Spi	ked Sample	%Recovery	Accept Range
Benzene	68.6	50.0	114	96.1%	39 - 150
Toluene	223	50 0	260	95.4%	46 - 148
Ethylbenzene	260	50 0	302	97.2%	32 - 160
p,m-Xylene	1,590	100	1,670	98.8%	46 - 148
o-Xylene	261	50.0	307	98.9%	46 - 148

ND - Parameter not detected at the stated detection limit,


References Method 5030B, Purge-and-Trap, Test Methods for Evaluating Solid Waste SW-846, USEPA

December 1996

Method 8021B. Aromatic and Halogenated Volatiles by Gas Chromatography Using Photoionization and/or Electrolytic Conductivity Detectors. SW-846, USEPA December 1996

Comments: QA/QC for Samples 49550, 49551, 49561, 49562, 49564 - 49566, and 49568 - 49570.

Analyst

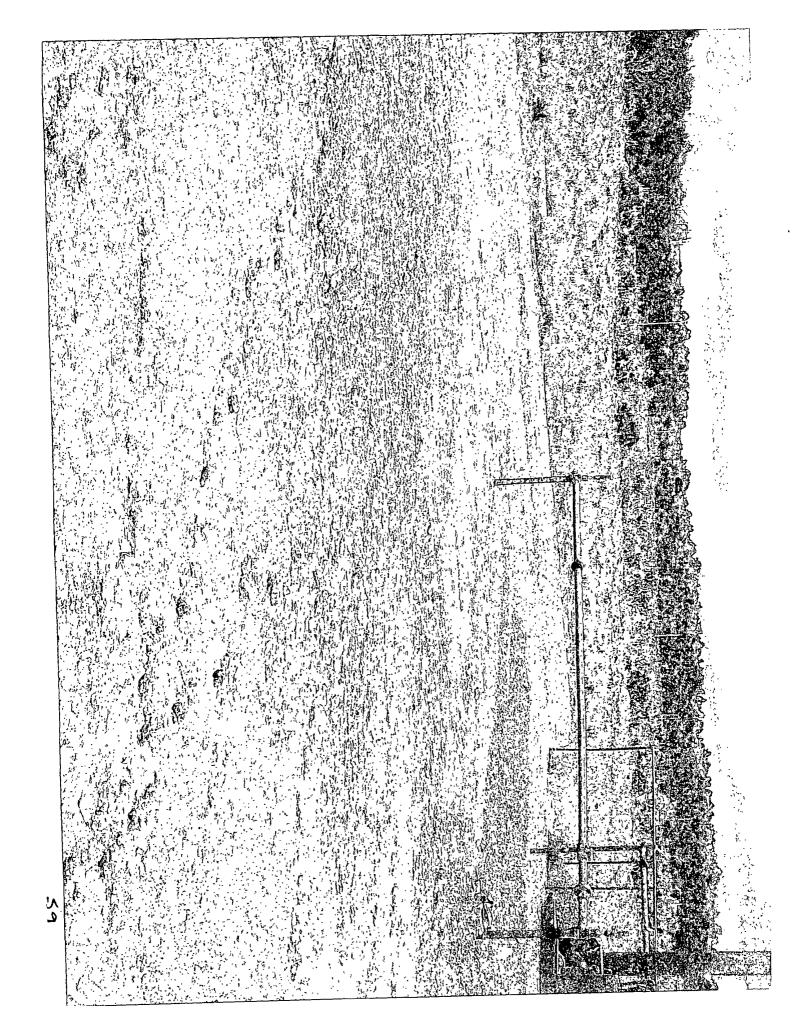

CHAIN OF CUSTODY RECORD

6730

Client:	Ext		Project Marge B	ocation:	59/L/	Tirosil	1.	97	MA	L				ANAL	YSIS	/ PAR	IAME	TERS					
. 15			Sampler Name.	Λωσ	3 10-1	الإهااا	رنة	17	100	Ê	<u> </u>					Γ	Γ		-				
1215.1	Jain.								TPH (Method 8015)	BTEX (Method 8021)	VOC (Method 9260)	S	·					}			}		İ
Client Phone No.:			Client No.:						hod	athor	thod	RCRA 8 Metals	Cation / Anion		TCLP with H/P		3.1	Ä				100	ntact
					-0003		,		(Met	Š	(Me	A 8 /	d / u		witt		(418	JRIC				ole C	ale II
Sample No./	Sample Date	Sample Time	Lab No.	1	ample Natrix	No./Volume of Containers			표	37E)	90/	3CR	Catio	<u>ي</u>	10.	PAH	TPH (418.1)	CHLORIDE		-		Sample Cool	Sample Intact
	1	11110	(, , ,)	Soil	Sludge	1 1	1,		+	7	-	-		-			+						-
Rosa 32B	8/3/09		49568	Solid	Aqueous	402	_		X	X	ļ						X	X					
Rosa 59GL	4/3/09		49569	Soil Solid	Sludge Aqueous	402			X	X					<u>.</u>		X	X					-
Jicarilla 92#17A	4/3/09	2:10,	49570	Solid Solid	Sludge Aqueous	402			\ \	٨							X	λ					
		•		Soil Solid	Sludge Aqueous				-														
				Soil Solid	Sludge Aqueous											_							,
				Soil Solid	Sludge Aqueous																		,
				Soil	Sludge														_				
				Solid	Aqueous Sludge				-										\dashv	-			
			 	Solid	Aqueous Sludge		-														-		
				Solid	Aqueous				<u></u>								•						
	h			Soil Solid	Sludge Aqueous																		
Relinquished by: (Signa	yure)[]			L	Date	Time	F	Receive	ed by:	(Sign	ature)		<u></u>				-	L		Da	ite	Tir	ne
	, -	W)			4-6-09	1:42	ورا			2/2	<u>^_</u> -			<u>S</u> _		>				4/4	109	: ژر	
Relinquished by: (Signa	iture)						F	Receive	ed By:	(Sign	atúre)					<u></u>	<u> </u>	111/		_			
Relinquished by: (Signa	14.40					 		Receive	od by:	/Sign	atura)					HE	した	IV	בט				
i neinquished by. (Signa	uore)							1606146	o by.	(Olgi ii	atorej				34.00	AP	R 1	3 20	109			٠.	
					FNV	ROT	F			n							Wi	Þχ				<u> </u>	
; [Ē											1	-	900	4 8		المحمد			
			5796 U.	S. High	way 64 °	Farming	ton	, NM	8740)1 •	Tel	505-	632-	0615	i								

Williams Production Co., LLC San Juan Basin: New Mexico Assets

Below-Grade Tank Removal
Closure Plan

In accordance with Rule 19.15.17.13 NMAC, the following plan describes the general closure requirements of below-grade tanks (BGT) on Williams Production Co, LLC (WPX) locations in the San Juan Basin of New Mexico. This is WPX's standard closure procedure for all BGTs regulated under Rule 19.15.17 NMAC and operated by WPX. For those closures which do not conform to this standard closure plan, a separate well/pit specific closure plan will be developed and utilized.

Closure Conditions and Timing:

Pursuant to 19.15.17.13 (A) NMAC, WPX will initiate closure of any BGT should any one of these conditions occur:

- The Division requires closure because of imminent danger to fresh water, public health or the environment.
- The integrity of the BGT fails. Notification will be within 48 hours to the Division and closure will be schedule as specified in 19.15.17.12 (A)(5) NMAC.
- WPX chooses to take the BGT out-of-service due to operational needs. Closure under these conditions will be initiated within 60 days of cessation of the BGT's operation.
- BGTs installed prior to June 16, 2008 that do not meet the requirements under 19.15.17.11.1(6) NMAC and WPX chooses not to retrofit or upgrade. Closure under these conditions will be completed within five years (by June 16, 2013).

General Plan Requirements:

- 1. Prior to initiating any BG1 Closure except in the case of an emergency, WPX will review County Tax Records for the current landowner of record. The landowner of record will be notified of the intent to closure the BGT by certified mail and a copy of this notification will be included in the closure report. In the case of an emergency, the landowner of record will be notified as soon as practical.
- 2. Notice of Closure will be given to the Aztec District office between 72 hours and one week of the scheduled closure via email or phone. The notification of closure will include the following:
 - a. Operators Name (WPX)
 - b. Well Name and API Number
 - c. Location (USTR)
- 3. All piping will be rerouted to an alternative produced water storage/disposal location (e.g. surface tanks, temporary frac tank, ...) The well will be temporarily shutin until the rerouting is completed.
- 4. All produced water will be removed from the BGT following discharge-pipe rerouting. Produced water will be disposed at one of the following NMOCD approved facilities depending on the proximity of the BGT site: Rosa Unit SWD #1 (Order: SWD-916, API: 30-039-27055), Rosa Unit #94 (Order: SWD-3RP-1003-0, API: 30-039-23035), Jillson Fed. SWD #001 (Order: R10168/R10168A, API: 30-039-25465), Middle Mesa SWD #001 (Order: SWD-350-0, API: 30-045-27004) and/or Basin Disposal (Permit: NM-01-0005).
- 5 Solids and sludges will be shoveled and /or vacuumed out for disposal at Envirotech (Permit Number NM-01-0011).
- 6. Williams will obtain prior approval from NMOCD to dispose, recycle, reuse, or reclaim the BGT and provide documentation of the disposition of the BGT in the closure report. Steel materials will be recycled or reused as approved by the Division. Fiberglass tanks will be empty, cut up or shredded, and EPA cleaned for disposal as solid waste. Liners materials will be cleaned without soils or contaminated material for disposal as solid waste. Fiberglass tanks and liner materials will meet the conditions of paragraph 1 subsection D or 19.15.9.712 NMAC. Disposal will be at a licensed disposal facility, presently San Juan Regional Landfill operated by Waste Management under NMED Permit SWM-052426.

- 7. Any equipment associated with the BGT that is no longer required for some other purpose, following the closure will be removed from the location.
- 8. Following removal of the tank and any liner material, a tive-point composite sample will be taken of the excavation and tested per 19.15.17.13(E)(4) NMAC as identified in Table 1. Grab samples will be collected from any area that is wet, discolored or showing other evidence of a release. Results will be report to the Division following receipt from the lab on Form C-141.

Table 1: Closure Criteria for BGTs

Components	Testing Methods	Closure Limits (mg/Kg)
Benzene	EPA SW-846 Method 8021B or 8260B	0.2
BTEX	EPA SW-846 Method 8021B or 8260B	50
TPH	EPA SW-846 Method 418.1(1)	100
Chlorides	EPA SW-846 Method 300.1(1)	250(2)

⁽¹⁾ Method modified for solid waste.

- 9. If the Division and/or Williams determine there is a release, Williams will comply with 19.15.3.116 NMAC and 19.15 1.19 NMAC.
- 10. Upon completion of the tank removal, and any necessary soil remediation, the excavation will be backfilled with non-waste earthen material compacted to native and covered with a minimum of one fool of top soil or background thickness. The surface will be recontoured to match the native grade.
- 11. For those portions of the former pit area no longer required for production activities, WPX will seed the disturbed areas the first growing season after the pit is covered. Seeding will be accomplished via drilling on the contour whenever practical, or by other Division-approved methods. Vegetative cover will equal 70% of the native perennial vegetative cover (un-impacted) consisting of at least three native plant species, including at least one grass, but not including noxious weeds, and maintained that cover through two successive growing seasons. Repeat seeding or planting will be continued until successful vegetative growth occurs. Note: WPX assumes the seeding stipulations including mix and seeding methods specified by the Surface Management Agency (BLM, BOR, USFS, Tribal, etc.) APD are Division-approved methods unless notified by the Division of their unacceptability. If a landowner agreement requires reseeding or other surface restoration that do not meet the revegetation requirements of 19.15.17.13. If then WPX will submit the proposed alternative with written documentation that the landowner agrees to the alternative, for Division approval.
- 12. For those portions of the former pit area required for production activities, reseeding will be done at well abandonment, and following the procedure noted above.

Closure Report:

All closure activities will include proper documentation and will be submitted to OCD within 60 days of the BGT closure on a Closure Report using Division Form C-144. The Report will include the following:

- Proof of Closure Notice (surface owner & NMOCD)
- Backfilling & Cover Installation
- Site Diagram with coordinates
- Available Inspection reports

- Confirmation Sampling Analytical Results
- Disposal Facility Name(s) and Permit Number(s)
- Re-vegetation Application Rate & Seeding techniques
- Photo Documentation of Reclamation

 $^{^{(2)}}$ If background concentration of Chlorides greater than 250 mg/Kg, then higher concentration will be used for closure.

Williams Production Co., LLC San Juan Basin: New Mexico Assets

Below Grade Tank Removal
Closure Plan

to accordance with Rule 19.15.17.13 NMAC the following plan describes the general classic requirements of below grade tanks (BGT) on Williams Production Co. LTC. (WPX) tocations in the San Juan Basin of New Mexico. This is WPX's standard closure procedure for all BGTs regulated under Rule 19.15.17 MMAC and operated by WPX. For those closures which do not conform to this standard closure plan a separate well/pit specific closure plan will be developed and utilized.

Closure Conditions and Timing:

Poissont to 19.15.17.13 (A) NMAC - WPX will initiate closure of any BG1 should any one of these conditions occur.

- The Division requires closure because of imminent danger to tresh water public health or the environment
- The integrity of the BGT fails. Notification will be within 48 hours to the Division and closure will be schedule as specified in 19.15.17.12 [A](5) NMAC.
- WPX chooses to take the BG1 out of service due to operational needs. Closure under these conditions will be closed within 60 days of cessation of the BG1's operation.
- BGIs installed prior to tune 16-2008 that do not meet the requirements under 19-15-17-11-1(6).
 UMAC, and WEX chooses not to retrofit or upgrade. Closure under these conditions will be completed within five years (by June 16-2013).

General Plan Requirements:

- Prior to initiating any BGT Closure except in the case of an emergency. WPX will review County Tax Records for the current surface owner of record. The surface owner of record will be notified of the intent to close the BGT by certified mail and a copy of this notification will be included in the closure report. In the case of an emergency, the surface owner of record will be notified as soon as practical.
- Notice of Closure will be given to the Aztec District office between 72 hours and one week of the scheduled closure via email or phone. The notification of closure will include the following
 - a Operators Name (WPX)
 - b. Well Name and API Number
 - c. Location (USTR)
- All piping will be rerouted to an alternative produced water storage/disposal location (e.g. surface tanks temporary fractank.) The well will be temporarily shut in until the rerouting is completed.
- All produced water will be removed from the BGT following discharge pipe rerouting Produced water will be disposed at one of the following NMOCD approved facilities depending on the proximity of the BGT site, Rosa Unit SWD #1 (Order: SWD 916, API: 30-039-27055). Rosa Unit #94 (Order: SWD-3RP-1003-0, API: 30-039-23035). Jillson Fed. SWD #001 (Order: SWD 350-0-AFI: 30-045-27004) and/or Basin Disposal (Permit NM-01-0005).

solids and studges will be shoveled and vor vacciomed out for disposal at Envirotech (Permit Nomber NM 01 00).

With will obtain prior approval trout RMOCLE to dispose the cicle there is a rectain the BGT and provide documentation of the disposition of the BGT in the closure report. Stee materials will be recycled or reused as approved by the Division. Tiberglass tanks will be empty, contain a shredded and FPA cleaned for disposor as solio waste. Tiber materials with



Exploration & Production PO Box 640

Artic NM 81137

505/634 4219

505/634 4214 Fox

March 10, 2009

Mr. Mark Kelly Bureau of Land Management Farmington Field Office 1235 La Plata Hwy Farmington, NM 87401

Sent via Certified Mail

RE Notification of Production Pit Closure
Rule 19 15 17 13 NMAC

Production Pits associated Natural Gas David

Production Pits associated Natural Gas Development Operated by Williams Production Co, LLC

Pursuant to Rule 19 15 17 13 NMAC, this correspondence is to notify the Bureau of Land Management, Farmington Field Office, of Williams Production LLC's (Williams') intent to clean close all production pits on the attached list of wells operated with the District in San Juan County and Rio Arriba County, New Mexico Closure will follow the plan included with this correspondence

Thank you for your consideration. If there are any questions or additional information is requested, please contact me at (505) 634-4209.

Respectfully submitted,

Holly C. Ferkins EH&S Specialist

Encl. Williams Production Pit Inventory List (Federal wells)

San Juan Basin - New Mexico Assels. Below-Grade Tank Closure Piar

cc Environmental File

WELLS W/FEDERAL SURF MGT	API	FMT	SEC	1WN	RNG	PIT TYPE	CONSTRUCTION MATERIAL
COX CANYON UNIT #001	3004511397	BI ANCU MV	16N	32N	HW	BGI	DBI WALL STEEL FIBERGLASS LANK WBANDED 20 mil
COX CANYON UNIT #001A	3004522086	BLANCO MV	16C	32N	11W	BGT	TIDPE SECONDARY LINER FIBERGLASS LANK WBANDED 20 mil
COX CANYON UNIT #001B	3004530791	BLANCO MV	161	3211	11W	BGT	HDPE SECONDARY LINER
COX CANYON UNIT #001C	3004532023	BLANCO MV	160:	32N	11W	BGI	DBL WALL STEEL FIBERGLASS TANK W/BANDED 20-mil
COX CANYON UNIT #003	3004511495	BLANCO MV	91	3214	11W	BGI	HDPE SECONDARY LINER
COX CANYON UNIT #003A	3004522088	BI ANCO MV	дÞ	3214	11W	BG1	DBI WALL STEEL
COX CANYON UNIT #003B	3004530871	BI ANCO MV	93	32N	11W	'BG1	DBI WALI STEET
COX CANYON UNIT #004	3004511368	BLANCO MV	21A	3211	11W	BG1	DBI WALI STEEL
COX CANYON UNIT #004A	3004522093	BI ANCO MV	21P	3211	11W	BG1	DBI WALL STEEL
COX CANYON UNIT #004B	3004532186	BI ANCO MV	21F	3211	11W	BGT	DBI WALL STEEL
COX CANYON UNIT #005	3004511326	BI ANCO MV	21K	3211	1111/	BG1	DBI WALL STEEL
COX CANYON UNIT #005A	3004522094	BLANCO MV BASIN DK /	211)	3214	11W	BGT	DBI WALL STEEL
COX CANYON UNIT #005B	3004532142	BI ANCO MV	211/	3514	1 I VV	BGI	DBL WALL STEEL
COX CANYON UNIT #0050	3004533493	BLANCO MV	211	3211	1 I W	BG1	DBI WALL SILEI
COX CANYON UNIT #006	3004511463	BI ANCO MV	16A	3211	11W	BG1	DBI WALL STEEL
COX CANYON UNIT #00GA	3004522095	BLANCO MV	161 .	3214	1 1 Vv	BGT	DBI WALL STEEL
COX CANYON UNIT #006B	3004532693	BI ANCO MV	16B	3214	111/	HG1	DBI WALI STEET
COX CANYON UNIT #006C	3004532733	BI ANCO MV	160	3214	1177	BG1	DBI WALL STEEL
COX CANYON UNIT #007	3004511455	BLANCO MV	17G	3214	1117	FGP	DBI WALI STEEL
COX CANYON UNIT #007A	3004522091	BLANCO MV	170	3514	11W	BG1	DBI WALL STEEL
COX CANYON UNIT #007C	3004533018	BASIN DK	17K	3514	1 1 VV	BG1	DBI WALL STEEL FIBERGLASS TANK W/BANDED 20-mil
COX CANYON UNIT #008	3004511492	BLANCO MV	81	3514	11W	BG1	HDPE SECONDARY LINER
COX CANYON UNIT #008A	3004522096	BLANCO MV	17H	32N	111/1	BG1	DBI WALL STEEL FIBERGLASS TANK WBANDED 20-mil
COX CANYON UNIT #008B	3004532080	BI ANCO MV	'8P	32N	11W	BG1	HDPE SECONDARY LINER FIBERGI ASS TANK WIBANDED 20 mil
COX CANYON UNIT #008C	3()04531187	BLANCO MV	1712	32N	11W	BGI	HDPE SECONDARY LINER FIBERGLASS TANK W/BANDED 20 mil
COM COX CANYON UNIT #009B	3004522092	BLANCO MV BASIN DK /	20D	32N	1177	BG1	HIDPE SECONDARY LINER
СОМ	3004533926	BLANCO MV BASIN DK /	20B	32N	11W	BG1	DBI WALL STEEL
COX CANYON UNIT #009C	3003933851	BL ANCO MV	20F	321/	11VV	BG1	DBI. WALL STEEL FIBERGLASS TANK WBANDED 20-mil
COX CANYON UNIT #013	3004521489	BLANCO PC	20A	3211	1177	BG1	HDPE SECONDARY LINER

be cleaned without soils or contaminated material for disposal as solid waste. Tiberglass tanks and liner materials will meet the conditions of paragraph 1 subsection D of 19.15.9.712. NMAC. Disposal will be at a licensed disposal facility, presently San Juan Regional Landill operated by Waste Management under RMLD Permit SWM 052426.

- Any equipment associated with the BGT that is no larger required for some other purpose following the closure will be removed from the location.
- 8 Following removal of the tank and any liner material a five point composite sample will be taken of the excavation and tested per 19.15.17.13(f;)(4) NMAC as identified in table 1. Grab samples will be collected from any area that is well discolored or showing other evidence of a release. Results will be report to the Division following receipt from the lab on Form C.141.

Table 1. Closure Criteria for BG1s

	rasio ii elasaro emene la col	
Components	Testing Methods	Closure Limits (mg/Kg)
Benzene	EPA SW-846 Method 8021B or 8260B	0.2
BIEX	EPA SW-846 Method 8021B or 8260B	50
1PH	EPA SW 846 Method 418.1111	100
Chlorides	EPA SW-846 Melhod 300 1111	250(-)

Method modified for solid waste

If bod ground concentration of Chlarides greater than 250 mg/r g, then higher concentration will exist for closure.

- 4 If the Division and/or WPX determine there is a release. WPX will comply with 19.15.3.116.

 TIMAC and 19.15.1.19 NMAC
- Upon completion of the tank removal. The excavation will be backfilled with non-waste earthen material compacted and covered with a minimum of one foot of top soil or background thickness whichever is greater and to existing grade. The surface will be recontoured to match the native grade and prevent ponding.
- For those portions of the former pit area no longer required for production activities. WPX will seed the disturbed areas the first growing season after the pit is covered. Seeding will be accomplished via drilling on the contour whenever proclicat or by other Division approved methods. Vegetative cover will equal 70% of the native perennial vegetative cover (un impacted) consisting of at least three native plant species, including at least one grass, but not including noxious weeds, and mointained that cover through two successive growing seasons. Repeat seeding or planting will be continued until successful vegetative growth occurs. Note, if a suitable owner agreement requires reseeding or other suifable restarction that do not meet re-vegetation requirements of 19.15.17.13.1.NMAC, then WPX will submit the proposed alternative with willen documentation that the suifable owner agrees to the alternative for Division approval.
- for those portions of the former pit area required for production activities reseeding will be done at well abandonment, and following the procedure noted above.

Closure Report:

All closure activities will include proper accumentation and will be submitted to OCD within 60 days of the RGT closure on a Closure Feboriusing Division Form C-144. The Report will include the following:

- From or Creame relate of the correct
- · Bore Filling & Cover stones
- · Sue Incomment of the time
- · Available inspectance:

- Continuation Sampling Flancisco Les 3
- · Insposort demit (sometic onci entra proeils)
- · Application hate & Security te thing;
- Photo Documentation of Le, armount

WELLS WIFEDERAL SURF MGT	API .	FMT	SEC	TWN	RNG	PIT TYPE	CONSTRUCTION MATERIAL
		BI ANCO MV /	-				
ROSA UNIT #012A	3003925900	ROSA PC	15J	31N	06W		DBL WALL STEEL
		BASIN DK /					FIBERGLASS TANK W/BANDED 20 mil
ROSA UNIT #012B	3003926555	BLANCO MV	1517	3111	(16W	BGT	HDPE SECONDARY LINER
ROSA UNIT #012C	3003929486	BLANCO MV	15A	31N	OGW	SG1	SINGLE WALL STEEL
							FIBERGLASS TANK W/BANDED 20 mil
ROSA UNIT #013	3003907936	BLANCO MV	31G	31N	0570	BGI	HDPE SECONDARY LINER
						•	FIBERGLASS TANK W/BANDED 20 mil
ROSA UNIT #013A	3003926298	BLANCO MV	311	31N	()5VV	BG1	HDPE SECONDARY LINER
		BASIN DK /					
ROSA UNIT #013B COM	3003929834	BLANCO MV	31A	31N	()5VV	BG1	DBI, WALL STEEL
							FIBERGLASS TANK W/BANDED 20-mil
ROSA UNIT #014	3003907958	BLANCO MV	23B	3111	06W		HDPE SECONDARY LINER
				- "			FIBERGLASS TANK W/BANDED 20-mil
ROSA UNIT #014A	3003926280	BLANCO MV	23P	31N	06W		HDPE SECONDARY LINER
		BASIN DK /					
ROSA UNIT #014C	3003930132	BI ANCO MV	2311	31N	06W	BGI	DBI. WALL STEEL
			•				FIBERGLASS TANK WBANDED 20 mil
ROSA UNIT #015	3003907946	BI ANCO MV	2911	31N	05W		HDPE SECONDARY LINER
							FIBERGLASS TANK W/BANDED 20 mil
ROSA UNIT #016	3003907963	BI ANCO MV	14N	3110	06W		HDPE SECONDARY LINER
							FIBERGLASS TANK W/BANDED 20-mil
ROSA UNIT #U16A	3003925496	BLANCO MV	14C	31N	06VV		HDPE SECONDARY LINER
							FIBERGLASS TANK W/BANDED 20-mill
ROSA UNIT #016B	3003926218	BLANCO MV	14M	31N	06V/	BG1	HDPE SECONDARY LINER
							FIBERGLASS TANK WBANDED 20-mil
ROSA UNIT #017A	3003926272	BLANCO MV	200	31N	05W	BG1	HDPE SECONDARY LINER .
		BASIN DK /					FIBERGLASS TANK w/BANDED 20-mi
ROSA UNIT #017B	3003926971	BI.ANCO MV	20J	31N	05VV		HDPE SECONDARY LINER
		BLANCO MV /					FIBERGLASS TANK W/BANDED 20-mil
ROSA UNIT #018	3003907960	ROSA PC	22H	31N	06W	BGI	HDPE SECONDARY LINER
		BLANCO MV /					
ROSA UNIT #018A	3003925436	ROSA PC	22P	31N	06W	SGI	DBI, WALL STEEL
,							
ROSA UNIT #018B	3003927052	BLANCO MV	220	31N	06W		DBL WALL STEEL
							FIBERGLASS TANK W/BANDED 20-mil
ROSA UNIT #019	3003907955	BI ANCO MV	24K	31N	06W	BGT	HDPE SECONDARY LINER
							FIBERGLASS TANK W/BANDED 20-mil
ROSA UNIT #019B	3003926560	BI ANCO MV	241	3110	06Vv	BG1	HDPE SECONDARY LINER
ROSA UNIT #019C	3003929625	BLANCO MV	24D	31N	06W	BGI	DBL WALL STEEL
DOCA LIBIT FOLOO	0000000000	DI ANCONY	0.5		0.0	~~~	DDL WALL CASS
ROSA UNIT #019C	3003929625	BI ANCO MV	24D	31N	06W	BG1	DBL WALL STEEL
DOCA LINIT MOOO	2002002002	DI ANGO IN			00141	0.03	FIBERGLASS TANK WIBANDED 20-mi
ROSA LINIT #020	3003907969	BLANCO MV	14G	3111	()6W	BG1	HDPE SECONDARY LINER
DUCV TIPE 4000V	2000005 105	DI 44100 1111			0.015	0.03	FIBERGLASS TANK W/BANDED 20 mg
ROSA UNIT #020A	3003925495	BI ANCO MV	140	31N	06W	BGT	HDPE SECONDARY LINER
DOCA HARL MOSON	200200000	DI ANCO III			/1/11 A ·	001	DOL WALL STEEL
ROSA UNIT #020B	3003926220	BI ANCO MV	14A	31N	06W	BGI	DBL WALL STEEL
DOO A LIBERT HOOCO	000000000	DI 44/20 11/1				507	FIBERGLASS TANK W/BANDED 20-mi
ROSA UNIT #020C	3003926221	BLANCO MV	143	31N	OGVV	BG1	HDPE SECONDARY LINER
DOCA LIEBY WOOLS		D/ 44120 :		6			FIBERGLASS TANK W/BANDED 20-mi
ROSA UNIT #021A	3003926121	BLANCO MV	23C	31N	06W	BG1	HDPE SECONDARY LINER
OOCA LINIT HOOLD	000000055	DI MICOLUI	221	2441	0011	0.07	DDI WALL CITTI
ROSA UNIT #021B	3003926554	BI.ANCO MV	23K	311	06W	BG7	DBL WALL STEEL
DOCA LIMIT word	200200707	DLANCOAN	40.6	2.11	415141	12 (2.3)	FIBERGLASS TANK W/BANDED 20-mi
ROSA UNIT #02!	3003907971	BLANCO MV	18A	3114	05W	BGT	HDPE SECONDARY LINER

.

WELLS WIFEDERAL						i	٠
SURF MGT	API	FMI	SEC	TWN.	RNG	PIT TYPE	
COX CANYON UNIT #023 COM	3004522537	BLANCO PC	17C	3214	1177	BG1	FIBERGLASS TANK W/BANDED 20-mil HDPL SECONDARY LINER
COX CANYON UNIT #025	3004522572	BLANCOPC	9O	3214	1 1 VV	BG1	HDPE SECONDARY LINER
COX CANYON UNIT #200	3004527878	BASINFIC	91	3514	1.1 VV	BGI	FIBERGLASS TANK W/BANDED 20 millippe SECONDARY LINER
COX CANYON UNIT #200A	3004532126	BASINTIC	90	32iN	11W	· BG1	FIBERGLASS TANK WBANDED 20-mil HOPE SECONDARY LINER FIBERGLASS TANK WBANDED 20-mil
COX CANYON UNIT #203	3004527872	BASIN FIC	17A	3214	11W	BG1	HDPE SECONDARY LINER
MAUDOX #001	3004511487	BLANCO MV	10N	32N	11W	BG1	DBI WALL STEEL
MAUDOX #001A	3004523539	BI ANCO MV	106	32N	11W	, BC1	DBI WALL STEEL
NM 32 11 #001	3004511309	BLANCO MV BASIN DK /	200	32N	liW	BG1	DBL WALL STEEL
NM 32-11 #001B COM	3004532024	BI ANCO MV BASIN DK /	20J	32N	τιW	BG1	DBI WALI STEEL
NM 32 11 #001C COM	3004532804	BLANCO MV	201	32N	1 1 V V	BG1	DBL WALL STEEL FIBERGLASS TANK WBANDED 20 mil
NM 32-11 #002 COM	3004511380	BI ANCO MV	19A	32N	111/	BGT	HDPE SECONDARY LINER
NM 32-11 #002A COM	3004529017	BI, ANCO MV	190	3214	111//	BGT	DBI WALL STEEL
NM 32-11 #002B COM	3004532670	BI ANCO MV	191	3211	IIW	BG1	DBI. WALL STEEL
NM 32-11 #002C COM	3004533077	BI ANCO MV	19G	32N	.11W	BG1	DBI WALL STEEL
ROSA UNIT #001 SWD	3003927055	SWD BASIN DK /	231	31N	06W	BGT	DBI WALL STEEL FIBERGLASS TANK WBANDED 20 mil
ROSA UNIT #001E	3003925411	BLANCO MV BLANCO MV /	11P	31N	06Vv	BGI	HDPE SECONDARY LINER
ROSA UNIT #005A	3003925407	ROSA PC BASIN DK /	26P	3111	W80	BG1	DBI WALL STEEL
ROSA UNIT #005B	3003926927	BI ANCO MV	26B	31N	06Vv	BGT	DBL WALL STEEL FIBERGLASS TANK W/BANDED 20-mil
ROSA UNIT #005Y	3003926078	BLANCO MV /	2611	31N	06W	BGT	HDPF SECONDARY LINER FIBERGLASS LANK W/BANDED 20 mil
ROSA UNIT #008	3003907944	ROSA PC BLANCO MV	26M	31N	06W	BGI	HDPE SECONDARY LINER FIBERGLASS TANK W/BANDED 20 mil
ROSA UNIT #008	3003907944	ROSA PC BLANCO MV /	2614	31N	06W	BGT	HDPE SECONDARY LINER FIBERGLASS TANK WIBANDED 20-mil
ROSA UNIT #008A	3003925430	ROSA PC	261)	31N	06W	BG1	HDPE SECONDARY LINER FIBERGLASS TANK WBANDED 20 mil
ROSA LINIT #008C	3003926944	BLANCO MV	26N	3114	06W	BG1	HDPE SECONDARY LINER FIBERGLASS TANK WBANDED 20 mil
ROSA UNIT #009	3003907975	BLANCO MV BASIN DK /	11K	3110	06W	BG1	HDPE SECONDARY LINER
ROSA UNIT #009A	3003925584	BLANCO MV	11C	3110	06W	BG1	DBL WALL STEEL FIBERGLASS TANK WBANDED 20-mil
ROSA UNIT #009B	3003927042	BLANCO MV	11E	3114	067/	BG1	HDPE SECONDARY LINER FIBERGLASS TANK W/BANDED 20-mil
ROSA UNIT #010B	3003926556	BLANCO MV	1311	31N	060	BGT	HDPE SECONDARY LINER
ROSA UNIT #010C	3003926918	BLANCO MV	13N	3111	06W	/ BG1	DBL WALL STEEL
ROSA UNIT #0100	3003926556	BLANCO MV	13N	3114	QGW	/ BGT	DBL WALL STEEL

WELLS W/FEDERAL SURF MG1	API	FM1	SEC	TWN	RNG	PIT TYPE	CONSTRUCTION MATERIAL
							FIBERGI ASS TANK W/BANDED 20-mil
ROSA UNIT #034C	3003926969	BLANCO MV	3611	3214	06W	BG1	HDPE SECONDARY LINER
ROSA UNIT #035X	3004510996	BLANCO MV	5K	3110	06W	BGI	DBI WALL STEEL
ROSA UNIT #036	3003907977	BLANCO MV	1.111	3110	06VV	BGT	FIBERGLASS TANK W/BANDED 20-mil HDPE SECONDARY LINER
ROSA UNIT #0360.	3003930182	BLANCO MV	11G	3114	06VV	BG1	LIBERGLASS TANK WBANDED 20 mill HDPE SECONDARY LINER
(COSK (141) #030()		DI ANCO MV	110	2111	OOVV	,	FIBERGLASS TANK W/BANDED 20 mil
ROSA UNIT #041	3003907981	BLANCO MV BASIN DK /	5K	31N	05W	BĠ1	HDPE SECONDARY LINER FIBERGLASS LANK WBANDED 20-mil
ROSA UNIT #041B	3003927014	BLANCO MV	6b	3118	05W	BG1	HDPL SECONDARY LINER
ROSA UNIT #044	3003925873	BI ANCO MV	35K	32N	UGW	' BG1	DBI WALL STEEL
ROSA UNIT #044A	3003926161	BLANCO MV	35E	3211	06W	SGI	SINGLE WALL STEEL
ROSA UNIT #()44A	3003926161	BLANCO MV	35E	32N	06W	SGI	DBL WALL STEEL
ROSA UNIT #044B	3003926685	BLANCO MV	35C	32N	06Vv	BGI	FIBERGLASS TANK WBANDED 20-mil HDPE SECONDARY LINER
ROSA UNIT #045	3003923013	BLANCO MV	M6	3110	05W	BG1	FIBERGLASS TANK W/BANDED 20-mil HDPE SECONDARY LINER
		BASIN DK /					FIBERGLASS TANK w/BANDED 20 mil
ROSA UNII #046A	3003926986	BI ANCO MV	8C)	3110	05W	BG1	HIDPE SECONDARY LINER
ROSA UNIT #051	3003920289	BASIN DK	23C	31N	()6\V	BG1	DBL WALL STEEL FIBERGLASS TANK W/BANDED 20-mil
ROSA UNIT #053	3003920293	BASIN DK	88	31N	05W	BG1	HDPE SECONDARY LINER
ROSA UNIT #055	3003920923	BASIN DK	341	3111	05VV	BG1	FIBERGLASS TANK W/BANDED 20 mil HDPE SECONDARY LINER
ROSA UNIT #059 DK	3003923270	BASIN DK	2514	31N	06\%	BGI	DBL WALL STEEL FIBERGLASS TANK WBANDED 20-mil
ROSA UNIT #059 GI	3003923270	UNDES GL	25N	31N	06W	BGT	HDPE SECONDARY LINER
ROSA UNIT #060	3004529798	BLANCO MV	41	3111	()6Vv	BG1	FIBERGLASS TANK W/BANDED 20-mil HDPE SECONDARY LINER
ROSA UNIT #064	3003921703	BASIN DK	29A	3118	05W	BGI	DBI WALL STEEL
ROSA UNIT #064	3003921703	BASIN DK BASIN DK /	29A	3111	05W	SGI	DBI WALL STEEL
ROSA UNIT #064M	3003925563	BLANCO MV	291	31N	05W	BG1	DBL WALL STEEL FIBERGLASS TANK WBANDED 20-mil
ROSA UNIT #065	3003921702	BASIN DK	17A	3111	05W	BGT	HDPE SECONDARY LINER
ROSA UNIT #066	3003921758	BASIN DK	131	31N	06W	BG1	FIBERGLASS TANK WBANDED 20-mil HDPE SECONDARY LINER
ROSA UNIT #066M	3003925747	BASIN DK / BLANCO MV	13F	31N	06W	BGI	FIBERGLASS TANK WBANDED 20-mil HDPE SECONDARY LINER
ROSA UNIT #072	3003925509	BLANCO MV	61	31N	(15VV	BGI	FIBERGLASS TANK W/BANDED 20-mil HDPE SECONDARY LINER
ROSA UNIT #072A	3003925795	BLANCO MV	6K	31N	05\/	BG1	FIBERGLASS TANK W/BANDED 20-mil HDPE SECONDARY LINER
ROSA UNIT #075	3004529895	BLANCO MV	101	311	06/7	BG1	FIBERGLASS TANK w/BANDED 20-mil HDPE SECONDARY LINER
ROSA UNIT #075A	3004529854	BI ANCO MV	40	31N	06VV	BGI	FIBERGLASS TANK W/BANDED 20-mil HDPE SECONDARY I INER
ROSA UNIT #07 ²	3003922538	DK/UNDES GL/BLANCO	331.	31N	05VV	BGI	FIBERGLASS TANK W/BANDED 20-mill HDPE SECONDARY LINER

. --

WELLS WIFEDERAL SURF MGT	API	FM1	SEC	TWN	RNG	PIT TYPE	CONSTRUCTION MATERIAL
						***************************************	FIBERGI ASS TANK W/BANDED 20-mi
ROSA UNIT #022A	3003926390	BI ANCO MV	18C	3110	05Vv		HDPE SECONDARY LINER FIBERGLASS TANK WBANDED 20 mil
ROSA UNIT #023	3003907942	BLANCO MV	29M	3114	05VV		HDPE SECONDARY LINER
ROSA UNIT #023B	3003926553	BI ANCO MV	29E	31N	05\/\	8G1	FIBERGLASS TANK WBANDED 20-mil HDPE SECONDARY LINER
ROSA UNIT #023C	3003927609	BASIN DK / BI ANCO MV	291	31N	05W	BG1	FIBERGLASS TANK WBANDED 20-mil HDPE SECONDARY LINER
ROSA UNIT #024	3003907933	BI ANCO MV	32M	3110	115VV	BG1	FIBERGI ASS TANK W/BANDED 20-mil HDPE SECONDARY LINER
ROSA UNIT #024A	3003925568	BASIN DK / BLANCO MV	32E	3114	05W	SG1	DBL WALL STEEL
OOCA LOUIS MODALI	00// 800 000	BASIN DK /					FIBERGLASS TANK W/BANDED 20 mil
ROSA UNIT #024B	3003926630	BLANCO MV BASIN DK <i>I</i>	32N	31N	05VV	-	FIBERGLASS TANK W/BANDED 20-mil
ROSA UNIT #024C	3003926968	BLANCO MV BASIN DK /	32C	31N	05W	BG1	HDPE SECONDARY LINER
ROSA UNIT #026A	3003925580	BLANCO MV	320	31N	05W	SG1	DBI WALL STEEL
ROSA UNIT #026B	3003926788	BASIN DK	32G	3114	05W		DBL WALL STEEL FIBERGLASS TANK WBANDED 20-mil
ROSA UNIT #029	3004511136	BLANCO MV BASIN DK /	32H	3210	0674	BG1	HDPE SECONDARY LINER FIBERGLASS TANK w/BANDE() 20-mil
POSA UNIT #029B	3004530709	BLANCO MV BASIN DK /	32B	32N	06Vv		HDPE SECONDARY LINER
ROSA UNIT #029M	3004529584	BLANCO MV BASIN DK /	321	3211	ObVV		DBL WALL STEEL
ROSA UNIT #030 COM	3003925570	BLANCO MV	120	31N	06W	BG1	FIBERGI ASS TANK W/BANDED 20 mil HDPE SECONDARY LINER
RUSA UNIT #030A	3003926068	BI ANCO MV	1214	3110	06W	BG1	FIBERGLASS TANK WBANDED 20 mil HDPE SECONDARY LINER
ROSA UNIT #030B	3003926601	BLANCO MV	12N	3111	06W		FIBERGI ASS TANK W/BANDED 20 mil HDPE SECONDARY LINER
ROSA UNIT #030C	3003929842	BI ANCO MV	12P	31N	06W	BGI	DBI. WALL STEEL
ROSA UNIT #031	3003926279	BI ANCO MV	17C	3111	05W	BG1	FIBERGLASS TANK W/BANDED 20-mil HDPE SECONDARY LINER
ROSA UNIT #031A	3003926346	BLANCO MV	171	31N	05W		FIBERGI ASS TANK W/BANDED 20-mit HDPE SECONDARY LINER
ROSA UNIT #031B	3003926579	BASIN DK / BLANCO MV	171)	3111	05W	BG1	FIBERGLASS TANK W/BANDED 20 mil HDPE SECONDARY LINER
ROSA UNIT #031C	3003926578	BLANCO MV	17N	31N	05VV	BG1	FIBERGLASS TANK W/BANDED 20-mil HDPE SECONDARY LINER
ROSA UNIT #032	3003925389	BLANCO MV / ROSA PC	2114	31N	06VV	BGT	DBL WALL STEEL
ROSA UNIT #032A	3003925417	BLANCO MV / ROSA PC	21F	3114	06W	BG1	DBI WALL STEEL
ROSA UNIT #032B	3003926771	BASIN DK / BLANCO MV	21G	311	06Vv	BG1	FIBERGLASS TANK W/BANDED 20-mil HDPE SECONDARY LINER
ROSA UNIT #032C	3003927240	BASIN DK / BLANCO MV	211	31N	06VV	BGI	FIBERGLASS TANK WBANDED 20-mil HDPE SECONDARY LINER
ROSA UNIT #034	3003907984	BLANCO MV	36B	32N	06W	BG1	FIBERGLASS TANK W/BANDED 20-mil HDPE SECONDARY LINER
ROSA UNIT #034A	3003926119	BI ANCO MV	361	32N	06W	BGI	DBL WALL STEEL
ROSA UNIT #034A	3003926119	BLANCO MV	361	32N	06W	SG1	DBL WALL STEEL
ROSA UNIT #034E	3003926629	BLANCO MV	3 6J	3211	06W	BG1	FIBERGLASS TANK W/BANDED 20-mil HDPE SECONDARY LINER

WELLS W/FEDERAL SURF MG1	API	FM1	SEC	TWN	RNG	PIT TYPE	CONSTRUCTION MATERIAL
ROSA UNIT #119	3003925143	BASIN DK	1817	3111	∪5\ V	BGI	DBI WALL STEEL FIBERGLASS LANK WBANDED 20-mi
ROSA UNIT #125	3003925144	BLANCO MV	13B	3111	06W	BG1	HDPE SECONDARY LINER
ROSA UNIT #125C	3003929843	BLANCO MV BASIN DK /	13G	31N	06W	BGI	DBL WALL STEEL FIBERGLASS TANK w/BANDED 20-mi
ROSA UNIT #125E	3003925526	BI ANCO MV	13J	3111	06W	BG1	HDPE SECONDARY LINER
ROSA UNIT #129	3003926304	BI ANCO MV	34E	3214	06W	BGT	DBI WALL STEEL
ROSA UNIT #129A	3003926297	BI ANCO MV	34K	32N	06W	BG1	DBI WALL STEEL FIBERGLASS TANK w/BANDED 20-mi
ROSA UNIT #137	3003925410	BLANCO MV /	31K	3110	05W	BG1	HDPE SECONDARY LINER
ROSA UNIT #137A	3003926129	ROSA PC	311	31N	05W	BG1	DBL WALL STEEL FIBERGLASS TANK W/BANDED 20-m
ROSA UNIT #137B	3003927002	BLANCO MV BLANCO MV /	31P	31N	05W	BG1	HDPE SECONDARY LINER
ROSA UNIT #138	3004529147	ROSA PC BLANCO MV /	171	3110	06W	BG1	FIBERGLASS TANK W/BANDED 20-mi HDPE SECONDARY LINER
ROSA UNIT #138A	3004529134	ROSA PC	1714	3111	W80	BG1	DBI WALL STEFI
ROSA UNIT #138B	3004532168	BI ANCO MV	1714	3111	06W	BG1	DBI WALL STEEL
ROSA UNIT #139A	3004529600	BI ANCO MV	17IM	3110	u6W	BG1	DBI WALL STEEL
ROSA UNIT #140	3003925435	ROSA PC	22K	31N	06W	BG1	DBL WALL STEEL
ROSA UNIT #144	3003925421	RUSA PC	26A	3111	06VV	BG1	DBI WALL STEEL
ROSA UNIT #145C	3004533086	BI ANCO MV	161	3111	(161/	BGT	DBI WALL STEEL
ROSA UNIT #146A	3003925513	BI ANCO MV	2814	3110	05٧٧	BG1	FIBERGLASS TANK W/BANDFD 20 mi HDPE SECONDARY LINER
ROSA UNIT #146C -	3003930187	BI ANCO MV	28B	31N	()5VV	BGI	DBI WALL STEEL
ROSA UNIT #148	3003925493	BASIN DK	20	3110	06₩	BG1	DBI WALI STEEL
ROSA UNIT #148A	3003925776	BI ANCO MV	214	31N	06₩	BG1	DBI WALL STEEL
ROSA UNIT #148B	3003926985	BI ANCO MV	2P	3111	06W	BG1	FIBERGLASS TANK w/BANDED 20-mill HDPE SECONDARY LINER
ROSA UNIT #149	3003925501	BI ANCO MV	12G	3111	06VV	BG1	TIBERGLASS TANK WBANDED 20-mi
ROSA UNIT #149A	3003925807	BI ANCO MV	121	3114	VV80	BGI	DBI WALL STEEL
ROSA UNIT #149B	3003926599	BASIN DK / BLANCO MV	12E	31N	06W	BG1	FIBERGLASS TANK W/BANDED 20-m HDPE SECONDARY LINER
ROSA UNIT #150	3004529229	BL ANCO MV	32F	3211	06W	BG1	FIBERGLASS TANK W/BANDED 20-m HDPE SECONDARY LINER
ROSA UNIT #150A	3004529592	BI ANCO MV	32M	32N	06VV	BGT	DBI WALL STEEL
ROSA UNIT #150B	3004530874	BASIN DK / BI ANCO MV	321)	3211	0677	BG1	DBL WALL STEEL
ROSA UNIT #1500	3004532157	BI ANCO MV	32K	32N	υ6 ν √	BG1	DBI WALL STEEL
ROSA UNIT #15	3004529267	BLANCO MV	33C	3214	u6W	BG1	DBL WALL STEEL

.

WELLS WIFEDERAL SURF MGT	API	FMI	SEC	TWN	RNG	PIT TYPE	CONSTRUCTION MATERIAL
		BASIN DK /	010		NINO	711 111 6	· · · · · · · · · · · · · · · · · · ·
ROSA UNIT #079	3003922539	BLANCO MV BASIN DK /	22K	31N	06W	BG1	DBL WALL STEEL
ROSA UNIT #079	3003922539	BLANCO MV BLANCO MV /	22K	3111		SGI	DBI WALL STEFF
ROSA UNIT #079A	3003925412	ROSA PC BASIN DK I	35E	3110	06W	BG1	DBI WALL STEEL
ROSA UNIT #079B	3003926920	BI. ANCO MV	22C	3114	06Vv	BGI	DBI WALL STEEL
ROSA UNIT #079C	3003929902	BLANCO MV BASIN DK /	31P	3118	05W	BGT	DBL WALL STEEL FIBERGLASS TANK W/BANDED 20-mil
ROSA UNIT #080	3003922537	BI ANCO MV	8K	3111	u5W	BG1	HDPE SECONDARY LINER FIBERGLASS TANK WBANDED 20-mil
ROSA UNIT #080A	3003926413	BLANCO MV	8F	31N	05W	BG1	HDPE SECONDARY LINER FIBERGI ASS TANK WBANDED 20 mil
ROSA UNIT #085	3003922778	BASIN DK	20A	31N	05W	BG1	HDPE SECONDARY LINER FIBERGI ASS TANK WBANDED 20-mil
ROSA UNIT #085	3003922778	BLANCO MV	20A	31N	05W	BG1	HDPE SECONDARY LINER
ROSA UNIT #085A	3003926314	BI ANCO MV	20C	31N	05W	BG1	FIBERGLASS TANK WBANDED 20 mil HDPE SECONDARY LINER
ROSA UNIT #085B	3003930130	BI ANCO MV	200	3110	05W	BGT	DBI WALL STEEL
ROSA UNIT #086	3003922766	UNDES GI BLANCO MV /	12W+	3111	04VV _.	SG1	SINGLE WALL STEEL
ROSA UNIT #088	3004525140	ROSA PC	8E	31N	06W	BGT	DBL WALL STEEL
ROSA UNIT #089	3003922782	BLANCO MV	34A	32N	0677	BGI	FIBERGLASS TANK WBANDED 20 mil HDPE SECONDARY LINER
 ROSA LINI1 #089A	3003925512	BI ANCO MV	34()	32N	06W	BG1	FIBERGLASS TANK w/BANDE() 20-mil HDPE SECONDARY LINER
ROSA UNIT #089B	3003926851	BI ANCO MV	341	3211	06W	BĞT	DBI WALI STEEL
ROSA UNIT #089C	3003926674	BI ANCO MV	34G	32N	OGVv	SGI	SINGLE WALL STEEL
ROSA UNIT #090 COM	3004525370	BI ANCO MV	33G	3210	06W	BG1	FIBERGLASS TANK WBANDED 20 mil HDPE SECONDARY LINER
ROSA UNIT #090A COM	3004529259	BI ANCO MV	33G	32N	06W	BG1	DBI. WALL STEEL
ROSA UNIT #091	3003922780	BI ANCO MV	3514	32N	06W	BGI	FIBERGLASS TANK WBANDED 20-mil HDPE SECONDARY LINER
ROSA UNIT #091A	3003925790	BLANCO MV	350	32N	06W	SGI	DBL WALL STEEL
ROSA UNIT #091B	3003926684	BI.ANCO MV	35P	32N	06W	BG1	DBL WALI. STEEL FIBERGLASS LANK w/BANDED 20 mil
ROSA UNIT #091C	3003926991	BI ANCO MV	35G	32N	06W	BG1	HDPE SECONDARY LINER
ROSA UNIT #098	3003923265	BASIN DK / GI BASIN DK /	231	31N	06٧٧	BG1	FIBERGI ASS TANK W/BANDED 20-mil HDPE SECONDARY LINER
ROSA UNIT #100B	3003929547	BLANCO MV	210	3111	06W	BG1	DBL WALL STEEL
ROSA UNIT #100C	3003929851	BLANCO MV BLANCO MV /	21K	31N	06Vv	BG1	DBL WALL STEEL
ROSA UNIT #100E	3003925135	ROSA PC	211	31N	06W	sG1	SINGLE WALL STEEL
ROSA UNIT #101M	3003925577	BI ANCO MV	24F	31N	06W	BG1	DBL WALL STEEL
ROSA UNIT #101	3003923506	BASIN DK / GL	7G	3110	U5W	BG1	FIBERGLASS TANK WBANDED 20-mil HDPE SECONDARY LINER

WELLS W/FEDERAL SURF MG1	API	FM1	SEC	TWN	RNG	PII TYPE	CONSTRUCTION MATERIAL
		BI ANCO MV /			1110		CONTROL IN THAT ENIAL
ROSA UNIT #165	3003926070	ROSA PC	251	31N	06W	BGT	DBI WALL STEEL FIBERGLASS LANK WIBANDLD 20 mil
ROSA UNIT #165A	3003926150	BLANCO MV BASIN DK /	25B	31N	OGVV	BG1	HDPE SECONDARY LINER
ROSA UNIT #165B	3003926557	BLANCO MV BASIN DK /	25E	31N	06W	BG1	DBL WALL STEEL
ROSA UNIT #165C	3003926961	BI ANCO MV	25G	31N	06VV	BG1	DBL WALL STEEL FIBERGLASS TANK W/BANDFD 20-mil
ROSA UNIT #166	3003926275	BI ANCO MV	30A	3110	05VV	BĞ1	HDPE SECONDARY LINER
ROSA UNIT #166A	3003926282	BI ANCO MV	30F	3110	05W	BGT	FIBERGLASS TANK W/BANDED 201-mill HDPE SECONDARY LINER
ROSA UNIT #167A	3004529886	BI ANCO MV	8A	31N	06W	' BG1	FIBERGLASS TANK W/BANDED 20-mil HDPE SECONDARY LINER
ROSA UNH #169	3003926130	BI ANCO MV	3J	31N	06W	BG1	DBI WALL STEEL
ROSA UNIT #169A	3003926149	BI ANCO MV	3J	31N	06W	RG1	DBI WALL STEEL
ROSA UNIT #169C	3003927717	BI ANCO MV	2M	3111	06W	BG1	FIBERGLASS TANK WBANDED 20-mil HDPE SECONDARY LINER
ROSA UNIT #170	3003925851	BLANCO MV	2110	31N	06W	BG1	DBI WALL STEEL
ROSA UNIT #171	3003926286	BI ANCO MV	7G	3111	05VV	BG1	DBI WALL STEEL
ROSA UNIT #171A	3003926389	BI ANCO MV	7G	31N	05W		FIBERGLASS TANK WBANDED 20 mil HDPE SECONDARY LINER
ROSA UNIT #171B	3003927013	BI ANCO MV	612	3111	05VV		FIBERGI ASS TANK WBANDED 20 mil HDPE SECONDARY LINER
ROSA UNIT #180	3004529898	BI ANCO MV	910	31N	06VV		FIBERGI ASS TANK W/BANDED 20 mil HDPE SECONDARY I INER
ROSA UNIT #180B	3004533134	BI ANCO MV	94.	3111	06W	BGI	DBI WALL STEEL
ROSA UNIT #180C	3004533191	BI ANCO MV	9E	31N	06W	BG1	DBI WALL STEEL
ROSA UNIT #181	3003926463	BI ANCO MV	11K	31N	06Vv		DBI WALL STEEL
ROSA UNIT #181A ROSA UNIT #181C (shared	3003926312	BI ANCO MV	15A	31N	06W		FIBERGLASS TANK W/BANDED 20 mil HDPE SECONDARY LINER
w/169C)	3003927714	BLANCO MV	214	3114	06W	BG1	FIBERGLASS TANK W/BANDED 20 mill HDPE SECONDARY LINER
ROSA UNIT #182	3003926283	BI ANCO MV	181	31N	05W	BG1	FIBERGLASS TANK W/BANDED 20-mil HDPE SECONDARY LINER
ROSA UNIT #182A	3003926285	BI, ANCO MV	18P	3111	05W	BGT	DBL WALL STEEL
ROSA UNIT #182C	3003930180	BL ANCO MV	18P	31N	05W	SGI	SINGLE WALL STEEL
ROSA UNIT #183	3003926387	BL ANCO MV	19G	31N	05W	BGI	FIBERGLASS TANK W/BANDED 20-mil HDPE SECONDARY LINER
ROSA UNIT #183A	3003926386	BLANCO MV	19F	31N.	05W	BG1	FIBERGLASS TANK W/BANDED 20-mil HDPE SECONDARY LINER
ROSA UNIT #183B	3003930087	BL ANCO MV	19B	3111	05W	BG1	DBI WALL STEEL
ROSA UNIT #185B	3004532734	BASIN DK / BLANCO MV	16F	31N	06W	вст	DBI WALL STEEL
ROSA UNIT #1850	3004534484	BLANCO MV	161	31N	06W	BGI	DBI WALL STEEL
ROSA UNIT #18!	3003930186	BLANCO MV	21G	3111	05VV	BG1	DBI. WALL STEEL

WELLS WIFEDERAL							
SURF MG1	API	. FMT	SEC	TWN	RNG	PH TYPE	CONSTRUCTION MATERIAL
ROSA UNIT #151A	3004529631	BI ANCO MV	33L	32N	0677	BG≀	DBL WALL STEEL
ROSA UNIT #151C	3004532196	BI ANCO MV	3311	32N	06W	BG1	DBL WALL STEEL
ROSA UNIT #152	3003925494	BI ANCO MV	36E	3214	06W	BGT	FIBERGLASS TANK W/BANDED 20 mil HDPE SECONDARY LINER
ROSA UNIT #152A	3003925695	BI ANCO MV	36N	3214	06W	BG1	DBI WALL STEEL
ROSA UNIT #152B	3003926631	BI ANCO MV	36C	32N	06//	BG1	DBI WALL STEEL
ROSA UNIT #152C	3003927635	BLANCO MV	361	32N	()6W	BG1	FIBERGLASS TANK WBANDED 20 mil HDPE SECONDARY LINER
ROSA UNIT #153	3003925524	BI ANCO MV	170	31N	05W	BG1	FIBERGLASS TANK WBANDED 20-mil HDPE SECONDARY LINER
ROSA UNIT #153A	3003926329	BLANCO MV	17A	31N	. 05W	BG1	FIBERGLASS TANK W/BANDED 20-mil HDPL SECONDARY LINER
ROSA UNIT #153B	3003927603	BASIN DK I BLANCO MV	171	31N	05W	BG1	FIBERGLASS TANK W/BANDED 20-mil HDPE SECONDARY LINER
ROSA UNIT #154	3003925893	BI ANCO MV	7N	311	05Vv	BG1	UBI. WALI STEEL
ROSA UNIT #154A	3003926274	BI ANCO MV	717	31N	05W	BGT	FIBERGLASS TANK WIBANDED 20 mil HDPE SECONDARY LINER
ROSA UNIT #156	3004529661	BI ANCO MV	9A	3110	06W	BG1	LIBERGLASS TANK WBANDED 20 mil LIDPE SECONDARY LINER
ROSA UNIT #156A	3004529640	BI ANCO MV	91	31N	06W	BG1	FIBERGLASS TANK WBANDED 20 mil HDPE SECONDARY LINER
ROSA UNIT #159 COM	3003925583	BASIN DK / BLANCO MV	190	31N	05W	BGI	DBI WALL STEEL
ROSA UNIT #159A	3003926273	BI ANCO MV	19N	3111	05W	BGI	FIBERGLASS TANK WBANDED 20 mil HDPE SECONDARY LINER
ROSA UNIT #15C	3003930111	BI ANCO MV	29G	3110	05Vv	BG1	FIBERGLASS TANK WBANDED 20 mil HDPE SECONDARY LINER
ROSA UNIT #160	3003925890	BLANCO MV / ROSA PC	250	3110	06٧٧	BG1	DBI WALL STEEL
ROSA UNIT #160#	3003925818	BLANCO MV	25N	3111	06Vv	BG1	DBI WALL STEEL
ROSA UNIT #1608	3003926962	BASIN DK / BI ANCO MV	251	31N	06W	BGI	FIBERGLASS TANK W/BANDED 20 mil HDPE SECONDARY LINER
ROSA UNIT #160C	3003929778	BLANCO MV	25J	31N	06W	BG1	DBI WALL STEEL
RUSA UNIT #162	3003926069	BI ANCO MV	30K	311	05W	BGI	FIBERGLASS TANK W/BANDED 20-mil HDPE SECONDARY LINER
ROSA UNIT #162B	3003929845	BI ANCO MV	30P	3 HN	05W	BG1	DBL WALL STEEL
ROSA UNIT #163	3003926345	BLANCO MV	24G	3111	06Vv	BG1	FIBERGLASS TANK W/BANDED 20-mil HDPE SECONDARY LINER
ROSA UNIT #163A	3003926336	BI.ANCO MV	240	3110	06VV		FIBERGLASS TANK WBANDED 20-mil HDPE SECONDARY LINER
ROSA UNIT #163B	3003929921	BL ANCO MV	24B	3111	06W	SGI	DBL WALL STEEL
ROSA UNIT #163C	3003929611	BLANCO MV	24J	31N	06VV	SG1	SINGLE WALL STEEL
ROSA UNIT #164	3003926151	BASIN DK / BLANCO MV	1.J	31N	06W		FIBERGLASS TANK w/BANDED 20-mil HDPE SECONDARY LINER
ROSA UNIT #164A	3003926080	BLANCO MV	13	3114	06 V V	BG1	FIBERGLASS TANK W/BANDED 20-mil HDPE SECONDARY I INER
ROSA UNIT #164E	3003927242	BASIN DK / BLANCO MV	1,J	31N	06VV	BGI	FIBERGLASS TANK w/BANDED 20-mil HDPE SECONDARY LINER

.

				-		Liner	Leak detect	eak detection		
Date	WellName	Run	Formation	Construction	SGT. BGT, Above	liner, Double Wall	Y/N	level	level	Comments / Repairs needed
	ROSA UNIT #59GL	04-63	Gallup	FIBERGLASS	BGT	Plastic liner-banded	Y	0"	0"	OK
9/19/2008	ROSA UNIT #59GL	04-63	Gallup	FIBERGLASS	BGT	Plastic liner- banded	Y	0"	0"	ОК
10/20/2008	ROSA UNIT #059GL	04-63	Gallup	FIBERGLASS	BGT	Yes	YES	0"	6"	
11/21/2008	ROSA UNIT #059GL	04-64	Gallup	FIBERGLASS	BGT	Yes	YES	0"	6"	
12/19/2008	ROSA UNIT #059GL	04-63	Gallup	FIBERGLASS	BGT	Yes	Yes	7"	6"	
1/14/2009	ROSA UNIT #059GL	04-63	Gallup	FIBERGLASS	BGT	Yes	· Yes	6"	7''	snowfall & rainwater
2/17/2009	ROSA UNIT #059GL	04-63	Gallup	FIBERGLASS	BGT	Yes	Yes	14"	12"	
3/16/2009	ROSA UNIT #059GL	04-63	Gallup	FIBERGLASS	BGT	Yes	Yes	14"	12"	Taken out of service

•

•

WELLS W/FEDERAL						-	
SURF MG1	<u> </u>	FMT	SEC	TWN	RNG	PIT TYPE	CONSTRUCTION MATERIAL
ROSA UNIT #231	3003924444	BASINTIC	31N	3111	0574	SG1	SINGLE WALL STEEL
ROSA UNIT #335A	3003930222	BASINFIC	05J	3114	05W	SGT	SINGLE WALL STEEL

.