District I . 1625 N French Dr., Hobbs, NM 88240 District II
1301 W. Grand Avenue, Artesia, NM 88210 District III 1000 Rio Brazos Road, Aztec, NM 87410 District IV 1220 S. St. Francis Dr., Santa Fe, NM 87505

State of New Mexico **Energy Minerals and Natural Resources** Department Oil Conservation Division 1220 South St. Francis Dr. Santa Fe, NM 87505

For temporary pits, closed-loop systems, and below-grade tanks, submit to the appropriate NMOCD District Office. For permanent pits and exceptions submit to the Santa Fe Environmental Bureau office and provide a copy to the appropriate NMOCD District Office.

732	Ļ

Pit Closed-Loop System Below-Grade Tank or

Proposed Alternative Method Permit or Closure Plan Application									
Type of action: Permit of a pit, closed-loop system, below-grade tank, or proposed alternative method Closure of a pit, closed-loop system, below-grade tank, or proposed alternative method Modification to an existing permit Closure plan only submitted for an existing permitted or non-permitted pit, closed-loop system, below-grade tank, or proposed alternative method									
Instructions: Please submit one application (Form C-144) per individual pit, closed-loop system, below-grade tank or alternative request									
lease be advised that approval of this request does not relieve the operator of liability should operations result in pollution of surface water, ground water or the nvironment. Nor does approval relieve the operator of its responsibility to comply with any other applicable governmental authority's rules, regulations or ordinances.									
Operator: WILLIAMS PRODUCTION COMPANY, LLC OGRID #: 120782									
Address: PO Box 640 Aztec, NM 87410									
Facility or well name: ROSA UNIT #089A									
API Number: 3003925512 OCD Permit Number:									
Section 340 Township 32N Range 06W County RIO ARRIBA									
Latitude: 36.931640000000002 Longitude 107.44268 NAD: 1983 Surface Owner: FEDERAL									
☐ Pit: Subsection F or G of 19.15.17.11 NMAC Temporary: ☐ Drilling ☐ Workover ☐ Permanent ☐ Emergency ☐ Cavitation ☐ P&A ☐ Lined ☐ Unlined Liner type: Thickness mil ☐ LLDPE ☐ HDPE ☐ PVC ☐ Other ☐ String-Reinforced Liner Seams: ☐ Welded ☐ Factory ☐ Other									
3. Closed-loop System: Subsection H of 19.15.17.11 NMAC									
Type of Operation: P&A Drilling a new well Workover or Drilling (Applies to activities which require prior approval of a permit or notice of intent)									
☐ Drying Pad ☐ Above Ground Steel Tanks ☐ Haul-off Bins ☐ Other									
☐ Drying Pad ☐ Above Ground Steel Tanks ☐ Haul-off Bins ☐ Other ☐ Lined ☐ Unlined Liner type: Thickness mil ☐ LLDPE ☐ HDPE ☐ PVC ☐ Other Liner Seams: ☐ Welded ☐ Factory ☐ Other									
Lincd Unlined Liner type: Thicknessmil									
4. A TECEIVED EN									
Below-grade tank: Subsection I of 19.15.17.11 NMAC									
Volume: 120 bbl Type of fluid: PRODUCED WATER (5)									
Tank Construction material:FIBERGLASS TANK w/BANDED 20-mil HDPE SECONDARY LINER									
Secondary containment with leak detection Visible sidewalls, liner, 6-inch lift and automatic overflow shut-off									
Liner type: Thickness mil									
5. Alternative Method:									

Submittal of an exception request is required. Exceptions must be submitted to the Santa Fe Environmental Bureau office for consideration of approval.

6. Fencing: Subsection D of 19.15.17.11 NMAC (Applies to permanent pits, temporary pits, and below-grade tanks)	
Chain link, six feet in height, two strands of barbed wire at top (Required if located within 1000 feet of a permanent residence, school, institution or church)	hospital,
☐ Four foot height, four strands of barbed wire evenly spaced between one and four feet	
Alternate. Please specify	
7.	
Netting: Subsection E of 19.15.17.11 NMAC (Applies to permanent pits and permanent open top tanks)	
Screen Netting Other	
Monthly inspections (If netting or screening is not physically feasible)	
8. Signs: Subsection C of 19.15.17.11 NMAC	
☐ 12"x 24", 2" lettering, providing Operator's name, site location, and emergency telephone numbers	
Signed in compliance with 19.15.3.103 NMAC	
Administrative Approvals and Exceptions:	
Justifications and/or demonstrations of equivalency are required. Please refer to 19.15.17 NMAC for guidance. Please check a box if one or more of the following is requested, if not leave blank:	
Administrative approval(s): Requests must be submitted to the appropriate division district or the Santa Fe Environmental Bureau of	office for
consideration of approval. Exception(s): Requests must be submitted to the Santa Fe Environmental Bureau office for consideration of approval.	
10.	
<u>Siting Criteria (regarding permitting)</u> : 19.15.17.10 NMAC Instructions: The applicant must demonstrate compliance for each siting criteria below in the application. Recommendations of accep	otable source
material are provided below. Requests regarding changes to certain siting criteria may require administrative approval from the appro	priate district
office or may be considered an exception which must be submitted to the Santa Fe Environmental Bureau office for consideration of ap Applicant must attach justification for request. Please refer to 19.15.17.10 NMAC for guidance. Siting criteria does not apply to dryi	
above-grade tanks associated with a closed-loop system.	
Ground water is less than 50 feet below the bottom of the temporary pit, permanent pit, or below-grade tank. - NM Office of the State Engineer - iWATERS database search; USGS; Data obtained from nearby wells	☐ Yes ☐ No
Within 300 feet of a continuously flowing watercourse, or 200 feet of any other significant watercourse or lakebed, sinkhole, or playa lake (measured from the ordinary high-water mark).	☐ Yes ☐ No
- Topographic map; Visual inspection (certification) of the proposed site	
Within 300 feet from a permanent residence, school, hospital, institution, or church in existence at the time of initial application.	☐ Yes ☐ No ☐ NA
(Applies to temporary, emergency, or cavitation pits and below-grade tanks) - Visual inspection (certification) of the proposed site; Aerial photo; Satellite image	
Within 1000 feet from a permanent residence, school, hospital, institution, or church in existence at the time of initial application.	Yes No
(Applies to permanent pits) - Visual inspection (certification) of the proposed site; Aerial photo; Satellite image	∐ NA
Within 500 horizontal feet of a private, domestic fresh water well or spring that less than five households use for domestic or stock	☐ Yes ☐ No
watering purposes, or within 1000 horizontal feet of any other fresh water well or spring, in existence at the time of initial application. NM Office of the State Engineer - iWATERS database search; Visual inspection (certification) of the proposed site	
Within incorporated municipal boundaries or within a defined municipal fresh water well field covered under a municipal ordinance	☐ Yes ☐ No
adopted pursuant to NMSA 1978, Section 3-27-3, as amended. - Written confirmation or verification from the municipality; Written approval obtained from the municipality	
Within 500 feet of a wetland US Fish and Wildlife Wetland Identification map; Topographic map; Visual inspection (certification) of the proposed site	☐ Yes ☐ No
Within the area overlying a subsurface mine. - Written confirmation or verification or map from the NM EMNRD-Mining and Mineral Division	☐ Yes ☐ No
Within an unstable area.	☐ Yes ☐ No
- Engineering measures incorporated into the design; NM Bureau of Geology & Mineral Resources; USGS; NM Geological Society; Topographic map	
Within a 100-year floodplain FEMA map	☐ Yes ☐ No

Temporary Pits, Emergency Pits, and Below-grade Tanks Permit Application Attachment Checklist: Subsection B of 19.15.17.9 NMAC Instructions: Each of the following items must be attached to the application. Please indicate, by a check mark in the box, that the documents are attached.
Hydrogeologic Report (Below-grade Tanks) - based upon the requirements of Paragraph (4) of Subsection B of 19.15.17.9 NMAC Hydrogeologic Data (Temporary and Emergency Pits) - based upon the requirements of Paragraph (2) of Subsection B of 19.15.17.9 NMAC Siting Criteria Compliance Demonstrations - based upon the appropriate requirements of 19.15.17.10 NMAC Design Plan - based upon the appropriate requirements of 19.15.17.11 NMAC
Operating and Maintenance Plan - based upon the appropriate requirements of 19.15.17.12 NMAC Closure Plan (Please complete Boxes 14 through 18, if applicable) - based upon the appropriate requirements of Subsection C of 19.15.17.9 NMAC and 19.15.17.13 NMAC
Previously Approved Design (attach copy of design) API Number: or Permit Number:
Closed-loop Systems Permit Application Attachment Checklist: Subsection B of 19.15.17.9 NMAC Instructions: Each of the following items must be attached to the application. Please indicate, by a check mark in the box, that the documents are attached.
Geologic and Hydrogeologic Data (only for on-site closure) - based upon the requirements of Paragraph (3) of Subsection B of 19.15.17.9 Siting Criteria Compliance Demonstrations (only for on-site closure) - based upon the appropriate requirements of 19.15.17.10 NMAC Design Plan - based upon the appropriate requirements of 19.15.17.11 NMAC Operating and Maintenance Plan - based upon the appropriate requirements of 19.15.17.12 NMAC
Closure Plan (Please complete Boxes 14 through 18, if applicable) - based upon the appropriate requirements of Subsection C of 19.15.17.9 NMAC and 19.15.17.13 NMAC
Previously Approved Design (attach copy of design) API Number:
Previously Approved Operating and Maintenance Plan API Number: (Applies only to closed-loop system that use
above ground steel tanks or haul-off bins and propose to implement waste removal for closure)
Permanent Pits Permit Application Checklist: Subsection B of 19.15.17.9 NMAC Instructions: Each of the following items must be attached to the application. Please indicate, by a check mark in the box, that the documents are attached. Hydrogeologic Report - based upon the requirements of Paragraph (1) of Subsection B of 19.15.17.9 NMAC Siting Criteria Compliance Demonstrations - based upon the appropriate requirements of 19.15.17.10 NMAC Climatological Factors Assessment Certified Engineering Design Plans - based upon the appropriate requirements of 19.15.17.11 NMAC Dike Protection and Structural Integrity Design - based upon the appropriate requirements of 19.15.17.11 NMAC Leak Detection Design - based upon the appropriate requirements of 19.15.17.11 NMAC Quality Control/Quality Assurance Construction and Installation Plan Operating and Maintenance Plan - based upon the appropriate requirements of 19.15.17.12 NMAC Precboard and Overtopping Prevention Plan - based upon the appropriate requirements of 19.15.17.11 NMAC Nuisance or Hazardous Odors, including H ₂ S, Prevention Plan Emergency Response Plan Oil Field Waste Stream Characterization Monitoring and Inspection Plan Erosion Control Plan Closure Plan - based upon the appropriate requirements of Subsection C of 19.15.17.9 NMAC and 19.15.17.13 NMAC
Proposed Closure: 19.15.17.13 NMAC Instructions: Please complete the applicable boxes, Boxes 14 through 18, in regards to the proposed closure plan. Type: Drilling Workover Emergency Cavitation P&A Permanent Pit Below-grade Tank Closed-loop System Alternative Proposed Closure Method: Waste Excavation and Removal Waste Removal (Closed-loop systems only) On-site Closure Method (Only for temporary pits and closed-loop systems)
☐ In-place Burial ☐ On-site Trench Burial ☐ Alternative Closure Method (Exceptions must be submitted to the Santa Fe Environmental Bureau for consideration)
Waste Excavation and Removal Closure Plan Checklist: (19.15.17.13 NMAC) Instructions: Each of the following items must be attached to the closure plan. Please indicate, by a check mark in the box, that the documents are attached. □ Protocols and Procedures - based upon the appropriate requirements of 19.15.17.13 NMAC □ Confirmation Sampling Plan (if applicable) - based upon the appropriate requirements of Subsection F of 19.15.17.13 NMAC □ Disposal Facility Name and Permit Number (for liquids, drilling fluids and drill cuttings) □ Soil Backfill and Cover Design Specifications - based upon the appropriate requirements of Subsection H of 19.15.17.13 NMAC □ Re-vegetation Plan - based upon the appropriate requirements of Subsection I of 19.15.17.13 NMAC □ Site Reclamation Plan - based upon the appropriate requirements of Subsection G of 19.15.17.13 NMAC

Waste Removal Closure For Closed-loop Systems That Utilize Above Ground Instructions: Please indentify the facility or facilities for the disposal of liquids, facilities are required.							
Disposal Facility Name:	Disposal Facility Permit Number:						
Disposal Facility Name: Disposal Facility Permit Number:							
Will any of the proposed closed-loop system operations and associated activities of ☐ Yes (If yes, please provide the information below) ☐ No	ecur on or in areas that will not be used for future serv	vice and operations?					
Required for impacted areas which will not be used for future service and operatio Soil Backfill and Cover Design Specifications based upon the appropriate Re-vegetation Plan - based upon the appropriate requirements of Subsection Site Reclamation Plan - based upon the appropriate requirements of Subsection	requirements of Subsection H of 19.15.17.13 NMAC Lof 19.15.17.13 NMAC	C					
Siting Criteria (regarding on-site closure methods only): 19.15.17.10 NMAC Instructions: Each siting criteria requires a demonstration of compliance in the provided below. Requests regarding changes to certain siting criteria may require considered an exception which must be submitted to the Santa Fe Environmental demonstrations of equivalency are required. Please refer to 19.15.17.10 NMAC	e administrative approval from the appropriate dist I Bureau office for consideration of approval. Justi	rict office or may be					
Ground water is less than 50 feet below the bottom of the buried waste. - NM Office of the State Engineer - iWATERS database search; USGS; Data	a obtained from nearby wells	☐ Yes ☑ No ☐ NA					
Ground water is between 50 and 100 feet below the bottom of the buried waste - NM Office of the State Engineer - iWATERS database search; USGS; Data	a obtained from nearby wells	☐ Yes ⊠ No ☐ NA					
Ground water is more than 100 feet below the bottom of the buried waste. - NM Office of the State Engineer - iWATERS database search; USGS; Data	a obtained from nearby wells	☐ Yes ☐ No ☐ NA					
Within 300 feet of a continuously flowing watercourse, or 200 feet of any other sig lake (measured from the ordinary high-water mark). - Topographic map; Visual inspection (certification) of the proposed site	nificant watercourse or lakebed, sinkhole, or playa	☐ Yes ⊠ No					
Within 300 feet from a permanent residence, school, hospital, institution, or church Visual inspection (certification) of the proposed site; Aerial photo; Satellite		☐ Yes ☑ No					
Within 500 horizontal feet of a private, domestic fresh water well or spring that les watering purposes, or within 1000 horizontal feet of any other fresh water well or see NM Office of the State Engineer - iWATERS database; Visual inspection (pring, in existence at the time of initial application.	☐ Yes ⊠ No					
Within incorporated municipal boundaries or within a defined municipal fresh water adopted pursuant to NMSA 1978, Section 3-27-3, as amended. - Written confirmation or verification from the municipality; Written approv		☐ Yes ⊠ No					
Within 500 feet of a wetland US Fish and Wildlife Wetland Identification map; Topographic map; Visua	al inspection (certification) of the proposed site	☐ Yes ☑ No					
Within the area overlying a subsurface mine Written confirmation or verification or map from the NM EMNRD-Mining	g and Mineral Division	☐ Yes ⊠ No					
Within an unstable area. - Engineering measures incorporated into the design; NM Bureau of Geolog Society; Topographic map	y & Mineral Resources; USGS; NM Geological	☐ Yes ☑ No					
Within a 100-year floodplain FEMA map		☐ Yes ☑ No					
On-Site Closure Plan Checklist: (19.15.17.13 NMAC) Instructions: Each of the by a check mark in the box, that the documents are attached. Siting Criteria Compliance Demonstrations - based upon the appropriate requirements of Construction/Design Plan of Burial Trench (if applicable) based upon the appropriate requirements of Construction/Design Plan of Temporary Pit (for in-place burial of a drying property Protocols and Procedures - based upon the appropriate requirements of 19.1. Site Material Sampling Plan (if applicable) - based upon the appropriate requirements of Disposal Facility Name and Permit Number (for liquids, drilling fluids and Construction Plan - based upon the appropriate requirements of Subsection Re-vegetation Plan - based upon the appropriate requirements of Subsection Site Reclamation Plan - based upon the appropriate requirements of Subsection	uirements of 19.15.17.10 NMAC f Subsection F of 19.15.17.13 NMAC oppropriate requirements of 19.15.17.11 NMAC ead) - based upon the appropriate requirements of 19. 5.17.13 NMAC uirements of Subsection F of 19.15.17.13 NMAC Subsection F of 19.15.17.13 NMAC drill cuttings or in case on-site closure standards cann H of 19.15.17.13 NMAC I of 19.15.17.13 NMAC	15.17.11 NMAC					

19. Operator Application Cartification:
Operator Application Certification: I hereby certify that the information submitted with this application is true, accurate and complete to the best of my knowledge and belief.
Name (Print): Title:
Signature: Date:
e-mail address: Telephone:
OCD Approval: ☐ Permit Application (including closure plan) ☐ Closure Plan (only) ☐ OCD Conditions (see attachment) OCD Representative Signature: Approval Date: ☐ Approval Date: ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐ ☐
Title: Compignce Office OCD Permit Number:
Closure Report (required within 60 days of closure completion): Subsection K of 19.15.17.13 NMAC Instructions: Operators are required to obtain an approved closure plan prior to implementing any closure activities and submitting the closure report. The closure report is required to be submitted to the division within 60 days of the completion of the closure activities. Please do not complete this section of the form until an approved closure plan has been obtained and the closure activities have been completed. Closure Completion Date: 9/3/2010
Closure Method: Waste Excavation and Removal On-Site Closure Method Alternative Closure Method Waste Removal (Closed-loop systems only) If different from approved plan, please explain.
Closure Report Regarding Waste Removal Closure For Closed-loop Systems That Utilize Above Ground Steel Tanks or Haul-off Bins Only: Instructions: Please indentify the facility or facilities for where the liquids, drilling fluids and drill cuttings were disposed. Use attachment if more than two facilities were utilized. Disposal Facility Name: Disposal Facility Permit Number:
Disposal Facility Name: Disposal Facility Permit Number: Disposal Facility Permit Number:
Were the closed-loop system operations and associated activities performed on or in areas that will not be used for future service and operations? Yes (If yes, please demonstrate compliance to the items below) No
Required for impacted areas which will not be used for future service and operations. Site Reclamation (Photo Documentation) Soil Backfilling and Cover Installation Re-vegetation Application Rates and Seeding Technique
24. Closure Report Attachment Checklist: Instructions: Each of the following items must be attached to the closure report. Please indicate, by a check mark in the box, that the documents are attached. Proof of Closure Notice (surface owner and division) Proof of Deed Notice (required for on-site closure) Plot Plan (for on-site closures and temporary pits) Confirmation Sampling Analytical Results (if applicable) Waste Material Sampling Analytical Results (required for on-site closure) Disposal Facility Name and Permit Number Soil Backfilling and Cover Installation Re-vegetation Application Rates and Seeding Technique Site Reclamation (Photo Documentation)
On-site Closure Location: Latitude Longitude NAD: 1927 1983
Operator Closure Certification: I hereby certify that the information and attachments submitted with this closure report is true, accurate and complete to the best of my knowledge and belief. I also certify that the closure complies with all applicable closure requirements and conditions specified in the approved closure plan. Name (Print): Vanessa Fields Title: EH&S Coordinator Signature: Date: 11-4-10
e-mail address: vanessa.fields@williams.com Telephone:505-634-4209



Explanation & Production FC Box 640 Azicc NM 61137 505/624 4219 505/634 4214 fox

March 10, 2009

Mr. Mark Kelly Bureau of Land Management Farmington Field Office 1235 La Plata Hwy. Farmington, NM 87401

Sent via Certified Mail

RE Notification of Production Pit Closure

Rule 19 15 17 13 NMAC

Production Pits associated Natural Gas Development

Operated by Williams Production Co. LLC

Pursuant to Rule 19 15 17 13 NMAC this correspondence is to notify the Bureau of Land Management, Farmington Field Office, of Williams Production LLC's (Williams) intent to clean close all production pits on the attached list of wells operated with the District in San Juan County and Rio Arriba County, New Mexico. Closure will follow the plan included with this correspondence.

Thank you for your consideration. If there are any questions or additional information is requested, please contact me at (505) 634-4209.

Respectfully submitted.

Holly C #erkins EH&S Specialist

Encl: Williams Production Pit Inventory List (Federal wells)

San Juan Basin - New Mexico Assets Below-Grade Tank Closure Plan

cc Environmental Fils

Williams Production Co., LLC San Juan Basin: New Mexico Assets

Below Grade Tank Removal
Closure Flan

to accordance with kule 1975-17-13 NMAC, the following plan describes the general closure requirements of below grade tanks (BCI) on Williams Froduction Co. (LC. (WFX) to cations in the San Juan Basin of New Mexico. This is WFX is landard closure procedure, for all BCIs regulated under kule 19-15-17 NMAC, and operated by WFX. For those closures which do not conform to this standard closure plan, a separate well/pit specific closure plan will be developed and utilized.

Closure Conditions and Timing:

Forsign to 19.15.17.13 (A) NMAC WPX will initiate closure of any 6G1 should any one of these conditions occur.

- The Division requires closure because of imminent danger to fresh water public health or the environment.
- The integrity of the BGT fails. Notification will be within 48 hours to the Division and closure will be schedule as specified in 19.15.17.12 (A)(5) NMAC.
- WPX chooses to take the BGT out of service due to operational needs. Clasure under these conditions will be closed within 60 days of dessation of the BGT's operation.
- BC-1s installed prior to June 16, 2008 that do not meet the requirements under 19,15.17 (1.1(6))
 NMAC and WP3 chooses not to retrofit or upgrade. Closure under these conditions will be completed within five years (by June 16, 2013).

General Plan Requirements:

- Prior to initiating any BGT Closure except in the case of an emergency. WPX will review County Tax Records for the current syrface owner of record. The surface owner of record will be notified of the intent to close the PGT by certified mail and a copy of this notification will be included in the closure report. In the case of an emergency, the surface owner of record will be notified as soon as practical.
- 2 Notice of Clasure will be given to the Aztec District office hetwicen 72 hours and one week of the scheduled clasure via email or phone. The notification of clasure will include the following.
 - a Operators Name (WPX)
 - b. Well Name and API Number
 - c tocation (USTR)
- All piping will be rerouted to an alternative produced water storage/disposal location (e.g. surface tanks temporary fractank...). The well will be temporarily shut in until the rerouting is completed.
- All produced water will be removed from the BGT following discharge pipe rerouting Froduced water will be disposed at one of the following NMOCD approved facilities depending on the proximity of the BGT site. Rosa Unit SWD #1 (Order: SWD-916, APT 30-039-27055). Rosa Unit #94 (Order: SWD-3RP-1003-0, APT 30-039-23035). Jillson Fed. SWD #001 (Order: R10168/R10168A, APT, 30-039-25465). Middle Mesa SWD #001 (Order: SWD-350-0, APT 30-045-27004). and/or Basin Disposal (Permit: NM-01-0005).
 - solias and sludges will be shoveted and 70% variuomed out for disposal at Envirotech (Fermit Normer NM 01 001)
- Who will out aim prior approval from MACC to be also selected reason of rectains the BCL and provide documentation of the disposition of the ECL in the closure report. Stee materials will be recycled or reason as approved by the bivision. The rigids, tanks will be empty still up or shredged, and EFA created for disposar as solio waste. Their materials will

be cleaned without soils or contaminated material for disposal as solid waste. Fill-erglass tanks and liner materials will meet the conditions of paragraph 1 subsection D of 19 15 9 212 NMAC. Disposal will be at a licensed disposal facility, presently San Juan Regional randfill operated by Waste Management under NMED Permit SWM 052426.

- Any equipment associated with the BGI that is no longer required for some other purpose following the closure will be removed from the location.
- tollowing removal of the tank and any liner material a five point composite sample will be taken of the excavation and fested per 19.15.17.13(E)(4) NMAC as identified in Table 1. Crab samples will be collected from any area that is wet discolored or showing other evidence of a release. Results will be report to the Division following receipt from the lab on form C.141.

Table 1. Closure Criteria for BG1s

	. The task that the second to	and the same of th	E and particular to the second extension of the second	
	Components	Testing Methods	Closure Limits (mg/Kg)	
	Benzene	FPA SW 846 Method 8021B or 8260B	0.2	
	BILX	FPA SW-846 Method 8021B or 8260B	50	
!	TEH	El'A SW-846 Method 418 1-1	100	
	Chlorides	EPA SW 846 Method 300 111	250(2)	

Method modified for solid waste.

If body ground can, sufration of C Mondes greater than $250\,\mathrm{mg}$ to their higher concentration with ϵ as a diar closure.

- 4 If the Division and/or WEX determine there is a release. WEX will comply with 19-15-3-116. NMAC and 19-15-1-19 NMAC.
- Upon completion of the tank removal, the excavation will be backfilled with non-waste earthen material compacted and covered with a minimum of one-foot of top soil or background thickness whichever is greater and to existing grade. The surface will be reconfoured to match the native grade and prevent ponding.
- for those portions of the former pit area no longer required for production activities. WPX will seed the disturbed areas the first growing season after the pit is covered. Seeding will be accomplished via diffling on the confour whenever practical or by other Division approved methods. Vegetative cover will equal 70% of the native perennial vegetative cover (un impacted) consisting of at least three native plant species including at least one grass but not including noxious weeds and maintained that cover through two successive growing seasons. Repeat seeding or plantling will be continued until successful vegetative growth occurs. Note, if a surface owner agreement requires reseeding or other surface restoration that do not meet re-vegetation requirements of 15-15-17-13 FMMAC then WPX will submit the proposed alternative with written documentation that the surface owner agrees to the alternative for Division approval.
- For those portions of the former pit area required for production activities reseeding will be done at well abandonment, and following the procedure noted above:

Closure Report

All closure activities withinclude proper accumentation and will be submitted to OCD within 60 days of the RGI closure on a Closure Kenart using Division Fami C 144. The Report withinclude the following:

- Froot at consule transcer come els inners.
 DMCX.E.
- · Backbaro & Cone Coro
- · SHE DRIGION WITH C. KNICH
- Avoiloble marie: percetti.

- · Continuence Something Many Coffes, 1
- Unsposoff ocurs from electronic ferral fumperist
- · Applications & Learne technique
- Eliato Documentamon en Ferramonos

WELLS W/FEDERAL SURF MGT	API	FM1	SEC	TWN	RNG	PIT TYPE	CONSTRUCTION MATERIAL
COX CANYON UNIT #001	3004511397	PLANCO MV	16N	32N	1 1 VV	BG1	DBL WALL STEEL FIBERGLASS TANK WBANDED 20-0
COX CANYON UNIT #001A	3004522086	BLANCO MV	16C	3211	11W	BG1	HIDDE SECONDARY LINER LIBERGLASS TANK W/BANDED 20 n
COX CANYON UNIT #001B	3004530791	BLANCO MV	161	32N	11W	BGI	HDPE SECONDARY LINER
COX CANYON UNIT #001C	3004532023	BLANCO MV	16F	3211	1 1 VV	BGI	DBL WALL STEFL FIRERGLASS TANK w/BANDED 20 n
COX CANYON UNIT #003	3004511495	BLANCO MV	91	32N	11VV	BG1	HDPE SECONDARY LINER
COX CANYON UNIT #003A	3004522088	BLANCO MV	919	32N	11Vv	BGT	DBI WALL STEEL
COX CANYON UNIT #003B	3004530871	BLANCO MV	9.1	32N	11W	BG1	DBI WALL STEEL
COX CANYON UNIT #004	3004511368	BI ANCO MV	21A	32N	11W	BGT	DBI WALL STEEL
COX CANYON UNIT #004A	3004522093	BLANCO MV	21F	32N	11W	BGT	DBI WALL STEEL
COX CANYON UNIT #004B	3004532186	BLANCO MV	211	32N	11W	BG1	DBI WALI STEEL
COX CANYON UNIT #005	3004511326	BLANCO MV	21K	32N	1 1 VV	BGT	DBI WALL STEFL
COX CANYON UNIT #005A	3004522094	BLANCO MV BASIN DK /	21[)	32N	11VV	BGT	DBL WALL STEEL
OX CANYON UNIT #005B	3004532142	BLANCO MV	21N	3211	11W	BGT	DBL WALL STEEL
COX CANYON UNIT #005C	3004533493	BLANCO MV	21f	32N	1 1 VV	BGT	DBI WALL STEFI
.Ox CANYON UNIT #006	3004511463	BLANCO MV	16A	32N	11W	BGT	DBI WALL STEEL
LOX CANYON UNIT #006A	3004522095	BLANCO MV	161	3214	11W	BGT	DBL WALL STEEL
COX CANYON UNIT #006B	3004532693	BLANCO MV	16B	32N	11W	BG1	DBI WALL STEEL
OS CANYON UNIT #006C	3004532733	BLANCO MV	160	32N	11W	BG1	DBI WALL STEEL
COX CANYON UNIT #007	3004511455	BLANCO MV	176	32N	11W	FGF	DBI WALL STEEL
COX CANYON UNIT #007A	3004522091	BLANCO MV	170	32N	11W	BGT	DBL WALL STEEL
COX CANYON UNIT #007C	3004533018	BASIN DK	17K	32N	11W		DBI, WALL STEEL FIBERGLASS TANK w/BANDED 20 m
COX CAN) ON UNIT #008	3004511492	BLANCO MV	81	32N	11W		HDPE SECONDARY LINER
COX CANYON UNIT #008A	3004522096	BLANCO MV	1711	32N	11W		DBL WALL STEEL FIBERGLASS TANK WBANDED 20-m
COX CANYON UNIT #008B	3004532080	BLANCO MV	8P	32N	11VV	BG1	HDPE SECONDARY LINER FIBERGLASS TANK W/BANDED 20 m
COX CANYON UNIT #008C	3004531187	BLANCO MV	1 <i>7F</i> ?	32N	11W	BGT	HDPE SECONDARY LINER FIBERGLASS TANK W/BANDED 20 m
COM CANYON UNIT #009A	3004522092	BLANCO MV BASIN DK /	20D	32N	11W		HDPE SECONDARY LINER
OM	3004533926	BLANCO MV BASIN DK /	. 20B	32N	11W	BG1 I	DBL WALL STEEL
OX CANYON UNIT #009C	3003933851	BL ANCO MV	20F	3211	11W		DBL WALL STEEL FIBERGLASS TANK W/BANDFD 20-m
OX CANYON UNIT #013	3004521489	BLANCO PC	20A	32N	11W		HDPE SECONDARY LINER

WELLS W/FEDERAL							and approximate the second control of the se
SURF MGT	API	FMT	SEC	TWN	RNG	PIT TYP	
COX CANYON UNIT #023							FIBERGLASS TANK w/BANDED 20-mil
COM	3004522537	BLANCOPC	17C	32N	111/	BG1	HDPE SECONDARY LINER
							FIBERGLASS TANK W/BANDED 20 mil
COX CANYON UNIT #025	3004522572	BLANCOIPC	90	32N	111//	BGT	HDPE SECONDARY LINER
							FIBERGLASS TANK W/BANDFD 20-mil
COX CANYON UNIT #200	3004527878	BASINFIC	91	3214	11VV	BG1	HDPE SECONDARY LINER
							FIBERGLASS TANK w/BANDED 20-mil
COX CANYON UNIT #200A	3004532126	BASINETC	9()	3214	1 1 VV	BGT	HOPE SECONDARY LINER
							FIBERGLASS TANK W/BANDED 20-mill
COX CANYON UNIT #203	3004527872	BASINFIC	17A	32N	111/0/	BG1	HDPE SECONDARY LINER
1							
MADDOX #001	3004511487	BLANCO MV	10N	.32N	11Vv	BG1	DBL WALL STEEL
MADDOX #001A	3004523539	BLANCO MV	10F)	32N	11VV	BGI	DBL WALL STEEL
NM 32-11 #001	3004511309	BLANCO MV	200	32N	11W	BG1	DBL WALL STEEL
1		BASIN DK /					••
NM 32-11 #001B COM	3004532024	BLANCO MV	20J	32N	11W	BG1	DBL WALL STEEL
1		BASIN DK /					
NM 32 11 #001C COM	3004532804	BLANCO MV	201	32N	11W	BGT	DBI WALL STEEL
1			• •		, , , ,	2.0	FIBERGLASS TANK w/BANDED 20 mil
NM 32 11 #002 COM	3004511380	BLANCO MV	19A	32N	11W	BGT	HDPE SECONDARY LINER
						2.5	
NM 32 11 #002A COM	3004529017	BLANCO MV	190	3211	11VV	BG1	DBL WALL STEEL
					, , • •	27171	
NM 32 11 #0028 COM	3004532670	BLANCO MV	191	32N	11W	BGT	DBI WALL STEFT
	000 1002010	Deriitoe Ait		, , , , , ,		1701	
NM 32-11 #002C COM	3004533077	BLANCO MV	19G	32N	11W	BG1	DBL WALL STEEL
	000 000071	D17	1 ()			501	DEL TOTAL COLLECTION
ROSA UNIT #001 SWD	3003927055	SWD	231	31N	06W	BGT	DBL WALL STEEL
		BASIN DK /			(-(,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,	501	FIBERGLASS TANK w/BANDED 20 mil
ROSA UNIT #001E	3003925411	BLANCO MV	1.1£3	31N	06W	BGT	HDPE SECONDARY LINER
	000020451	BLANCO MV		() 114	0,00	1501	
ROSA UNIT #005A	3003925407	ROSA PC	26F	31N	06W	BGT	DBL WALL STEEL
TOO TO THE TOTAL T	0000020401	BASIN DK /	2 (7)	W111	(1(1))	DOT	DEL WALL OTTEL
ROSA UNIT #005E	3003926927	BLANCO MV	26B	31N	06W	BG1	DBL WALL STEEL
11001101111110000	110000020021	DI MOO MA	1 (11)	.1114	COVV	1,01	FIBERGLASS TANK W/BANDED 20 mil
ROSA UNIT #005Y	3003926078	BLANCO MV	26H	31N	06W	BGT	HDPE SECONDARY LINER
TOO TO THE THORN	3003820010	BLANCO MV	1 11/3	0114	(1611	001	FIBERGI ASS TANK W/BANDED 20-mil
ROSA UNIT #008	3003907944	ROSA PC	26M	31N	OGW	BG1	HDPE SECONDARY LINER
110,671 01111 #000	5005301344	BLANCO MV /	2 OIVI	SIN	CCCVV	ВОТ	FIBERGLASS TANK w/BANDED 20 mil
ROSA UNIT #008	3003907944	ROSA PC	26M	31N	06W	BG1	HDPE SECONDARY LINER
		BLANCO MV /		01.4	(/////		FIBERGLASS TANK W/BANDED 20 mil
ROSA UNIT #006A	3003925430	ROSA PC	26D	3114	06W	BG1	HDPE SECONDARY LINER
	0000020100	7700	100	0774	,,,,,,,	12/01	FIBERGLASS TANK W/BANDED 20 mil
≺OSA UNIT #008C	3003926944	BLANCO MV	26N	31N	06W	BGT	HDPE SECONDARY LINER
TO STATE OF THE ST	5005520544	DITTINGO IIII	2011	DIIV	OUVV	601	FIBERGLASS TANK W/BANDED 20-mil
₹OSA UNIT #009	3003907975	BLANCO MV	11K	31N	06W	BGT	HDPE SECONDARY LINER
	JOGGGGGTTTT	BASIN DK /	1118	5114	OOVV	1,01	ADLE OF OCCUPANT CHIEF
ROSA UNIT #009A	3003925584	BL ANCO MV	11C	31N	06W	BGT	DBI WALL STEEL
(Ota) Givi moda,	3003823304	DI AIVOO IIIV	110	3114	OOW	1301	FIBERGLASS TANK W/BANDED 20-mil
3089 ANI #008R	3003927042	BLANCO MV	11 E	31N	06W	BG1	HDPE SECONDARY LINER
WOLLDOWN BOOK	0000021042	DI MINOU WIN	1 1 L	0114	UUVV	וטטו	FIBERGLASS TANK W/BANDED 20 mil
'OSA UNIT #010B	3003926556	BLANCO MV	13N	31N	06W	BG1	HDPE SECONDARY LINER
CONCORT TOTAL	3003820330	DI ANCO WIV	HJIV	2114	OOVV	100	HDI E GEOGRAMAT LINETA
OSA UNIT #010C	2002026049	BLANCO MV	1261	Q 1 kJ	OCIM	BC7	DBL WALL STEEL
ENDER OF THE COOL	3003926918	DEMINOO MIA	13N	31N	06W	BGT	DOL WALL STELL
OSA UNIT #0100	3003926556	BLANCO MV	13N	31N	06W	BG1	DBL WALL STEEL
COLORI POLICE	3003820330	DI MINOU IVIV	1017	JIIN	DOVV	וטטו	DDL WALL OTELL

WELLS W/FEDERAL	,						
SURF MG1	API	FMT	SEC	TWN	RNG	PITTYP	E CONSTRUCTION MATERIAL
		BLANCO MV /					
ROSA UNIT #012A	3003925900	ROSA Pt.	15J	31N	OGVV	EGI	DBL WALL STEEL
		BASIN DK /					FIBERGLASS TANK W/BANDED 20 mil
ROSA UNIT #012B	3003926555	BLANCO MV	15F	3110	OBVV	BGI	HOPE SECONDARY LINER
ROSA UNIT #012C	3003929486	BLANCO MV	15A	31N	0077	S(31	SINGLE WALL STELL
				.,,,,,,	170211	(1).	FIBERGLASS TANK W/BANDED 20 mil
ROSA UNIT #013	3003907936	BLANCO MV	31G	31N	05W	BGT	HDPE SECONDARY LINER
					-		FIBERGLASS TANK w/BANDED 20 mil
ROSA UNIT #013A	3003926298	BLANCO MV	31F	31N	05W	FGT	HDPE SECONDARY LINER
		BASIN DK /					
ROSA UNIT #013B COM	3003929834	BLANCO MV	31A	31N	05Vv	BGT	DBL WALL STEEL
							FIBERGLASS TANK w/BANDED 20-mill
ROSA UNIT #014	3003907958	BLANCO MV	23B	31N	06W	BG1	HDPE SECONDARY LINER
							FIBERGLASS TANK w/BANDED 20 mil
ROSA UNIT #014A	3003926280	BLANCO MV	23F	31N	06VV	BG1	HDPE SECONDARY LINER
		BASIN DK /					
ROSA UNIT #014C	3003930132	BLANCO MV	23H	31N	06W	BG1	DBL WALL STEEL
DOCA LINE BOAR							FIBERGLASS TANK W/BANDED 20 mil
ROSA UNIT #015	3003907946	BI ANCO MV	2911	31N	05VV	BGT	HDPE SECONDARY LINER
DOEA LINIT HOTE	0000007000	DI ALICICI LAV	4 4 3 1		0.0144	50	FIBERGLASS TANK w/BANDED 20-mil
ROSA UNIT #016	3003907963	BLANCO MV	1411	3111	06Vv	BGI	HDPE SECONDARY LINER FIBERGLASS TANK w/BANDED 20-mil
ROSA UNIT #016A	2002004.400	DI ANCOM	146	2.464	(ACAA)	001	HDPE SECONDARY LINER
NOSA CIVIT FOTOA	3003925496	BLANCO MV	14C	31N	06W	BGT	FIBERGLASS TANK W/BANDED 20-mil
ROSA UNIT #016B	3003926218	BLANCO MV	141/1	31N	06W	BGT	HDPE SECONDARY LINER
NOON ONLY PARKET	3003920210	DLANCO WIV	14101	OHA	OGVV	()()!	TIBERGLASS TANK w/BANDED 20 mil
ROSA UNIT #01/A	3003926272	BLANCO MV	200	31N	05W	BGT	HDPE SECONDARY LINER
	WWW. 20212	BASIN DK /	200	., 114	(17,14	1501	FIBERGLASS TANK w/BANDED 20 mil
ROSA UNIT #017B	3003926971	BLANCO MV	20J	31N	05W	BGT	HDPE SECONDARY LINER
	(2000)	BLANCO MV /				.,,,,	FIBERGLASS TANK w/BANDED 20-mil
ROSA UNIT #018	3003907960	ROSA PC	22H	31N	06W	BGT	HDPE SECONDARY LINER
		BLANCO MV /					
ROSA UNIT #018A	3003925436	ROSA PC	22F	31N	06VV	SGT	DBL WALL STEEL
ROSA UNIT #018B	3003927052	BLANCO MV	220	31N	06W	BGT	DBI WALL STEEL
	•						FIBERGLASS TANK W/BANDED 20-mil
ROSA UNIT #019	3003907955	BLANCO MV	24K	31N	06W	BGT	HOPE SECONDARY LINER
0.000 1.0101		D1 44100 401					FIBERGLASS TANK w/BANDED 20-mil
ROSA UNIT #019B	3003926560	BLANCO MV	241	3111	06W	BGT	HDPE SECONDARY LINER
ROSA UNIT #019C	3003929625	BLANCO MV	24D	31N	06W	BGT	DBI WALL STEEL
	5000020020	DET INGO III	• 12.		0,0,1,	00,1	
ROSA UNIT #019C	3003929625	BLANCO MV	24D	31N	06W	BGT	DBL WALL STEEL
							FIBERGLASS TANK w/BANDED 20 mil
ROSA UNIT #020	3003907969	BLANCO MV	14G	31N	06W	BG1	HDPE SECONDARY LINER
							FIBERGLASS TANK w/BANDED 20 mill
ROSA UNIT #020A	3003925495	BLANCO MV	14()	31N	06W	BG1	HDPE SECONDARY LINER
ROSA UNIT #020B	3003926220	BLANCO MV	14A	31N	06W	BG1	DBL WALL STEEL
							FIBERGLASS TANK W/BANDED 20 mil
ROSA UNIT #020C	3003926221	BLANCO MV	14J	31N	W80	BG1	HDPE SECONDARY LINER
2006 HAUT 2004		81 4440 8 4 7 7	0.00			s. 21-	FIBERGLASS TANK W/BANDED 20-mil
ROSA UNIT #021A	3003926121	BLANCO MV	23C	31N	06W	BGT	HDPE SECONDARY LINER
2000 TIBUT 20010	annana a a a	DI ANGO AN	0.214	0.41.	nest:	DO:	DDI MALL CIEF!
ROSA UNIT #021B	3003926554	BL ANCO MV	23K	31N	06W	BGT	DBL WALL STEEL
ROSA UNIT #02!	3000007074	DI ANICO MA	104	9410	DENN	DOT	FIBERGLASS TANK w/BANDED 20-mil HDPE SECONDARY LINER
NOOM UNIT HUZZ	3003907971	BLANCO MV	18A	31N	05W	BGT	HUFT SECONDAIL FINER

WELLS W/FEDERAL	A F2 1		0.5.0				
SURF MGT	API	FMT	<u>SEC</u>	TWN	RNG	PITTYP	FIBERGLASS TANK w/BANDED 20-mil
ROSA UNIT #022A	3003926390	BLANCO MV	18C	3114	05W	BG1	HOPE SECONDARY LINER
ROSA UNIT #023	3003907942	BLANCO MV	2914	31N	05Vv	BGI	FIBERGLASS TANK WBANDED 20 mil HDPE SECONDARY LINER
ROSA UNIT #023B	3003926553	BLANCO MV	29E	31N	05Vv	BGI	FIBERGLASS TANK W/BANDED 20 mil HDPE SECONDARY LINER
ROSA UNIT #023C	3003927609	BASIN DK / BLANCO MV	291	31N	05W	BGT	FIBERGLASS TANK W/BANDED 20-mil HDPE SECONDARY LINER
ROSA UNIT #024	3003907933	BLANCO MV	32M	31N	05W	BGI	FIBERGLASS TANK WBANDED 20 mil HDPE SECONDARY LINER
ROSA UNIT #024A	3003925568	BASIN DK / BLANCO MV	32E	31N	05Vv	SG1	DBL WALL STEEL
ROSA UNIT #024B	3003926630	BASIN DK / BLANCO MV	32N	31N	05W	BG1	FIBERGLASS TANK W/BANDED 20 mill HDPE SECONDARY LINER
ROSA UNIT #024C	3003926968	BASIN DK / BLANCO MV	32C	31N	05W	BGT	FIBERGLASS TANK W/BANDED 20-mill HDPE SECONDARY LINER
ROSA UNIT #026A	3003925580	BASIN DK / BI ANCO MV	32O	31N	05W	SGT	DBL WALL STEEL
ROSA UNIT #026B	3003926788	BASIN DK	32G	31N	05W	SG1	DBI WALL STEEL FIBERGLASS TANK W/BANDED 20 mil
ROSA UNIT #029	3004511136	BLANCO MV BASIN DK /	32H	32N	06VV	BGI	HDPE SECONDARY LINER FIBERGLASS TANK w/BANDED 20 mil
FOSA UNIT #029B	3004530709	BLANCO MV BASIN DK /	32B	3211	06W	BGI	HDPE SECONDARY LINER
ROSA UNIT #029M	3004529584	BLANCO MV BASIN DK /	321	3211	Was	BGI	DBL WALL STEFL FIBERGLASS TANK w/BANDED 20-mil
ROSA UNIT #030 COM	3003925570	BLANCO MV	120	31N	0677	BGT	HDPE SECONDARY LINER FIBERGLASS TANK w/BANDED 20 mil
ROSA UNIT #030A	3003926068	BLANCO MV	12M	31N	06W	BGT	HDPE SECONDARY LINER LIBERGLASS TANK W/BANDED 20 mil
ROSA UNIT #030B	3003926601	BLANCO MV	12N	3110	06W ·	BGT	HDPE SECONDARY LINER
ROSA UNIT #030C	3003929842	BLANCO MV	12F*	31N	06W	BGT	DBL WALL STEEL FIBERGLASS TANK w/BANDED 20 mil
ROSA UNIT #031	3003926279	BLANCO MV	17C	31N	05Vv	BGT	HOPE SECONDARY LINER FIBERGLASS TANK W/BANDED 20 mil
ROSA UNIT #031A	3003926346	BLANCO MV BASIN DK /	171	31N	05W	BGT	HDPE SECONDARY LINER FIBERGLASS TANK w/BANDED 20 mil
ROSA UNIT #0316	13003926579	BI ANCO MV	17[)	31N	05Vv	BG1	HDPE SECONDARY LINER FIBERGLASS TANK WBANDED 20 mil
ROSA UNIT #031C	3003926578	BLANCO MV BLANCO MV /	17 I N	31N	05W	BGT	HDPE SECONDARY LINER
ROSA UNIT #032	3003925389	ROSA PC BLANCO MV /	2114	31N	06W	BG1	DBL WALL STEEL
ROSA UNIT #032A	3003925417	ROSA PC BASIN DK /	21F	31N	06W	BG1	DBL WALL STEEL FIBERGLASS TANK w/BANDED 20 mil
ROSA UNIT #032B	3003926771	BLANCO MV BASIN DK /	21G	31N	06W		HDPE SECONDARY LINER FIBERGLASS TANK W/BANDE() 20 mil
ROSA UNIT #032(.	3003927240	BI ANCO MV	21F	31N	06VV	BG1	HDPE SECONDARY LINER FIBERGLASS TANK W/BANDED 20 mil
ROSA UNIT #034	3003907984	BLANCO MV	36B	3211	06W		HDPE SECONDARY LINER
ROSA UNIT #034A	3003926119	BI ANCO MV	361	32N	06W	BGT	DBL WALL STEEL
ROSA UNIT #034A	3003926119	BLANCO MV	361	32N	06W		DBL WALL STEEL FIBERGLASS TANK W/BANDED 20-mil
ROSA UNIT #034E	3003926629	BLANCO MV	36J	32N	06W		HDPE SECONDARY LINER

WELLS W/FEDERAL							and the state of t
SURF MG1	API	FMT	SEC	TWN	RNG	PIT TY	PE CONSTRUCTION MATERIAL
		AND IN THE PART OF THE PARTY AND ADDRESS OF	-				FIBERGLASS TANK W/BANDED 20 mil
ROSA UNIT #034C	3003926969	BLANCO MV	36H	32N	06/\	FG1	HUPE SECONDARY LINER
ROSA UNIT #035X	3004510996	PLANCO MV	5K	3114	06Vv	BG1	DBL WALL STEEL FIBERGLASS TANK w/BANDED 20 mil
ROSA UNIT #036	3003907977	ELANCO MV	1111	3110	aevv	BG1	HDPE SECONDARY LINER
ROSA UNIT #036C	3003930182	BLANCO MV	116	3111	υ6W	HG1	HIBERGLASS TANK WIBANDED 20 mill HDPF SECONDARY LINER
ROSA UNIT #041	3003907981	BLANCO MV	5K	31N	05Vv	BGT	FIBERGLASS TANK WBANDED 20 mil HDPE SECONDARY LINER
ROSA UNIT #041B	3003927014	BASIN DK / BLANCO MV	6P	31N	05VV	BGT	FIBERGLASS TANK W/BANDFD 20 mil HDPE SECONDARY LINER
ROSA UNIT #044	3003925873	BI ANCO MV	35K	32N	06W	BG1	DBI WALL STEEL
ROSA UNIT #044A	3003926161	BLANCO MV	35E	32N	06M	SGI	SINGLE WALL STEFL
ROSA UNIT #044A	3003926161	BLANCO MV	35E	32N	OGW	SGI	DBL WALL STEEL
ROSA UNIT #044B	3003926685	BLANCO MV	35C	32N	06VV	BG1	FIBERGLASS TANK w/BANDED 20 mil HDPF SECONDARY LINER
ROSA UNII #045	3003923013	BI ANCO MV	Me	31N	osw	BG1	FIBERGLASS TANK W/BANDED 20-mil HDPE SECONDARY LINER
ROSA UNIT #046A	3003926986	BASIN DK / BLANCO MV	80	31N	05W	BGT	FIBERGLASS TANK w/BANDED 20 mil HDPE SECONDARY LINER
ROSA UNIT #051	3003920289	BASIN DK	23C	31N	O6√v	BGT	DBL WALL STEEL
ROSA UNIT #053	3003920293	BASIN DK	8B .	31N	05W	BGT	FIBERGLASS TANK W/BANDED 20-mil HDPE SECONDARY LINER
ROSA UNIT #055	3003920923	BASIN DK	341	31N	05VV	BGT	FIBERGLASS TANK w/BANDED 20 mil HDPE SECONDARY LINER
ROSA UNIT #059 DK	3003923270	BASIN DK	25N	3111	06W	BG1	DBL WALL STEFF
ROSA UNIT #059 GL	3003923270	UNDES GL	25N	31N	06Vv	BGT	FIBERGLASS TANK w/BANDED 20-mil HDPE SECONDARY LINER
ROSA UNIT #060	3004529798	BLANCO MV	41	31N	06 V V	BG1	FIBERGLASS TANK WBANDED 20-mil HDPE SECONDARY LINER
ROSA UNIT #064	3003921703	BASIN DK	29A	31N	05W	BGT	DBL WALL STEEL
ROSA UNIT #064	3003921703	BASIN DK	29A	31N	05W	SGI	DBL WALL STEEL
ROSA UNIT #064M	3003925563	BASIN DK / BLANCO MV	29F	31N	05W	BGT	DBL WALL STEEL
ROSA UNIT #065	3003921702	BASIN DK	17A	31N	05VV	BG1	FIBERGLASS TANK WBANDED 20-mil HDPE SECONDARY LINER
ROSA UNIT #066	3003921758	BASIN DK	13L .	31N	06/\	BGT	FIBERGLASS TANK W/BANDED 20-mill HDPE SECONDARY LINER
ROSA UNIT #066M	3003925747	BASIN DK / BLANCO MV	13F	31N	06W	BGT	FIBERGLASS TANK w/BANDED 20 mill HDPE SECONDARY LINER
ROSA UNIT #072	3003925509	BLANCO MV	Gl	31N	05W	BGT	FIBERGLASS TANK W/BANDED 20 mil HDPE SECONDARY LINER
ROSA UNIT #072A	3003925795	BI ANCO MV	6K	31N	05W	BG1	FIBERGLASS TANK W/BANDED 20 mil HDPE SECONDARY LINER
ROSA UNIT #075	3004529895	BLANCO MV	101	31N	06W	BGT	FIBERGLASS TANK W/BANDED 20 mil HDPE SECONDARY LINER
ROSA UINIT #075A	3004529854	BLANCO MV	4()	31N	06VV		FIBERGLASS TANK w/BANDED 20-mil HDPE SECONDARY LINER
ROSA UNIT #07	3003922538	DK/UNDES GL/BLANCO	33L	31N	05W		FIBERGLASS TANK W/BANDFD 20 mil HDPE SECONDARY LINER

WELLS W/FEDERAL							
SURF MGT	API	FMT	SEC	TWN	RNG	PIT TY	PE CONSTRUCTION MATERIAL
		BASIN DK /					,
ROSA UNIT #079	3003922539	BLANCO MV BASIN DK /	22K	3111	06W	BGT	DBL WALL STEEL
ROSA UNIT #079	3003922539	BLANCO MV BLANCO MV /	22K	31N	06W	SGT	DBL WALL STEFT
ROSA UNIT #079A	3003925412	ROSA PC BASIN DK /	22F	3111	06W	BG1	DBL WALL STEEL
ROSA UNIT #079B	3003926920	BLANCO MV	22C	31N	06W	861	DBL WALL STEEL
ROSA UNIT #079C	3003929902	BLANCO MV BASIN DK /	31P	3111	05W	BGT	DBL WALL STEEL FIBERGLASS TANK w/BANDED 20-mil
ROSA UNIT #080	3003922537	BLANCO MV	8K	31N	05Vv	BG1	HDPE SECONDARY LINER LIBERGLASS TANK WBANDED 20-mil
ROSA UNIT #080A	3003926413	BLANCO MV	8f	31N	05W	BGT	HDPE SECONDARY LINER FIBERGLASS TANK WBANDED 20 mil
ROSA UNIT #085	3003922778	BASIN DK	20A	31N	05W	BGT	HDPL SECONDARY LINER FIBERGLASS TANK W/BANDED 20-mil
ROSA UNIT #085	3003922778	BLANCO MV	20A	31N	0517	BGI	HDPE SECONDARY LINER FIBERGLASS TANK W/BANDED 20-mil
ROSA UNIT #085A	3003926314	BI ANCO MV	20C	31N	05W	BGT	HDPE SECONDARY LINER
ROSA UNIT #0858	3003930130	BLANCO MV	20D	3111	05W	BGI	DBI WALL STEEL
ROSA UNIT #086	3003922766	UNDES GI	12W	31N	04W	SG1	SINGLE WALL STEEL
ROSA UNIT #088	3004525140	BLANCO MV / ROSA PC	48	31N	06W	BGT	DBL WALL STEEL FIBERGLASS TANK w/BANDED 20 mil
ROSA UNIT #059	3003922782	BLANCO MV	34A	32N	06W	BG1	HDPE SECONDARY LINER (IBERGLASS JANK & BANDED 20 mil
ROSA UNIT-#089A	(3003925512,	BITANCOMV	-34(1)	32N -	.0 <u>6</u> W	THG1	THORE SECONDARY LINER
ROSA UNIT #089B	3003926851	BLANCO MV	341	32N	06W	BG1	DBI WALL STEEL
ROSA UNIT #089C	3003926674	BLANCO MV	34G	32N	0674	SG1	SINGLE WALL STELL FIBERGLASS TANK WBANDED 20 mil
ROSA UNIT #090 COM	3004525370	BLANCO MV	33G	3211	0674	BGT	HDPE SECONDARY LINER
ROSA UNIT #090A COM	3004529259	BI ANCO MV	33G	3211	06\V	RGI	()BL WALL STEEL FIBERGLASS TANK W/BANDED 20 mil
ROSA UNIT #091	3003922780	BI ANCO MV	3511	32N	06W	BG1	HDPE SECONDARY LINER
ROSA UNIT #091A	3003925790	BLANCO MV -	35O	32N	06W	SGT	DBI WALL STEFL
ROSA UNIT #091B	3003926684	BI ANCO MV	36P	32N	06W	BGT	DBL WALL STEEL FIBERGLASS TANK w/BANDED 20 mil
30SA UNIT #091C	3003926991	BLANCO MV	35G	32N	06W	BGT	HDPE SECONDARY LINER FIBERGLASS TANK W/BANDED 20-mil
ROSA UNIT #098	3003923265	BASIN DK / GI	231	31N	06W	BG1	HDPE SECONDARY LINER
ROSA UNIT #100B	3003929547	BASIN DK / BLANCO MV	21()	31N	06W	вGТ	DBL WALL STEEL
OSA UNIT #100C	3003929851	BLANCO MV BLANCO MV /	21K	31N	06W	BGT	DBL WALL STEEL
OSA UNIT #100E	3003925135	ROSA PC	211	31N	06W	SG1	SINGLE WALL STEEL
OSA UNIT #10114	3003925577	BLANCO MV	24F	31N	06W	BGT	DBL WALL STEEL FIBERGLASS TANK w/BANDED 20 mil
OSA UNIT #108	3003923506	BASIN DK / GL	7G	3111	05W	BG1	HDPE SECONDARY LINER

WELLS W/FEDERAL SURF MGT	API	FMT	SEC	TWN	RNG	PIT TYP	E CONSTRUCTION MATERIAL
ROSA UNIT #119	3003925143	BASIN DK	18N	31N	06:10	BG1	DBL WALL STELL
ROSA UNIT #125	3003925144	BLANCO MV	13B	31N	06Vv	BGT	HIBERGLASS TANK WBANDED 20 m HDPL SECONDARY LINER
ROSA UNIT #1250	3003929843	BLANCO MV BASIN DK /	13(2	31N	06W	BGT	DRI WALL STEEL FIBERGLASS TANK W/BANDED 20 m
ROSA UNIT#125E	3003925526	BLANCO MV	13.1	31N	06W	BGT	HDFE SECONDARY LINER
ROSA UNIT #129	3003926304	BLANCO MV	34E	32N	06W	bG1	DRI WALL STEFF
ROSA UNIT #129A	3003926297	BLANCO MV	34K	32N	06W	BGT	DBL WALL STEEL FIBERGLASS TANK WBANDED 20-m
ROSA UNIT #137	3003925410	BLANCO MV BLANCO MV /	31K	31N	05W	BG1	HDPE SECONDARY LINER
ROSA UNIT #137A	3003926129	ROSA PC	311	31N	05W	BG1	DBL WALL STEEL FIBERGLASS TANK WBANDED 20 mi
ROSA UNIT #137B	3003927002	BLANCO MV BLANCO MV /	31P	31N	05W	BG1	HDF'E SECONDARY LINER FIBERGLASS TANK WBANDED 20 m
ROSA UNIT #138	3004529147	ROSA PC BLANCO MV /	171	31N	06VV	BG1	HUPE SECONDARY LINER
ROSA UNIT#138A	3004529134	ROSA PC	1711	3111	W80	HGT	DBI WALL STEFF
ROSA UNIT #138B	3004532168	BLANCO MV	1711	31N	06W	BG1	DBI WALL STEFF
ROSA UNIT #139A	3004529600	BLANCO MV	17M	31N	0GW	HG1	DPL WALL STEEL
ROSA UNIT #140	3003925435	ROSA PC	22K	31N	06W	BG1	DBL WALL STEEL
ROSA UNIT #144	3003925421	ROSA FC	26A	31N	06₩	BG1	DBI WALI STEEL
ROSA UNIT #145C	3004533086	BLANCO MV	16F	31N	06W	BGT	DBL WALL STEEL TIBERGLASS TANK WBANDED 20-na
ROSA UNIT #146A	3003925513	BLANGO MV	28N	31N	()5W	BG1	HDPE SECONDARY LINER
ROSA UNIT #146C	3003930187	BLANCO MV	28B	31N	05W	BG1	DBI WALL STEEL
ROSA UNIT #148	3003925493	BASIN DK	20	31N	06W	BG1	DBI WALL STEEL
ROSA UNIT #148A	3003925776	BLANCO MV	51/1	31N	06W	BG1	DBL WALL STEEL FIBERGLASS TANK WBANDED 20 mil
ROSA UNIT #148B	3003926985	BLANCO MV	2P	31N	W90	RG1	HDPE SECONDARY LINER FIBERGLASS TANK W/BANDED 20-mil
ROSA UNIT #149	3003925501	BLANCO MV	12G	31N	W90	BG1	HOPE SECONDARY LINER
ROSA UNIT #149A	3003925807	BLANCO MV BASIN DK /	12F	3111	W30	BG1	DBL WALL STEEL FIBERGLASS TANK W/BANDED 20 mil HDPE SECONDARY LINER
ROSA UNIT #149B ROSA UNIT #150	3003926599	BLANCO MV	12E	31N	Wan	_ •	FIBERGLASS TANK W/BANDED 20 mill HDPE SECONDARY LINER
ROSA UNIT #150A	3004529229	BLANCO MV	32F	32N	Wan		DBI WALL STEEL
ROSA UNIT #150B	3004529592	BASIN DK /	32M	32N	06W		•
	3004530874	BLANCO MV	32D	32N	06W		DBI WALL STEEL
ROSA UNIT #1500	3004532157	BLANCO MV	32K 33C	32N 32N	06W		DBL WALL STEEL DBL WALL STEEL

WELLS W/FEDERAL							- CONCIDUCION MATERIAL
SURF MGT	API	FMT	SEC	IWN	RNG	PITTYPE	CONSTRUCTION MATERIAL
ROSA UNIT #151A	3004529631	BLANCO MV	331	3214	ОБУч	BG1	DBI WALL STEFT
ROSA UNIT #151C	3004532196	BLANCO MV	33N	32N	06W	FGI	DBI WALL STEEL
ROSA UNIT #152	3003925494	BLANCO MV	ЗbЕ	32N	0617	EGI	FIBERGLASS TANK W/BANDED 20 mil HDPE SECONDARY LINER
ROSA UNIT #152A	3003925695	BLANCO MV	36N	3214	06W	BGT	UBL WALL STEEL
ROSA UNIT #152B	3003926631	BLANCO MV	36C	32N	06W	BG1	DBL WALL STEEL
ROSA UNIT #152C	3003927635	BLANCO MV	361	32N	06W	BG1	FIBERGLASS TANK WBANDED 20 mil HDPE SECONDARY LINER
ROSA UNIT #153	3003925524	BI ANCO MV	17()	31N	05W	BGT	FIBERGLASS TANK WBANDED 20 mil HDPF SECONDARY LINER
							FIBERGLASS TANK W/BANDED 20 mil
ROSA UNIT #153A	3003926329	BLANCO MV BASIN DK /	170	31N	05VV	BG1	HDPE SECONDARY LINER FIBERGLASS TANK WBANDED 20-mil
ROSA UNIT #153B	3003927603	BLANCO MV	171	31N	05W	BG1	HDPE SECONDARY LINER
ROSA UNIT #154	3003925893	BLANCO MV	7N	31N	05VV	BGT	DBL WALL STEEL FIBERGLASS TANK WBANDED 20 mil
ROSA UNIT #154A	3003926274	BLANCO MV	7P	3114	05W	BGT	HDPE SECONDARY LINER FIBERGLASS TANK WBANDLD 20 mil
ROSA UNIT #156	3004529661	BLANCO MV	9A	3414	06W	BG1	HDPE SECONDARY LINER FIBERGLASS TANK WBANDED 20 mil
ROSA UNIT #156A	3004529640	BLANCO MV BASIN DK /	91	31N	0644	BG1	HDPE SECONDARY LINER
ROSA UNIT #159 COM	3003925583	BLANCO MV	190	31N	05W	BGT	DBI WALL STEEL FIBERGLASS TANK W/BANDED 20 mil
ROSA UNIT #159A	3003926273	BLANCO MV	19N	3111	05Vv	BG1	HDPE SECONDARY LINER FIBERGLASS TANK WBANDED 20-mil
ROSA UNIT #15C	3003930111	BLANCO MV	29G	31N	OBVV		HDPE SECONDARY LINER
ROSA UNIT #160	3003925890	BLANCO MV / ROSA PC	250	31N	0614	BG1	DBL WALL STEEL
ROSA UNIT #160A	3003925818	BLANCO MV	25N	31N	()6W		DBL WALL STEEL FIBERGLASS TANK w/BANDED 20 mil
ROSA UNIT #160B	3003926962	BASIN DK / BLANCO MV	251	31N	06/4		HDPE SECONDARY LINER
ROSA UNIT #160C	3003929778	BLANCO MV	25J	31N	06W		DBL WALL STEEL FIBERGLASS TANK w/BANDED 20 mil
ROSA UNIT #162	3003926069	BI ANCO MV	30K	31N	05W		HDPE SECONDARY LINER
ROSA UNIT #162B	3003929845	BLANCO MV	30P	31N	05W		DBL WALL STEEL FIBERGLASS TANK W/BANDED 20 mil
ROSA UNIT #163	3003926345	BI ANCO MV	24G	31N	06W	BGT	HDPE SECONDARY LINER FIBERGLASS TANK W/BANDED 20-mil
ROSA UNIT #163A	3003926336	BLANC() MV	240	31N	0674		HDPE SECONDARY LINER
ROSA UNIT #163B	3003929921	BLANCO MV	24B	31N	06W	SGI	DBL WALL STEEL
ROSA UNIT #163C	3003929611	BLANCO MV	2 4 J	31N	06W		SINGLE WALL STEEL
ROSA UNIT #164	3003926151	BASIN DK / BLANCO MV	1,5	31N	06W	BG1	FIBERGLASS TANK w/BANDE() 20-mil HDPE SECONDARY LINER
ROSA UNIT #164A	3003926080	BI ANCO MV	1 J	31N	06W	BGT	FIBERGLASS TANK W/BANDED 20-mil HDPE SECONDARY LINER
ROSA UNIT #164E	3003927242	BASIN DK / BLANCO MV	1J	31N	06W		FIBERGLASS TANK w/BANDFI) 20 mil HDPE SECONDARY LINER

.

WELLS W/FEDERAL			***				
SURF MG1	API	FMT	SEC	_TWN_	RNG	PIT TYP	E CONSTRUCTION MATERIAL
574.614.414.41		BLANCO MV /					
ROSA UNII #165	3003926070	ROSA PC	251	31N	06W	BGT	DBI WALL STEEL
ECOCA INIT LICEA		to 441					FIBERGLASS TANK WBANDED 20 mil
ROSA UNIT #165A	3003926150	BLANCO MV	25B	31N	OeVV	BG1	HDFE SECONDARY LINER
12474 6 1 14 11 11 11 11 11 11 11		BASIN DK /					
ROSA UNIT #165B	3003926557	BLANCO MV	25F	31N	0644	BG1	DBI WALL STEEL
5056 1 1 1 1 2 1 1 1 1 1		BASIN DK /					
ROSA UNIT #165C	3003926961	BLANCO MV	25G	311/	06₩	BG1	DBI WALL STEEL
TO CO. 1 11 11 11 11 11 11 11 11 11 11 11 11							FIBERGLASS TANK W/BANDED 20-mil
ROSA UNIT #166	3003926275	BLANCO MV	30A	31N	USVV	BG1	HDPE SECONDARY LINER
DOM A LIBERT LACET							FIBERGLASS TANK w/BANDFD 20 mil
ROSA UNIT #166A	3003926282	BLANCO MV	30F	31N	05W	HG1	HUFE SECONDARY LINER
DOGA LIBIT WALZA							FIBERGLASS TANK W/BANDED 20-mil
ROSA UNIT #167A	3004529886	BLANCO MV	8A	31N	06Vv	BGT	HDPE SECONDARY LINER
DOCA UNIT HAVO	0.000,000,000	() (4. 1				100 HALL 7 755
ROSA UNII #169	3003926130	BLANCO MV	3J	3111	06VV	BG1	DBI WALL STEFE
ROSA UNIT #169A	2002026140	BLANCO MV	2.1	214.61	00141	DOT	DBI WALL STEEL
ROSA ON # 109A	3003926149	DI ANCO IVIV	3.1	31N	06W	BGT	FIBERGLASS TANK W/BANDED 20-mil
ROSA UNIT #1690	3003927717	BLANCO MV	2M	3111	06Vv	14(2.)	HDFE SECONDARY LINER
KOSA ONT # 1080	3003827777	DI ANCO WV	71/4	2114	OOVV	BG1	TIDE SECONDART TIMER
ROSA UNIT #170	3003925851	BLANCO MV	21N	31N	06W	BG1	DBI WALL STEEL
TROCK ONLY BY TO	300387 (031	DI ANGO MIV	2118	9114	OGVV	וטמ	THE WALL STEEL
ROSA UNIT #171	3003926286	BLANCO MV	7G	3111	05W	861	DBL WALL STEEL
	3003020200	the fire of the	, 0	7.11 4	17, 77	UCT	FIBERGLASS TANK W/BANDED 20-mil
ROSA UNIT #171A	3003926389	BLANCO MV	7G	31N	05W	BGT	HDPE SECONDARY LINER
			7 (3	7,114	0.071	. 17(7)	FIBERGLASS TANK W/BANDED 20-mil
ROSA UNIT #1716	3003927013	-BLANCO MV	6P	31N	05W	BG1	HDDE SECONDARY LINER
	000002 1010			.,,,,,	(,,,,,,	1,01	FIBERGLASS TANK W/BANDED 20 mil
ROSA UNIT #180	3004529898	BLANCO MV	9N	31N	06W	BGT	HDPE SECONDARY LINER
ROSA UNIT #180B	3004533134	BLANCO MV	9ા	3114	06W	BG1	DBL WALL STEEL
ROSA UNIT #180C	3004533191	BLANCO MV	9E	31N	06W	BG1	DBL WALL STEFL
ROSA UNIT #181	3003926463	BLANCO MV	11K	31N	0677	BG1	DBI WALL STEEL
							FIBERGLASS TANK w/BANDED 20 mil
ROSA UNIT #181A	3003926312	BLANCO MV	15A	31N	06W	BG1	HDPE SECONDARY LINER
ROSA UNIT #1810 (shared							FIBERGLASS TANK w/BANDED 20 mil
w/169C)	3003927714	BLANCO MV	2M	31N	06W	BGT	HDPE SECONDARY LINER
							FIBERGLASS TANK W/BANDED 20-mil
ROSA UNIT #182	3003926283	BLANCO MV	18N	31N	05W	BG1	HDFE SECONDARY LINER
							_
ROSA UNIT #182A	3003926285	BLANCO MV	18P	31N	05W	BGT	DBL WALL STEEL
ROSA UNIT #182C	3003930180	BLANCO MV	18F	31N	05W		SINGLE WALL STEEL
2000 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1							FIBERGLASS TANK w/BANDED 20 mil
ROSA UNIT #183	3003926387	BLANCO MV	19G	31N	05W		HDPE SECONDARY LINER
2000 A LIMIT WARDS		D1 441/20 441/					FIBERGLASS TANK W/BANDED 20 mil
ROSA UNIT #183A	3003926386	BI ANCO MV	19F	31N	05W	BG1	HDPE SECONDARY LINER
SOCA HALL MADOD	000000000	DI ANICO MY	4.005	0.414	0.5147	0.07	COLUMN CITT
ROSA UNIT #183B	3003930087	BLANCO MV	19B	31N	05W	BG1	DBL WALL STEEL
2000 A LIMIT #405D		BASIN DK /	105	0.441	4.014.	0.07	ODLIMAL CIEF
ROSA UNIT #185B	3004532734	BLANCO MV	16F	31N	06W	BG1	DBL WALL STEFL
SUCVIENT 4-10FC	2004624404	DI ANCO M	165	9481	06144	500	DDI MALI CIELI
ROSA UNIT #1850	3004534484	BLANCO MV	16F	31N	06W	BGT	DBI WALL STEEL
ROSA UNIT #18	3003030400	BLANCO MV	210	246	HAM	B/ST	DBL WALL STEEL
NOA DINIT # 10:	3003930186	BLANCO WIV	21G	31N	U5W	BG1	UDL WALL STEEL

,

WELLS W/FEDERAL							A TANKE OF THE PARTY OF THE PAR
SURF MGT	API	FMT	SEC	TWN	RNG	PIT TYPE	CONSTRUCTION MATERIAL
ROSA UNIT #231	3003924444	BASINFIC	31N	3111	05Vv	561	SINGLE WALL SILLI
ROSA UNIT #335A	3003930222	BASINFIC.	05.1	3114	()5VV	SG1_	SINGLE WALL STEEL

-

• •

.

Fields, Vanessa

From:

Fields, Vanessa

Sent:

Monday, August 16, 2010 10:34 AM 'Brandon.Powell@state.nm.us'

To: Cc:

Meador, Tasha; Basye, Matt

Subject:

Pit Closure Notice

Brandon: Williams tentatively plans to initiate closure of the following BGT this week, depending on weather and available resources.

WELLSITE	API	FMT	SEC	TWN
Rosa Unit #072A	3003925795	BLANCO MV	6K	05W
Rosa Unit #089A	3003925512	BLANCO MV	340	06W .P
Rosa Unit # L	16A 3003926986	BLANCO MV	80	05W

Please contact me if there are any problems or you request additional information. Thanks for your consideration.

Vanessa Fields

EH&S Coordinator Williams Exploration and Production 721 S. Main Aztec, NM 87410 office: 505-634-4200

fax: 505-634-4205

vanessa.fields@williams.com

District J 1625 N. French Dr., Hobbs, NM 88240 District II 1301 W. Grand Avenue, Artesia, NM 88210 District III 1000 Rio Brazos Road, Aztec, NM 87410 District IV 1220 S. St. Francis Dr., Santa Fe, NM 87505

State of New Mexico Energy Minerals and Natural Resources

Oil Conservation Division 1220 South St. Francis Dr. Santa Fe, NM 87505 Submit 2 Copies to appropriate District Office in accordance with Rule 116 on back side of form

Form C-141

Revised October 10, 2003

Release Notification and Corrective Action

	•					OPERATOR					Final Report	
Name of Company WILLIAMS PRODUCTION, LLC						Contact Vanessa Fields						
Address P.O. BOX 640, AZTEC, NM 87410						Telephone No. (505) 634-4209						
Facility Name Rosa Unit # 089A F							Facility Type Well Site					
Surface Own	ner: Fede	ral		Mineral O	wner:			Lease	No.			
				LOCA	TION	OF RE	LEASE					
Unit Letter	Section	Township	Range	Feet from the		South Line	Feet from the	East/West Line	County			
О	34	32N	06W									
Latitude 36.03925512N Longitude -107.44268W												
				NAT	URE	OF REL	EASE					
Type of Relea	se No Rele	ease Occurred				Volume of		Volume	Recovered			
Source of Rel						<u> </u>	lour of Occurrence	ce Date and	Hour of Dis	covery		
Was Immedia	ite Notice (Yes [] No ⊠ Not Re	anired	If YES, To	Whom?					
By Whom?					quired	Date and F	lour					
Was a Watero	ourse Read	ched?					olume Impacting t	the Watercourse.				
			Yes 🗵] No								
If a Watercou	rse was Im	pacted, Descr	ibe Fully.	* N/A								
Describe Cau No action req		em and Reme	dial Actio	n Taken.*								
Describe Area	a Affected	and Cleanup A	Action Tal	ken.*							-	
N/A												
regulations al public health should their o	I hereby certify that the information given above is true and complete to the best of my knowledge and understand that pursuant to NMOCD rules and regulations all operators are required to report and/or file certain release notifications and perform corrective actions for releases which may endanger public health or the environment. The acceptance of a C-141 report by the NMOCD marked as "Final Report" does not relieve the operator of liability should their operations have failed to adequately investigate and remediate contamination that pose a threat to ground water, surface water, human health or the environment. In addition, NMOCD acceptance of a C-141 report does not relieve the operator of responsibility for compliance with any other											
OIL CONSERVATION DIVISION												
Signature: Common Fully												
Printed Name: Vanessa Fields Approved by District Supervisor:												
Title: EH&S	Coordinate	or				Approval Date: Expiration			Date:	Date:		
E-mail Addre	ss: Vaness	sa.fields@will	iams.com		(Conditions o	f Approval:		Attached	. 🗆		
Date: 11-04	10		Phor	ne: (505) 634-4209	9							

^{*} Attach Additional Sheets If Necessary

Williams Production Co., LLC San Juan Basin: New Mexico Assets

Below-Grade Tank Removal Closure Plan

In accordance with Rule 19.15.17.13 NMAC, the following plan describes the general closure requirements of below-grade tanks (BGT) on Williams Production Co, LLC (WPX) locations in the San Juan Basin of New Mexico. This is WPX's standard closure procedure for all BGTs regulated under Rule 19.15.17 NMAC and operated by WPX. For those closures which do not conform to this standard closure plan, a separate well/pit specific closure plan will be developed and utilized.

Closure Conditions and Timing:

Pursuant to 19.15.17.13 (A) NMAC, WPX will initiate closure of any BGT should any one of these conditions occur:

- The Division requires closure because of imminent danger to fresh water, public health or the environment.
- The integrity of the BGT fails. Notification will be within 48 hours to the Division and closure will be schedule as specified in 19.15.17.12 (A)(5) NMAC.
- WPX chooses to take the BGT out-of-service due to operational needs. Closure under these conditions will be closed within 60 days of cessation of the BGT's operation.
- BGTs installed prior to June 16, 2008 that do not meet the requirements under 19.15.17.11.1(6) NMAC and WPX chooses not to retrofit or upgrade. Closure under these conditions will be completed within five years (by June 16, 2013).

General Plan Requirements:

- 1. Prior to initiating any BGT Closure except in the case of an emergency, WPX will review County Tax Records for the current surface owner of record. The surface owner of record will be notified of the intent to closure the BGT by certified mail and a copy of this notification will be included in the closure report. In the case of an emergency, the surface owner of record will be notified as soon as practical.
- 2. Notice of Closure will be given to the Aztec District office between 72 hours and one week of the scheduled closure via email or phone. The notification of closure will include the following:
 - a. Operators Name (WPX)
 - b. Well Name and API Number
 - c. Location (USTR)
- 3. All piping will be rerouted to an alternative produced water storage/disposal location (e.g. surface tanks, temporary frac tank, ...). The well will be temporarily shutin until the rerouting is completed.
- 4. All produced water will be removed from the BGT following discharge-pipe rerouting. Produced water will be disposed at one of the following NMOCD approved facilities depending on the proximity of the BGT site: Rosa Unit SWD #1 (Order: SWD-916, API: 30-039-27055), Rosa Unit #94 (Order: SWD-3RP-1003-0, API: 30-039-23035), Jillson Fed. SWD #001 (Order: R10168/R10168A, API: 30-039-25465), Middle Mesa SWD #001 (Order: SWD-350-0, API: 30-045-27004) and/or Basin Disposal (Permit: NM-01-0005).
- 5. Solids and sludges will be shoveled and /or vacuumed out for disposal at Envirotech (Permit Number NM-01-0011).
- 6. WPX will obtain prior approval from NMOCD to dispose, recycle, reuse, or reclaim the BGT and provide documentation of the disposition of the BGT in the closure report. Steel materials will be recycled or reused as approved by the Division. Fiberglass tanks will be empty, cut up or shredded, and EPA cleaned for disposal as solid waste. Liners materials will be cleaned without soils or contaminated material for disposal as

solid waste. Fiberglass tanks and liner materials will meet the conditions of paragraph 1 subsection D of 19.15.9.712 NMAC. Disposal will be at a licensed disposal facility, presently San Juan Regional Landfill operated by Waste Management under NMED Permit SWM-052426.

- 7. Any equipment associated with the BGT that is no longer required for some other purpose, following the closure will be removed from the location.
- 8. Following removal of the tank and any liner material, a five-point composite sample will be taken of the excavation and tested per 19.15.17.13(E)(4) NMAC as identified in Table 1. Grab samples will be collected from any area that is wet, discolored or showing other evidence of a release. Results will be report to the Division following receipt from the lab on Form C-141.

Table 1: Closure Criteria for BGTs

Components	Testing Methods	Closure Limits (mg/kg)
Benzene	EPA SW-846 Method 8021B or 8260B	- 0,2
BTEX	EPA SW-846 Method 8021B or 8260B	50
TPH	EPA SW-846 Method 418.1(1)	100
Chlorides	EPA SW-846 Method 300.1(1)	250(2)

⁽¹⁾ Method modified for solid waste.

- 9. If the Division and/or WPX determine there is a release, WPX will comply with 19.15.3.116 NMAC and 19.15.1.19 NMAC.
- 10. Upon completion of the tank removal, the excavation will be backfilled with non-waste earthen material compacted and covered with a minimum of one foot of top soil or background thickness whichever is greater and to existing grade. The surface will be recontoured to match the native grade and prevent ponding.
- 11. For those portions of the former pit area no longer required for production activities, WPX will seed the disturbed areas the first growing season after the pit is covered. Seeding will be accomplished via drilling on the contour whenever practical, or by other Division-approved methods. Vegetative cover will equal 70% of the native perennial vegetative cover (un-impacted) consisting of at least three native plant species, including at least one grass, but not including noxious weeds, and maintained that cover through two successive growing seasons. Repeat seeding or planting will be continued until successful vegetative growth occurs. Note: If a surface owner agreement requires reseeding or other surface restoration that do not meet the revegetation requirements of 19.15.17.13.1 NMAC then WPX will submit the proposed alternative with written documentation that the surface owner agrees to the alternative, for Division approval.
- 12. For those portions of the former pit area required for production activities, reseeding will be done at well abandonment, and following the procedure noted above.

Closure Report:

All closure activities will include proper documentation and will be submitted to OCD within 60 days of the BGT closure on a Closure Report using Division Form C-144. The Report will include the following:

- Proof of Closure Notice (surface owner & NMOCD)
- Backfilling & Cover Installation
- Site Diagram with coordinates
- Available Inspection reports

- Confirmation Sampling Analytical Results
- Disposal Facility Name(s) and Permit Number(s)
- Application Rate & Seeding techniques
- Photo Documentation of Reclamation

 $^{^{(2)}}$ If background concentration of Chlorides greater than 250 mg/Kg, then higher concentration will be used for closure.

Williams Production Co., LLC San Juan Basin: New Mexico Assets

Production Pit: Fiberalass Below-Grade Tank

Although these tanks have performed well to protect the public health, welfare and environment, in accordance with Rule 19.15.17.13.A (4) NMAC, Williams will removed all BGTs constructed of fiberglass by June 16, 2013. These tanks do not meet the construction/design standards specified in 19.15.17.11 (1-4). The following plans describes the general design and construction (D&C) and Operations and Maintenance (O&M)of these production pits used on Williams Production Co, LLC (WPX) locations in the San Juan Basin of New Mexico.

Design and Construction Plan

The pit is located as close as possible to the well and associated production/process equipment to minimize surface disturbance. The excavation bottom and sidewalls were compacted prior to installation of the pit. The BGT consisted of single-wall fiberglass tank following appropriate API and industry codes, placed in a 20-mil High-Strength Polyethylene resin (Permeability Rating – 0.041 USPerms), and the liner banded to the tanks. A 2" Sch-40 PVC riser was placed between the tank and liner as a leak-detection inspection port. See the attached Schematic and liner spec sheet. The pit is protected from runon by the construction of a compacted earthen berm. Fencing is constructed to protect livestock/wildlife as specified by the federal Surface Management Agency or, if not federal land/minerals requirements. WPX posts a well sign in accordance with the federal Surface Management Agency and rule 19.15.3.103.

Operations and Maintenance Plan

- WPX only allows produced liquids meeting the RCRA exemption for O&G wastes to be stored in the SGT. WPX will not discharge or store any hazardous waste as defined under RCRA 40CFR 261 and 19.15.1.7.W(3) NMAC in any temporary pit. Produced water is disposed by evaporation or transport any of the following NMOCD approved facilities depending on the well location: Basin-Disposal, Inc in Bloomfield, New Mexico (Permit # NM-01-005), Williams Rosa SWD#1 (Permit # SWD-916), Williams Rosa #94 (Permit # SWD-758), Burlington Resources Jillson SWD#1 (Permit #R10168A), or other NMOCD approved water disposal facilities. WPX maintains sufficient freeboard for to prevent overtopping. Discharges to the pit will be shutoff if the liquid level does not provided sufficient free-board and liquid removal can not be scheduled in a timely manner. Any oil or hydrocarbon collecting on the pit is removed. Saleable condensate is returned to the sales tank. Slop oil from compression is recycled with Safety Kleen, Farmington, NM or Hydropure, Aztec, NM (No Permit Required).
- 2. If the tank integrity is compromised:
 - a. All discharges will be shut off to the pit.
 - b. All liquids will be removed as soon as possible but no more that within 24 hours of discovery
 - c. WPX will notify and report to NMOCD as follows:
 - i. If the release is less than 25 bbls, the Aztec District Office by phone or email within 48-hours of discovery and repair.
 - ii. If the release is suspected to be greater than 25 bbls, the Aztec District Office and the Environmental Bureau Chief by phone for immediate verbal notification pursuant to 19.15.3.116.B (1)(d).
 - d. Written Spill/Release reports will be submitted on Form C-141 per 19.15.3.116.C NMAC within 15 days to the Aztec District Office.
- 3. Berms around the perimeter of the pit, shall be maintained as protection from run-on.
- 4. WPX will inspect the BGT pit monthly. Electronic copies of the inspections will be kept at the WPX San Juan Basin office for a minimum of five years following completion. Copies of the inspections will be available to NMOCD upon request.

Williams Production Co., LLC San Juan Basin: New Mexico Assets

Production Pit: Below-Grade Tank
Closure Plan

In accordance with Rule 19.15.17.13 NMAC, the following plan describes the general closure requirements of below-grade tanks (BGT) on Williams Production Co, LLC (WPX) locations in the San Juan Basin of New Mexico. This is WPX's standard procedure for all out-of-service BGTs used to store produced liquids during production operations at gas wells operated by WPX.

For those closures which do not conform to this standard closure plan, a separate well/pit specific closure plan will be developed and utilized. All closure activities will include proper documentation and will be submitted to OCD within 60 days of the pit closure on a Closure Report using Division Form C-144. The Report will include the following:

- Plot Plan (Pit Diagram)
- Available Inspection reports

- Sampling Results
- Waste disposal documentation

General Plan Requirements:


- 1. All piping will be rerouted to an alternative produced water storage/disposal location (e.g. surface tanks, temporary frac tank ...). The well will be temporarily shut in until the rerouting is completed.
- 2. All produced water will be removed from the BGT following discharge-pipe rerouting. Produced water will be disposed of by injection at one of the Williams Production Rosa Unit Salt Water Disposal wells: Rosa SWD #1 (API: 30-039-27055) I-23-31N-06W Permit SWD-916 or Rosa Unit #94 (API: 30-039-23035) K-16-31N-05W, Permit SWD-758.
- 3. Notice of Closure will be given to the landowner or SMA, and the Aztec District office between 72 hours and one week of the scheduled closure via email or phone. The notification of closure will include the followina:
 - a. Operators Name (WPX)
 - b. Well Name and API Number
 - c. Location (USTR)
- 4. The BGT and all associated materials will be removed, and recycled, reused, or disposed. of in a Division-approved facility. All materials that can not be recycled or reused will be treated a solid waste and will be disposed of at a licensed disposal facility (probably San Juan Regional Landfill operated by Waste Management under NMED Permit SWM-052426).
- 5. Following removal of the tank and any liner material, a five-point composite sample will be taken of the excavation and tested per 19.15.17.13(B)(1)(b) NMAC. In the event that the criteria are not met (See Table 1), a release will be reported following Rule 116 and impacted soils will be excavated and hauled to Envirotech Landfarm near Bloomfield, NM (NMOCD Permit NM-01-0011). Approval to haul will be requested of the Aztec District office prior to initiation.

Table 1: Closure Criteria for BGTs

Components	Jesting#Weihods 2	- Gloswe dimils (mg/kg)
Benzene	EPA SW-846 Method 8021B or 8260B	0.2
BTEX	EPA SW-846 Method 8021B or 8260B	50
TPH	EPA SW-846 Method 8015 M(Full Range)*	100
	or Method 418.1	
Chlorides	EPA SW-846 Method 300.1	250

^{*} Preferred method

- 6. Upon completion of the tank removal and any necessary soil remediation, the excavation will be backfilled with non-waste earthen material compacted to native and covered with a minimum of one foot of top soil. The surface will be re-contoured to match the native grade.
- 7. For those portions of the former pit area no longer required for production activities, WPX will seed the disturbed areas the first growing season after the pit is covered. Seeding will be accomplished via drilling on the contour whenever practical, or by other Division-approved methods. Vegetative cover will equal 70% of the native perennial vegetative cover (un-impacted) consisting of at least three native plant species, including at least one grass, but not including noxious weeds, and maintained that cover through two successive growing seasons. Repeat seeding or planting will be continued until successful vegetative growth occurs. Note: WPX assumes the seeding stipulations including mix and seeding methods specified by the Surface Management Agency (BLM, BOR, USFS, Tribal, etc.) or Land owner as part of a surface use agreement or APD are Division-approved methods unless notified by the Division of their unacceptability.
- 8. For those portions of the former pit area required for production activities, re-seeding will be done at well abandonment, and following the procedure noted above.

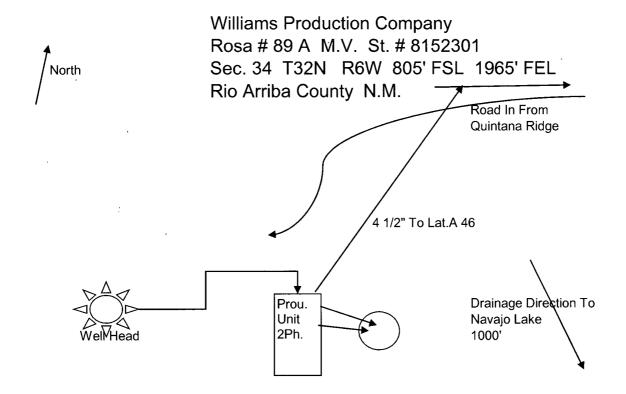



Ground Bed

Sep Olman Heath 2 Ph. Ser. # 17'
Pit 120 Bbl. Fiberglass Lined & Leak Detection
Rectifier J A Electronic 180/ 240 S Ser. # 95418



EPA METHOD 8015 Modified Nonhalogenated Volatile Organics Total Petroleum Hydrocarbons

Client:	WPX	Project #:	04108-0136
Sample ID:	Excavation	Date Reported:	09-07-10
Laboratory Number:	55771	Date Sampled:	08-26-10
Chain of Custody No:	10306	Date Received:	09-03 - 10
Sample Matrix:	Soil	Date Extracted:	09-03-10
Preservative:	Cool	Date Analyzed:	09-07-10
Condition:	Intact	Analysis Requested:	8015 TPH

Parameter	Concentration (mg/Kg)	Det. Limit (mg/Kg)
Gasoline Range (C5 - C10)	1.1	0.2
Diesel Range (C10 - C28)	1.0	0.1
Total Petroleum Hydrocarbons	2.1	

ND - Parameter not detected at the stated detection limit.

References:

Method 8015B, Nonhalogenated Volatile Organics, Test Methods for Evaluating Solid Waste,

SW-846, USEPA, December 1996.

Comments:

Rosa 89A - BGT

Analyst

Review

Ph (505) 632-0615 Fr (800) 362-1879 Fx (505) 632-1865 lab@envirotech-inc.com envirotech-inc.com



EPA Method 8015 Modified Nonhalogenated Volatile Organics Total Petroleum Hydrocarbons

Quality Assurance Report

Client:	QA/QC	Project #:	N/A
Sample ID:	09-07-10 QA/QC	Date Reported:	09-07-10
Laboratory Number:	55750	Date Sampled:	N/A
Sample Matrix:	Methylene Chloride	Date Received:	N/A
Preservative:	N/A	Date Analyzed:	09-07-10
Condition:	N/A	Analysis Requested:	TPH

	I-Cal Date.	L I-Cal RF	0±Call-Rif	% Difference:	Accept Range
Gasoline Range C5 - C10	09-07-10	9.9960E+002	1.0000E+003	0.04%	0 - 15%
Diesel Range C10 - C28	09-07-10	9.9960E+002	1.0000E+003	0.04%	0 - 15%

Blank Conc. (mg/L = mg/Kg)	Concentration	Detection Limit
Gasoline Range C5 - C10	ND	0.2
Diesel Range C10 - C28	ND	0.1
Total Petroleum Hydrocarbons	· ND	

Duplicate Conc. (mg/Kg)	Sample	Duplicate	-% Difference	Accept Range
Gasoline Range C5 - C10	ND	ND	0.0%	0 - 30%
Diesel Range C10 - C28	ND	ND	0.0%	0 - 30%

Spike Conc. (mg/Kg)	Sample	Spike Added	Spike Result	% Recovery	Accept: Range
Gasoline Range C5 - C10	ND	250	224	89.6%	75 - 125%
Diesel Range C10 - C28	ND	250	246	98.5%	75 - 125%

ND - Parameter not detected at the stated detection limit.

References:

Method 8015B, Nonhalogenated Volatile Organics, Test Methods for Evaluating Solid Waste,

SW-846, USEPA, December 1996.

Comments:

QA/QC for Samples 55752-55753, 55749-55750, 55767-55771, 55787

alvst Rev



EPA METHOD 8021 AROMATIC VOLATILE ORGANICS

Det

Client:	WPX	Project #:	04108-0136
Sample ID:	Excavation	Date Reported:	09-07-10
Laboratory Number:	55771	Date Sampled:	08 - 26-10
Chain of Custody:	10306	Date Received:	09-03-10
Sample Matrix:	Soil	Date Analyzed:	09-07-10
Preservative:	Cool	Date Extracted:	09-03-10
Condition:	Intact	Analysis Requested:	BTEX
	-	Dilution:	10

Parameter	Concentration (ug/Kg)	Limit (ug/Kg)	
			-
Benzene	. ND	0.9	
Toluene	ND	1.0	
Ethylbenzene	ND	1.0	
p,m-Xylene	ND	1.2	
o-Xylene	ND	0.9	
Total BTEX	ND		

ND - Parameter not detected at the stated detection limit.

Surrogate Recoveries:	Parameter	Percent Recovery
	Fluorobenzene	98.4 %
	1,4-difluorobenzene	101 %
	Bromochlorobenzene	101 %

References:

Method 5030B, Purge-and-Trap, Test Methods for Evaluating Solid Waste, SW-846, USEPA,

December 1996.

Method 8021B, Aromatic Volatile Organics, Test Methods for Evaluating Solid Waste, SW-846,

USEPA, December 1996.

Comments:

Rosa 89A - BGT

Analyst



EPA METHOD 8021 AROMATIC VOLATILE ORGANICS

Client:	N/A		Project #:		N/A
Sample ID:	0907BBLK QA/Q0	3	Date Reported:		09-07-10
Laboratory Number:	55767		Date Sampled:		N/A
Sample Matrix:	Soil		Date Received:		N/A
Preservative:	N/A		Date Analyzed:		09-07-10
Condition:	N/A		Analysis:		BTEX
		~	Dilution:		10
Gallbration and	#OaliRF	C-CaliRF)	%Diff.	Blank	Detect
Detection(Limits (ug/L)		Accept:Ren	ge 0 = 15%	Conc	Limit,
Benzene	7.2228E+005	7.2373E+005	0.2%	ND	0.1
Toluene	8.0110E+005	8.0270E+005	0.2%	ND	0.1
	7.3488E+005	7.3635E+005	0.2%	ND ND	0.1
Ethylbenzene	7.3400=7003				
Ethylbenzene p,m-Xylene	1.7885E+006	1.7920E+006	0.2%	ND	0.1

Duplicate Conc. (ug/Kg)	Sample Du	plicate/	%Dlff;	AcceptiRange	Detect Limit
Benzene	3.1	3.0	3.2%	0 - 30%	0.9
Toluene	4.6	4.8	4.3%	0 - 30%	1.0
Ethylbenzene	1.4	1.6	14.3%	0 - 30%	1.0
p,m-Xylene	ND	ND	0.0%	0 - 30%	1.2
o-Xylene	5.5	5.4	1.8%	0 - 30%	0.9

Spike Gonc, (ug/Kg)	Sample Amo	ount Spiked - Spi	kediSamble %	Recovery	Accept/Range
Benzene	3.1	500	531	106%	39 - 150
Toluene	4.6	500	527	104%	46 - 148
Ethylbenzene	1.4	500	501	100%	32 - 160
p,m-Xylene	ND	1000	1,120	112%	46 - 148
o-Xylene	5.5	500	515	102%	46 - 148

ND - Parameter not detected at the stated detection limit.

Dilution: Spike and spiked sample concentration represent a dilution proportional to sample dilution.

References:

Method 5030B, Purge-and-Trap, Test Methods for Evaluating Solid Waste, SW-846, USEPA.

December 1996.

Method 8021B, Aromatic and Halogenated Volatiles by Gas Chromatography Using Photoionization and/or Electrolytic Conductivity Detectors, SW-846, USEPA December 1996.

Comments:

QA/QC for Samples 55749-55750, 55752-55753, 55767, 55770-55771, 55787

Analyst

EPA METHOD 418.1 TOTAL PETROLEUM HYDROCARBONS

Client:	WPX	Project #:	04108-0136
Sample ID:	Excavation	Date Reported:	09-07-10
Laboratory Number:	55771	Date Sampled:	08-26-10
Chain of Custody No:	10306	Date Received:	09-03-10
Sample Matrix:	Soil	Date Extracted:	09-07-10
Preservative:	Cool	Date Analyzed:	09-07-10
Condition:	Intact	Analysis Needed:	TPH-418.1

_		Det.
	Concentration	Limit
Parameter	(mg/kg)	(mg/kg)

Total Petroleum Hydrocarbons

62.5

13.4

ND = Parameter not detected at the stated detection limit.

References:

Method 418.1, Petroleum Hydrocarbons, Total Recoverable, Chemical Analysis of Water

and Waste, USEPA Storet No. 4551, 1978.

Comments:

Rosa 89A - BGT

Analyst



EPA METHOD 418.1 TOTAL PETROLEUM **HYROCARBONS QUALITY ASSURANCE REPORT**

Client:

QA/QC

Project #:

N/A

Sample ID:

QA/QC

Date Reported:

09-07-10

Laboratory Number: Sample Matrix:

09-07-TPH.QA/QC 55772

Date Sampled:

N/A

Preservative:

Freon-113 N/A

Date Analyzed: Date Extracted:

09-07-10 09-07-10

Condition:

N/A

Analysis Needed:

TPH

Calibration

I-Cal Date 07-29-10 C-Cal Date 09-07-10

I-Cal RF: 1,860

C-Cal RF: 1,770

% Difference 4.8%

Accept. Range +/- 10%

Blank Conc. (mg/Kg)

Concentration

Detection Limit

TPH

ND

13.4

Duplicate Conc. (mg/Kg)

TPH

TPH

Sample 253

Duplicate 261

% Difference 3.0%

Accept. Range +/- 30%

Spike Conc. (mg/Kg) Sample Spike Added Spike Result % Recovery Accept Range

2,000

2,200

97.6%

80 - 120%

ND = Parameter not detected at the stated detection limit.

References:

Method 418.1, Petroleum Hydrocarbons, Total Recoverable, Chemical Analysis of Water

and Waste, USEPA Storet No. 4551, 1978.

Comments:

QA/QC for Samples 55770-55773, 55737, 55767

Analyst



Chloride

Client: **WPX** Project #: 04108-0136 Sample ID: Excavation Date Reported: 09-07-10 Lab ID#: 55771 Date Sampled: 08-26-10 Sample Matrix: Soil Date Received: 09-03-10 Preservative: Cool Date Analyzed: 09-07-10 Condition: Intact Chain of Custody: 10306

Parameter

Concentration (mg/Kg)

Total Chloride

30

Reference:

U.S.E.P.A., 4500B, "Methods for Chemical Analysis of Water and Wastes", 1983. Standard Methods For The Examination of Water And Waste Water", 18th ed., 1992.

Comments:

Rosa 89A - BGT

Analyst

CHAIN OF CUSTODY RECORD

Client:		Р	roject Name / L	ocation	:				T					ΔΝΔΙ	vsis.	/ PAR	AME1	ΓERS					
WPX ROSA 89A - BGT],	,				W 17 12	. 0.0		· · · · ·	v			_		
Client Address:		S	ampler Name:						25	213	i g						^						
			MATT	3/15°	Œ_				80	98	826	8	_		n.								
Client Phone No.:		1 -	lient No.:						D De	흝	P P	/eta	ig		Η̈́].	£	ш			1	8	ıtacı
			04108-t						Met	Įξ	₩	181	\ \ \ \	}	with		(418) E				e C	le Ir
Sample No./	Sample	Sample	Lab No.		ample	No./Volume of			TPH (Method 8015)	BTEX (Method 8021)	VOC (Method 8260)	RCRA 8 Metals	Cation / Anion	PG.	TCLP with H/P	PAH	TPH (418.1)	CHLORIDE				Sample Cool	Sample Intact
Identification	Date	Time	ne Soff		Matrix Containers		пусы	-			t	1 65	0	<u> </u>	<u> </u>	<u>a.</u>	<u> </u>	0	-		\vdash	S	(/
Excavasion)	126	1000	55771	Solid	Aqueous	1				ے ا												Y	7
				Soil Solid	Sludge Aqueous																		
				Soil Solid	Sludge Aqueous																		
				Soil Solid	Sludge Aqueous																		
				Soil Solid	Sludge Aqueous																		
				Soil Solid	Sludge Aqueous														_				
				Soil Solid	Sludge Aqueous																		
				Soil Solid	Sludge Aqueous							_											
				Soil Solid	Sludge Aqueous																		
				Soil Solid	Sludge Aqueous	:																	
Relinquished by: (Signa	turel				9/3/10	Time		ecel	ed by:	(Sign	ature)			<u> </u>				l		9/3	ate	Tin	ne >
Relinquished by: (Signa	ature)		<u> </u>		13/10	7:38		eceiv	ed by:	(Sign) سینے							7		ر م	, 0
Relinquished by: (Signa	ature)						R	eceiv	ed by:	(Sign	ature)	İ					-						
			5796 U:	S Highwa	y 64 • Farming		aly	tico	al La	bore	atory	Y	h-inc.o	om						1			

							Leak			
						Liner	detection		Pit	
		-				Bangeg Plastic				
						liner,				
						Double				
						Wall				
						Steel,				
					SGT.	Bottom				
					BGT,	Plastic				Comments / Repairs
Date	WellName	Run	Formation	Construction	Above	Liner	Y/N	level	level	needed
						Banded				
	ROSA UNIT		l., .,			Plastic				
9/5/2008		04-66	Mesa Verde	FIBERGLASS	BGT	liner,	YES	0"	19"	
	ROSA UNIT		.							
9/24/2008		04-66	Mesa Verde	FIBERGLASS	BGT	NO	YES	0	20"	
	ROSA UNIT		.							
10/16/2008		04-66	Mesa Verde	FIBERGLASS	BGT	NO	YES	0	28"	
	ROSA UNIT		.							
11/14/2008		04-66	Mesa Verde	FIBERGLASS	BGT	NO	YES	1"	33"	
, ,	ROSA UNIT	04.00		EIDEDOL AGO	ВОТ	NO		- **		
12/22/2008		04-66	Mesa Verde	FIBERGLASS	BGT	NO	YES	1"	40"	
. / /	ROSA UNIT	04.00		EIDEDOL AGO	ВОТ	N/O		- "	11	
1/20/2009	<u> </u>	04-66	Mesa Verde	FIBERGLASS	BGT	NO	YES	1"	20"	
0 /0 /0000	ROSA UNIT	04.00		EIDEDOL AGO	ВОТ	NO				
2/9/2009		04-66	iviesa verde	FIBERGLASS	BGT	NO	YES			
2/5/2000	ROSA UNIT	04.66	Nana Vanda	EIDEDOL ACC	DOT	NO	\/F6	4.11	4711	
3/5/2009	#089A	04-66	iviesa verde	FIBERGLASS	BGT	NO	YES	1"	17"	-
F /4 /2000	ROSA UNIT #089A	04.66	Mana Varda	EIDEDOLACO	ВСТ	NO	V50	411	2211	
5/4/2009	<u> </u>	04-66	iviesa verde	FIBERGLASS	BGT	NO	YES	1"	33"	
4/20/2000	ROSA UNIT #089A	04-66	Moss Vords	FIBERGLASS	BGT	NO	VEC	4"	2211	
4/20/2009		04-00	iviesa verde	FIDERGLASS	BGT	INO	YES	1"	33"	
C /1 /2000	ROSA UNIT #089A	04.66	 Mose \/erd=	EIDEDCI ASC	BGT	NO	VEC		20"	
6/1/2009		04-66	iviesa verde	FIBERGLASS	BG I	NO	YES		39"	
7/6/2000	ROSA UNIT #089A	04-66	Mosa Varda	FIBERGLASS	BGT	NO	VEC		4211	
7/6/2009	#009A	U4-00	Iwesa verde	FIDERGLASS	ВОТ		YES		42"	

8/27/2009	ROSA UNIT #089A	04-66	Mesa Verde	FIBERGLASS	BGT	NO	YES	0in	48in	
9/1/2009	ROSA UNIT #089A	04-66	Mesa Verde	FIBERGLASS	BGT	NO	YES	1in	58in	
10/28/2009	ROSA UNIT #089A	04-66	Mesa Verde	FIBERGLASS	BGT	NO	YES	Oin	21in	
11/11/2009	ROSA UNIT #089A	04-66	Mesa Verde	FIBERGLASS	BGT	NO	YES	Oin	28in	
12/1/2009	ROSA UNIT #089A	04-66	Mesa Verde	FIBERGLASS	BGT	NO	YES	0in	39in	
1/12/2010	ROSA UNIT #089A	04-66	Mesa Verde	FIBERGLASS	BGT	NO	YES	0in	22in	
2/16/2010	ROSA UNIT #089A	04-66	Mesa Verde	FIBERGLASS	BGT	NO	YES	0in	24in	
3/9/2010	ROSA UNIT	04-66	Mesa Verde	FIBERGLASS	BGT	NO	YES	1in	29in	
16-Apr	ROSA UNIT #089A	04-66	Mesa Verde	FIBERGLASS	BGT	NO	YES	0"	2"	
14-May	ROSA UNIT	04-66	Mesa Verde	FIBERGLASS	BGT	NO	YES	0"	2"	
10-Jun	ROSA UNIT	04-66	Mesa Verde	FIBERGLASS	BGT	NO	YES	0"	10"	

.



WM of NM - San Juan County 78 County Road 3140 Aztec, NM, 87410 Ph. (505) 334-1121

Original Ticket# 1306723

Customer Name WILLIAMSPRO WILLIAMS PRODUCTI Carrier HALD HALD SERVICES INC
Ticket Date 09/16/2010 Vehicle# T17 Volume
Payment Type Credit Account Container
Manual Ticket# Driver
Hauling Ticket# Check#
Route Billing # 0000114
State Waste Code Gen EPA 1D

Manifest Destination PO Profile Generator

Gric

Time Scale Operator Inbound Gross 44780 lb In 09/16/2010 09:40:51 Inbound 301 vickyd Tare 40460 lb Out 09/16/2010 10:40:25 Outbound 302 vickyd Net 4320 lb Tons 2.16

Comments,

Products	Otŷ UOM Rate	Tax Amount Origin
1 MLY-MSW-Loose- Yds 100.	12.00 Yands 5.56	4.21 \$66.72 RIOARRIBA

RECEIVED
SEP 2.1 2010

WPX

Maricus Cherey
Halo Services
The Product

(Rosa 8711 PHC,724

(Rosa 8711 PHC,724

1538, 464 30 otal Tax

1538, 464 Total Ticket

\$4,21 \$70,93

Driver's Signature

403/0/04

Williams Production Co., LLC San Juan Basin: New Mexico Assets

Below-Grade Tank Removal Closure Report

> Well: API No:

(Rosa Unit#089A) 30-03925512

Location: O-S34-T32N-R06W, NMPM



In accordance with Rule 19.15.17.13 NMAC, the following report describes the general closure of the referenced below-grade tanks (BGT) on Williams Production Co, LLC (WPX) location in the San Juan Basin of New Mexico. The closure follows this WPX's standard closure procedure for all BGTs regulated under Rule 19.15.17 NMAC and operated by WPX. For those closures which do not conform to the standard closure plan, a separate well/pit specific closure plan will be developed and utilized.

Closure Conditions and Timina:

Pursuant to 19.15.17.13 (A) NMAC, WPX will initiate closure of any BGT should any one of these conditions occur:

- The Division requires closure because of imminent danger to fresh water, public health or the environment.
- The integrity of the BGT fails. Notification will be within 48 hours to the Division and closure will be schedule as specified in 19.15.17.12 (A) (5) NMAC.
- WPX chooses to take the BGT out-of-service due to operational needs. Closure under these conditions will be initiated within 60 days of cessation of the BGT's operation.
- BGTs installed prior to June 16, 2008 that do not meet the requirements under 19.15.17.11.1(6) NMAC and WPX chooses not to retrofit or upgrade. Closure under these conditions will be completed within five years (by June 16, 2013).

General Plan Requirements:

1. Prior to initiating any BGT Closure except in the case of an emergency, WPX will review County Tax Records for the current landowner of record. The landowner of record will be notified of the intent to closure the BGT by certified mail and a copy of this notification will be included in the closure report. In the case of an emergency, the landowner of record will be notified as soon as practical.

Williams notified the SMA of its intent to clean close the BGT via Certified Mail on March 10, 2009 see attached. No return receipt required per BLM:FFO/NMOCD MOU dated 5/4/09.

- 2. Notice of Closure will be given to the Aztec District office between 72 hours and one week of the scheduled closure via email or phone. The notification of closure will include the following:
 - a. Operators Name (WPX)
 - b. Well Name and API Number
 - c. Location (USTR)

Aztec District office was notified of Williams E&P intent to close on (08/16/2010). Email attached.

3. All piping will be rerouted to an alternative produced water storage/disposal location (e.g. surface tanks, temporary frac tank, ...). The well will be temporarily shut-in until the rerouting is completed.

Williams closed the BGT used by the separator and piped all liquids to the Rosa <u>Unit#089A Produced Water Storage Tank.</u>

4. All produced water will be removed from the BGT following discharge-pipe rerouting. Produced water will be disposed at one of the following NMOCD approved facilities depending on the proximity of the BGT site: Rosa Unit SWD #1 (Order: SWD-916, API: 30-039-27055), Rosa Unit #94 (Order: SWD-3RP-1003-0, API: 30-039-23035), Jillson Fed. SWD #001 (Order: R10168/R10168A, API: 30-039-25465), Middle Mesa SWD #001 (Order: SWD-350-0, API: 30-045-27004) and/or Basin Disposal (Permit: NM-01-0005).

<u>Produced water in the BGT prior to closures was removed by vacuum truck and hauled to the Rosa Unit disposal wells listed.</u>

5. Solids and sludges will be shoveled and /or vacuumed out for disposal at Envirotech (Permit Number NM-01-0011).

No solids or sludge required removal prior to excavation and removal of the tank.

6. Williams will obtain prior approval from NMOCD to dispose, recycle, reuse, or reclaim the BGT and provide documentation of the disposition of the BGT in the closure report. Steel materials will be recycled or reused as approved by the Division. Fiberglass tanks will be empty, cut up or shredded, and EPA cleaned for disposal as solid waste. Liners materials will be cleaned without soils or contaminated material for disposal as solid waste. Fiberglass tanks and liner materials will meet the conditions of paragraph 1 subsection D or 19.15.9.712 NMAC. Disposal will be at a licensed disposal facility, presently San Juan Regional Landfill operated by Waste Management under NMED Permit SWM-052426.

The fiberglass tank and plastic liner was disposed of at the San Juan Regional Landfill.

- 7. Any equipment associated with the BGT that is no longer required for some other purpose, following the closure will be removed from the location.

 The fiberglass tank and plastic liner were removed offsite. All other piping and equipment remains in use. See attached photo.
- 8. Following removal of the tank and any liner material, a five-point composite sample will be taken of the excavation and tested per 19.15.17.13(E)(4) NMAC as identified in Table 1. Grab samples will be collected from any area that is wet, discolored or showing other evidence of a release. Results will be report to the Division following receipt from the lab on Form C-141.

Testing Methods	Closure Limits (mg/Kg)	Sample Results (mg/Kg)
EPA SW-846 Method 8021B or 8260B	0.2	ND
EPA SW-846 Method 8021B or 8260B	50	ND

100

250(2)

Table 1: Closure Criteria for BGTs

- (1) Method modified for solid waste.
- $^{(2)}$ If background concentration of Chlorides greater than 250 mg/Kg, then higher concentration will be used for closure.
- 9. If the Division and/or Williams determine there is a release, Williams will comply with 19.15.3.116 NMAC and 19.15.1.19 NMAC.

EPA SW-846 Method 418.1(1)

EPA SW-846 Method 300.1(1)

No release detected.

Components

Benzene BTEX

TPH

Chlorides

10. Upon completion of the tank removal, and any necessary soil remediation, the excavation will be backfilled with non-waste earthen material compacted to native and covered with a minimum of one foot of top soil or background thickness. The surface will be recontoured to match the native grade.

<u>Pit area backfilled with clean earthen material following sample results. No contaminated soil taken off site.</u> Backfill compacted to avoid settling and pit area <u>remains in use for production operations.</u>

62.5

30

11. For those portions of the former pit area no longer required for production activities, WPX will seed the disturbed areas the first growing season after the pit is covered. Seeding will be accomplished via drilling on the contour whenever practical, or by other Division-approved methods. Vegetative cover will equal 70% of the native perennial vegetative cover (un-impacted) consisting of at least three native plant species, including at least one grass, but not including noxious weeds, and maintained that cover through two successive growing seasons. Repeat seeding or planting will be continued until successful vegetative growth occurs. Note: WPX assumes the seeding stipulations including mix and seeding methods specified by the Surface Management Agency (BLM, BOR, USFS, Tribal, etc.) APD are Division-approved methods unless notified by the Division of their unacceptability. If a landowner agreement requires reseeding or other surface restoration that does not meet the revegetation requirements of 19.15.17.13., I then WPX will submit the proposed alternative with written documentation that the landowner agrees to the alternative, for Division approval.

Pit area along with unused portions of well pad interim reclaimed and following P&A entire location to be reclaimed and recontoured in accordance with Surface Management Agency requirements in APD-COAs and per BLM:FFO/NMOCD MOU dated 5/4/09.

12. For those portions of the former pit area required for production activities, reseeding will be done at well abandonment, and following the procedure noted above. See above notes.

Closure Report:

All closure activities will include proper documentation and will be submitted to OCD within 60 days of the BGT closure on a Closure Report using Division Form C-144. The Report will include the following:

- Proof of Closure Notice (surface owner & NMOCD)
- Backfilling & Cover Installation
- Site Diagram with coordinates
- Available Inspection reports

- Confirmation Sampling Analytical Results
- Disposal Facility Name(s) and Permit Number(s)
- Re-vegetation Application Rate & Seeding techniques
- Photo Documentation of Reclamation

