District I 1625 N French Dt , Hobbs, NM 88240

District II 1301 W Grand Ave . Artesia, NM 88210 District III 1000 Rio Biazos Rd , Aztec, NM 87410

1220 S St Francis Dr , Santa Fe, NM 87505

### State of New Mexico **Energy Minerals and Natural Resources**

Department Oil Conservation Division 1220 South St. Francis Dr. Santa Fe, NM 87505

Pit, Closed-Loop System, Below-Grade Tank, or

Form C-144 July 21, 2008

For temporary pits, closed-loop sytems, and below-grade tanks, submit to the appropriate NMOCD District Office

For permanent pits and exceptions submit to the Santa Fe Environmental Bureau office and provide a copy to the appropriate NMOCD District Office

517	O
-----	---

District IV

Proposed Alternative Method Permit or Closure Plan Application
Type of action: Permit of a pit, closed-loop system, below-grade tank, or proposed alternative method
X Closure of a pit, closed-loop system, below-grade tank, or proposed alternative method
Modification to an existing permit
Closure plan only submitted for an existing permitted or non-permitted pit, closed-loop system, below-grade tank, or proposed alternative method
leges submit ane annlication (Form C-144) ner individual nit-clased laan system-below-grade tank ar alternative reque

Instructions: Please submit one application (Form C-144) per individual pit, closed-loop system, below-grade tank or alternative request

Please be advised that approval of this request does not relieve the operator of liability should operations result in pollution of surface water, ground water or the

environment. Nor does approval relieve the operator of its responsibility to comply with any other applicable governmental authority's rules, regulations or ordinances
Operator: Burlington Resources Oil & Gas Company, LP  Address: P.O. Box 4289, Farmington, NM 87499
Facility or well name: SAN JUAN 30-6 UNIT 43N
*
API Number: 30-039-30958 OCD Permit Number
U/L or Qtr/Qtr: J(NW/SE) Section: 14 Township: 30N Range: 6W County: Rio Arriba
Center of Proposed Design: Latitude: 36.8108 °N Longitude: 107.42826 °W NAD: 1927 X 1983  Surface Owner: X Federal State Private Tribal Trust or Indian Allotment
Surface Owner: X Federal State Private Tribal Trust or Indian Allotment
RCUD AUG 23 12
Elliet Sealis X weided X Factory Office Volume 7/00 but Dimensions E 120 x w 33 x D 12
Closed-loop System: Subsection H of 19 15 17 11 NMAC
Liner Seams Welded Factory Other
4 Below-grade tank: Subsection I of 19 15 17 11 NMAC  Volume
Submittal of an exception request is required Exceptions must be submitted to the Santa, Fe Environmental Bureau office for consideration of approval

Form C-144

Oil Conservation Division

Page 1 of 5

6'		
Fencing: Subsection D of 19 15.17 11 NMAC (Applies to permanent pit, temporary pits, and below-grade tanks)		
Chain link, six feet in height, two strands of barbed wire at top (Required if located within 1000 feet of a permanent residence, school, hospital, institu	ition or church	,
Four foot height, four strands of barbed wire evenly spaced between one and four feet		<b>´</b>
Alternate. Please specify		
7		
Netting: Subsection E of 19 15.17.11 NMAC (Applies to permanent pits and permanent open top tanks)		
Screen Netting Other		
Monthly inspections (If netting or screening is not physically feasible)		
8		
Signs: Subsection C of 19.15.17.11 NMAC		
12" X 24", 2" lettering, providing Operator's name, site location, and emergency telephone numbers		
X Signed in compliance with 19 15.3 103 NMAC		
9		
Administrative Approvals and Exceptions:  Justifications and/or demonstrations of equivalency are required. Please refer to 19.15.17 NMAC for guidance.		
Please check a box if one or more of the following is requested, if not leave blank:		
Administrative approval(s). Requests must be submitted to the appropriate division district of the Santa Fe Environmental Bureau office for considerations o	leration of ann	roval.
(Fencing/BGT Liner)	oration of appr	.0.1
Exception(s). Requests must be submitted to the Santa Fe Environmental Bureau office for consideration of approval.		
10		
Siting Criteria (regarding permitting) 19.15.17.10 NMAC		;
Instructions: The applicant must demonstrate compliance for each siting criteria below in the application. Recommendations of acceptable		
source material are provided below. Requests regarding changes to certain siting criteria may require administrative approval from the appropriate district office or may be considered an exception which must be submitted to the Santa Fe Environmental Bureau Office for		
consideration of approval. Applicant must attach justification for request. Please refer to 19.15.17.10 NMAC for guidance. Siting criteria		
does not apply to drying pads or above grade-tanks associated with a closed-loop system.		
Ground water is less than 50 feet below the bottom of the temporary pit, permanent pit, or below-grade tank.	Yes	□No
- NM Office of the State Engineer - iWATERS database search; USGS; Data obtained from nearby wells		<del></del>
Within 300 feet of a continuously flowing watercourse, or 200 feet of any other watercourse, lakebed, sinkhole, or playa lake	Yes	No
(measured from the ordinary high-water mark).  - Topographic map; Visual inspection (certification) of the proposed site		
Within 300 feet from a permanent residence, school, hospital, institution, or church in existence at the time of initial application.	∐Yes	L_]No
(Applies to temporary, emergency, or cavitation pits and below-grade tanks)	□NA	
- Visual inspection (certification) of the proposed site; Aerial photo; Satellite image		
Within 1000 feet from a permanent residence, school, hospital, institution, or church in existence at the time of initial application.	∏Yes	□No
(Applied to permanent pits)		<b>—</b>
- Visual inspection (certification) of the proposed site; Aerial photo; Satellite image	L	
Within 500 horizonal feet of a private, domestic fresh water well or spring that less than five households use for domestic or stock watering	□Yes	□No
purposes, or within 1000 horizontal feet of any other fresh water well or spring, in existence at the time of initial application.		
- NM Office of the State Engineer - iWATERS database search; Visual inspection (certification) of the proposed site.		:
		□N <sub>0</sub>
Within incorporated municipal boundaries or within a defined municipal fresh water well field covered under a municipal ordinance adopted pursuant to NMSA 1978, Section 3-27-3, as amended	Yes	∐No
- Written confirmation or verification from the municipality; Written approval obtained from the municipality		_
Within 500 feet of a wetland.  - US Fish and Wildlife Wetland Identification map; Topographic map; Visual inspection (certification) of the proposed site	Yes	No
Within the area overlying a subsurface mine.	Yes	По
- Written confirmation or verification or map from the NM EMNRD - Mining and Mineral Division		
Within an unstable area.	Yes	No
- Engineering measures incorporated into the design; NM Bureau of Geology & Mineral Resources; USGS; NM Geological		
Society; Topographic map		□N₁-
Within a 100-year floodplain - FEMA map	Yes	∐No

Temporary Pits, Emergency Pits and Below-grade Tanks Permit Application Attachment Checklist Subsection B of 19.15 17.9 NMAC
Instructions: Each of the following items must be attached to the application. Please indicate, by a check mark in the box, that the documents are attached
Hydrogeologic Report (Below-grade Tanks) - based upon the requirements of Paragraph (4) of Subsection B of 19 15 17.9 NMAC
Hydrogeologic Data (Temporary and Emergency Pits) - based upon the requirements of Paragraph (2) of Subsection B of 19 15.17.9
Siting Criteria Compliance Demonstrations - based upon the appropriate requirements of 19.15.17.10 NMAC
Design Plan - based upon the appropriate requirements of 19.15.17.11 NMAC
Operating and Maintenance Plan - based upon the appropriate requirements of 19.15.17 12 NMAC
Closure Plan (Please complete Boxes 14 through 18, if applicable) - based upon the appropriate requirements of Subsection C of
19.15 17 9 NMAC and 19.15.17 13 NMAC
Previously Approved Design (attach copy of design)  API or Permit
12
Closed-loop Systems Permit Application Attachment Checklist: Subsection B of 19 15 17.9 NMAC
Instructions Each of the following items must be attached to the application. Please indicate, by a check mark in the box, that the documents are attached.
Geologic and Hydrogeologic Data (only for on-site closure) - based upon the requirements of Paragraph (3) of Subsection B of 19 15.17.9
Siting Criteria Compliance Demonstrations (only for on-site closure) - based upon the appropriate requirements of 19.15.17.10 NMAC
Design Plan - based upon the appropriate requirements of 19.15 17.11 NMAC
Operating and Maintenance Plan - based upon the appropriate requirements of 19 15.17.12 NMAC
Closure Plan (Please complete Boxes 14 through 18, if applicable) - based upon the appropriate requirements of Subsection C of 19.15.17.9
NMAC and 19.15 17 13 NMAC
Previously Approved Design (attach copy of design)  API
Previously Approved Operating and Maintenance Plan API
13
Permanent Pits Permit Application Checklist: Subsection B of 19.15.17.9 NMAC
Instructions: Each of the following items must be attached to the application. Please indicate, by a check mark in the box, that the documents are attached.
Hydrogeologic Report - based upon the requirements of Paragraph (I) of Subsection B of 19 15.17.9 NMAC
Siting Criteria Compliance Demonstrations - based upon the appropriate requirements of 19.15.17.10 NMAC
Climatological Factors Assessment
Certified Engineering Design Plans - based upon the appropriate requirements of 19.15.17.11 NMAC
Dike Protection and Structural Integrity Design based upon the appropriate requirements of 19.15.17 11 NMAC
Leak Detection Design - based upon the appropriate requirements of 19 15 17.11 NMAC
Liner Specifications and Compatibility Assessment - based upon the appropriate requirements of 19.15.17 11 NMAC
Quality Control/Quality Assurance Construction and Installation Plan
Operating and Maintenance Plan - based upon the appropriate requirements of 19.15.17.12 NMAC
Freeboard and Overtopping Prevention Plan - based upon the appropriate requirements of 19.15.17.11 NMAC
Nuisance or Hazardous Odors, including H2S, Prevention Plan
Emergency Response Plan
Oil Field Waste Stream Characterization
Monitoring and Inspection Plan
Erosion Control Plan
Closure Plan - based upon the appropriate requirements of Subsection C of 19 15.17.9 NMAC and 19 15.17.13 NMAC
14
Instructions: Please complete the applicable boxes, Boxes 14 through 18, in regards to the proposed closure plan.
Type: Drilling Workover Emergency Cavitation P&A Permanent Pit Below-grade Tank Closed-loop System
Alternative
Proposed Closure Method: Waste Excavation and Removal
Waste Removal (Closed-loop systems only)
On-site Closure Method (only for temporary pits and closed-loop systems)
In-place Burial On-site Trench
Alternative Closure Method (Exceptions must be submitted to the Santa Fe Environmental Bureau for consideration)
15
Waste Excavation and Removal Closure Plan Checklist (19 15.17.13 NMAC) Instructions: Each of the following items must be attached to the closure plan.
Please indicate, by a check mark in the box, that the documents are attached.
Protocols and Procedures - based upon the appropriate requirements of 19.15.17.13 NMAC
Confirmation Sampling Plan (if applicable) - based upon the appropriate requirements of Subsection F of 19.15.17.13 NMAC
Disposal Facility Name and Permit Number (for liquids, drilling fluids and drill cuttings)
Soil Backfill and Cover Design Specifications - based upon the appropriate requirements of Subsection H of 19 15.17.13 NMAC
Re-vegetation Plan - based upon the appropriate requirements of Subsection I of 19.15.17.13 NMAC
Site Reclamation Plan - based upon the appropriate requirements of Subsection G of 19.15.17.13 NMAC
Site Regiantation Figure based upon the appropriate requirements of Subsection G of 19.13.17.13 NMAC

Form C-144 Oil Conservation Division Page 3 of 5

16				
Waste Removal Closure For Closed-loop Systems That Utilize Abov	e Ground Steel Tanks or Haul-off Bins Only:(19 15 17 13 D NMAC)			
Instructions Please identify the facility or facilities for the disposal of lifacilities are required.	quids, drilling fluids and drill cuttings. Use attachment if more than tw	o		
,	Discoul Partie Provide			
Disposal Facility Name				
Disposal Facility Name	_ <del></del>			
Will any of the proposed closed-loop system operations and assorting Yes (If yes, please provide the information No	ociated activities occur on or in areas that will nbe used for futur	e service and		
Required for impacted areas which will not be used for future service an				
	n the appropriate requirements of Subsection H of 19.15.17.13 I	NMAC		
Re-vegetation Plan - based upon the appropriate requireme				
Site Reclamation Plan - based upon the appropriate require	ments of Subsection G of 19 13 17 13 NMAC			
Siting Criteria (Regarding on-site closure methods only: 19.15 Instructions Each siting criteria requires a demonstration of compliance in the certain siting criteria may require administrative approval from the appropriate of office for consideration of approval Justifications and/or demonstrations of equi	losure plan Recommendations of acceptable source material are provided belo district office or may be considered an exception which must be submitted to the	w Requests regarding changes to Santa Fe Environmental Buveau		
Ground water is less than 50 feet below the bottom of the buried	waste.	Yes No		
- NM Office of the State Engineer - (WATERS database search; US	SGS. Data obtained from nearby wells	N/A		
Ground water is between 50 and 100 feet below the bottom of th	e buried waste	Yes No		
- NM Office of the State Engineer - tWATERS database search, US				
	·			
Ground water is more than 100 feet below the bottom of the buri		Yes No		
- NM Office of the State Engineer - (WATERS database search, US	GS. Data obtained from nearby wells	□N/A		
Within 300 feet of a continuously flowing watercourse, or 200 feet of an (measured from the ordinary high-water mark).	y other significant watercourse or lakebed, sinkhole, or playa lake	Yes No		
- Topographic map, Visual inspection (certification) of the proposed	1 site			
Within 300 feet from a permanent residence, school, hospital, institution - Visual inspection (certification) of the proposed site, Aerial photo,		Yes No		
proces		☐Yes ☐No		
Within 500 horizontal feet of a private, domestic fresh water well or sprir purposes, or within 1000 horizontal fee of any other fresh water well or NM Office of the State Engineer - iWATERS database; Visual insp	spring, in existence at the time of the initial application			
Within incorporated municipal boundaries or within a defined municipal figuresuant to NMSA 1978, Section 3-27-3, as amended	• • •	Yes No		
- Written confirmation or verification from the municipality: Written	n approval obtained from the municipality	l		
Within 500 feet of a wetland		Yes No		
- US Fish and Wildlife Wetland Identification map. Topographic ma	ap. Visual inspection (certification) of the proposed site			
Within the area overlying a subsurface mine.  - Written confirantion or verification or map from the NM EMNRD	Mining and Minaral Disease	Yes No		
Within an unstable area.	-Minning and Minicial Division			
- Engineering measures incorporated into the design, NM Bureau of	Garlogy & Mineral Recourses, USGS: NM Garlogical Society:	Yes No		
Topographic map	Geology & Milicial Resources, 0303, MM Geological Society,			
Within a 100-year floodplam. - FEMA map		Yes No		
On-Site Closure Plan Checklist: (19.15 17 13 NMAC) Instruction by a check mark in the box, that the documents are attached.	ctions: Each of the following items must bee attached to the cl	osure plan. Please indicate,		
Siting Criteria Compliance Demonstrations - based upon	the appropriate requirements of 19.15.17.10 NMAC			
Proof of Surface Owner Notice - based upon the appropri				
<b>=</b>	based upon the appropriate requirements of 19.15.17.11 NMA	c		
	burial of a drying pad) - based upon the appropriate requirement			
Protocols and Procedures - based upon the appropriate rec		5 01 17.10.17.11 11WING		
	the appropriate requirements of Subsection F of 19 15.17.13 NM	MAC		
		· · · ·		
Waste Material Sampling Plan - based upon the appropriate requirements of Subsection F of 19.15 17.13 NMAC  Disposal Facility Name and Permit Number (for liquids, drilling fluids and drill cuttings or in case on-site closure standards cannot be achieved)				
	-	rus cannot de achieved)		
Soil Cover Design - based upon the appropriate requirements		1		
Re-vegetation Plan - based upon the appropriate requirem				

19
Operator Application Certification:
I hereby certify that the information submitted with this application is true, accurate and complete to the best of my knowledge and belief
Name (Print): Title
Signature: Date.
e-mail address: Telephone
C-man address.
20 OCD Approval: Permit Application (including closure plan) Closure plan (only) OCD Conditions (see attachment) OCD Representative Signature:  Approval Date: 23/2012  Title: GMO GACE CLOSURE Plan (only) OCD Conditions (see attachment)
Closure Report (required within 60 days of closure completion): Subsection K of 19 15 17 13 NMAC Instructions Operators are required to obtain an approved closure plan prior to implementing any closure activities and submitting the closure report. The closure report is required to be submitted to the division within 60 days of the completion of the closure activities. Please do not complete this section of the form until an approved closure plan has been obtained and the closure activities have been completed    X   Closure Completion Date:   September 19, 2011
22
Closure Method:  Waste Excavation and Removal  Alternative Closure Method  Waste Removal (Closed-loop systems only)  If different from approved plan, please explain
23
Closure Report Regarding Waste Removal Closure For Closed-loop Systems That Utilize Above Ground Steel Tanks or Haul-off Bins Only:
Instructions: Please identify the facility or facilities for where the liquids, drilling fluids and drill cuttings were disposed. Use attachment if more than two facilities
were utilized.  Dienosal Facility Nama
Disposal Facility Name Disposal Facility Permit Number.
Disposal Facility Name Disposal Facility Permit Number.
Were the closed-loop system operations and associated activities performed on or in areas that will not be used for future service and operations?
Yes (If yes, please demonstrate complilane to the items below)
Required for impacted areas which will not be used for future service and operations.
Site Reclamation (Photo Documentation)
Soil Backfilling and Cover Installation
Re-vegetation Application Rates and Seeding Technique
Closure Report Attachment Checklist: Instructions: Each of the following items must be attached to the closure report. Please indicate, by a check mark in the box, that the documents are attached.  X Proof of Closure Notice (surface owner and division)  X Proof of Deed Notice (required for on-site closure)  X Plot Plan (for on-site closures and temporary pits)
X Confirmation Sampling Analytical Results (if applicable)
Waste Material Sampling Analytical Results (if applicable)
X   Disposal Facility Name and Permit Number
X Soil Backfilling and Cover Installation
X   Re-vegetation Application Rates and Seeding Technique
X   Site Reclamation (Photo Documentation)   On-site Closure Location. Latitude: 36.81059 °N Longitude: 107.42836 °W NAD   1927   X   1983
On-site Ciosare Education. Latitude. 30.01037 17 Congitude. 107.42030 17 1970 1727 A 1703
Operator Closure Certification:  I hereby certify that the information and attachments submitted with this closure report is ture, accurate and complete to the best of my knowledge and belief I also certify that the closure complies with all applicable closure requirements and conditions specified in the approved closure plan.
Name (Brint) Jamie Goodwin Title: Pagulatory Tech
Name (Print).  Signature:  Date:  Signature:  Name (Print).  Jamie Goodwin  Title:  Regulatory Tech.  Date:
e-mail address: jamie   goodwin@conocophillips com Telephone. 505-326-9784

# Burlington Resources Oil Gas Company, LP San Juan Basin Closure Report

Lease Name: SAN JUAN 30-6 UNIT 43N

API No.: 30-039-30958

In accordance with Rule 19.15.17.13 NMAC the following information describes the closure of the temporary pit referenced above. All proper documentation regarding closure activities is being included with the C-144. The temporary pit for this location was constructed and location drilled before June 16, 2008 (effective date for Rule 19.15.17). While closure of the temporary pit did fall within the rule some dates for submittals are after the rig release date.

- Details on Capping and Covering, where applicable. (See report)
- Plot Plan (Pit Diagram) (Included as an attachment)
- Inspection Reports (Included as an attachment)
- Sampling Results (Included as an attachment)
- C-105 (Included as an attachment)
- Copy of Deed Notice will be filed with County Clerk (Not required on Federal, State, or Tribal land as stated by FAQ dated October 30, 2008)

### **General Plan:**

1. All free standing liquids will be removed at the start of the pit closure process from the pit and disposed of in a division—approved facility or recycle, reuse or reclaim the liquids in a manner that the appropriate division district office approves.

All recovered liquids were disposed of at Basin Disposal (Permit #NM-01-005) and any sludge or soil required to be removed to facilitate closure was hauled to Envirotech Land Farm (Permit #NM-01-011) and JFJ Landfarm % IEI (Permit #NM-01-0010B).

2. The preferred method of closure for all temporary pits will be on-site burial, assuming that all the criteria listed in sub-section (B) of 19.15.17.13 are met.

The pit was closed using onsite burial.

3. The surface owner shall be notified of BR's closing of the temporary pit as per the approved closure plan using certified mail, return receipt requested.

The closure process notification to the landowner was sent via email. (See Attached)(Well located on Federal Land, certified mail is not required for Federal Land per BLM/OCD MOU.)

4. Within 6 months of the Rig Off status occurring BR will ensure that temporary pits are closed, re-contoured, and reseeded.

The closure plan requirements were met due to rig move off date as noted on C-105.

- 5. Notice of Closure will be given to the Aztec Division office between 72 hours and one week of closure via email, or verbally. The notification of closure will include the following:
  - i. Operator's name
  - ii. Location by Unit Letter, Section, Township, and Range. Well name and API number.

Notification is attached.

6. Liner of temporary pit shall be removed above "mud level" after stabilization. Removal of liner will consist of manually or mechanically cutting liner at mud level and removing all remaining liner. Care will be taken to remove "All" of the liner i.e., edges of liner entrenched or buried. All excessive liner will be disposed of at a licensed disposal facility.

Liner of temporary pit was removed above "mud level" after stabilization. Removal of the liner consisted of manually cutting liner at mud level and removing all remaining liner. Care was taken to remove "ALL" of the liner i.e., edges of liner entrenched or buried. All excessive liner was disposed of at a licensed disposal facility, (San Juan County Landfill).

7. Pit contents shall be mixed with non-waste containing, earthen material in order to achieve the solidification process. The solidification process will be accomplished using a combination of natural drying and mechanically mixing. Pit contents will be mixed with non-waste, earthen material to a consistency that is deemed a safe and stable. The mixing ratio shall not exceed 3 parts clean soil to 1 part pit contents.

Burlington mixed the Pit contents with non-waste containing, earthen material in order to achieve the solidification process. The solidification process was accomplished by using a combination of natural drying and mechanically mixing. Pit contents were mixed with non-waste, earthen material to a consistency that is deemed as safe and stable. The mixing ratio consisted of approximately 3 parts clean soil to 1 part pit contents.

8. A five point composite sample will be taken of the pit using sampling tools and all samples tested per Subsection B of 19.15.17.13(B)(1)(b). In the event that the criteria are not met, all contents will be handled per Subparagraph (a) of Paragraph (1) of Subsection B of 19.15.17.13 i.e., Dig and haul.

A five point composite sample was taken of the pit using sampling tools and all samples tested per Subsection B of 19.15.17.1 3(B)(1)(b). (Sample results attached).

Components	Tests Method	Limit (mg/Kg)	Results
Benzene	EPA SW-846 8021B or 8260B	0.2	ND ug/kg
BTEX	EPA SW-846 8021B or 8260B	50	ND ug/kG
ТРН	EPA SW-846 418.1	2500	99.2mg/kg
GRO/DRO	EPA SW-846 8015M	500	ND mg/Kg
Chlorides	EPA 300.1	1000/500	100 mg/L

9. Upon completion of solidification and testing standards being passed, the pit area will be backfilled with compacted, non-waste containing, earthen material. A minimum of four feet of cover shall be achieved and the cover shall include one foot of suitable material to establish vegetation at the site, or the background thickness of topsoil, whichever is greater. If standard testing fails BR will dig and haul all contents pursuant to 19.15.17.13.i.a. After doing such, confirmation sampling will be conducted to ensure a release has not occurred.

The pit material passed solidification and testing standards. The pit area was then backfilled with compacted, non-waste containing, earthen material. More than four feet of cover was achieved and the cover included one foot of suitable material to establish vegetation at the site.

10. During the stabilization process if the liner is ripped by equipment the Aztec OCD office will be notified within 48 hours and the liner will be repaired if possible. If the liner can not be repaired then all contents will be excavated and removed.

The integrity of the liner was not damaged in the pit closure process.

11. Dig and Haul Material will be transported to the Envirotech Land Farm located 16 miles south of Bloomfield on Angel Peak Road, CR 7175. Permit # NM010011

Dig and Haul was not required.

12. Re-contouring of location will match fit, shape, line, form and texture of the surrounding. Re-shaping will include drainage control, prevent ponding, and prevent erosion. Natural drainages will be unimpeded and water bars and/or silt traps will be place in areas where needed to prevent erosion on a large scale. Final recontour shall have a uniform appearance with smooth surface, fitting the natural landscape.

The pit area was re-contoured to match fit, shape, line, form and texture of the surrounding area. Re-shaping included drainage control, to prevent ponding and erosion. Natural drainages were unimpeded and water bars and/or silt traps were placed in areas where needed to prevent erosion on a large scale. Final recontour has a uniform appearance with smooth surface, fitting the natural landscape.

13. Notification will be sent to OCD when the reclaimed area is seeded.

Provision 13 was accomplished through complying with BLM seeding requirements as allowed by the BLM/OCD MOU.

14. BR shall seed the disturbed areas the first growing season after the operator closes the pit. Seeding will be accomplished via drilling on the contour whenever practical or by other division-approved methods. BLM or Forest Service stipulated seed mixes will used on federal lands. Vegetative cover will equal 70% of the native perennial vegetative cover (un-impacted) consisting of at least three native plant species, including at least one grass, but not including noxious weeds, and maintain that cover through two successive growing seasons. Repeat seeding or planting will be continued until successful vegetative growth occurs.

Provision 14 was accomplished through complying with BLM seeding requirements as allowed by the BLM/OCD MOU.

15. The temporary pit will be located with a steel marker, no less than four inches in diameter, cemented in a hole three feet deep in the center of the onsite burial upon the abandonment of all the wells on the pad. The marker will be flush with the ground to allow access of the active well pad and for safety concerns. The marker will include a threaded collar to be used for future abandonment. The top of the marker will contain a welded steel 12" square plate that indicates the onsite burial of the temporary pit. The plate will be easily removable and a four foot tall riser will be threaded into the top of the collar marker and welded around the base with the operator's information at the time of all wells on the pad are abandoned. The operator's information will include the following: Operator Name, Lease Name, Well Name and number, Unit Number, Section, Township, Range and an indicator that the marker is an onsite burial location.

Provision 15 was accomplished by installing a steel marker in the temporary pit, no less than four inches in diameter, cemented in a hole three feet deep in the center of the onsite burial. The marker is flush with the ground to allow access of the active well pad and for safety concerns. The top of the marker contains a welded steel 12" square plate that indicates the onsite burial of the temporary pit. The plate contains the following: Operator Name, Lease Name, Well Name and number, Unit Number, Section, Township, Range and an indicator that the marker is an onsite burial location.

The plate will be easily removable and a four foot tall riser will be threaded into the top of the collar marker and welded around the base with the following operator's information at the time of all wells on the pad are abandoned. The riser will be labeled: BR, BLM, SAN JUAN 30-6 UNIT 43N, UL-J, Sec. 14, T 30N, R 6W, API # 30-039-30958

### Jaramillo, Marie E

From:

Jaramillo, Marie E

Sent:

Monday, March 22, 2010 9:43 AM

To:

Farrell, Juanita R; Maxwell, Mary Alice; 'mark\_kelly@nm.blm.gov'

Subject:

SURFACE OWNER VERIFICATION 03/22/10

The subject well will have a temporary pit that will be closed on-site. Please let me know if you have any questions.

SAN JUAN 30-6 UNIT 43N

Marie Jaramillo Staff Regulatory Tech. ConocoPhillips Office # (505) 326-9865 Fax # (505) 599-4062

mailto:marie.e.jaramillo@conocophillips.com

District I 1625 N. French Dr., Hobbs, NM 88240

State of New Mexico Energy, Minerals & Natural Resources Department

Form C-102 Revised October 12, 2005 Instructions on back Appropriate District Office

District II 1301 W. Grand Avenue, Artesia, NM 88210 District III 1000 Rio Brazos Rd., Aztec. NM 87410

OIL CONSERVATION DIVISION 1220 South St. Francis Dr. Santa Fe. NM 87505 Submit to Appropriate District Office State Lease - 4 Copies Fee Lease - 3 Copies


District IV 1220 S. St. Francis Dr., Santa Fe, NM 87505


\_\_\_ AMENDED REPORT

### WELL LOCATION AND ACREAGE DEDICATION PLAT

۱,۵	PI Number	٢	72	*Pool Coo 319 / 7	-		PDO! Nam		NVOT A
			/2.	319 / /			IESAVERDE /		
'Property	Code				Property	y Name			"We]] Number
			SAN JUAN 30-6 UNIT				43N		
'OGRID N	No.				*Operator	Name			°Elevation
14538	3		BURLI	NGTON F	RESOURCES	OIL & GAS CO	DMPANY LP		6209
<sup>10</sup> Surface Location									
UL or lot no.	Section	Township	Range	Lat Idn	Feat from the	North/South line	Feet from the	East/West line	County
J	14	30Ň	6W		1980	SOUTH	1475	EAST	ARRIBA
<sup>11</sup> Bottom Hole Location If Different From Surface									
UL or lot no	Section	Township	Range	Lot Idn	Feet from the.	North/South line	Feet from the	East/West line	RIO
0	14	30N	6₩		835	SOUTH	2330	EAST	ARRIBA
Dedicated Acres	320.0	) Acres ) Acres	- E/2 - F/2	(MV) (DK)	13 Joint or Infill	<sup>14</sup> Consolidation Code	<sup>13</sup> Order No.		

NO ALLOWABLE WILL BE ASSIGNED TO THIS COMPLETION UNTIL ALL INTERESTS HAVE BEEN CONSOLIDATED OR A NON-STANDARD UNIT HAS BEEN APPROVED BY THE DIVISION

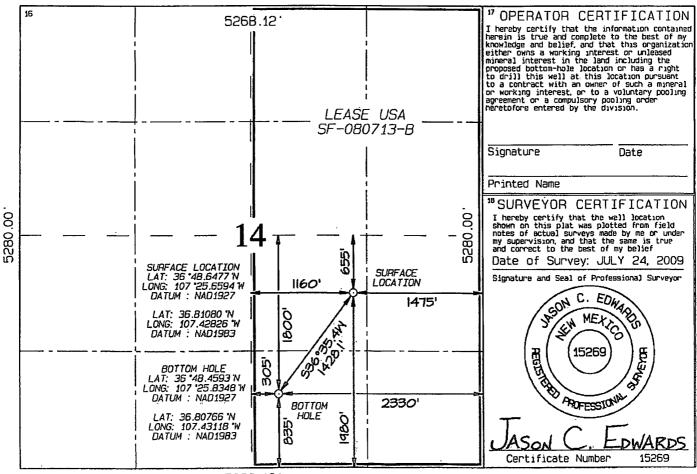

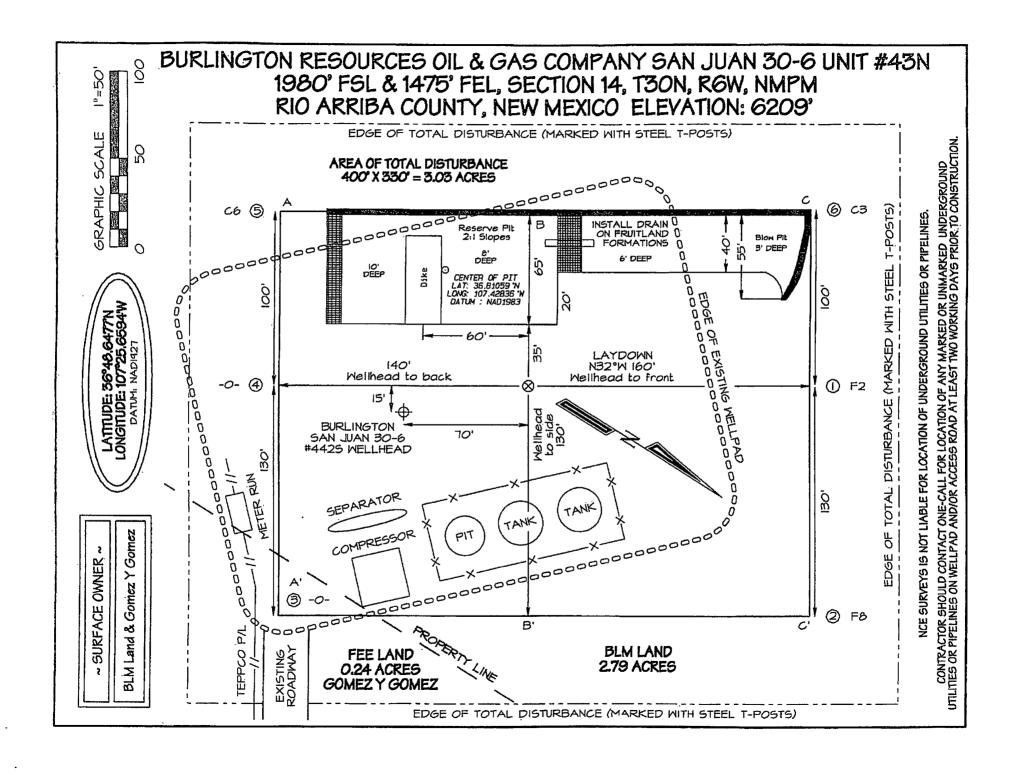



### EPA METHOD 8015 Modified Nonhalogenated Volatile Organics Total Petroleum Hydrocarbons

Client:	ConocoPhillips	Project #:	96052-1706
Sample ID:	Back Ground	Date Reported:	08-15-11
Laboratory Number:	59248	Date Sampled:	08-11-11
Chain of Custody No:	12345	Date Received:	08-11-11
Sample Matrix:	Soil	Date Extracted:	08-12-11
Preservative:	Cool	Date Analyzed:	08-12 <b>-1</b> 1
Condition:	Intact	Analysis Requested:	8015 TPH

Parameter	Concentration (mg/Kg)	Det. Limit (mg/Kg)
Gasoline Range (C5 - C10)	ND	0.2
Diesel Range (C10 - C28)	ND	0.1
Total Petroleum Hydrocarbons	ND -	

ND - Parameter not detected at the stated detection limit.

References:

Method 8015B, Nonhalogenated Volatile Organics, Test Methods for Evaluating Solid

Waste, SW-846, USEPA, December 1996.

Comments:

S.J. 30-6 #43N



### EPA METHOD 8015 Modified Nonhalogenated Volatile Organics Total Petroleum Hydrocarbons

Client:	ConocoPhillips	Project #:	96052-1706
Sample ID:	Reserve Pit	Date Reported:	08-15-11
Laboratory Number:	59249	Date Sampled:	08-11-11
Chain of Custody No:	12345	Date Received:	08-11-11
Sample Matrix:	Soil	Date Extracted:	08-12-11
Preservative:	Cool	Date Analyzed:	08-12-11
Condition:	Intact	Analysis Requested:	8015 TPH

Parameter	Concentration (mg/Kg)	Det. Limit (mg/Kg)
Gasoline Range (C5 - C10)	ND	0.2
Diesel Range (C10 - C28)	2.5	0.1
Total Petroleum Hydrocarbons	2.5	

ND - Parameter not detected at the stated detection limit.

References:

Method 8015B, Nonhalogenated Volatile Organics, Test Methods for Evaluating Solid

Waste, SW-846, USEPA, December 1996.

Comments:

S.J. 30-6 #43N

Arralyst



### **EPA Method 8015 Modified Nonhalogenated Volatile Organics Total Petroleum Hydrocarbons**

### **Quality Assurance Report**

Client:	QA/QC	Project #:	N/A
Sample ID:	08-12-11 QA/QC	Date Reported:	08-13-11
Laboratory Number:	59243	Date Sampled:	N/A
Sample Matrix:	Methylene Chloride	Date Received:	N/A
Preservative:	N/A	Date Analyzed:	08-12-11
Condition:	N/A	Analysis Requested:	TPH

	İ-Çal Date	I-Cal RF:	Ĉ-Cal RF:	% Difference	Accept. Range
Gasoline Range C5 - C10	08/12/11	9.996E+02	1.000E+03	0.04%	0 - 15%
Diesel Range C10 - C28	08/12/11	9.944E+02	9.948E+02	0.04%	0 - 15%

Blank Conc. (mg/L - mg/Kg)	Concentration	Detection Limit
Gasoline Range C5 - C10	1.9	0.2
Diesel Range C10 - C28	2.3	0.1

Duplicate Conc. (mg/Kg)	Sample	Duplicate	% Difference	Range
Gasoline Range C5 - C10	9.3	9.8	5.6%	0 - 30%
Diesel Range C10 - C28	2.7	2.6	0.6%	0 - 30%

Spike Conc. (mg/Kg)	Sample	Spike Added	Spike Result	% Recovery	Accept: Range
Gasoline Range C5 - C10	9.3	250	281	108%	75 - 125%
Diesel Range C10 - C28	2.7	250	251	99.3%	<b>75 - 125%</b>

ND - Parameter not detected at the stated detection limit.

References:

Method 8015B, Nonhalogenated Volatile Organics, Test Methods for Evaluating Solid

SW-846, USEPA, December 1996.

Comments:

QA/QC for Samples 59243-59249



## EPA METHOD 8021 AROMATIC VOLATILE ORGANICS

Client:	ConocoPhillips	Project #:	96052-1706
Sample ID:	Back Ground	Date Reported:	08-15-11
Laboratory Number:	59248	Date Sampled:	08-11-11
Chain of Custody:	12345	Date Received:	08-11-11
Sample Matrix:	Soil	Date Analyzed:	08-12-11
Preservative:	Cool	Date Extracted:	08-12-11
Condition:	Intact	Analysis Requested:	BTEX
		Dilution:	10

Parameter	Concentration (ug/Kg)	Det. Limit (ug/Kg)	
Benzene	ND	0.9	
Toluene	ND	1.0	

loluelle	שא	1.0
Ethylbenzene	ND	1.0
p,m-Xylene	ND	1.2
o-Xylene	ND	0.9
T-4-I DTEV	ND	

Total BTEX ND

ND - Parameter not detected at the stated detection limit.

Surrogate Recoveries:	Parameter	Percent Recovery
	Fluorobenzene	96.6 %
	1,4-difluorobenzene	97.9 %
	Bromochlorobenzene	108 %

References:

Method 5030B, Purge-and-Trap, Test Methods for Evaluating Solid Waste, SW-846, USEPA,

December 1996.

Method 8021B, Aromatic Volatile Organics, Test Methods for Evaluating Solid Waste, SW-846,

USEPA, December 1996.

Comments:

S.J. 30-6 #43N

Analysi



### **EPA METHOD 8021 AROMATIC VOLATILE ORGANICS**

Client:	ConocoPhillips	Project #:	96052-1706
Sample ID:	Reserve Pit	Date Reported:	08-15-11
Laboratory Number:	59249	Date Sampled:	08-11-11
Chain of Custody:	12345	Date Received:	08-11-11
Sample Matrix:	Soil	Date Analyzed:	08-12-11
Preservative:	Cool	Date Extracted:	08-12-11
Condition:	Intact	Analysis Requested:	BTEX
		Dijution:	10

	Diation.	10	
Parameter	Concentration (ug/Kg)	Det. Limit (ug/Kg)	
Damasa		•	
Benzene	ND	0.9	
Toluene	ND	1.0	
Ethylbenzene	ND	1.0	
p,m-Xylene	ND	1.2	
o-Xylene	ND	0.9	
Total BTEX	ND		

ND - Parameter not detected at the stated detection limit.

Surrogate Recoveries:	Parameter	Percent Recovery
	Fluorobenzene	95.2 %
	1,4-difluorobenzene	94.5 %
	Bromochlorobenzene	100 %

References:

Method 5030B, Purge-and-Trap, Test Methods for Evaluating Solid Waste, SW-846, USEPA,

December 1996.

Method 8021B, Aromatic Volatile Organics, Test Methods for Evaluating Solid Waste, SW-846,

USEPA, December 1996.

Comments:

S.J. 30-6 #43N



### EPA METHOD 8021 AROMATIC VOLATILE ORGANICS

Client:	N/A		Project #:		N/A
Sample ID:	0812BBLK QA/QC	;	Date Reported:		08-13-11
Laboratory Number:	59243		Date Sampled:		N/A
Sample Matrix:	Soil		Date Received:		N/A
Preservative:	N/A		Date Analyzed:		08-12-11
Condition:	N/A		Analysis:		BTEX
			Dilution:		10
Calibration and	l-Cal RF.	C-Cal RF:	%Diff.	Blank	Detect.
Detection Limits (ug/L)	ر در دو در	Accept. Ra	nge 0 - 15%	Conc	<u>Limit</u>
Benzene	2.8743E+006	2.8800E+006	0.2%	ND	0.1
Toluene	3.0182E+006	3.0242E+006	0.2%	ND	0.1
Ethylbenzene	2.7567E+006	2.7622E+006	0.2%	ND	0.1
p,m-Xylene	7.3598E+006	7.3745E+006	0.2%	ND	0.1
o-Xylene	2.5254E+006	2.5305E+006	0.2%	ND	0.1

Duplicate Conc. (ug/Kg)	Sample	Duplicate	%Diff,	Accept Range	Detect. Limit
Benzene	1.7	1.3	23.5%	0 - 30%	0.9
Toluene	2.3	2.4	4.3%	0 - 30%	1.0
Ethylbenzene	ND	ND	0.0%	0 - 30%	1.0
p,m-Xylene	ND	ND	0.0%	0 - 30%	1.2
o-Xylenø	ND	ND	0.0%	0 - 30%	0.9

Spike Conc. (ug/Kg)	Sample Amo	unt Spiked Spik	ed Sample %	Recovery	Accept Range
Benzene	1.7	500	480	95.6%	39 - 150
Toluene	2.3	500	480	95.6%	46 - 148
Ethylbenzene	ND	500	477	95.5%	32 - 160
p,m-Xylene	ND	1000	970	97.0%	46 - 148
o-Xylene	ND	500	481	96.3%	46 - 148

ND - Parameter not detected at the stated detection limit.

Dilution: Spike and spiked sample concentration represent a dilution proportional to sample dilution.

References:

Method 5030B, Purge-and-Trap, Test Methods for Evaluating Solid Waste, SW-846, USEPA,

December 1996.

Method 8021B, Aromatic and Halogenated Volatiles by Gas Chromatography Using Photoionization and/or Electrolytic Conductivity Detectors, SW-846, USEPA December 1996.

Comments:

QA/QC for Samples 59225-59226, 59243-59249



## EPA METHOD 418.1 TOTAL PETROLEUM HYDROCARBONS

Client:	ConocoPhillips	Project #:	96052-1706
Sample ID:	Back Ground	Date Reported:	08/13/11
Laboratory Number:	59248	Date Sampled:	08/11/11
Chain of Custody No:	12345	Date Received:	08/11/11
Sample Matrix:	Soil	Date Extracted:	08/12/11
Preservative:	Cool	Date Analyzed:	08/12/11
Condition:	Intact	Analysis Needed:	TPH-418.1

		Det.
	Concentration	Limit
Parameter	(mg/kg)	(mg/kg)

**Total Petroleum Hydrocarbons** 

34.7

5.0

ND = Parameter not detected at the stated detection limit.

References:

Method 418.1, Petroleum Hydrocarbons, Total Recoverable, Chemical Analysis of Water

and Waste, USEPA Storet No. 4551, 1978.

Comments:

S.J. 30-6 #43N



### **EPA METHOD 418.1 TOTAL PETROLEUM HYDROCARBONS**

Client:	ConocoPhillips	Project #:	96052-1706
Sample ID:	Reserve Pit	Date Reported:	08/13/11
Laboratory Number:	59249	Date Sampled:	08/11/11
Chain of Custody No:	12345	Date Received:	08/11/11
Sample Matrix:	Soil	Date Extracted:	08/12/11
Preservative:	Cool	Date Analyzed:	08/12/11
Condition:	Intact	Analysis Needed:	TPH-418.1

		Det.
	Concentration	Limit
Parameter	(mg/kg)	(mg/kg)

**Total Petroleum Hydrocarbons** 

99.2

5.0

ND = Parameter not detected at the stated detection limit.

References:

Method 418.1, Petroleum Hydrocarbons, Total Recoverable, Chemical Analysis of Water

and Waste, USEPA Storet No. 4551, 1978.

Comments:

S.J. 30-6 #43N

Review

Ph (505) 632-0615 Fr (800) 362-1879 Fx (505) 632-1865 lab@envirotech-inc.com envirotech-inc.com



### **EPA METHOD 418.1** TOTAL PETROLEUM HYDROCARBONS QUALITY ASSURANCE REPORT

Client:

QA/QC

Project #:

N/A

Sample ID:

QA/QC

Date Reported:

08/13/11

Laboratory Number:

08-12-TPH.QA/QC 59225 Freon-113

Date Sampled: Date Analyzed: N/A 08/12/11

Sample Matrix: Preservative:

N/A N/A Date Extracted:

08/12/11

Condition:

I-Cal Date

C-Cal Date

I-Cal RF:

C-Cal RF:

Analysis Needed:

% Difference Accept. Range

TPH

Calibration

07/25/11

08/12/11

1,810

1,740

3.9%

+/- 10%

Blank Conc. (mg/Kg)

Concentration

**Détection Limit** 

**TPH** 

7.2

5.0

Duplicate Conc. (mg/Kg)

Sample

Duplicate

% Difference Accept. Range.

**TPH** 

**TPH** 

39.1

36.2

7.4%

+/- 30%

Spike Conc. (mg/Kg)

Sample 39.1

2,000

Spike Added Spike Result % Recovery 1,920

94.2%

Accept Range 80 - 120%

ND = Parameter not detected at the stated detection limit.

References:

Method 418.1, Petroleum Hydrocarbons, Total Recoverable, Chemical Analysis of Water

and Waste, USEPA Storet No. 4551, 1978.

Comments:

QA/QC for Samples 59225-59226, 59246-59249



### Chloride

Client: ConocoPhillips Project #:
Sample ID: Back Ground Date Reported:
Lab ID#: 59248 Date Sampled:
Sample Matrix: Soil Date Received:
Preservative: Cool Date Analyzed:

Intact

Date Sampled: 08/11/11
Date Received: 08/11/11
Date Analyzed: 08/15/11
Chain of Custody: 12345

96052-1706

08/15/11

Parameter

Condition:

Concentration (mg/Kg)

**Total Chloride** 

50

Reference:

U.S.E.P.A., 4500B, "Methods for Chemical Analysis of Water and Wastes", 1983.

Standard Methods For The Examination of Water And Waste Water", 18th ed., 1992.

Comments:

S.J. 30-6 #43N

5796 US Highway 64, Farmington, NM 87401

Review

Ph (505) 632-0615 Fr (800) 362-1879 Fx (505) 632-1865 lab@envirotech-inc.com envirotech-inc.com



### Chloride

Client:

ConocoPhillips

Project #:

96052-1706

Sample ID:

Reserve Pit

Date Reported:

08/15/11

Lab ID#:

59249

Date Sampled:

08/11/11

Sample Matrix:

Soil Cool Date Received:

08/11/11

Preservative: Condition:

Intact

Date Analyzed:

Chain of Custody:

08/15/11

12345

Concentration (mg/Kg)

**Total Chloride** 

**Parameter** 

100

Reference:

U.S.E.P.A., 4500B, "Methods for Chemical Analysis of Water and Wastes", 1983. Standard Methods For The Examination of Water And Waste Water", 18th ed., 1992.

Comments:

S.J. 30-6 #43N

5796 US Highway 64, Farmington, NM 87401

Review

Ph (505) 632-0615 Fr (800) 362-1879 Fx (505) 632-1865 lab@envirotech-inc.com envirotech-inc.com

Submit To Approp Two Copies	riate District	Offic	ce		_		State of No												rm C-105
District I 1625 N French Dr	, Hobbs, NN	и 882	240		Ene	ergy, l	Minerals an	id Na	itural R	esou	urces	1. W	ELL.	A PI	NO	—			July 17, 2008
District II 1301 W Grand Av	enue, Artesi	a, NM	4 88210			Οi	l Conserva	ition	Divici	on		30-03							
District III 1000 Rio Brazos R	d . Aztec, N	M 874	410				20 South S					2 Typ	e of Le		ПБ			ED (ILID	1437
District IV 1220 S St Francis	Dr. Santa F	e NN	√ 87505				Santa Fe, I			71.		3 Stat					_ KI FI	ED/IND	IAN
												SF - 0					L Mode	51790 Pr. 107	
		ET	ION C	RR	RECC	MPL	ETION RE	POI	RT ANI	) L	<u>OG</u>	212 2010	75. 7	1976 F	H 0 - 1/40	· · · · · ·	P-367 20-2	140 - 7	
4 Reason for fil												SAN o					ment Na	ıme	
☐ COMPLET	ION REPO	ORT	`(Fill in b	oxes #	1 throu	ıgh #31	for State and Fe	ee well	s only)			6 Well							
C-144 CLOS #33; attach this a	nd the plat	TAC to th	HMENT e C-144 c	(Fill losure	in boxe report	s #1 thr	ough #9, #15 D rdance with 19.	ate Rig 15.17	g Released 13 K NM <i>A</i>	and i	#32 and/o	43N							
7. Type of Comp		l wo	ORKOVE	RП	DEEPE	ENING	□PLUGBAC	к 🗆	DIFFERE	NT R	RESERVO	IR □ OT	HER						
8 Name of Oper	ator											9 OGF							
Burlington R		s Oi	il Gas	Com	pany,	LP						14538	l name	or W	ildeat				
PO Box 4298, Fa		NM 8	87499											0. 11	macat				
12.Location	Unit Ltr	;	Section		Towns	hip	Range	Lot		Feet from the		N/S Lin	ne	Feet	from	the	E/W L	ine	County
Surface:		1						ļ				ļ					<u> </u>		
BH:	t I 14 Do	to T I	D. Reache		115 0	Note Die	Released		16	Date	- Commiss	-d (Daader)	to Dead				Planet	one (DE	and DVD
13. Date Spudded	14. Da	16 1 1	D. Reacin	eu	5/27/		, Released		10	Date	e Compieu	ed (Ready 1	io Prod	uce	,		Elevati Γ, GR, et		and RKB,
18 Total Measur	ed Depth o	of We	ell		19. F	Plug Bac	k Measured De	pth	20	. Wa	s Directio	nal Survey	Made?	I	21	Гуре	Electric	c and Ot	her Logs Run
22. Producing Int	terval(s), of	fthis	complete	on - T	op, Bot	tom, Na	nne												
23.						CAS	ING REC	OR	D (Rep	ort	all strii	ngs set	in we	ell)					
CASING SI	ZE	v	VEIGHT	LB./F	Т		DEPTH SET		Н	OLE S	SIZE	CEME	ENTIN	GRE	CORD	<u>-</u>	AM	10UNT	PULLED
									<del></del>			+			-	+			
																$\vdash$			
																工			
24						LINI	ED DECORD					<u>_</u>	T	unn	NG RI		<u></u>		
SIZE	TOP	•		BOT	ТОМ	LIINI	ER RECORD SACKS CEM	1ENT	SCREE	N	2   S	IZE			EPTH S			PACKE	ER SET
26. Perforation	roomd (in	terno	1 cuza an	d num	har)				27. 40	un (	SHOT F	DACTUR	r or	MEN	IT CC	NI III	TEZE I	TTC	
20. Perioration	record (iii	iciva	i, size, aii	u mum	ibei)				DEPTH			RACTUR AMOU					EEZE, E FERIAL		
20				<del></del>				DDA	DDUC	TIC	) NI								
28. Date First Produc	ction		Pro	ductio	on Metl	nod (Flo	wing, gas lift, p					Well	Status	(Prod	d or Si	hut-i:	<u>n)</u>		
								-	-										
Date of Test	Hours	Teste	ed	Chol	ke Size		Prod'n For Test Period		Oıl - Bb	1	0	as - MCF		w 	ater - E	3bl.	_	Gas - O	nl Ratio
Flow Tubing	Casing	Pres	sure	Calc	ulated 2	 24 <b>-</b>	Oıl - Bbl.		Gas	- MC	L CF	Water - E	Bbl.		Oil	Grav	ity - AP	PI - (Cori	·.)
Press					r Rate												•		
29 Disposition o	,	l, use	ed for fuel,	, vente	ed, etc )									30. 1	est W	itnes:	ssed By		
31 List Attachmo																			
32 If a temporary	•				•			•	٠.										
33 If an on-site b	ourial was t									1027	<u></u>					_			
I hereby certij	fy that th	e in	Latitude . formatio	36.810 20 sh	own a	n both	gitude 107.4283 I sides of this	s forn	naD □	1927 and	complet	e to the b	best of	f my	know	led	ge and	l belief	•
Signature (		ر سال	$\cap$	do		Prin									: 8/24			J	
E-mail Addre		.l.gc		-		nillips.	com												

# ConocoPhillips

Pit Closure Form:	
Date: 9/19/20/1	
Well Name: <u>\$5 30-6</u> 43N	<del></del>
Footages:	Unit Letter:
Section: <u>/</u> //, T- <u>30</u> -N, R- <u>6</u> -W, County: <u>/</u>	₹A. State: <u>NM</u>
Contractor Closing Pit: Ritter	
Construction Inspector: <u>Norman Faver</u> Inspector Signature: <u>Illuman Jave</u>	Date: <u>9/19/201</u> /
Revised 11/4/10 Office Use Only: Subtask DSM Folder	

### Goodwin, Jamie L

From: Sent:

Payne, Wendy F

Wednesday. September 07, 2011 9.57 AM

To:

(Brandon Powell@state.nm.us); GRP:SJBU Regulatory; Blair, Maxwell O; Blakley, Mac; Farrell, Juanita R; Gillette, Steven L (PAC); Maxwell, Mary Alice; McWilliams, Peggy L; Saiz. Kooper (Finney Land Co.); Seabolt, Elmo F; Thayer, Ashley A; Thompson, Trey E (Finney

Land Co.); Eli (Cimarron) (eliv@qwestoffice.net); James (Cimarron)

(jwood@cimarronsvc.com); Mark Kelly; Randy McKee; Robert Switzer; Sherrie Landon; Bassing, Kendal R.; Berenz (mxberenz@yahoo.com); Chavez Darrell (dchavez0330

@yahoo.com); Crawford, Lea A; Elmer Perry; Faver Norman; Fred Martinez; Jared Chavez; Lowe, Terry; McDonald Johnny (jr\_mcdonald@msn.com); Payne, Wendy F; Smith, Mike W; Spearman, Bobby E; Steve McGlasson; Tally, Ethel; Becker, Joey W; Bowker, Terry D; Frost, Ryan M; Goosey, Paul P; Gordon Chenault; Green, Cary J, GRP:SJBU Production Leads; Hockett, Christy R; Johnson, Kirk L; Bassing, Kendal R.; Kennedy, Jim R; Lopez, Richard A; Nelson, Garry D; O'Nan, Mike J.; Peace, James T; Pierce, Richard M; Poulson, Mark E; Schaaphok, Bill; Smith, Randall O; Souther, Tappan G; Spearman, Bobby E; Stamets, Steve A: Thacker, LARRY, Thibodeaux, Gordon A; Work, Jim A; Corey Alfandre, 'isaiah@crossfire-

llc.com'; Jerid Cabot (jerid@crossfire-llc.com)

Cc:

'idritt@aol.com'

Subject:

Reclamation Notice: San Juan 30-6 Unit 43N (Area 8 \* Run 806)

Importance:

High

Attachments:

San Juan 30-6 Unit 43N.pdf

JD Ritter Construction will move a tractor to the San Juan 30-6 Unit 43N to start the reclamation process on Monday, September 12, 2011. Please contact Norm Faver (320-0670) if you have guestions or need further assistance.



San Juan 30-6 Unit 43N.pdf (18...

Burlington Resources Well - Network # 10302721 - Activity Code D250 (reclamation) & D260 (pit closure) - PO: Kaitlw Rio Arriba County, NM

### San Juan 30-6 Unit 43N - Fee & BLM surface/BLM minerals

Onsite: Mike Flaniken 3-10-09

Twin: San Juan 30-6 Unit 442S (existing)

1980' FSL, 1475' FEL - Sec.14, T30N,R6W Unit Letter " J " Lease # SF-080713-B

BH: SWSE, Sec. 14, T30N, R6W Latitude: 36° 48' 39" N (NAD 83) Longitude: 107° 25' 42" W (NAD 83)

Elevation: 6209

Total Acres Disturbed: 3.03 acres

Access Road: n/a API # 30-039-30958 Within City Limits: NO


Pit Lined: YES


Wendy Payne -ConocoPhillips-SJBU 505-326-9533


## ConocoPhillips

Reclamation Form:	•
Date: 11-30-201	7.
Well Name: <u>\$3</u> 30	D-6 H3N
Footages: 1980 FSL	. 1475 FEL Unit Letter: 3
Section: 14 , T-30	-N, R- <u>6</u> -W, County: <u>RA</u> State: <u>MM</u>
Reclamation Contractor:	Riffer
Reclamation Date:	9-29-2011
Road Completion Date:	11-4-2011
Seeding Date:	11-4-2011
MARKER PLACED :  LATATUDE:  LONGITUDE:	(When Required): Picture of Marker set needed 9-30-2011 (DATE)
MARKER PLACED :  LATATUDE:  LONGITUDE:  Pit Manifold removed	9-30-2011 (DATE)
MARKER PLACED :  LATATUDE:  LONGITUDE:  Pit Manifold removed  Construction Inspector:	9-30-2011 (DATE)  19-2011 (DATE)  Norman Faver Date: 11-30-2011
MARKER PLACED :  LATATUDE:  LONGITUDE:  Pit Manifold removed  Construction Inspector:	9-30-2011 (DATE)



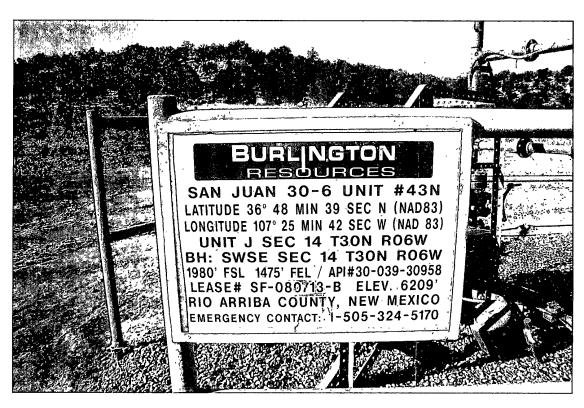

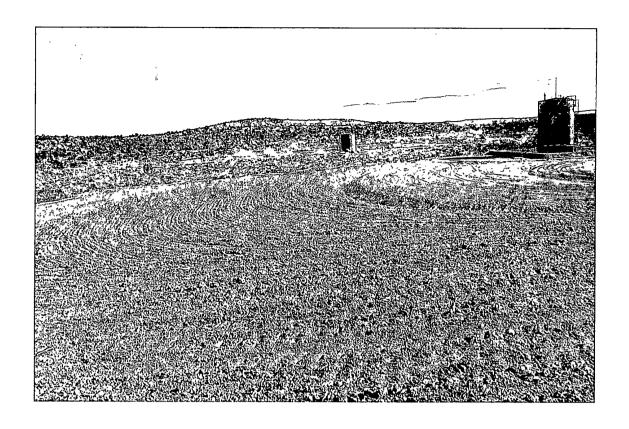

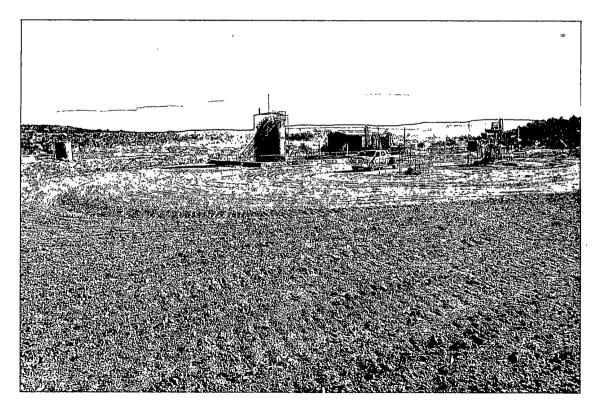

### **WELL NAME: OPEN PIT INSPECTION FORM** ConocoPhillips San Juan 30-6 Unit 43N INSPECTOR Fred Mtz F.MTZ Fred Mtz DATE 05/05/11 05/12/11 05/19/11 05/26/11 06/01/11 06/09/11 06/16/11 06/23/11 611/30/ Week 1 Week 2 Week 3 Week 4 Week 5 Week 6 Week 7 Week 8 Week 9 \*Please request for pit extention after 26 weeks ☐ Drilled Drilled ☐ Drilled ☐ Drilled ☐ Drilled ☐ Drilled ☑ Drilled Drilled ☐ Drilled Completed Completed Completed Completed Completed Completed Completed Completed Completed PIT STATUS Clean-Lin Clean-Up Clean-Lin Clean-Up Clean-Up Clean-Up Clean-Un Clean-Un Clean-Un Is the location marked with the proper flagging? ✓ Yes ☐ No ☐ Yes ☐ No. Yes No Yes No ☑ Yes ☐ No Yes No ☑ Yes ☐ No ☐ Yes ☐ No. Yes No (Const. Zone, poles, pipelines, etc.) Is the temporary well sign on location and visible ✓ Yes ☐ No ☐ Yes ☐ No Yes No Yes No ✓ Yes ☐ No ☐ Yes ☐ No ✓ Yes 🗌 No Yes No Yes No from access road? Is the access road in good driving condition? ✓ Yes No ☐ Yes ☐ No Yes No Yes No ☑ Yes ☐ No ☐ Yes ☐ No ☑ Yes ☐ No Yes No Yes 🗌 No (deep ruts, bladed) Are the culverts free from debris or any object ✓ Yes 🗌 No Yes No Yes No Yes No ✓ Yes ☐ No Yes No ✓ Yes □ No Yes No Yes No preventing flow? is the top of the location bladed and in good ☑ Yes ☐ No ☐ Yes ☐ No ☐ Yes ☐ No Yes No ☐ Yes ☑ No ☐ Yes ☐ No ☑ Yes ☐ No ✓ Yes □ No ☐ Yes ☐ No operating condition? Is the fence stock-proof? (fences tight, barbed ☐ Yes 🗸 No Yes No Yes No ☐ Yes ☐ No. ✓ Yes ☐ No ☐ Yes ☐ No Yes V No Yes No Yes No wire, fence clips in place? Is the pit liner in good operating condition? (no ✓ Yes 🗌 No Yes No ☐ Yes ☐ No ☐ Yes ☐ No ☑ Yes ☐ No Yes No ✓ Yes 🗌 No ☐ Yes ☐ No. Yes No tears, up-rooting corners, etc.) Is the the location free from trash, oil stains and ☐ Yes ☐ No. ✓ Yes No ✓ Yes ☐ No. ☐ Yes ☐ No. ☐ Yes ☐ No. ☑ Yes ☐ No ☐ Yes ☐ No ☐ Yes ☐ No. Yes No other materials? (cables, pipe threads, etc.) ENVIRONMENTAL Does the pit contain two feet of free board? (check ☑ Yes ☐ No ☐ Yes ☐ No ☐ Yes ☐ No Yes No ✓ Yes 🗆 No ☐ Yes ☐ No ✓ Yes ☐ No ☐ Yes ☐ No Yes No the water levels) Is there any standing water on the blow pit? ✓ Yes ☐ No ☐ Yes ☐ No ☐ Yes ☐ No Yes No Yes No ☑ Yes ☐ No ✓ Yes ☐ No Yes No Yes No Are the pits free of trash and oil? ☑ Yes ☐ No Yes No Yes No Yes No ✓ Yes ☐ No Yes No ✓ Yes ✓ No ☐ Yes ☐ No Yes No Are there diversion ditches around the pits for ☑ Yes ☐ No ☐ Yes ☐ No Yes No Yes No ☐ Yes ☑ No Yes No ✓ Yes 🗌 No Yes No ☐ Yes ☐ No natural drainage? Is there a Manifold on location? Yes V No Yes No Yes No Yes No ✓ Yes ☐ No Yes No ✓ Yes 🗌 No Yes No ☐ Yes ☐ No is the Manifold free of leaks? Are the hoses in ✓ Yes 🗌 No Yes No Yes No Yes No ✓ Yes ☐ No Yes No ✓ Yes 🗌 No Yes No Yes No good condition? △ Was the OCD contacted? Yes 🛂 No ☐ Yes ☐ No ☐ Yes ☐ No Yes No ☐ Yes ☑ No ☐ Yes ☐ No ☐ Yes 🗸 No Yes No Yes No ☐ Yes 🗸 No Yes No ☐ Yes ☐ No ☐ Yes ☐ No Yes No PICTURE TAKEN Yes 🗹 No Yes 🗹 No Yes No Yes No COMMENTS Fence is down Contact Flint To because rig is Aztec ng 730 ng Aztec ng 730 rig KEY RIG ON Aztec rig on No repairs, no Swabbing Rig on Fix fence and King rig on noving on on location. location on location. diversion ditches ocation debre in pit LOCATION ocation

**WELL NAME:** San Juan 30-6 Unit 43N INSPECTOR F.MTZ F.MTZ Fred Mtz F.MTZ F.MTZ DATE 07/14/11 07/21/11 07/28/11 08/11/11 08/26/11 Week 10 Week 12 Week 13 Week 14 \*Please request for pit extention after 26 weeks Week 11 Week 15 Week 16 Week 17 Week 18 Drilled Drilled Drilled ✓ Drilled ✓ Drilled ☐ Drilled Drilled Drilled Drilled Completed Completed Completed ☐ Completed Completed Completed Completed Completed Completed PIT STATUS Clean-Up Clean-Lin Clean-Up Clean-Lin Clean-Up Clean-Lin Clean-Lin Clean-Up Clean-Lin Is the location marked with the proper flagging? ☐ Yes ☐ No ☐ Yes ☐ No ☐ Yes ☐ No ☑ Yes ☐ No ☑ Yes ☐ No ☐ Yes ☐ No Yes No Yes No Yes No (Const. Zone, poles, pipelines, etc.) Is the temporary well sign on location and visible Yes No ☐ Yes ☐ No ☐ Yes ☐ No ☑ Yes ☐ No ✓ Yes ☐ No Yes No ☐ Yes ☐ No Yes No Yes No from access road? Is the access road in good driving condition? Yes No ☐ Yes ☐ No Yes No ☑ Yes ☐ No ✓ Yes ☐ No ☐ Yes ☐ No ☐ Yes ☐ No Yes No Yes No (deep ruts, bladed) Are the culverts free from debris or any object ☐ Yes ☐ No ☐ Yes ☐ No Yes No ☑ Yes ☐ No ✓ Yes ☐ No ☐ Yes ☐ No Yes No ☐ Yes ☐ No Yes No preventing flow? Is the top of the location bladed and in good Yes No Yes No Yes No ☑ Yes ☐ No ✓ Yes 🗌 No Yes No Yes No Yes No Yes No operating condition? Is the fence stock-proof? (fences tight, barbed ☐ Yes ☐ No Yes No Yes No ☑ Yes ☐ No ✓ Yes 🗌 No ☐ Yes ☐ No Yes No Yes No ☐ Yes ☐ No wire, fence clips in place? Is the pit liner in good operating condition? (no Yes No ☐ Yes ☐ No ☐ Yes ☐ No ✓ Yes 🗌 No ☑ Yes ☐ No ☐ Yes ☐ No ☐ Yes ☐ No ☐ Yes ☐ No ☐ Yes ☐ No tears, up-rooting corners, etc.) is the the location free from trash, oil stains and Yes No Yes No Yes No ☑ Yes ☐ No ✓ Yes No ☐ Yes ☐ No ☐ Yes ☐ No ☐ Yes ☐ No Yes No other materials? (cables, pipe threads, etc.) Does the pit contain two feet of free board? (check Yes No Yes No Yes No ✓ Yes No ✓ Yes 🗌 No Yes No Yes No Yes No ☐ Yes ☐ No the water levels) Is there any standing water on the blow pit? ☐ Yes ☐ No. ☐ Yes ☐ No. Yes No Yes No ☐ Yes ☐ No ✓ Yes ☐ No ☑ Yes ☐ No ☐ Yes ☐ No Yes No Are the pits free of trash and oil? Yes No ✓ Yes ☐ No ☐ Yes ☐ No Yes No ✓ Yes ☐ No ☐ Yes ☐ No ☐ Yes ☐ No Yes No ☐ Yes ☐ No Are there diversion ditches around the pits for Yes No Yes No Yes No ✓ Yes 🗌 No ✓ Yes 🗌 No Yes No Yes No Yes No Yes No natural drainage? is there a Manifold on location? Yes No Yes No Yes No ☑ Yes ☐ No Yes No Yes No Yes No ☑ Yes ☐ No ☐ Yes ☐ No Is the Manifold free of leaks? Are the hoses in Yes No ☐ Yes ☐ No Yes No ✓ Yes ☐ No ✓ Yes □ No Yes No Yes No Yes No Yes No good condition? ⋈ ⇔ Was the OCD contacted? Yes No ☐ Yes ☐ No ☐ Yes ☐ No Yes V No ☐ Yes ☑ No Yes No ☐ Yes ☐ No Yes No Yes No Yes No Yes No Yes No Yes 🛂 No Yes 🗸 No Yes No Yes No Yes No Yes No PICTURE TAKEN COMMENTS No repairs welder on location no RIG ON LOC' KEY RIG ON LOC RIG ON LOC NO REPAIRS crew