Form C-144 July 21, 2008

<u>District I</u> 1625 N. French Dr., Hobbs, NM 88240 District II
1301 W Grand Avenue, Artesia, NM 88210
District III 1000 Rio Brazos Road, Aztec, NM 87410 District IV 1220 S St. Francis Dr , Santa Fe, NM 87505

Alternative Method:

State of New Mexico Energy Minerals and Natural Resources Department Oil Conservation Division 1220 South St. Francis Dr. Santa Fe, NM 87505

For temporary pits, closed-loop systems, and below-grade tanks, submit to the appropriate NMOCD District Office.

For permanent pits and exceptions submit to the Santa Fe Environmental Bureau office and provide a copy to the appropriate NMOCD District Office.

Submittal of an exception request is required. Exceptions must be submitted to the Santa Fe Environmental Bureau office for consideration of approval.


Page 1 of 9 Rosa Unit 380

Fencing: Subsection D of 19 15 17 11 NMAC (Applies to permanent pits, temporary pits, and below-grade tanks)	
Chain link, six feet in height, two strands of barbed wire at top (Required if located within 1000 feet of a permanent residence, school, institution or church)	hospital,
Four foot height, four strands of barbed wire evenly spaced between one and four feet	
☐ Alternate Please specify As per BLM specifications	
7	
Netting: Subsection E of 19 15 17 11 NMAC (Applies to permanent pits and permanent open top tanks)	
Screen Netting Other	
Monthly inspections (If netting or screening is not physically feasible)	
8 Signs: Subsection C of 19 15 17 11 NMAC	
☐ 12"x 24", 2" lettering, providing Operator's name, site location, and emergency telephone numbers	
✓ Signed in compliance with 19.15 3 103 NMAC	
Za signed in compinance with 19-19-9-103 MW/Ne	
9 Administrative Approvals and Exceptions:	
Justifications and/or demonstrations of equivalency are required Please refer to 19 15 17 NMAC for guidance	
Please check a box if one or more of the following is requested, if not leave blank:  Administrative approval(s) Requests must be submitted to the appropriate division district or the Santa Fe Environmental Bureau of the Santa Fe Env	office for
consideration of approval	
Exception(s) Requests must be submitted to the Santa Fe Environmental Bureau office for consideration of approval	
Siting Criteria (regarding permitting): 19 15 17 10 NMAC Instructions: The applicant must demonstrate compliance for each siting criteria below in the application. Recommendations of accept material are provided below. Requests regarding changes to certain siting criteria may require administrative approval from the appropriate or may be considered an exception which must be submitted to the Santa Fe Environmental Bureau office for consideration of a Applicant must attach justification for request. Please refer to 19.15.17.10 NMAC for guidance. Siting criteria does not apply to drying the same of th	priate district pproval.
above-grade tanks associated with a closed-loop system.	
Ground water is less than 50 feet below the bottom of the temporary pit, permanent pit, or below-grade tank.  - NM Office of the State Engineer - iWATERS database search, USGS, Data obtained from nearby wells	☐ Yes ☑ No
Within 300 feet of a continuously flowing watercourse, or 200 feet of any other significant watercourse or lakebed, sinkhole, or playa lake (measured from the ordinary high-water mark)	☐ Yes ☑ No
- Topographic map; Visual inspection (certification) of the proposed site	
Within 300 feet from a permanent residence, school, hospital, institution, or church in existence at the time of initial application (Applies to temporary, emergency, or cavitation pits and below-grade tanks)  - Visual inspection (certification) of the proposed site, Aerial photo, Satellite image	☐ Yes ☑ No ☐ NA
Within 1000 feet from a permanent residence, school, hospital, institution, or church in existence at the time of initial application	Yes No
(Applies to permanent pits)  - Visual inspection (certification) of the proposed site, Aerial photo, Satellite image	⊠ NA
Within 500 horizontal feet of a private, domestic fresh water well or spring that less than five households use for domestic or stock	☐ Yes ☑ No
watering purposes, or within 1000 horizontal feet of any other fresh water well or spring, in existence at the time of initial application  - NM Office of the State Engineer - iWATERS database search, Visual inspection (certification) of the proposed site	
Within incorporated municipal boundaries or within a defined municipal fresh water well field covered under a municipal ordinance adopted pursuant to NMSA 1978, Section 3-27-3, as amended	☐ Yes ⊠ No
- Written confirmation or verification from the municipality, Written approval obtained from the municipality	
Within 500 feet of a wetland - US Fish and Wildlife Wetland Identification map, Topographic map, Visual inspection (certification) of the proposed site	☐ Yes ⊠ No
Within the area overlying a subsurface mine  Written confirmation or verification or map from the NM EMNRD-Mining and Mineral Division	☐ Yes ⊠ No
<ul> <li>Within an unstable area</li> <li>Engineering measures incorporated into the design, NM Bureau of Geology &amp; Mineral Resources, USGS, NM Geological Society, Topographic map</li> </ul>	☐ Yes ☑ No
Within a 100-year floodplain - FEMA map	☐ Yes ⊠ No

Temporary Pits, Emergency Pits, and Below-grade Tanks Permit Application Attachment Checklist: Subsection B of 19.15.17.9 NMAC
Instructions: Each of the following items must be attached to the application. Please indicate, by a check mark in the box, that the documents are attached.    Hydrogeologic Report (Below-grade Tanks) - based upon the requirements of Paragraph (4) of Subsection B of 19.15.17.9 NMAC     Hydrogeologic Data (Temporary and Emergency Pits) - based upon the requirements of Paragraph (2) of Subsection B of 19.15.17.9 NMAC     Siting Criteria Compliance Demonstrations - based upon the appropriate requirements of 19.15.17.10 NMAC     Design Plan - based upon the appropriate requirements of 19.15.17.11 NMAC     Operating and Maintenance Plan - based upon the appropriate requirements of 19.15.17.12 NMAC     Closure Plan (Please complete Boxes 14 through 18, if applicable) - based upon the appropriate requirements of Subsection C of 19.15.17.9 NMAC and 19.15.17.13 NMAC
Previously Approved Design (attach copy of design) API Number: or Permit Number:
Closed-loop Systems Permit Application Attachment Checklist: Subsection B of 19.15.17.9 NMAC  Instructions: Each of the following items must be attached to the application. Please indicate, by a check mark in the box, that the documents are attached.  Geologic and Hydrogeologic Data (only for on-site closure) - based upon the requirements of Paragraph (3) of Subsection B of 19.15.17.9 Siting Criteria Compliance Demonstrations (only for on-site closure) - based upon the appropriate requirements of 19.15.17.10 NMAC Design Plan - based upon the appropriate requirements of 19.15.17.11 NMAC Glosure Plan (Please complete Boxes 14 through 18, if applicable) - based upon the appropriate requirements of Subsection C of 19.15 17.9 NMAC and 19.15.17.13 NMAC  Previously Approved Design (attach copy of design) API Number:  Previously Approved Operating and Maintenance Plan API Number:  API Number:  (Applies only to closed-loop system that use above ground steel tanks or haul-off bins and propose to implement waste removal for closure)
Permanent Pits Permit Application Checklist: Subsection B of 19.15.17.9 NMAC  Instructions: Each of the following items must be attached to the application. Please indicate, by a check mark in the box, that the documents are attached.    Hydrogeologic Report - based upon the requirements of Paragraph (1) of Subsection B of 19.15.17.9 NMAC   Siting Criteria Compliance Demonstrations - based upon the appropriate requirements of 19.15.17.10 NMAC   Climatological Factors Assessment   Certified Engineering Design Plans - based upon the appropriate requirements of 19.15.17.11 NMAC   Dike Protection and Structural Integrity Design - based upon the appropriate requirements of 19.15.17.11 NMAC   Leak Detection Design - based upon the appropriate requirements of 19.15.17.11 NMAC   Quality Control/Quality Assurance Construction and Installation Plan   Operating and Maintenance Plan - based upon the appropriate requirements of 19.15.17.12 NMAC   Freeboard and Overtopping Prevention Plan - based upon the appropriate requirements of 19.15.17.11 NMAC   Nuisance or Hazardous Odors, including H <sub>2</sub> S, Prevention Plan   Emergency Response Plan   Oil Field Waste Stream Characterization   Monitoring and Inspection Plan   Erosion Control Plan   Closure Plan - based upon the appropriate requirements of Subsection C of 19.15.17.9 NMAC and 19.15.17.13 NMAC
Proposed Closure: 19.15.17.13 NMAC Instructions: Please complete the applicable boxes, Boxes 14 through 18, in regards to the proposed closure plan.
Type: Drilling Workover Emergency Cavitation P&A Permanent Pit Below-grade Tank Closed-loop System Alternative Proposed Closure Method: Waste Excavation and Removal Waste Removal (Closed-loop systems only) On-site Closure Method (Only for temporary pits and closed-loop systems) In-place Burial On-site Trench Burial Alternative Closure Method (Exceptions must be submitted to the Santa Fe Environmental Bureau for consideration)
Waste Excavation and Removal Closure Plan Checklist: (19.15.17.13 NMAC) Instructions: Each of the following items must be attached to the closure plan. Please indicate, by a check mark in the box, that the documents are attached.  Protocols and Procedures - based upon the appropriate requirements of 19.15.17.13 NMAC  Confirmation Sampling Plan (if applicable) - based upon the appropriate requirements of Subsection F of 19.15.17.13 NMAC  Disposal Facility Name and Permit Number (for liquids, drilling fluids and drill cuttings)  Soil Backfill and Cover Design Specifications - based upon the appropriate requirements of Subsection H of 19.15.17.13 NMAC  Re-vegetation Plan - based upon the appropriate requirements of Subsection G of 19.15.17.13 NMAC

Waste Removal Closure For Closed-loop Systems That Utilize Above Ground Instructions: Please indentify the facility or facilities for the disposal of liquids, facilities are required.		
Disposal Facility Name:	Disposal Facility Permit Number:	
Disposal Facility Name:	Disposal Facility Permit Number:	
Will any of the proposed closed-loop system operations and associated activities of ☐ Yes (If yes, please provide the information below) ☐ No	·	vice and operations?
Required for impacted areas which will not be used for future service and operatio  Soil Backfill and Cover Design Specifications based upon the appropriate Re-vegetation Plan - based upon the appropriate requirements of Subsection Site Reclamation Plan - based upon the appropriate requirements of Subsect	e requirements of Subsection H of 19.15.17 13 NMAC L of 19.15.17.13 NMAC	C
17. Siting Criteria (regarding on-site closure methods only): 19.15.17.10 NMAC Instructions: Each siting criteria requires a demonstration of compliance in the provided below. Requests regarding changes to certain siting criteria may require considered an exception which must be submitted to the Santa Fe Environmenta demonstrations of equivalency are required. Please refer to 19.15.17.10 NMAC.	e administrative approval from the appropriate disti I Bureau office for consideration of approval. Justi	rict office or may be
Ground water is less than 50 feet below the bottom of the buried waste.  - NM Office of the State Engineer - iWATERS database search; USGS; Dat	a obtained from nearby wells	☐ Yes ☑ No ☐ NA
Ground water is between 50 and 100 feet below the bottom of the buried waste - NM Office of the State Engineer - iWATERS database search; USGS; Dat	a obtained from nearby wells	☐ Yes ⊠ No ☐ NA
Ground water is more than 100 feet below the bottom of the buried waste - NM Office of the State Engineer - iWATERS database search; USGS; Dat	a obtained from nearby wells	⊠ Yes □ No □ NA
Within 300 feet of a continuously flowing watercourse, or 200 feet of any other sig lake (measured from the ordinary high-water mark).  - Topographic map; Visual inspection (certification) of the proposed site	nificant watercourse or lakebed, sinkhole, or playa	☐ Ycs ☒ No
Within 300 feet from a permanent residence, school, hospital, institution, or church  - Visual inspection (certification) of the proposed site; Aerial photo; Satellite		☐ Yes ⊠ No
Within 500 horizontal feet of a private, domestic fresh water well or spring that les watering purposes, or within 1000 horizontal feet of any other fresh water well or so. NM Office of the State Engineer - iWATERS database; Visual inspection of	pring, in existence at the time of initial application.	☐ Yes ⊠ No
Within incorporated municipal boundaries or within a defined municipal fresh water adopted pursuant to NMSA 1978, Section 3-27-3, as amended.  - Written confirmation or verification from the municipality; Written approv	•	☐ Yes ⊠ No
Within 500 feet of a wetland.  - US Fish and Wildlife Wetland Identification map; Topographic map; Visu	al inspection (certification) of the proposed site	Yes      No
Within the area overlying a subsurface mine.  Written confirmation or verification or map from the NM EMNRD-Mining	g and Mineral Division	☐ Yes ☒ No
Within an unstable area.  - Engineering measures incorporated into the design; NM Bureau of Geolog Society; Topographic map	y & Mineral Resources; USGS; NM Geological	☐ Yes ☑ No
Within a 100-year floodplain FEMA map		☐ Yes ⊠ No
On-Site Closure Plan Checklist: (19.15.17 13 NMAC) Instructions: Each of the by a check mark in the box, that the documents are attached.  Siting Criteria Compliance Demonstrations - based upon the appropriate requirements of Construction/Design Plan of Burial Trench (if applicable) based upon the appropriate requirements of Construction/Design Plan of Temporary Pit (for in-place burial of a drying protocols and Procedures - based upon the appropriate requirements of 19.1.  Confirmation Sampling Plan (if applicable) - based upon the appropriate requirements of Disposal Facility Name and Permit Number (for liquids, drilling fluids and Soil Cover Design - based upon the appropriate requirements of Subsection Re-vegetation Plan - based upon the appropriate requirements of Subsection Site Reclamation Plan - based upon the appropriate requirements of Subsection	uirements of 19.15.17.10 NMAC f Subsection F of 19.15.17.13 NMAC propriate requirements of 19.15.17.11 NMAC pad) - based upon the appropriate requirements of 19. 5.17.13 NMAC uirements of Subsection F of 19.15.17.13 NMAC Subsection F of 19.15.17.13 NMAC Irill cuttings or in case on-site closure standards cann H of 19.15.17.13 NMAC I of 19.15.17.13 NMAC	15.17.11 NMAC

10
Operator Application Certification:  I hereby certify that the information submitted with this application is true, accurate and complete to the best of my knowledge and belief
Name (Print) Ben Mitchell Title Regulatory Specialist
Signature Date
e-mail address ben mitchell@wpxenergy com Telephone 505-333-1806
OCD Approval: Permit Application (including closure plan) A Closure Plan (only) OCD Conditions (see attachment)  OCD Representative Signature:  Approval Date: OCD Permit Number:
Title: OCD Permit Number:
Closure Report (required within 60 days of closure completion): Subsection K of 19.15 17 13 NMAC Instructions: Operators are required to obtain an approved closure plan prior to implementing any closure activities and submitting the closure report. The closure report is required to be submitted to the division within 60 days of the completion of the closure activities. Please do not complete this section of the form until an approved closure plan has been obtained and the closure activities have been completed.
☐ Closure Completion Date:9/7/12
Closure Method:  Waste Excavation and Removal On-Site Closure Method Alternative Closure Method Waste Removal (Closed-loop systems only)  If different from approved plan, please explain
Closure Report Regarding Waste Removal Closure For Closed-loop Systems That Utilize Above Ground Steel Tanks or Haul-off Bins Only: Instructions: Please indentify the facility or facilities for where the liquids, drilling fluids and drill cuttings were disposed. Use attachment if more than two facilities were utilized.
Disposal Facility Name Disposal Facility Permit Number
Disposal Facility Name Disposal Facility Permit Number
Were the closed-loop system operations and associated activities performed on or in areas that will not be used for future service and operations?  Yes (If yes, please demonstrate compliance to the items below)  No
Required for impacted areas which will not be used for future service and operations  Site Reclamation (Photo Documentation) Soil Backfilling and Cover Installation Re-vegetation Application Rates and Seeding Technique
Closure Report Attachment Checklist: _Instructions: Each of the following items must be attached to the closure report. Please indicate, by a check mark in the box, that the documents are attached.  Proof of Closure Notice (surface owner and division) Proof of Deed Notice (required for on-site closure) Plot Plan (for on-site closures and temporary pits) Confirmation Sampling Analytical Results (if applicable) Waste Material Sampling Analytical Results (required for on-site closure) Disposal Facility Name and Permit Number Soil Backfilling and Cover Installation Re-vegetation Application Rates and Seeding Technique Site Reclamation (Photo Documentation) On-site Closure Location Latitude 36 88499N Longitude107,28476W NAD
Operator Closure Certification:
I hereby certify that the information submitted with this application is true, accurate and complete to the best of my knowledge and belief
Name (Print) Ben Mitchell Title. Regulatory Specialist
Signature: Date
e-mail addressben mitchell@wpxenergy.com Telephone:505-333-1806

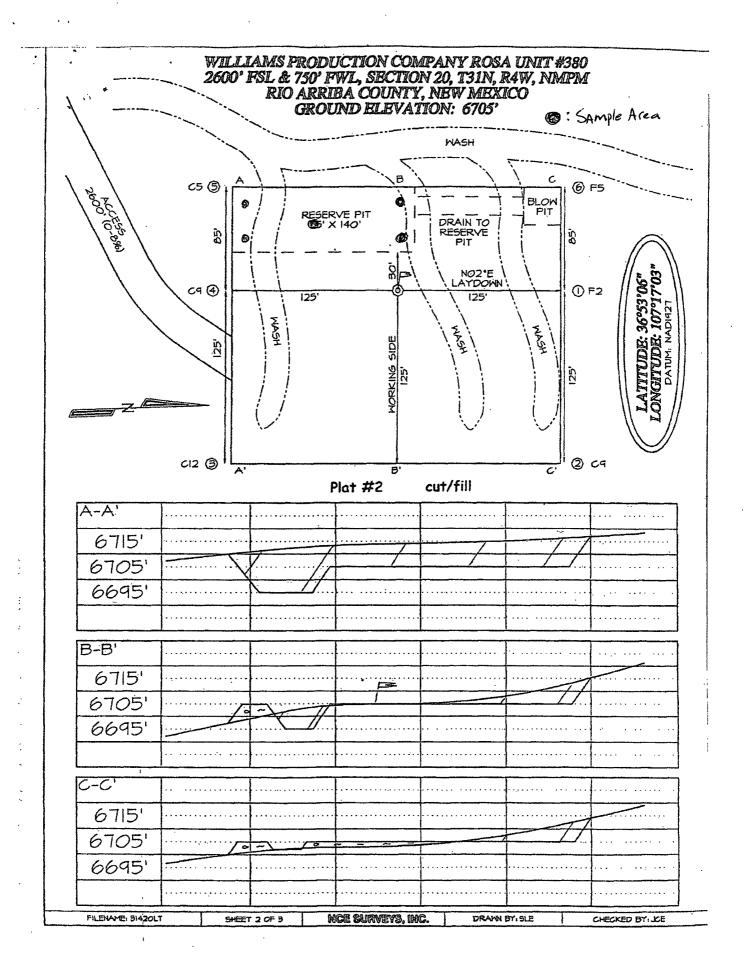

## WPX Energy Production, LLC San Juan Basin: New Mexico Assets

Temporary Pit In-place Closure Report Drilling/Completion and Workover (Groundwater >100 feet bgs)

Well: (Rosa Unit #380) API No: 30-039-27491

Location: L-S20-T31N-R04W, NMPM

In accordance with Rule 19.15.17.13 NMAC, the following plan describes the general in-place closure requirements of temporary pits on WPX Energy Production, LLC locations in the San Juan Basin of New Mexico. This is WPX's standard procedure for all temporary pits to be utilized for the drilling, completion and/or workovers of oil and gas wells operated by WPX. For those temporary pits which do not conform to this standard closure plan, a separate well/pit specific closure plan will be developed and utilized.

All closure activities will include proper documentation and will be submitted to OCD within 60 days of the pit closure on a Closure Report using Division Form C-144. The Report will include the following:

- Details on Capping and Covering, where applicable
- Plot Plan (Pit Diagram)
- Inspection reports
- Sampling Results
- Division Form C-105: WELL COMPLETION OR RECOMPLETION REPORT AND LOG
- Copy of Deed Notice filed with the County Clerk (format to meet County requirements)
   <u>A deed notice is not required on state, federal or tribal land according to NMOCD FAQ</u>
   dated October 30, 2008 and posted on the NMOCD website.

#### General Plan Requirements:

1. All free standing liquids will be removed from the pit at the start of the closure process. Liquids will be removed in a manner that the appropriate District Office approves including; recycled, reused, reclaimed, evaporated, and/or disposed of in a Division-approved facility. Once all free liquids are removed, the sludge will be stabilized by one of the following methods depending on equipment availability: blending with clean stockpiled soils or dewatering using a Bowl Decanter Centrifuge then blending with clean stockpiles soils.

To the extent practical, free liquids were pulled from the reserve pit following the completion rigoff. Haul dates were 6/23/2012 to SWD #002 API # 30-039-3081 Order – SWD-1236

2. The preferred method of closure for all temporary pits will be on-site closure by in-place burial, provided all the criteria in 19.15.17.13.B are met.

On-site burial plan for this location was approved by the Aztec District Office on (06/01/2012)

- The surface owner shall be notified of WPX's proposed closure plan using a means that
  provides proof of notice (i.e. certified mail/return receipt requested)
   Williams notified the SMA of its intent to use a temporary pit and onsite burial in the Surface Use
  Plan in the well APD. The SMA was notified by email see attached. No return receipt required per
  BLM:FFO/NMOCD MOU dated 5/4/09.
- 4. Within six months of the "rig-off" status occurring WPX will ensure that the temporary pit is covered, recontoured and reseeding in progress.

<u>Drill rig-off (7/4/2012).</u> Completion rig-off (8/9/2012). Pit covered (9/7/2012). Pit area along with unused portions of well pad to be interim reclaimed in accordance with Surface Management Agency requirements in APD-COAs and per BLM:FFO/NMOCD MOU dated 5/4/09.

- 5. Notice of Closure will be given to the Aztec District office between 72 hours and one week of the scheduled closure via email or phone. The notification of closure will include the following:
  - a. Operators Name (WPX)
  - b. Well Name and API Number
  - c. Location (USTR)

The Aztec District Office of NMOCD was notified by email using a format acceptable to the District. Copies of the notification from Abode Contractors on 8/24/2012 is attached.

6. The pit liner shall be removed above "mud level" after stabilization. Removal of the liner will consist of manually or mechanically cutting the liner at the mud level and removing all remaining liner. Care will be taken to remove "all" of the liner (I.e. anchored material). All excessive liner will be disposed of at a licensed disposal facility (probably San Juan Regional Landfill operated by Waste Management under NMED Permit SWM-052426).

The liner to the temporary pit was removed above the "mud level" once stabilized. Removal of the liner consisted of manually cutting the liner and removing all remaining liner material above the "mud level" including the anchor material. All excessive liner was disposed of at the San Juan Regional Landfill operated by Waste Management under NMED Permit SWM-052426.

7. Solidification of the remaining pit contents shall be achieved by mixing non-waste containing, earthen material. The solidification process will be accomplished use a combination of natural drying and mechanical mixing. Pit contents will be mixed with non-waste, earthen material to a consistency that is deemed safe and stable. The mixing ratio shall not exceed 3 parts non-waste to 1 part pit contents.

Following removal of free liquids, the pit contents were mixed with non-waste containing, earthen material in order to achieve appropriate solidification and a consistency that was deemed safe and stable. The solidification process was accomplished using a combination of natural drying, and mechanically mixing using a dozer and trackhoe. The mixing ration was approximately 2.5-3 parts native soil to 1 part pit contents. Solidification was completed (9/5/2012

8. A five-point composite sample will be taken of the pit using sampling tools and all samples tested per 19.15.17.13(B)(1)(b) NMAC. In the event that the criteria are not met (See Table 1), all contents will be handled per 19.15.17.13(B)(1)(a) (i.e. dig and haul to a Division-approved facility). Approval to haul will be requested of the Aztec District office prior to initiation.

A five-point composite sampling was taken of the pit area using sampling tools and the sample was tested per 19.15.17.13(B)(1)(b) NMAC. Results are shown in Table 1 and lab reports are

Table 1: Closure Criteria for Temporary Pits in Non-sensitive Areas with Groundwater > 100 bgs.

attached.

Components	Testing Methods	Limits (mg/Kg)	Pit (mg/Kg)
Benzene	EPA SW-846 Method 8021B or 8260B	0.2	ND
BTEX	EPA SW-846 Method 8021B or 8260B	50	.198
TPH	EPA SW-846 Method 418.1	2500	31.9
GRO/DRO	EPA SW-846 Method 8015M (GRO/DRO)	500	ND
Chlorides	EPA SW-846 Method 300.1	500	217

9. Upon completion of solidification and testing, the pit area will be backfilled with non-waste earthen material compacted to native conditions to enable effective revegetation for successful evapotranspiration. A minimum of four feet of cover including replacement of one foot of suitable material to establish vegetation, or the background thickness of topsoil, whichever is greater.

Upon completion of solidification and testing, the pit area was backfilled with non-waste earthen material compacted to native conditions. A minimum of four feet of cover to the extent practical was achieved and the cover included just over a foot of topsoil suitable to establish vegetation.

10. Following cover, the site will be recontoured to meet the Surface Management Agency or surface owner requirements. Re-contouring will attempt to match fit, shape, line form, and texture of the surrounding geography. Re-shaping will include drainage control, prevent ponding, and minimize erosion. Natural drainages will be unimpeded and stormwater Best Management Practices (BMPs) will be used to aid in soil stabilization and protection surface water quality.

Following cover, Williams reestablished drainage and contours to approximately match previous topography meeting the Conditions of Approval in the APD and the direction offered by a BLM/USFS inspector. Cover and re-contouring were completed 9/7/2012

- 11. Notification will be sent to the Aztec District office when the reclaimed area is seeded. WPX Energy Production, LLC will comply with Surface Management Agency reseeding requirements in the COAs of the APD for the referenced well, per BLM:FFO/NMOCD MOU dated 5/4/09.
- 12. WPX shall seed the disturbed areas the first growing season after the pit is covered. Seeding will be accomplished via drilling on the contour whenever practical, or by other Division-approved methods. Vegetative cover will equal 70% of the native perennial vegetative cover (un-impacted) consisting of at least three native plant species, including at least one grass, but not including noxious weeds, and maintained that cover through two successive growing seasons. Repeat seeding or planting will be continued until successful vegetative growth

Page 8 of 9 Rosa Unit 380

occurs. Note: WPX assumes the seeding stipulations including mix and seeding methods specified by the Surface Management Agency (BLM, BOR, USFS, Tribal, etc.) or Land owner as part of a surface use agreement or APD are Division-approved methods unless notified by the Division of their unacceptability.

WPX Energy Production, LLC will comply with Surface Management Agency reseeding requirements in the COAs of the APD for the referenced well, per BLM:FFO/NMOCD MOU dated 5/4/09.

13. The temporary pit will be located with a steel marker, no less than four inches in diameter, cemented in a hole three feet deep in the center of the on site burial upon the abandonment of all wells on the pad. The marker will be flush with the ground to allow access of the active well pad and for safety concerns. The marker will include a threaded collar to be used for future abandonment. The top of the marker will contain a welded steel 12" square plate that indicates the on site burial of the temporary pit. The plate will be easily removable and a four-foot tall riser will be threaded into the top of the collar marker and welded around the base with the operations information at the time of all wells on the pad abandoned. The information will include Operator Name, Lease Name, Well Name, and number, USTR, and an indicator that the marker is an onsite pit burial location.

<u>The temporary pit was located with a steel marker meeting the above listed specifications. The marker has the following information welded for future reference: WPX Energy Production, LLC, 20-I31N-R04W-L, "In Place Burial" (photo attached). Steel marker set 9/7/2012</u>



### **Report Summary**

Client: WPX Energy

Chain of Custody Number: 14410

Samples Received: 09-07-12

Job Number: 04108-0136

Sample Number(s): 63157

Project Name/Location: Rosa Unit 380

Entire Report Reviewed By:

The analytical results in this report are based upon information supplied by you, the client, and are for your exclusive use. If you have any questions regarding this data package, please do not hesitate to call.





### EPA METHOD 8015 Modified Nonhalogenated Volatile Organics Total Petroleum Hydrocarbons

Client:	WPX Energy	Project #:	04108-0136
Sample ID:	Reserve Pit	Date Reported:	09-12-12
Laboratory Number:	63157	Date Sampled:	09-05-12
Chain of Custody No:	14410	Date Received:	09-07-12
Sample Matrix:	Soil/ Solid	Date Extracted:	09-10-12
Preservative:	Cool	Date Analyzed:	09-10-12
Condition:	Intact	Analysis Requested:	8015 TPH

Parameter	Concentration (mg/Kg)	Det. Limit (mg/Kg)
Gasoline Range (C5 - C10)	ND	0.2
Diesel Range (C10 - C28)	ND.	0.1
Total Petroleum Hydrocarbons	ND	

ND - Parameter not detected at the stated detection limit.


References:

Method 8015B, Nonhalogenated Volatile Organics, Test Methods for Evaluating Solid Waste,

SW-846, USEPA, December 1996.

Comments:

Rosa Unit 380

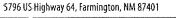

Ph (505) 632-0615 Fx (505) 632-1865

Three Springs - 65 Mercado Street, Suite 115, Durango, CO 81301

Ph (970) 259-0615 Fr (800) 362-1879

envirotech-inc.com laboratory@envirotech-inc.com



### EPA Method 8015 Modified Nonhalogenated Volatile Organics Total Petroleum Hydrocarbons

#### **Quality Assurance Report**

Client:	QA/QC	Project #:	N/A
Sample ID:	0910TCAL QA/QC	Date Reported:	09-12-12
Laboratory Number:	63137	Date Sampled:	N/A
Sample Matrix:	Methylene Chloride	Date Received:	N/A
Preservative:	N/A	Date Analyzed:	09-10-12
Condition:	N/A	Analysiś Requested:	TPH

	I-Cal Date	I-Cal RF:	C-Cal RF : % %	Difference	Accept. Range
Gasoline Range C5 - C10	09-10-12	9.9960E+02	1.0000E+03	0.04%	0 - 15%
Diesel Range C10 - C28	09-10-12	9.9960E+02	1.0000E+03	0.04%	0 - 15%

Blank Conc. (mg/L - mg/Kg)	Concentration	Detection Limit
Gasoline Range C5 - C10	ND	0.2
Diesel Range C10 - C28	ND	0.1
Total Petroleum Hydrocarbons	ND	

Duplicate Conc. (mg/Kg)	⊮ Sample	Duplicate	% Difference	Accept. Range
Gasoline Range C5 - C10	ND	ND	0.0%	0 - 30%
Diesel Range C10 - C28	ND	ND	0.0%	0 - 30%

Spike Conc. (mg/Kg)	Sample	Spike Added	Spike Result	% Recovery	Accept: Range
Gasoline Range C5 - C10	ND	250	262	105%	75 - 125%
Diesel Range C10 - C28	ND	250	269	108%	75 - 125%

ND - Parameter not detected at the stated detection limit.

References: Method 8015B, Nonhalogenated Volatile Organics, Test Methods for Evaluating Solid Was

SW-846, USEPA, December 1996.

Comments: QA/QC for Samples 63137-63139, 63142-63143, 63149-63151 and 63157



# EPA METHOD 8021 AROMATIC VOLATILE ORGANICS

Client:	WPX Energy	Project #:	04108-0136
Sample ID:	Reserve Pit	Date Reported:	09-13-12
Laboratory Number:	63157	Date Sampled:	09-05-12
Chain of Custody:	14410	Date Received:	09-07-12
Sample Matrix:	Soil/ Solid	Date Analyzed:	09-13-12
Preservative:	Cool	Date Extracted:	09-10-12
Condition:	Intact	Analysis Requested:	BTEX
		Dilution:	50

		Det.
	Concentration	Limit
Parameter	(ug/Kg)	(ug/Kg)
Benzene	ND	10.0
Toluene	76.0	10.0
Ethylbenzene	ND	10.0
p,m-Xylene	99.3	10.0
o-Xylene	23.1	10.0
Total BTFX	198	

ND - Parameter not detected at the stated detection limit.

Surrogate Recoveries:	Parameter	Percent Recovery
	Fluorobenzene	93.2 %
	1,4-difluorobenzene	103 %
	Bromochlorobenzene	107 %

References:

Method 5030B, Purge-and-Trap, Test Methods for Evaluating Solid Waste, SW-846, USEPA,

December 1996.

Method 8021B, Aromatic Volatile Organics, Test Methods for Evaluating Solid Waste, SW-846

USEPA, December 1996.

Comments:

Rosa Unit 380





# EPA METHOD 8021 AROMATIC VOLATILE ORGANICS

Client: Sample ID: Laboratory Number: Sample Matrix: Preservative:	N/A 0913BCAL QA/QC 63157 Soil <sup>i</sup> N/A	Da Da Da Da	oject #: ite Reported: ite Sampled: ite Received: ite Analyzed:	09- N/A N/A 09-	N/A 09-13-12 N/A N/A 09-13-12		
Condition:	N/A		nalysis: ution:	BT 50	EX		
Calibration and	I-Cal RF: C-	diamen needs are serviced	%Diff.	Blank	Detect.		
Detection Limits (ug/L	) Accep	t. Range 0-15%		Conc	Limit		
Benzene	9.6049E÷06 9.	6049E-06	0.000	ND	0.2		
Toluene		2110E-06	0.000	NĐ	0.2		
Ethylbenzene		0378E-05	0.000	ND	0.2		
p,m-Xylene		7.4844E-06 <b>0.000</b> 1.0395E-05 <b>0.000</b>		ND ND	0.2 0.2		
o-Xylene	1.0395E-05 1.	039 <b>5</b> E-05	0.000		·		
	1.0395E-05 1.			٠٠٠ الروز في الأغرابية ا			
Duplicate Conc. (ug/Kg) Benzene Toluene	Sample STORE  ND 76.0	uplicate ND 42.7	%Ďiff. <i>A</i> 0.00 0.44	0 - 30% 0 - 30%	Dětřect: Limit 10 10		
Duplicate Conc. (ug/Kg) Benzene Toluene Ethylbenzene	Sample ND ND 76.0 ND	uplicate ND 42.7 ND	0.00 0.44 0.00	0 - 30% 0 - 30% 0 - 30% 0 - 30%	Detect, Limit 10 10 10 10		
Duplicate Conc. (ug/Kg) Benzene Toluene Ethylbenzene p,m-Xylene	Sample ND 76.0 ND 99.3	ND 42.7 ND 85.2	0.00 0.44 0.00 0.14	0 - 30% 0 - 30% 0 - 30% 0 - 30% 0 - 30%	Detect: Limit 10 10 10 10 10		
Duplicate Conc. (ug/Kg) Benzene Toluene Ethylbenzene	Sample ND 76.0 ND 99.3 23.1	ND 42.7 ND 85.2 19.9	0.00 0.44 0.00 0.14 0.14	0 - 30% 0 - 30% 0 - 30% 0 - 30%	Detect Limit 10 10 10		
Duplicate Conc. (ug/Kg) Benzene Toluene Ethylbenzene p,m-Xylene o-Xylene	Sample ND 76.0 ND 99.3 23.1	ND 42.7 ND 85.2 19.9	0.00 0.44 0.00 0.14 0.14	0 - 30% 0 - 30% 0 - 30% 0 - 30% 0 - 30%	Defect Limit 10 10 10 10 10		
Duplicate Conc. (ug/Kg) Benzene Toluene Ethylbenzene p,m-Xylene o-Xylene Spike Conc. (ug/Kg)	Sample D ND 76.0 ND 99.3 23.1	ND 42.7 ND 85.2 19.9	%Diff	0 - 30% 0 - 30% 0 - 30% 0 - 30% 0 - 30% 0 - 30%	Defect Limit  10 10 10 10 10 10 Accept Range		
Duplicate Conc. (ug/Kg) Benzene Toluene Ethylbenzene p,m-Xylene o-Xylene Spike Conc. (ug/Kg)	Sample  ND 76.0 ND 99.3 23.1  Sample  Am	ND 42.7 ND 85.2 19.9	%Diff. 0.00 0.44 0.00 0.14 0.14 piked Sample	0 - 30% 0 - 30% 0 - 30% 0 - 30% 0 - 30% % Recovery	Detect: Limit:  10 10 10 10 10 10 Accept Range 39 - 150		

ND - Parameter not detected at the stated detection limit.

Dilution: Spike and spiked sample concentration represent a dilution proportional to sample dilution.

23.1

References: Method 5030B, Purge-and-Trap, Test Methods for Evaluating Solid Waste, SW-846, USEPA,

December 1996.

Method 8021B, Aromatic and Halogenated Volatiles by Gas Chromatography Using Photoionization and/or Electrolytic Conductivity Detectors, SW-846, USEPA December 1996.

2500

2780

110

46 - 148

Comments: QA/QC for Samples 63134, 63142-63143 and 63157-63158



o-Xylene

Ph (505) 632-0615 Fx.(505) 632-1865

Ph.(970) 259-0615 Fr (800) 362-1879





Client:	WPX Energy	Project #:	04108-0136
Sample ID:	Reserve Pit	Date Reported:	09-11-12
Laboratory Number:	63157	Date Sampled:	09-05-12
Chain of Custody No:	14410	Date Received:	09-07-12
Sample Matrix:	Soil/ Solid	Date Extracted:	09-11-12
Preservative:	Cool	Date Analyzed:	09-11-12
Condition:	Intact	Analysis Needed:	TPH-418.1

		Det.
	Concentration	Limit
Parameter	(mg/kg)	(mg/kg)

**Total Petroleum Hydrocarbons** 

31.9

6.6

ND = Parameter not detected at the stated detection limit.


References:

Method 418.1, Petroleum Hydrocarbons, Total Recoverable, Chemical Analysis of Water

and Waste, USEPA Storet No. 4551, 1978.

Comments:

Rosa Unit 380

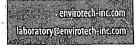



Client:

**QA/QC** 

Project #:

N/A

Sample ID:

**QA/QC** 

Date Reported:

09-11-12

Laboratory Number:

09-11-TPH.QA/QC 63137 Freon-113

Date Sampled: Date Analyzed: N/A

Sample Matrix: Preservative:

N/A

09-11-12

Condition:

N/A

Date Extracted: Analysis Needed: 09-11-12 **TPH** 

Calibration

l-Cal Date

I-Cal RF. C-Cal RF: % Difference Accept. Range

07-11-12

C-Cal Date 09-11-12

1,660

1,720

3.6%

+/- 10%

Blank Conc. (mg/Kg)

Concentration

**Detection Limit** 

TPH

ND

6.6

Duplicate Conc. (mg/Kg)

**TPH** 

Sample 1,020

770

24.5%

Duplicate % Difference Accept. Range +/- 30%

Spike Conc. (mg/Kg) Sample

Spike Added Spike Result % Recovery

Accept Range

**TPH** 

1,020

2,000

2,520

83.4%

80 - 120%

ND. = Parameter not detected at the stated detection limit.

References:

Method 418.1, Petroleum Hydrocarbons, Total Recoverable, Chemical Analysis of Water

and Waste, USEPA Storet No. 4551, 1978.

Comments:

QA/QC for Samples 63137-63139, 63153-63154, 63157 and 63161-63162

envirotech-inc.com



#### Chloride

Client:

**WPX** Energy

Project #:

04108-0136

Sample ID:

Reserve Pit

Date Reported:

09-17-12

Lab ID#:

63157

Date Sampled:

09-05-12

Sample Matrix:

Soil / Solid

Preservative:

Cool

Date Received: 'Date Analyzed:

09-07-12 09-17-12

Condition:

Intact

Chain of Custody:

14410

**Parameter** 

Concentration (mg/Kg)

**Total Chloride** 

217

Reference:

U.S.E.P.A., 4500B, "Methods for Chemical Analysis of Water and Wastes", 1983.

Standard Methods For The Examination of Water And Waste Water", 18th ed., 1992.

Comments:

Rosa Unit 380



14410

## CHAIN OF CUSTODY RECORD

Client: WPX Energy	./	Pro	ject Name / Locat		4 38	0			ANALYSIS / PARAMETERS													
Client:  WPX Energy Email results to:  Client Phone No.:			npler Name: Jejun ent No.:	$\sum_{i}$	0136				TPH (Method 8015)	BTEX (Method 8021)	VOC. (Method: 8260)	Metals	Anion		th H/P	9 910-1	3.1)	DE			Sool	ntact
Sample No./ Identification	Sample Date	Sample Time	Lab No.	No.	Volume ontainers	Pi HgCl <sub>2</sub>	reservat HCI	tive	трн (ме	BTEX (M	VOC. (Me	RCRA 8 Metals	Cation / Anion	RCI	TCLP with H/P	CO Table 910-1	TPH (418.1)	CHLORIDE	-		Sample Cool	Sample Intact
Reserve Pit	9/5/12	2:30	U3157	1	400				V	<b>V</b>	,						/	<i>i</i> ~			X	y
	,		·		•														-			
			AND TO THE RESIDENCE OF THE PARTY OF THE PAR			<u> </u>			,													
		-							,											-		
						<u>-</u>																
Relinquished by: (Signature)	U.			Date 9/7/12	Time 225	L Recei	ved b	iy: (Sig	gnati	· ·	33	$\nu$								Date 9/17/16		ime 25p
Relinquistied by: (Signature)						Recei	ved b	ıy: (Si	gnatt	ire)												•
Sample Matrix Soil.☑ Solid ☒ Sludge ☐	Aqueous 🗌	Other 🗌																				
Sample(s) dropped off after	hours to sec	cure drop off	area.	3 6	Anal	ir C	) † (	<b>e C</b> bora	hitory	)												
5795 US Highway 64	<ul> <li>Farmingto</li> </ul>	n, NM 87401	• 505-632=0615 • T	hree Spri	ngs • 65 M	eŕcac	to Stre	et, Su	uite 1	15, Du	Jiang	o, CC	D 813	01 • 1	abor	atory	@env	iroted	ch-inc	.cóm		

District I

1625 N French Drive, Hobbs, NM 88240
Phone (575) 393-6161 Fax (575) 393-0720
District II

811 S First Street, Artesia, NM 88210
Phone (575) 748-1283 Fax: (575) 748-9720
District III

1000 Rio Brazos Road, Aztec, NM 87410
Phone (505) 334-6178 Fax: (505) 334-6170
District IV

1220 S St Francis Drive, Santa Fe, NM 87505
Phone (505) 476-3460 Fax (505) 476-3462

'API Number

640.0 Acres

#### State of New Mexico Energy, Minerals & Natural Resources Department

Form C-102 Revised August 1, 2011

Submit one copy to Appropriate District Office

#### OIL CONSERVATION DIVISION 1220 South St. Francis Drive Santa Fe, NM 87505

\_\_ AMENDED REPORT

As Drilled

BASIN FRUITLAND COAL

#### WELL LOCATION AND ACREAGE DEDICATION PLAT

2Pop1 Code


71629

S/2 - Section 20

N/2 - Section 29

					1								
*Property	Code				*Property	y Name		⁵ W∈	ell Number				
1703	3		ROSA UNIT 380										
'OGRID	No		*Operator Name *Elevation										
12078	32		WPX ENERGY PRODUCTION, LLC 6706'										
<sup>10</sup> Surface Location													
UL or lot no	Sect ion	Township	Range	Lot Idn	Feet from the	North/South line	Feet from the	East/West line	County RIO				
L	20	31N	4W		2607	SOUTH	758	WEST	ARRIBA				
			11 Botto	m Hole	Location I	f Dıfferent	From Surfac	е					
UL or lat no.	Section	Township	Range	Lot Idn	Feet from the	North/South line	Feet from the	East/West line	County				
С	29	31N	4W		717	WEST	ARRIBA						
12 Dedicated Acres		5/2 -	Soction	20	13 Joint or Infill	<sup>14</sup> Consolidation Code	<sup>15</sup> Order No						

NO ALLOWABLE WILL BE ASSIGNED TO THIS COMPLETION UNTIL ALL INTERESTS HAVE BEEN CONSOLIDATED OR A NON-STANDARD UNIT HAS BEEN APPROVED BY THE DIVISION

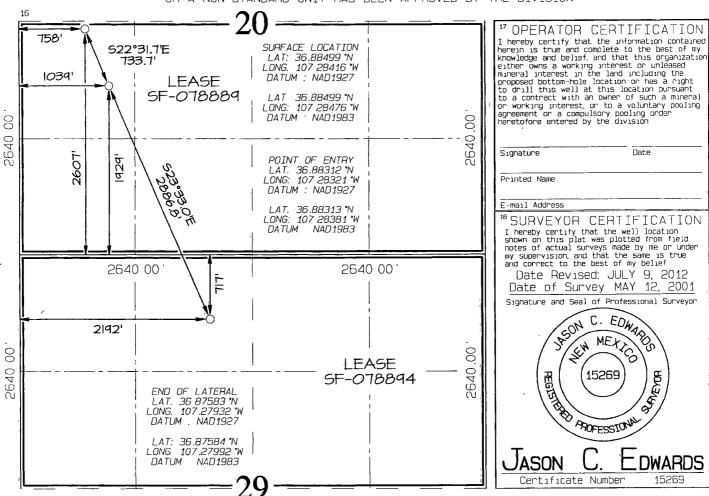

#### Meador, Tasha

From:

Glenn Shelby [glenn@adobecontractorsinc.com]

Sent:

To:

Cc:

Friday, August 24, 2012 7 57 AM
Brandon Powell (Nmocb)
Mitchell, Ben, Granillo, Lacey, Meador, Tasha, Johnny Stinson

Subject:

WPX Energy Pit Closures/ Rosa Unit 380

Brandon,

Early next week we will start backfilling the reserve pit on the Rosa Unit 380. If you have any question or concerns call or email me.

Thanks,

Glenn Shelby

**Adobe Contractors** Field Foreman glenn@adobecontractorsinc.com (505) 320-7187

#### Meador, Tasha

From:

Glenn Shelby [glenn@adobecontractorsinc com]

Sent:

To:

Cc:

Friday, August 24, 2012 8:08 AM

JJ Miller (NMFS)

Mitchell, Ben; Granillo, Lacey; Meador, Tasha; Johnny Stinson
WPX Energy Pit Closures/ Rosa Unit 380

Subject:

Good morning,

Early next week we will start backfilling the reserve pit on the Rosa Unit 380. If you have any question or concerns call or email me.

Thanks,

Glenn Shelby

**Adobe Contractors** Field Foreman glenn@adobecontractorsinc.com (505) 320-7187

Two Copies	ate Distri	ci Office	2			State of Ne				Form C-10							
District I 1625 N French Dr	Hobbe N	1N/1 882/1/1	10	E	nergy,	Minerals and	d Na	atural R	esources				3.0			July 17, 2008	
District II											1. WELL/ 30-039-274		ÑŌ:				
1301 W Grand Av District III	enue, Arte:	sıa, NM	88210		O	il Conservat	tion	Divisi	on		2 Type of Le						
1000 Rio Brazos R	d , Aztec, ì	NM 8741	10		12	220 South St	t. Fı	rancis I	Or.		STA		☐ FEE	⊠F	ED/IND	IAN	
District IV 1220 S St Francis	Dr , Santa	Fe, NM	87505			Santa Fe, N	ΙM	87505		ĺ	3 State Oil &	Gas	Lease No.				
WFII	COMP	LFTI	ION O	R REC	OMPI	LETION REI	POI	RT ANI	OLOG	$\neg$							
4 Reason for fil										$\dashv$	5 Lease Name	e or l	Jnit Agreei	ment Na	ame		
COMPLET	···	ODT (	(F.11 b.		1. #2.1	I 6 - 64-4 1 F							R	osa			
COMPLET	ION REI	OKI (	(Fill in bo	xes #1 th	ough #31	I for State and Fee	e well	is only)		}	6 Well Númb	er.	,				
#33, attach this a	nd the pla					nrough #9, #15 Da ordance with 19 I				or	V 1,910.00		Rosa U	nıt #380	0		
7. Type of Comp		TI WOI	DVOVED		DENING	F □PLUGBACK	<i>,</i> $\Box$	DIECEDE	NT DECEDIA	ΔID	. ⊠ OTHER	6.4	a +=aale				
8 Name of Oper			ergy Produ			PLUGBACK	<u>` Ц</u>	DIFFERE	NI KESEKV	OIR	9 OGRID	120	e-track 782				
/ / / / / · · · · · · · · · · · · · · ·	•										**************************************						
10 Address of O	perator	PO B	3OX 640	AZ	TEC, NM	1 87410					11 Pool name	or W	'ildcat				
12.Location	Unit Ltr	S	Section	Tov	nship	Range	Lot		Feet from the	ne .	N/S Line	Fee	t from the	E/W I	Line	County	
Surface:																	
BH:																· · · · · · · · · · · · · · · · · · ·	
13. Date Spudde	1 14 D	Pate T D	) Reache	d 15	Date R	ig Released 8/9/2012	<u> </u>	16	Date Comple	eted	(Ready to Prod	uce)		Elevat Γ, GR, ε		and RKB,	
18 Total Measur	8 Total Measured Depth of Well 19 Plug Back Measured Depth 20 Was Directional S								l Survey Made <sup>9</sup>		21 Type	e Electr	ic and Oi	her Logs Run			
22 Producing Interval(s), of this completion - Top, Bottom, Name																	
22					CAS	SING REC	ΩD	D (Don	ort all atm	ine	ra got in xx	<u> </u>					
CASING SI	7F	w	VEIGHT L	R /FT	CAN	DEPTH SET	UK		DLE SIZE	1115	CEMENTIN		CORD	ΔΝ	MOUNT	PULLED	
CASIIVO SI	Z, L.	, , , , , , , , , , , , , , , , , , ,	VLIOIII L	.D/II		DEFITISE		110	JLL SIZL	-	CEMENTIN	O KL	CORD		VICOIVI	I OLLLO	
										-							
													Ì				
															·		
24.	1					NER RECORD				25			NG RECO		г		
SIZE	TOP			BOTTON	<u> </u>	SACKS CEM	ENT	SCREE	N	SIZ	ZE	$+^{D}$	EPTH SET	T PACKER SET		ER SET	
												+			<del> </del>		
26 Perforation	record (ı	nterval.	size and	l number)				27 AC	TOH2 GI	FR.	ACTURE CE	ME	NT SOLIE	FZF	L FTC	· · ·	
		,	, - ,	,					INTERVAL	1 10	RACTURE, CEMENT, SQUEEZE, ETC.  AMOUNT AND KIND MATERIAL USED						
																W-1-1-1	
											<u></u>						
28								<u>ODUC</u>		_							
Date First Produc	ction		Pro	duction N	ethod (F	lowing, gas lift, pi	итри	ng - Size ai	nd type pump)		Well Status	(Pro	d or Shut-	in)			
Date of Test	Hour	s Tested	d	Choke S	ze	Prod'n For		Oil - Bb	1	Gas	s - MCF	, W	ater - Bbl		Gas - C	Il Ratio	
			1			Test Period											
Flow Tubing	Casır	ng Press	sure	Calculate		Oıl - Bbl		Gas	- MCF		Water - Bbl		Oil Grav	vity - A	PI - (Cor	r.)	
Press				Hour Ra	e												
29. Disposition o	f Gas (So	ld, usea	d for fuel,	vented, e	c)					ㅗ		30.	Test Witne	ssed By	,		
31 List Attachm	ents																
32 If a temporar	v nit was	neškožiat.	the well*	attach air	låt:with t	he location of the	.temn	oran/init/									
z amag ay suar 1 man	1 100000	, , , , ,		· , /•	nogo er a. v	ocation of the on-s Latitude 3	6.884	499 Longi	tude <sup>-</sup> 107 284	<u>76</u>				1983			
	<i>f<u>y that t</u></i> en Mitc		formatio		<i>on bo</i> . l Name	th sides of this	forr	n is true	and compl	ete	to the best o	f my	knowlea	lge an	d beliej		
	$\nearrow$	10	-1				_	m:	•		=	1.	1-1-				
Signature Z	>~	10	/4/	- <b>v</b>				itle R	egulatory S	pe	cialist Date	: 10	0/3/201	ر م)			
E-mail Addre	ss: ben	mitch	hell@wi	nxenerg	v.com												



## **TEMPORARY PIT INSPECTION REPORT**

Well Name		Rosa Unit 380		Field Name	Bas	sın Fruitland Coal		API#	30-039-27491 Report # 1
Location	NW/4 SV	N/4 Sec 20(L), T3	1N, R4W	County		Rio Arriba		State	NM Rpt Date 6/17/2010
Date	Report Type	Inspector	Liner Intact Y/N	Fenced Y/N	Slopes Intact Y/N	Adequate Freeboard Y/N	Oil Free Y/N	Flare Pit Liquid Free Y/N	Comment
6/17/10								·	
6/18/10									
6/21/10									
6/22/10									
6/19/12									
6/20/12									
6/21/12									
6/23/12	Daily		Υ	Y	Y	YY	Y	Y	
6/24/12	Daily		Y	Y	Y	Y	Y	Y	
6/25/12	Daily		Y	Y	Y	Y	Y	Y	
6/26/12	Daily		Y	Y	Y	Y	Y	Y	
6/27/12	Daily		Y	Y	Y	Y	Y	Y	
6/28/12 6/29/12	Daily		Y	Y	Y	Y	Y	Y	
6/30/12	Daily Daily		Y	Y	Y	Y	Y	Y	
7/1/12	Daily		Y	Y	Y	Y	Y	Y	
7/2/12	Daily		Y	Y	Y	Y	Y	Y	
7/3/12	Daily		Y	Y	Y	Y	Y	Y	
7/4/12	Daily		Y	Y	Y	Y	Y	Y	Phone (505) 801-0826
7/5/12	Daily		Y	Y	Y		Y	Y	Phone (505) 801-0826
7/6/12	Daily		Y	Y	Y	Y	Y	Y	(337)337333
7/7/12	Daily		Y	Y	Y	Y	Y	Y	
7/30/12		·							
7/31/12	Daily		Υ	Y	Υ	Y	Y	Y	
8/1/12	Daily		Υ	Υ	Υ	Y	Υ	Y	
8/2/12	Daily		Υ	Υ	Y	Y	Υ	Y	
8/3/12	Daily		Y	Υ	Υ	Y	Υ	Y	
8/6/12	Daily		Υ	Υ	Υ	Υ	Υ	Y	
8/7/12	Daily		Y		Y	Y	Υ	Υ	SEVERE RAINSTORM OVER WEEKEND PUT
8/8/12	Daily		Υ	Y	Y	Y	Y	Y	TRIPLE S HAULING WATER FREEBOARD 4'6'
8/9/12	Daily		Υ	Y	Y	Y	Y	Y	
7/16/12	Weekly		Υ	Y	Y	Y	Y	Y	
7/26/12	Weekly		Y	Y	Y	Y	Υ	Y	
7/26/12	Weekly		Y	Y	Y	Y	Y	Y	
8/28/12	Weekly		Y	Y	Y	Y	Y	Y	
8/28/12	Weekly		Y	Y	Y	Y	Y	Y	
9/4/12	Weekly		Y	Y	Y	Y	Y	Y	
							<b> </b>		
	'						<del> </del>		
						1	-		
							<del> </del>	<del> </del>	
							<del> </del>	<del> </del>	
							<b></b>		
			<u> </u>	·····					
		L	20	101-2009 M/ell	z Information **	lanagement II C Al	Lughte rec	erved ver 111709jc	

