Form 3160-5 (August 1999)

Š

## D BUREAU OF LAND MANAGEMENT

**SUNDRY NOTICES AND REPORTS ON WELLS** 

UNITED STATES
EPARTMENT OF THE INTERIOR
NUMBER OF TAXIDAGANIA CEMENTE

Do not use this form for proposals to drill or to re-enter and fill 29

FURWIALLIO LED	
OMB No. 1004-0135	
Expires November 30,	2000
Expires Provenious 50,	2000

Lease Serial No. CE 000043

NM

1			
Indian, A	Allottee or	Tribe	Name
	Indian,	Indian, Allottee or	Indian, Allottee or Tribe

abandoned Well. Use Form 3160-3	(APD) for such proposals.	
SUBMIT IN TRIPLICATE - Other in	istructions on reverse side.	7. If Unit or CA/Agreement, Name and/or No.
M Oil Well ☐ Gas Well ☐ Other  2. Name of Operator Pure Resources, L. P.		8. Well Name and No. Rincon Unit No. 230
		9. API Well No. 30-039-22643
3a. Address 500 W. Illinois Midland, Texas 79701	3b. Phone No. (include area code) (432)498-8662	10: Field and Pool, or Exploratory Area
4. Location of Well (Footage, Sec., T., R., M., or Survey De: 970' FSL & 790' FWL UL M. Sec. 28. T-27-N. R-7-W	scription) Te	Yo Largo Chacra Field  11. County or Parish, State Rio Arriba


12. CHECK AF	PPROPRIATE BOX(ES)	TO INDICATE NATU	RE OF NOTICE, REPORT, C	
TYPE OF SUBMISSION		TY	PE OF ACTION	ent vice vice vice in the second of the seco
□ Notice of Intent □ Subsequent Report	☐ Acidize ☐ Alter Casing ☐ Casing Repair	Deepen Fracture Treat New Construction	☐ Production (Start/ Resume) ☐ Reclamation ☐ Recomplete	<ul><li>□ Water Shut-Off</li><li>□ Well Integrity</li><li>□ Other</li></ul>
Final Abandonment Notice	Change Plans Convert to Injection	<ul><li>☑ Plug and Abandon</li><li>☐ Plug Back</li></ul>	☐ Temporarily Abandon ☐ Water Disposal	1 + 12

Describe Proposed or Completed Operation (clearly state all pertinent details, including estimated starting date of any proposed work and approximate duration thereof. If the proposal is to deepen directionally or recomplete horizontally, give subsurface locations measured and true vertical depths of all pertinent markers and zones. Attach the Bond under which the work will be performed or provide the Bond No. on file with BLM/BIA. Required subsequent reports shall be filed within 30 days following completion of the involved operations. If the operation results in a multiple completion or recompletion in a new interval, a Form 3160-4 shall be filed once testing has been completed. Final Abandonment Notices shall be filed only after all requirements, including reclamation, have been completed, and the operator has determined that the site is ready for final inspection.)

This well was Plugged & Abandoned on August 1, 2005 per the attached report.

This should now bring this well into compliance with the latest BLM letter request dated May 10, 2005 (copy also attached).

(SEE ATTACHED PLUG & ABANDONMENT REPORT)

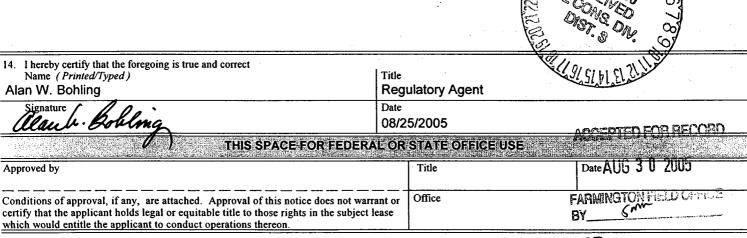

Title 18 U.S.C. Section 1001, makes it a crime for any person knowingly and willfully to make to any department or agence of the Children statements or representations as to any matter within its invisdiction. fraudulent statements or representations as to any matter within its jurisdiction.

### A-PLUS WELL SERVICE, INC.

P.O. BOX 1979 Farmington, New Mexico 87499 505-325-2627 \* fax: 505-325-1211

Pure Resources, L.P. Rincon Unit No. 230

August 1, 2005 Page 1 of 1

970' FSL & 790' FWL, Section 28, T-27-N, R-7-W Rio Arriba County, NM SF-080213 API #30-039-22643

**Plug & Abandonment Report** 

#### **Summary:**

Notified BLM & NMOCD 7/28/05

7/28/05 MOL. RU equipment. Dig out bradenhead valve. Well pressures: 60# casing pressure, no tubing. ND wellhead. NU BOP. TIH with 2.875" wireline gauge ring to 3813'. TIH and set 2.875" PlugWell CIBP at 3813'. PU 122 joints A-Plus 1.25" tubing workstring and tag CIBP at 3813'. Shut in well.

7/29/05 Pump 5 bbls water down tubing, plugged. TOH with tubing and found plug 2 joints from bottom. RIH with tubing. Circulate well with 20 bbls of water. Attempt to pressure test casing to 500#, bled down 250# in 1 minute.

**Plug #1** with CIBP at 3813', spot 10 sxs Type III cement (13 cf) inside casing from 3813' to 3407' to isolate the Chacra perforations.

PUH and WOC. TIH with tubing and tag cement at 3617'. B. Vigil, BLM, approved tag. Plug #2 spot 25 sxs Type III cement (33 cf) inside casing from 2998' to 1983' to cover the Pictured Cliffs, Fruitland, Kirtland and Ojo Alamo tops. TOH with tubing. Shut in well.

8/01/05 TIH and tag cement at 1955'. Load casing with 4 bbls of water. Attempt to pressure test casing, leak ½ bpm at 1000#. PUH to 1010'

**Plug #3** spot 6 sxs Type III cement (8 cf) inside casing from 1010' to 767' to cover the Nacimiento top.


TOH and LD tubing. WOC. RIH with wireline and tag cement at 730'. Perforate 2 squeeze holes at 184'. Establish circulation out bradenhead with 40 bbls of water. **Plug #4** with 73 sxs Type III cement (97 cf) pumped down the 2.875" casing from 184'

to surface, circulate good cement out bradenhead valve. Shut in well and WOC. Dig out and cut off wellhead. Found cement at surface in the 2.875" casing and annulus.

Install P&A marker with 20 sxs Type III cement.

RD rig and equipment. MOL.

B. Vigil, BLM representative, was on location 7/29/05.





# United States Department of the Interior

#### **BUREAU OF LAND MANAGEMENT**

Farmington Field Office 1235 La Plata Highway, Suite A Farmington, New Mexico 87401

IN REPLY REFER TO:

NMSF-080213 (WC) 3162.3-2 (21110)

May 10, 2005

Mr. Mike Phillips Pure Resources, L.P. 500 W. Illinois Midland, TX 79701

Dear Mr. Phillips:

Reference is made to your well No. 230 Rincon Unit located 970' FSL & 790' FWL sec. 28, T. 27 N., R. 7 W., Rio Arriba County, New Mexico, Lease NMSF-080213. Also referenced is our letter dated March 31, 2005, which required you to plug and abandon the above mentioned well and to submit a subsequent report of abandonment by April 30, 2005.

You are in violation of 43 CFR 3163.1. This is a minor violation. If the violation is not corrected you may be subject to an assessment. You have until May 31, 2005 to correct this violation. Failure to comply within the time above may result in an assessment in accordance with 43 CFR 3163.1.

Under provisions of 43 CFR 3165.3, you may request an Administrative Review of the orders described above. Such request, including all supporting documents, must be filed in writing within 20 business days of receipt of this notice and must be filed with the State Director, Bureau of Land Management (NM-93000), P. O. Box 27115, Santa Fe, New Mexico 87502-0115. Such requests shall not result in a suspension of the order(s) unless the reviewing official so determines. Procedures governing appeals from instructions, orders or decisions are contained in 43 CFR 3165.4 and 43 CFR 4.400 et seq.

If you have any questions please contact Stephen Mason with this office at (505) 599-6364.

Sincerely,

Stephen Mason

Supte An Mon

Petroleum Engineer, Petroleum Management Team