

District I
1625 N. French Dr., Hobbs, NM 88240
District II
1301 W. Grand Avenue, Artesia, NM 88210
District III
1000 Rio Brazos Road, Aztec, NM 87410
District IV
1220 S. St. Francis Dr., Santa Fe, NM 87505

State of New Mexico
Energy Minerals and Natural Resources

Oil Conservation Division
1220 South St. Francis Dr.
Santa Fe, NM 87505

Form C-141
Revised August 8, 2011

Submit 1 Copy to appropriate District Office to
accordance with 19.15.29 NMAC.

Release Notification and Corrective Action

OPERATOR

☐ Initial Report ☒ Final Report

Name of Company Burlington Resources Oil & Gas Company	Contact Crystal Tafoya	
Address 3401 East 30th St, Farmington, NM	Telephone No. (505) 326-9837	
Facility Name: San Juan 30-6 Unit 476	Facility Type: Gas Well	
Surface Owner BLM	Mineral Owner BLM (NM-04052)	API No. 30-039-24469

LOCATION OF RELEASE

Unit Letter A	Section 28	Township 30N	Range 6W	Feet from the 1060	North/South Line North	Feet from the 825	East/West Line East	County Rio Arriba
-------------------------	----------------------	------------------------	--------------------	------------------------------	----------------------------------	-----------------------------	-------------------------------	-----------------------------

Latitude **36.78792** Longitude **107.46164**

RCVD FEB 22 '13
OIL CONS. DIV.
DIST 3

NATURE OF RELEASE

Type of Release Produced Water	Volume of Release 30 bbls	Volume Recovered 20 bbls
Source of Release Tank Bottom	Date and Hour of Occurrence 12/6/2012 at 12:00pm	Date and Hour of Discovery 12/6/12 at 1:00pm
Was Immediate Notice Given? ☒ Yes ☐ No ☐ Not Required	If YES, To Whom? Sherri Landon (BLM) & Jonathan Kelly (OCD)	
By Whom? Crystal Tafoya	Date and Hour 12/6/2012 at 3:35pm	
Was a Watercourse Reached? ☐ Yes ☒ No	If YES, Volume Impacting the Watercourse.	

If a Watercourse was Impacted, Describe Fully.*
N/A


Describe Cause of Problem and Remedial Action Taken.*

A hole was discovered in the water tank bottom on the subject location which allowed 30bbls of produced water to be released. Approximately 20 bbls of produced water was recovered.

Describe Area Affected and Cleanup Action Taken.*

Historical hydrocarbon impacted soil was found during the spill assessment for the subject well. The area was hydrovac'd 18'x 16' x 7' and 74 yds of soil was transported to IEI landfarm and 75 yds of clean soil was transported and placed in the excavation site. The soil sampling report is attached for review.

I hereby certify that the information given above is true and complete to the best of my knowledge and understand that pursuant to NMOCD rules and regulations all operators are required to report and/or file certain release notifications and perform corrective actions for releases which may endanger public health or the environment. The acceptance of a C-141 report by the NMOCD marked as "Final Report" does not relieve the operator of liability should their operations have failed to adequately investigate and remediate contamination that pose a threat to ground water, surface water, human health or the environment. In addition, NMOCD acceptance of a C-141 report does not relieve the operator of responsibility for compliance with any other federal, state, or local laws and/or regulations.

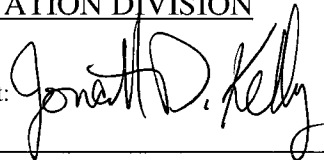Signature: 	OIL CONSERVATION DIVISION	
Printed Name: Crystal Tafoya	Approved by Environmental Specialist: 	
Title: Field Environmental Specialist	Approval Date: 2/27/2013	Expiration Date:
E-mail Address: crystal.tafoya@conocophillips.com	Conditions of Approval:	Attached ☐
Date: 2/19/2013 Phone: (505) 326-9837		

* Attach Additional Sheets If Necessary

nJK1305841476



Contaminated Cleanup

Located at:

SAN JUAN 30-6 #476

1/22/2013

Prepared for:

ConocoPhillips

Crystal Tafoya

Prepared by:

Nelson Revegetation LLC

Brad Griffith



January 22, 2013

Crystal Tafoya

ConocoPhillips

Dear Crystal,

Attached you will find a detailed description of work performed on the:

SAN JUAN 30-6 #476,

API # 3003924469

If you need any further information or have any questions, please do not hesitate to call.
(505)419-3333

Respectfully submitted,

Brad Griffith

**Work Request:**

On January 7, 2013 Nelson Reveg was told that there was an estimated 30 barrels of produced water released from a tank on the SAN JUAN 30-6 #476 location. The excavation was recommended to be 18'x14'x5' deep.

Actions Performed:

Starting January 7, 2013 Nelson Reveg sent a hydroexcavation truck to location to start the cleanup. Due to temperatures well below freezing progress was slower than expected. On the third day of excavating a historical release was found at a depth of 3ft. The change in color to a dark black soil and strong odor gives reason to believe this stained soil was unrelated to the produced water release originally reported. Nelson Reveg excavated all of the visually contaminated soil, hauling the material to IEI Landfarm for disposal. The final excavation was approximately 18'x16'x7ft deep and was completed on January 21, 2013. On January 22, 2013 samples from the wall and floor were taken to Hall Environmental and ran for 8015 and 8021.

Conclusion:

After performing the site inspection and cleanup, Nelson Reveg feels confident that all contaminated soil has been removed. The attached results from the lab confirm the cleanup was successful.



Disclaimer:

All New Mexico Oil Conservation Division standards have been met and are in compliance by any work and services provided by Nelson Revegetation. The observations and determinations made by Nelson Revegetation are conclusions directly related to data collected on-site at that current time. Obviously circumstances can change and therefore no warranties are made to the accuracy of the data after the time of the assessment. There are many choices to perform this service and we thank you for using Nelson Revegetation.




Nelson Revegetation On-Site Form

Well Name SJ 30-6 #476 API# 3003924469

Section 28 Township 30 N Range 6 W County _____

Contractors On-Site Ø Time On-Site 830 Time Off-Site 930

Company Contracting For Composites Gallons of Water Used N/A # of potholes excavation

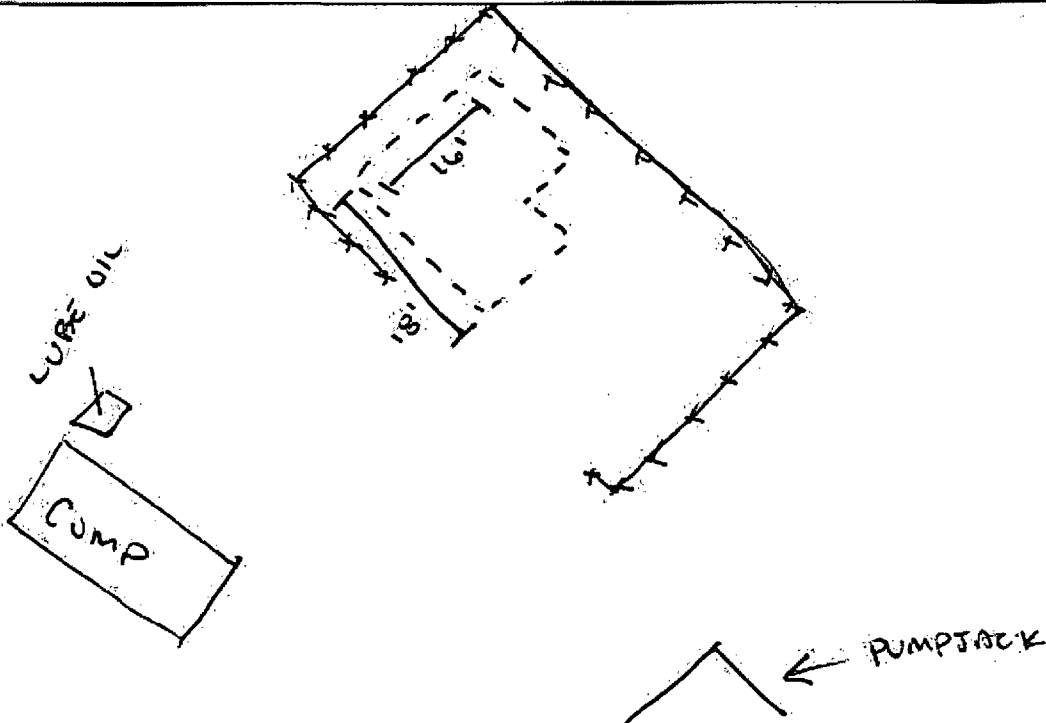

Site Diagram


- Comments
- COMPOSITE SAMPLES TAKEN FROM WALLS.
 - COMPOSITE SAMPLE TAKEN FROM FLOOR

Pothole #	Type of Line	Depth to line	Size of line	Description

Name BRAO GRIFFIN

Sign Bl Griffin

Date 1/22/13

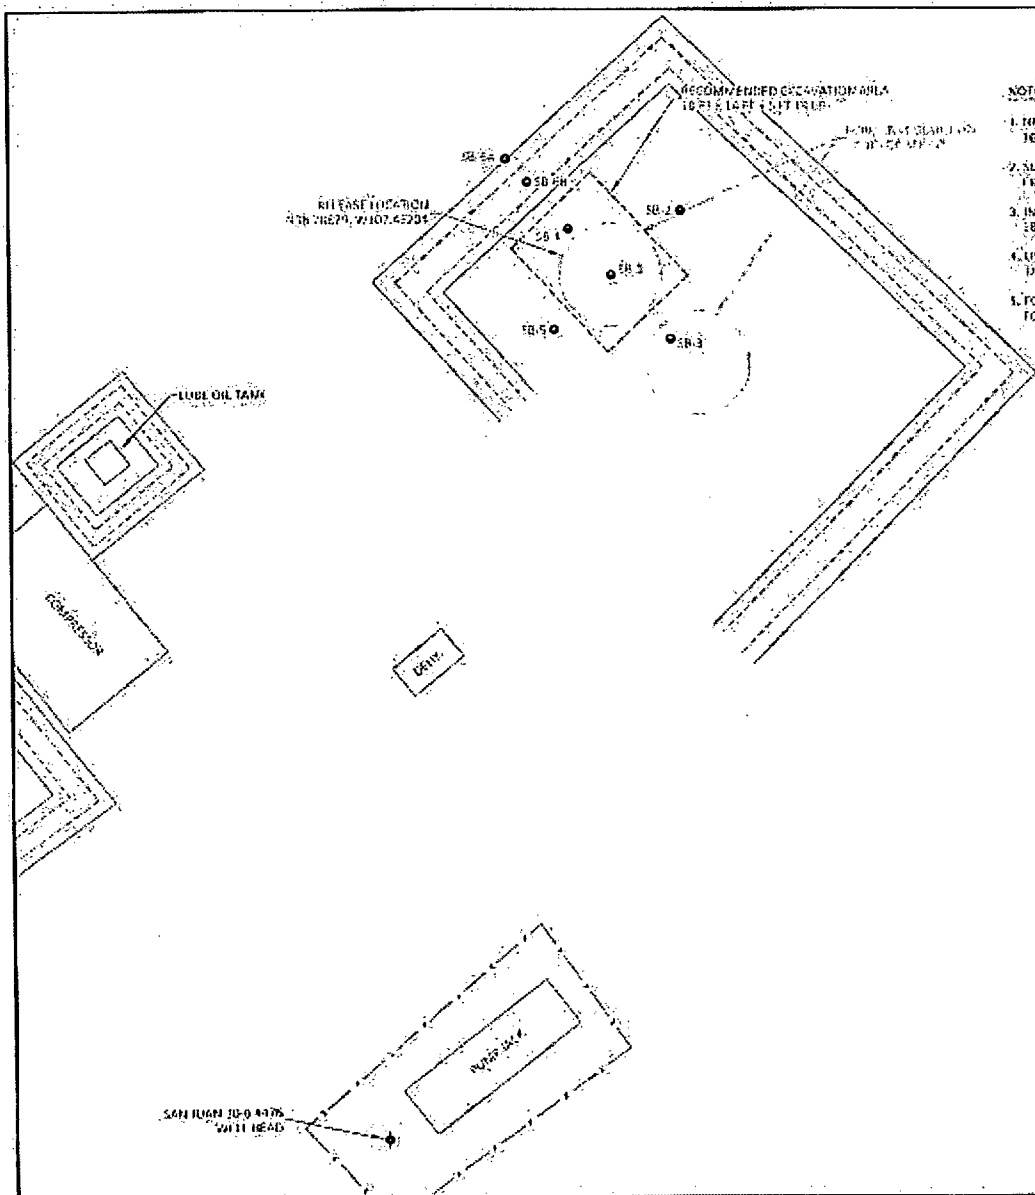

NOTES AND RECOMMENDATIONS

- INITIAL RISK RANK IS "20", RISK RADIATION STANDARD IS 1,000 mg/kg TPH, 10 mg/kg BENZENE AND 50 mg/kg TOTAL BTEX.
- SOIL BODIES SB-5A AND SB-6A WERE ATTEMPTED SOIL BODIES. DUE TO FROZEN SURFACE, AUGER REFUSAL WAS ENCOUNTERED AT 1 INCH.
- INITIAL RECOMMENDED EXCAVATED AREA WOULD BE APPROXIMATELY 18 FEET x 14 FEET x 1 FT DEEP.
- USE EPA-PID ACTION LEVEL OF 100 ppm ANTH IN WETTED SCREENING TO DETERMINE FINAL EXCAVATION EXTENTS.
- FOLLOWING COMPLETION OF EXCAVATION, COLLECT ADDITIONAL SAMPLES FOR CONFIRMATION.

Field Screening Results				
Sample ID	Date	Depth (ft)	OSMA PID (ppm)	TPH (mg/kg)
EPA ACTION LEVEL				
SB-1	12/25/12	0.5	436	>12,500
		2	707	1,500
		4	27.3	730
		6	2.1	<10.0
		8	1.0	65.0
SB-2	12/26/12	0.5	0.0	<20.0
		2	0.7	NA
		4	1.6	<20.0
SB-3	12/26/12	0.5	2.3	NA
		2	0.5	NA
		4	0.1	<20.0
SB-4	12/25/12	0.5	41.5	2,010
		2	1.8	<10.0
		0.5	0.8	NA
SB-5	12/26/12	2	0.4	NA
		4	1.0	<20.0
SB-6A	12/26/12	Surface	NA	NA
SB-10	12/26/12	Surface	NA	NA

NA = NOT ANALYZED

FIGURE 3

INITIAL ASSESSMENT SOIL SAMPLE LOCATIONS, RESULTS, AND RECOMMENDATIONS, DECEMBER 2012

ConocoPhillips

SAN JUAN 10-0-4176

ECO ARIZONA COUNTY, NEW MEXICO

NE, NE, SECTION 20, T10N, R6W

N 107.62735, W 107.62734



Arizona Environmental Services, LLC

DRAWN BY:

C. Lamerton

DATE DRAWN:

December 18, 2012

REVISIONS BY:

C. Lamerton

DATE REVISION:

December 18, 2012

CHECKED BY:

D. Watson

DATE CHECKED:

December 25, 2012

APPROVED BY:


E. McNulty


DATE APPROVED:

December 26, 2012

LEGEND

● SAMPLE LOCATIONS

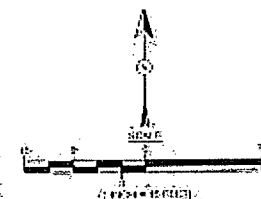

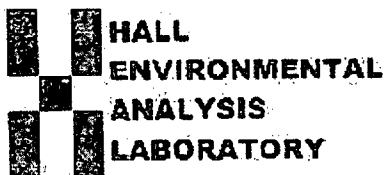

Hall Environmental Analysis Laboratory
4901 Hawkins NE
Albuquerque, NM 87109
TEL: 505-345-3975 FAX: 505-345-4107
Website: www.hallenvironmental.com

January 28, 2013

Crystal Tafoya
Conoco Phillips
5525 Hwy 64 (3401 E 30th St)
Farmington, NM 87402
TEL: (505) 215-4361
FAX

RE: SJ 30-6 #476

OrderNo.: 1301771

Dear Crystal Tafoya:

Hall Environmental Analysis Laboratory received 2 sample(s) on 1/23/2013 for the analyses presented in the following report:

These were analyzed according to EPA procedures or equivalent. To access our accredited tests please go to www.hallenvironmental.com or the state specific web sites. See the sample checklist and/or the Chain of Custody for information regarding the sample receipt temperature and preservation. Data qualifiers or a narrative will be provided if the sample analysis or analytical quality control parameters require a flag. All samples are reported as received unless otherwise indicated. Lab measurement of analytes considered field parameters that require analysis within 15 minutes of sampling such as pH and residual chlorine are qualified as being analyzed outside of the recommended holding time.

Please don't hesitate to contact HEAL for any additional information or clarifications.

Sincerely,

Andy Freeman
Laboratory Manager
4901 Hawkins NE
Albuquerque, NM 87109

Analytical Report
 Lab Order 1301771
 Date Reported: 1/28/2013

Hall Environmental Analysis Laboratory, Inc.

CLIENT: Conoco Phillips

Client Sample ID: Wall Comp

Project: SJ 30-6 #476

Collection Date: 1/22/2013 9:07:00 AM

Lab ID: 1301771-001

Matrix: SOIL

Received Date: 1/23/2013 10:05:00 AM

Analyses	Result	RL	Qual	Units	DF	Date Analyzed
EPA METHOD 8015B: DIESEL RANGE ORGANICS						Analyst: MMD
Diesel Range Organics (DRO)	ND	9.6		mg/Kg	1	1/26/2013 6:59:23 AM
Sum: DNOP	96.3	72.4-120		%REC	1	1/26/2013 6:59:23 AM
EPA METHOD 8015B: GASOLINE RANGE						Analyst: NSB
Gasoline Range Organics (GRO)	ND	4.9		mg/Kg	1	1/24/2013 6:59:08 PM
Sum: SFB	102	84-116		%REC	1	1/24/2013 6:59:08 PM
EPA METHOD 8021B: VOLATILES						Analyst: NSB
Benzene	ND	0.049		mg/Kg	1	1/24/2013 6:59:08 PM
Toluene	ND	0.049		mg/Kg	1	1/24/2013 6:59:08 PM
Ethylbenzene	ND	0.049		mg/Kg	1	1/24/2013 6:59:08 PM
Xylenes, Total	ND	0.097		mg/Kg	1	1/24/2013 6:59:08 PM
Sum: 4-Bromofluorobenzene	109	80-120		%REC	1	1/24/2013 6:59:08 PM

Qualifiers:

- * Value exceeds Maximum Contaminant Level
- E Value above quantitation range
- J Analyte detected below quantitation limits
- P Sample pH greater than 2
- RL Reporting Detection Limit

- B Analyte detected in the associated Method Blank
- H Holding times for preparation or analysis exceeded
- ND Not Detected at the Reporting Limit
- R RPD outside accepted recovery limits
- S Spike Recovery outside accepted recovery limits

Analytical Report

Lab Order 1301771

Date Reported: 1/28/2013

Hall Environmental Analysis Laboratory, Inc.

CLIENT: Conoco Phillips

Client Sample ID: Floor Comp

Project: SJ-30-6-#476

Collection Date: 1/22/2013 9:14:00 AM

Lab ID: 1301771-002

Matrix: SOIL

Received Date: 1/23/2013 10:05:00 AM

Analyses	Result	RL	Qual	Units	DF	Date Analyzed
EPA METHOD 8015B: DIESEL RANGE ORGANICS						Analyst: MMD
Diesel Range Organics (DRO)	ND	9.9		mg/Kg	1	1/26/2013 7:26:22 AM
Surr: DNOP	95.5	72.4-120		%REC	1	1/26/2013 7:26:22 AM
EPA METHOD 8015B: GASOLINE RANGE						Analyst: NSB
Gasoline Range Organics (GRO)	ND	4.9		mg/Kg	1	1/24/2013 7:27:58 PM
Surr: BFB	101	84-118		%REC	1	1/24/2013 7:27:58 PM
EPA METHOD 8021B: VOLATILES						Analyst: NSB
Benzene	ND	0.049		mg/Kg	1	1/24/2013 7:27:58 PM
Toluene	ND	0.049		mg/Kg	1	1/24/2013 7:27:58 PM
Ethylbenzene	ND	0.049		mg/Kg	1	1/24/2013 7:27:58 PM
Xylenes: Total	ND	0.098		mg/Kg	1	1/24/2013 7:27:58 PM
Surr: 4-Bromofluorobenzene	109	80-120		%REC	1	1/24/2013 7:27:58 PM

Qualifiers:

- ** Value exceeds Maximum Contaminant Level
- E- Value above quantitation range
- J- Analyte detected below quantitation limits
- P- Sample pH greater than 2
- RL- Reporting Detection Limit

- B- Analyte detected in the associated Method Blank
- H- Holding times for preparation or analysis exceeded
- ND- Not Detected at the Reporting Limit
- R- RPD outside accepted recovery limits
- S- Spike Recovery outside accepted recovery limits

QC SUMMARY REPORT

Hall Environmental Analysis Laboratory, Inc.

WO#: 1301771

28-Jan-13

Client: Conoco Phillips

Project: SJ 30-6 #476

Sample ID: MB-5800	SampType: MBLK	TestCode: EPA Method 8015B: Diesel Range Organics								
Client ID: PBS	Batch ID: 5800	RunNo: 8204								
Prep Date: 1/23/2013	Analysis Date: 1/23/2013	SeqNo: 237348 Units: %REC								
Analyte	Result	PQL	SPK value	SPK Ref Val	%REC	LowLimit	HighLimit	%RPD	RPDLimit	Qual
Surr: DNOF	10		10.00		103	72.4	120			

Sample ID: LCS-5800	SampType: LCS	TestCode: EPA Method 8015B: Diesel Range Organics								
Client ID: LCSS	Batch ID: 5800	RunNo: 8204								
Prep Date: 1/23/2013	Analysis Date: 1/23/2013	SeqNo: 237349 Units: %REC								
Analyte	Result	PQL	SPK value	SPK Ref Val	%REC	LowLimit	HighLimit	%RPD	RPDLimit	Qual
Surr: DNOP	5.5		5.000		109	72.4	120			

Sample ID: MB-5814	SampType: MBLK	TestCode: EPA Method 8015B: Diesel Range Organics								
Client ID: PBS	Batch ID: 5814	RunNo: 8204								
Prep Date: 1/24/2013	Analysis Date: 1/24/2013	SeqNo: 238133 Units: mg/Kg								
Analyte	Result	PQL	SPK value	SPK Ref Val	%REC	LowLimit	HighLimit	%RPD	RPDLimit	Qual
Diesel Range Organics (DRO)	ND	10								
Surr: DNOP	9.8		10.00		97.7	72.4	120			

Sample ID: LCS-5814	SampType: LCS	TestCode: EPA Method 8015B: Diesel Range Organics								
Client ID: LCSS	Batch ID: 5814	RunNo: 8204								
Prep Date: 1/24/2013	Analysis Date: 1/24/2013	SeqNo: 238134 Units: mg/Kg								
Analyte	Result	PQL	SPK value	SPK Ref Val	%REC	LowLimit	HighLimit	%RPD	RPDLimit	Qual
Diesel Range Organics (DRO)	49	10	50.00	0	97.0	47.4	122			
Surr: DNOP	5.4		5.000		109	72.4	120			

Qualifiers:

- * Value exceeds Maximum Contaminant Level
- E Value above quantitation range
- J Analyte detected below quantitation limits
- P Sample pH greater than 2

- B Analyte detected in the associated Method Blank
- H Holding times for preparation or analysis exceeded
- ND Not Detected at the Reporting Limit
- R RPD outside accepted recovery limits

QC SUMMARY REPORT

Hall Environmental Analysis Laboratory, Inc.

WO#: 1301771

28-Jan-13

Client: Conoco Phillips

Project: SJ 30-6 #476

Sample ID: MB-5805	SampType: MBLK	TestCode: EPA Method 8015B: Gasoline Range
Client ID: PBS	Batch ID: 5805	RunNo: 8244
Prep Date: 1/23/2013	Analysis Date: 1/24/2013	SeqNo: 238379 Units: mg/Kg
Analyte	Result	PQL SPK value SPK Ref Val %REC LowLimit HighLimit %RPD RPDLimit Qual
Gasoline Range Organics (GRO)	ND	5.0
Surr: BFB	1000	1000 102 84 116

Sample ID: LCS-5805	SampType: LCS	TestCode: EPA Method 8015B: Gasoline Range
Client ID: LCSS	Batch ID: 5805	RunNo: 8244
Prep Date: 1/23/2013	Analysis Date: 1/24/2013	SeqNo: 238380 Units: mg/Kg
Analyte	Result	PQL SPK value SPK Ref Val %REC LowLimit HighLimit %RPD RPDLimit Qual
Gasoline Range Organics (GRO)	29	5.0 25.00 0 116 74 117
Surr: BFB	1100	1000 108 84 116

Sample ID: MB-5805	SampType: MBLK	TestCode: EPA Method 8015B: Gasoline Range
Client ID: PBS	Batch ID: R8244	RunNo: 8244
Prep Date: 1/23/2013	Analysis Date: 1/24/2013	SeqNo: 238469 Units: %REC
Analyte	Result	PQL SPK value SPK Ref Val %REC LowLimit HighLimit %RPD RPDLimit Qual
Surr: BFB	1000	1000 102 84 116

Sample ID: LCS-5805	SampType: LCS	TestCode: EPA Method 8015B: Gasoline Range
Client ID: LCSS	Batch ID: R8244	RunNo: 8244
Prep Date: 1/23/2013	Analysis Date: 1/24/2013	SeqNo: 238470 Units: %REC
Analyte	Result	PQL SPK value SPK Ref Val %REC LowLimit HighLimit %RPD RPDLimit Qual
Surr: BFB	1100	1000 108 84 116

Qualifiers:

- * Value exceeds Maximum Contaminant Level.
- E Value above quantitation range
- J Analyte detected below quantitation limits
- P Sample pH greater than 2
- B Analyte detected in the associated Method Blank
- H Holding times for preparation or analysis exceeded
- ND Not Detected at the Reporting Limit
- R RPD outside accepted recovery limits

QC SUMMARY REPORT

Hall Environmental Analysis Laboratory, Inc.

WO#: 1301771

28-Jan-13

Client: Conoco Phillips

Project: SL30-6 #176

Sample ID: MB-5805	SampType: MBLK	TestCode: EPA Method 8021B: Volatiles								
Client ID: PBS	Batch ID: 5805	RunNo: 8244								
Prep Date: 1/23/2013	Analysis Date: 1/24/2013	SeqNo: 238402 Units: mg/Kg								
Analyte	Result	PQL	SPK value	SPK Ref Val	%REC	LowLimit	HighLimit	%RPD	RPDLimit	Qual
Benzene	ND	0.050								
Toluene	ND	0.050								
Ethylbenzene	ND	0.050								
Xylenes, Total	ND	0.10								
Sum: 4-Bromofluorobenzene	1.1		1.000		113	80	120			

Sample ID: LCS-5805	SampType: LCS	TestCode: EPA Method 8021B: Volatiles								
Client ID: LCSS	Batch ID: 5805	RunNo: 8244								
Prep Date: 1/23/2013	Analysis Date: 1/24/2013	SeqNo: 238403 Units: mg/Kg								
Analyte	Result	PQL	SPK value	SPK Ref Val	%REC	LowLimit	HighLimit	%RPD	RPDLimit	Qual
Benzene	1.0	0.050	1.000	0	104	80	120			
Toluene	1.0	0.050	1.000	0	104	80	120			
Ethylbenzene	1.1	0.050	1.000	0	106	80	120			
Xylenes, Total	3.2	0.10	3.000	0	106	80	120			
Sum: 4-Bromofluorobenzene	1.1		1.000		110	80	120			


Sample ID: MB-5805	SampType: MBLK	TestCode: EPA-Method 8021B: Volatiles								
Client ID: PBS	Batch ID: R8244	RunNo: 8244								
Prep Date: 1/23/2013	Analysis Date: 1/24/2013	SeqNo: 238467 Units: %REC								
Analyte	Result	PQL	SPK Value	SPK Ref Val	%REC	LowLimit	HighLimit	%RPD	RPDLimit	Qual
Sum: 4-Bromofluorobenzene	1.1		1.000		113	80	120			

Sample ID: LCS-5805	SampType: LCS	TestCode: EPA Method 8021B: Volatiles								
Client ID: LCSS	Batch ID: R8244	RunNo: 8244								
Prep Date: 1/23/2013	Analysis Date: 1/24/2013	SeqNo: 238468 Units: %REC								
Analyte	Result	PQL	SPK value	SPK Ref Val	%REC	LowLimit	HighLimit	%RPD	RPDLimit	Qual
Sum: 4-Bromofluorobenzene	1.1		1.000		110	80	120			

Qualifiers:

- * Value exceeds Maximum Contaminant Level
- E Value above quantitation range
- J Analyte detected below quantitation limits
- P Sample pH greater than 2

- B Analyte detected in the associated Method Blank
- H Holding times for preparation or analysis exceeded
- ND Not Detected at the Reporting Limit
- R RPD outside accepted recovery limits

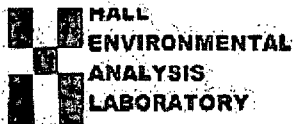

Hall Environmental Analysis Laboratory
4901 Hawkins NE
Albuquerque, NM 87110
TEL: 505-345-3975 FAX: 505-345-4107
Website: www.hallenvironmental.com

Sample Log-In Check List

Client Name: Conoco Phillips Farm, HWY 64 Work Order Number: 1301771

Received by/date: AG 01/23/13

Logged By: Anne Thorne 1/23/2013 10:05:00 AM

Completed By: Anne Thorne 1/23/2013

Reviewed By: [Signature] 01/23/13

Chain of Custody

1. Were seals intact? Yes ☐ No ☐ Not Present ☒
2. Is Chain of Custody complete? Yes ☒ No ☐ Not Present ☐
3. How was the sample delivered? Courier

Log In

4. Coolers are present? (see 19 for cooler specific information) Yes ☒ No ☐ NA ☐
5. Was an attempt made to cool the samples? Yes ☒ No ☐ NA ☐
6. Were all samples received at a temperature of $>0^{\circ}\text{C}$ to 6.0°C ? Yes ☒ No ☐ NA ☐
7. Sample(s) in proper container(s)? Yes ☒ No ☐
8. Sufficient sample volume for indicated test(s)? Yes ☒ No ☐
9. Are samples (except VOA and ONG) properly preserved? Yes ☒ No ☐
10. Was preservative added to bottles? Yes ☐ No ☒ NA ☐
11. VOA vials have zero headspace? Yes ☐ No ☐ No VOA Vials ☒
12. Were any sample containers received broken? Yes ☐ No ☒
13. Does paperwork match bottle labels?
(Note discrepancies on chain of custody) Yes ☒ No ☐
14. Are matrices correctly identified on Chain of Custody? Yes ☒ No ☐
15. Is it clear what analyses were requested? Yes ☒ No ☐
16. Were all holding times able to be met?
(If no, notify customer for authorization) Yes ☒ No ☐

of preserved
bottles checked
for pH:

(<2 or >12 unless noted)

Adjusted? _____

Checked by: _____

Special Handling (if applicable)

17. Was client notified of all discrepancies with this order? Yes ☐ No ☐ NA ☒

Person Notified: _____

Date: _____

By Whom: _____

Via: ☐ eMail ☐ Phone ☐ Fax ☐ In Person

Regarding: _____

Client Instructions: _____

18. Additional remarks: _____

19. Cooler Information

Cooler No.	Temp $^{\circ}\text{C}$	Condition	Seal Intact	Seal No.	Seal Date	Signed By
1	11.0	Good	Yes			

Chain-of-Custody Record		Turn-Around Time:	
Client: <u>Canoco Phillips</u>		☒ Standard ☐ Rush	
Mailing Address: <u>HWY 64</u>		Project Name: <u>SS 30-4 #476</u>	
Phone #: <u>505-215-4361</u>		Project #: _____	
email or Fax#: <u>SJBV</u>		Project Manager: <u>CRYSTAL TAPAYA</u>	
QA/QC Package:		Sampler: <u>BRAD GRIFFITH</u>	
☒ Standard ☐ Level 4 (Full Validation)		On Ice: ☒ Yes ☐ No	
Accreditation:		Sample Temperature: <u>10°C</u>	
☐ NELAP ☐ Other: _____			
☐ EDD (Type): _____			

☒ Standard ☐ Rush

SI 30-4 #476

Project #:

Project Manager:

CRYSTAL TAPPOYA

Sampler: **BRAD GRIFFITH**

On Ice: ☒ Yes ☐ No

Sample temperature: 100°C

[illegible]

Date:	Time:	Relinquished by:	Received by:	Date:	Time:
1/22/13	1546	BELGAPK	Christine Waelen	1/22/13	1546
Date:	Time:	Relinquished by:	Received by:	Date:	Time:
1/22/13	1648	Christine Waelen	DR	01/23/13	1005



HALL ENVIRONMENTAL ANALYSIS LABORATORY

www.hallenvironmental.com

4901 Hawkins NE - Albuquerque, NM 87109

Tel: 505-345-3975 Fax: 505-345-4107

Analysis Request

[illegible]

Remarks: COFO
PO: KGARCIA
9391088

If necessary, samples submitted to Hall Environmental may be subcontracted to other accredited laboratories. This serves as notice of this possibility. Any sub-contracted data will be clearly notated on the analytical report.