District I
1625 N. French Dr., Hobbs, NM 88240
District II
811 S. First St., Artesia, NM 88210
District III
1000 Rio Brazos Road, Aztec, NM 87410
District IV
1220 S. St. Francis Dr., Santa Fe, NM 87505

State of New Mexico Energy Minerals and Natural Resources Department Oil Conservation Division 1220 South St. Francis Dr.

Form C-144 Revised June 6, 2013

For temporary pits, below-grade tanks, and multi-well fluid management pits, submit to the appropriate NMOCD District Office.

For permanent pits submit to the Santa Fe Environmental Bureau office and provide a copy to the appropriate NMOCD District Office.

1	4	7	7		
١	5	٦	7	1	

Proposed Alternative Method Permit or Closure Plan Application

Santa Fe, NM 87505

Froposed Alternative Method Fermit of Closure Flan Application
Type of action: Below grade tank registration Permit of a pit or proposed alternative method Closure of a pit, below-grade tank, or proposed alternative method Modification to an existing permit/or registration Closure plan only submitted for an existing permitted or non-permitted pit, below-grade tank, or proposed alternative method
Instructions: Please submit one application (Form C-144) per individual pit, below-grade tank or alternative request
Please be advised that approval of this request does not relieve the operator of liability should operations result in pollution of surface water, ground water or the nvironment. Nor does approval relieve the operator of its responsibility to comply with any other applicable governmental authority's rules, regulations or ordinances.
Operator: ConocoPhillips Company OGRID #: 217817 OJL CONS. DIV DIST. 3
Address: PO BOX 4289, Farmington, NM 87499 Facility or well name: SAN JUAN 29-6 UNIT 72A
API Number:30-039-21344 OCD Permit Number:
U/L or Qtr/Qtr _ F
Pit: Subsection F, G or J of 19.15.17.11 NMAC
3. Below-grade tank: Subsection I of 19.15.17.11 NMAC Volume:
4. Alternative Method: Submittal of an exception request is required. Exceptions must be submitted to the Santa Fe Environmental Bureau office for consideration of approval.
s. Fencing: Subsection D of 19.15.17.11 NMAC (Applies to permanent pits, temporary pits, and below-grade tanks) □ Chain link, six feet in height, two strands of barbed wire at top (Required if located within 1000 feet of a permanent residence, school, hospital, institution or church) □ Four foot height, four strands of barbed wire evenly spaced between one and four feet □ Alternate. Please specify

6. Netting: Subsection E of 19.15.17.11 NMAC (Applies to permanent pits and permanent open top tanks)	
☐ Screen ☐ Netting ☐ Other	
☐ Monthly inspections (If netting or screening is not physically feasible)	
7.	
Signs: Subsection C of 19.15.17.11 NMAC	
☐ 12"x 24", 2" lettering, providing Operator's name, site location, and emergency telephone numbers	
☐ Signed in compliance with 19.15.16.8 NMAC	
8.	
Variances and Exceptions:	
Justifications and/or demonstrations of equivalency are required. Please refer to 19.15.17 NMAC for guidance. Please check a box if one or more of the following is requested, if not leave blank:	
Variance(s): Requests must be submitted to the appropriate division district for consideration of approval.	
Exception(s): Requests must be submitted to the Santa Fe Environmental Bureau office for consideration of approval.	
9	
Siting Criteria (regarding permitting): 19.15.17.10 NMAC	-1-11
Instructions: The applicant must demonstrate compliance for each siting criteria below in the application. Recommendations of acceptanterial are provided below. Siting criteria does not apply to drying pads or above-grade tanks.	ptable source
General siting	
Ground water is less than 25 feet below the bottom of a low chloride temporary pit or below-grade tank. - □ NM Office of the State Engineer - iWATERS database search; □ USGS; □ Data obtained from nearby wells	☐ Yes ☐ No ☐ NA
	Yes No
Ground water is less than 50 feet below the bottom of a Temporary pit, permanent pit, or Multi-Well Fluid Management pit. NM Office of the State Engineer - iWATERS database search; USGS; Data obtained from nearby wells	NA NA
Within incorporated municipal boundaries or within a defined municipal fresh water well field covered under a municipal ordinance	☐ Yes ☐ No
adopted pursuant to NMSA 1978, Section 3-27-3, as amended. (Does not apply to below grade tanks) - Written confirmation or verification from the municipality; Written approval obtained from the municipality	
Within the area overlying a subsurface mine. (Does not apply to below grade tanks) - Written confirmation or verification or map from the NM EMNRD-Mining and Mineral Division	☐ Yes ☐ No
 Within an unstable area. (Does not apply to below grade tanks) Engineering measures incorporated into the design; NM Bureau of Geology & Mineral Resources; USGS; NM Geological Society; Topographic map 	☐ Yes ☐ No
Within a 100-year floodplain. (Does not apply to below grade tanks)	☐ Yes ☐ No
- FEMA map	
Below Grade Tanks	
Within 100 feet of a continuously flowing watercourse, significant watercourse, lake bed, sinkhole, wetland or playa lake (measured	☐ Yes ☑ No
from the ordinary high-water mark). - Topographic map; Visual inspection (certification) of the proposed site	
Within 200 horizontal feet of a spring or a fresh water well used for public or livestock consumption;.	☐ Yes ☑ No
- NM Office of the State Engineer - iWATERS database search; Visual inspection (certification) of the proposed site	L 163 Z No
Temporary Pit using Low Chloride Drilling Fluid (maximum chloride content 15,000 mg/liter)	
Within 100 feet of a continuously flowing watercourse, or any other significant watercourse or within 200 feet of any lakebed, sinkhole,	☐ Yes ☐ No
or playa lake (measured from the ordinary high-water mark). (Applies to low chloride temporary pits.) - Topographic map; Visual inspection (certification) of the proposed site	
Within 300 feet from a occupied permanent residence, school, hospital, institution, or church in existence at the time of initial	☐ Yes ☐ No
 application. Visual inspection (certification) of the proposed site; Aerial photo; Satellite image 	
Within 200 horizontal feet of a spring or a private, domestic fresh water well used by less than five households for domestic or stock	
watering purposes, or 300feet of any other fresh water well or spring, in existence at the time of the initial application. NM Office of the State Engineer - iWATERS database search; Visual inspection (certification) of the proposed site	Yes No

Within 100 feet of a wetland. - ' US Fish and Wildlife Wetland Identification map; Topographic map; Visual inspection (certification) of the proposed site	☐ Yes ☐ No
Temporary Pit Non-low chloride drilling fluid	
Within 300 feet of a continuously flowing watercourse, or any other significant watercourse, or within 200 feet of any lakebed, sinkhole, or playa lake (measured from the ordinary high-water mark). - Topographic map; Visual inspection (certification) of the proposed site	☐ Yes ☐ No
Within 300 feet from a permanent residence, school, hospital, institution, or church in existence at the time of initial application. - Visual inspection (certification) of the proposed site; Aerial photo; Satellite image	☐ Yes ☐ No
Within 500 horizontal feet of a spring or a private, domestic fresh water well used by less than five households for domestic or stock watering purposes, or 1000 feet of any other fresh water well or spring, in the existence at the time of the initial application; - NM Office of the State Engineer - iWATERS database search; Visual inspection (certification) of the proposed site	☐ Yes ☐ No
Within 300 feet of a wetland. - US Fish and Wildlife Wetland Identification map; Topographic map; Visual inspection (certification) of the proposed site	☐ Yes ☐ No
Permanent Pit or Multi-Well Fluid Management Pit	
Within 300 feet of a continuously flowing watercourse, or 200 feet of any other significant watercourse, or lakebed, sinkhole, or playa lake (measured from the ordinary high-water mark). - Topographic map; Visual inspection (certification) of the proposed site	☐ Yes ☐ No
Within 1000 feet from a permanent residence, school, hospital, institution, or church in existence at the time of initial application. - Visual inspection (certification) of the proposed site; Aerial photo; Satellite image	☐ Yes ☐ No
Within 500 horizontal feet of a spring or a fresh water well used for domestic or stock watering purposes, in existence at the time of initial application. - NM Office of the State Engineer - iWATERS database search; Visual inspection (certification) of the proposed site	☐ Yes ☐ No
Within 500 feet of a wetland. - US Fish and Wildlife Wetland Identification map; Topographic map; Visual inspection (certification) of the proposed site	☐ Yes ☐ No
Temporary Pits, Emergency Pits, and Below-grade Tanks Permit Application Attachment Checklist: Subsection B of 19.15.17.9 Natural Instructions: Each of the following items must be attached to the application. Please indicate, by a check mark in the box, that the do attached. Hydrogeologic Report (Below-grade Tanks) - based upon the requirements of Paragraph (4) of Subsection B of 19.15.17.9 NMAC Hydrogeologic Data (Temporary and Emergency Pits) - based upon the requirements of Paragraph (2) of Subsection B of 19.15.17.9 Siting Criteria Compliance Demonstrations - based upon the appropriate requirements of 19.15.17.10 NMAC Design Plan - based upon the appropriate requirements of 19.15.17.11 NMAC Operating and Maintenance Plan - based upon the appropriate requirements of 19.15.17.12 NMAC Closure Plan (Please complete Boxes 14 through 18, if applicable) - based upon the appropriate requirements of Subsection C of 19. and 19.15.17.13 NMAC Previously Approved Design (attach copy of design) API Number: or Permit Number: or Permit Number:	NMAC 15.17.9 NMAC
11. Multi-Well Fluid Management Pit Checklist: Subsection B of 19.15.17.9 NMAC	
Instructions: Each of the following items must be attached to the application. Please indicate, by a check mark in the box, that the do attached. Design Plan - based upon the appropriate requirements of 19.15.17.11 NMAC Design Plan - based upon the appropriate requirements of 19.15.17.12 NMAC A List of wells with approved application for permit to drill associated with the pit. Closure Plan (Please complete Boxes 14 through 18, if applicable) - based upon the appropriate requirements of Subsection C of 19 and 19.15.17.13 NMAC Hydrogeologic Data - based upon the requirements of Paragraph (4) of Subsection B of 19.15.17.9 NMAC Siting Criteria Compliance Demonstrations - based upon the appropriate requirements of 19.15.17.10 NMAC Previously Approved Design (attach copy of design) API Number: or Permit Number:	.15.17.9 NMAC

Permanent Pits Permit Application Checklist: Subsection B of 19.15.17.9 NMAC Instructions: Each of the following items must be attached to the application. Please indicate, by a check mark in the box, that the attached.	documents are
Hydrogeologic Report - based upon the requirements of Paragraph (1) of Subsection B of 19.15.17.9 NMAC Siting Criteria Compliance Demonstrations - based upon the appropriate requirements of 19.15.17.10 NMAC Climatological Factors Assessment Certified Engineering Design Plans - based upon the appropriate requirements of 19.15.17.11 NMAC Dike Protection and Structural Integrity Design - based upon the appropriate requirements of 19.15.17.11 NMAC Leak Detection Design - based upon the appropriate requirements of 19.15.17.11 NMAC Liner Specifications and Compatibility Assessment - based upon the appropriate requirements of 19.15.17.11 NMAC Quality Control/Quality Assurance Construction and Installation Plan Operating and Maintenance Plan - based upon the appropriate requirements of 19.15.17.12 NMAC Freeboard and Overtopping Prevention Plan - based upon the appropriate requirements of 19.15.17.11 NMAC Nuisance or Hazardous Odors, including H₂S, Prevention Plan Emergency Response Plan Oil Field Waste Stream Characterization Monitoring and Inspection Plan Erosion Control Plan Closure Plan - based upon the appropriate requirements of Subsection C of 19.15.17.9 NMAC and 19.15.17.13 NMAC Instructions: Please complete the applicable boxes, Boxes 14 through 18, in regards to the proposed closure plan. Type: □ Drilling □ Workover □ Emergency □ Cavitation □ P&A □ Permanent Pit □ Below-grade Tank □ Multi-well F □ Alternative Proposed Closure Method: ☑ Waste Excavation and Removal	luid Management Pit
 ☐ Waste Removal (Closed-loop systems only) ☐ On-site Closure Method (Only for temporary pits and closed-loop systems) ☐ In-place Burial ☐ On-site Trench Burial ☐ Alternative Closure Method 	
14. Waste Excavation and Removal Closure Plan Checklist: (19.15.17.13 NMAC) Instructions: Each of the following items must be	attached to the
closure plan. Please indicate, by a check mark in the box, that the documents are attached. ☐ Protocols and Procedures - based upon the appropriate requirements of 19.15.17.13 NMAC ☐ Confirmation Sampling Plan (if applicable) - based upon the appropriate requirements of Subsection C of 19.15.17.13 NMAC ☐ Disposal Facility Name and Permit Number (for liquids, drilling fluids and drill cuttings) ☐ Soil Backfill and Cover Design Specifications - based upon the appropriate requirements of Subsection H of 19.15.17.13 NMAC ☐ Re-vegetation Plan - based upon the appropriate requirements of Subsection H of 19.15.17.13 NMAC ☐ Site Reclamation Plan - based upon the appropriate requirements of Subsection H of 19.15.17.13 NMAC	
Siting Criteria (regarding on-site closure methods only): 19.15.17.10 NMAC Instructions: Each siting criteria requires a demonstration of compliance in the closure plan. Recommendations of acceptable sour provided below. Requests regarding changes to certain siting criteria require justifications and/or demonstrations of equivalency. F 19.15.17.10 NMAC for guidance.	
Ground water is less than 25 feet below the bottom of the buried waste. - NM Office of the State Engineer - iWATERS database search; USGS; Data obtained from nearby wells	☐ Yes ☐ No ☐ NA
Ground water is between 25-50 feet below the bottom of the buried waste - NM Office of the State Engineer - iWATERS database search; USGS; Data obtained from nearby wells	☐ Yes ☐ No ☐ NA
Ground water is more than 100 feet below the bottom of the buried waste. - NM Office of the State Engineer - iWATERS database search; USGS; Data obtained from nearby wells	☐ Yes ☐ No ☐ NA
Within 100 feet of a continuously flowing watercourse, or 200 feet of any other significant watercourse, lakebed, sinkhole, or playa lake (measured from the ordinary high-water mark). - Topographic map; Visual inspection (certification) of the proposed site	☐ Yes ☐ No
Within 300 feet from a permanent residence, school, hospital, institution, or church in existence at the time of initial application. - Visual inspection (certification) of the proposed site; Aerial photo; Satellite image	☐ Yes ☐ No
Within 300 horizontal feet of a private, domestic fresh water well or spring used for domestic or stock watering purposes, in existence at the time of initial application. - NM Office of the State Engineer - iWATERS database; Visual inspection (certification) of the proposed site	☐ Yes ☐ No
Written confirmation or verification from the municipality; Written approval obtained from the municipality	☐ Yes ☐ No
Within 300 feet of a wetland. US Fish and Wildlife Wetland Identification map; Topographic map; Visual inspection (certification) of the proposed site	☐ Yes ☐ No
Within incorporated municipal boundaries or within a defined municipal fresh water well field covered under a municipal ordinance	

-1-sted supposed to NIMCA 1079 Continu 2 27 2 as amonded	
adopted pursuant to NMSA 1978, Section 3-27-3, as amended. - ' Written confirmation or verification from the municipality; Written approval obtained from the municipality	☐ Yes ☐ No
Within the area overlying a subsurface mine Written confirmation or verification or map from the NM EMNRD-Mining and Mineral Division	☐ Yes ☐ No
Within an unstable area.	
 Engineering measures incorporated into the design; NM Bureau of Geology & Mineral Resources; USGS; NM Geological Society; Topographic map 	☐ Yes ☐ No
Within a 100-year floodplain FEMA map	☐ Yes ☐ No
On-Site Closure Plan Checklist: (19.15.17.13 NMAC) Instructions: Each of the following items must be attached to the closure play a check mark in the box, that the documents are attached.	an. Please indicate,
Siting Criteria Compliance Demonstrations - based upon the appropriate requirements of 19.15.17.10 NMAC Proof of Surface Owner Notice - based upon the appropriate requirements of Subsection E of 19.15.17.13 NMAC Construction/Design Plan of Burial Trench (if applicable) based upon the appropriate requirements of Subsection K of 19.15.17. Construction/Design Plan of Temporary Pit (for in-place burial of a drying pad) - based upon the appropriate requirements of 19. Protocols and Procedures - based upon the appropriate requirements of 19.15.17.13 NMAC Confirmation Sampling Plan (if applicable) - based upon the appropriate requirements of 19.15.17.13 NMAC Waste Material Sampling Plan - based upon the appropriate requirements of 19.15.17.13 NMAC Disposal Facility Name and Permit Number (for liquids, drilling fluids and drill cuttings or in case on-site closure standards cann Soil Cover Design - based upon the appropriate requirements of Subsection H of 19.15.17.13 NMAC Re-vegetation Plan - based upon the appropriate requirements of Subsection H of 19.15.17.13 NMAC	15.17.11 NMAC
17.	
Operator Application Certification: I hereby certify that the information submitted with this application is true, accurate and complete to the best of my knowledge and beli	ef
Name (Print): Title:	
Signature: Date:	
e-mail address: Telephone:	
18. OCD Approval: Permit Application (including closure plan) Closure Man (only) OCD Conditions (see attachment)	1
OCD Representative Signature: Approval Date:	//7
OCD Representative Signature: Approval Date: 2/1 Title: Environmental Spec. OCD Permit Number:	// 7
Title: DVI TON MENTAL Spec. OCD Permit Number: 19. Closure Report (required within 60 days of closure completion): 19.15.17.13 NMAC Instructions: Operators are required to obtain an approved closure plan prior to implementing any closure activities and submitting The closure report is required to be submitted to the division within 60 days of the completion of the closure activities. Please do not	the closure report.
Title:OCD Permit Number:	the closure report.
Title:	the closure report.
Title:	complete this
Title:	oop systems only)

22.
Operator Closure Certification:
I hereby certify that the information and attachments submitted with this closure report is true, accurate and complete to the best of my knowledge and
belief. I also certify that the closure complies with all applicable closure requirements and conditions specified in the approved closure plan.
Name (Print) Crystal Walker Title: Regulatory Coordinator
Signature: Date: 1/6/2017
e-mail address: <u>crystal.walker@cop.com</u> Telephone: (505) 326-9837

ConocoPhillips Company San Juan Basin Below Grade Tank Closure Report

Lease Name: San Juan 29-6 Unit 72A

API No.: 30-039-21344

In accordance with Rule 19.15.17.13 NMAC the following information describes the closure of the below-grade tank referenced above. All proper documentation regarding closure activities is being included with the C-144.

General Plan:

COPC shall close a below-grade tank within 60 days of cessation of operations per Subsection G.4 of 19.15.17.13
 NMAC. This will include a) below-grade tanks that do not meet the requirements of Paragraphs (1) through (4) of
 Subsection I of 19.15.17.11 NMAC or is not included in Paragraph (5) of Subsection I of 19.15.17.11 NMAC within five
 years, if not retrofitted to comply with Paragraphs (1) through (4) of Subsection I of 19.15.17.11 NMAC; b) an earlier
 date that the division requires because of imminent danger to fresh water, public health or the environment. For any
 closure, COPC will file the C144 Closure Report as required.

The below-grade tank referenced above was permitted and closed within 60 days of cessation of the below-grade tanks operation.

COPC shall remove liquids and sludge from a below-grade tank prior to implementing a closure method and shall
dispose of the liquids and sludge in a division-approved facility. The facilities to be used will be Basin Disposal
(Permit #NM-01-005), JFJ Landfarm % Industrial Ecosystem Inc. (Permit # NM-01-0010B) and Envirotech Land Farm
(Permit #NM-01-011). The liner after being cleaned well (Subsection D, Paragraph 1, Subparagraph (m) of
19.15.9.712 NMAC) will be disposed of at the San Juan County Regional Landfill located on CR 3100.

All recovered liquids were disposed of at Basin Disposal (Permit #NM-01-005) and any sludge or soil required to be removed to facilitate closure was hauled to Envirotech Land Farm (Permit #NM-01-011) and JFJ Landfarm % IEI (Permit #NM-01-0010B). The liner was cleaned per Subsection D, Paragraph 1, Subparagraph (m) of 19.15.9.712 NMAC was disposed of at the San Juan County Regional Landfill located on CR 3100.

3. COPC will receive prior approval to remove the below-grade tank and dispose of it in a division-approved facility or recycle, reuse, or reclaim it in a manner that the appropriate division district office approves.

The below-grade tank was disposed of in a division-approved manner.

4. If there is any on-site equipment associated with a below-grade tank, then COPC shall remove the equipment, unless the equipment is required for some other purpose.

All on-site equipment associated with the below-grade tank was removed.

5. COPC will test the soils beneath the below-grade tank to determine whether a release has occurred. COPC shall collect, at a minimum, a five point, composite sample; collect individual grab samples from any area that is wet, discolored or showing other evidence of a release; and analyzed for the constituents listed in Table I of 19.15.17.13 NMAC. COPC shall notify the division of its results on form C-141.

A five point composite sample was taken of the below-grade tank using sampling tools and all samples tested per Subsection B of 19.15.17.1 3(B)(1)(b). (Sample results attached). Form C-141 is attached.

Components	Tests Method	Limit (mg/kg)
Benzene	Benzene EPA SW-846 8021B or 8260B	
BTEX	EPA SW-846 8021B or 8260B	50
TPH	EPA SW-846 418.1	100
Chlorides	EPA 300.0	250

6. If COPC or the division determines that a release has occurred, then COPC shall comply with 19.15.3.116 NMAC and 19.15.1.19 NMAC, as appropriate.

A release was not determined for the above referenced well.

7. If the sampling program demonstrates that a release has not occurred or that any release does not exceed the concentrations specified in Table I of 19.15.17.13 NMAC, then COPC shall backfill the excavation with compacted, non-waste containing, earthen material; construct a division-prescribed soil cover; recontour and re-vegetate the site.

The below-grade tank area passed all requirements of Paragraph (4) of Subsection E of 19.15.17.13 NMAC and was backfilled with compacted, non-waste containing, earthen material.

- 8. Notice of Closure will be given prior to closure to the Aztec Division office between 72 hours and one week via email or verbally. The notification of closure will include the following:
 - i. Operator's name
 - ii. Location by Unit Letter, Section, Township, and Range. Well name and API number.

Notification was not found.

9. The surface owner shall be notified of COPC's closing of the below-grade tank 72 hours, but not more than one week, prior to closure as per the approved closure plan via certified mail, return receipt requested.

The closure process notification to the landowner was not found.

10. Re-contouring of location will match fit, shape, line, form and texture of the surrounding. Re-shaping will include drainage control, prevent ponding, and prevent erosion. Natural drainages will be unimpeded and water bars and/or silt traps will be place in areas where needed to prevent erosion on a large scale. Final re-contour shall have a uniform appearance with smooth surface, fitting the natural landscape.

The below-grade tank area was re-contoured to match fit, shape, line, form and texture of the surrounding area. Re-shaping including drainage control, to prevent ponding and erosion. Natural drainages were unimpeded and water bars and/or silt traps were placed in areas where needed to prevent erosion on a large scale. Final recontour has a uniform appearance with smooth surface, fitting the natural landscape.

11. COPC shall seed the disturbed areas the first favorable growing season following closure of a below-grade tank. Seeding will be accomplished via drilling on the contour whenever practical or by other division-approved methods. BLM stipulated seed mixes will be used on federally regulated lands and division-approved seed mixtures (administratively approved if required) will be utilized on all State or private lands. A uniform vegetative cover has been established that reflects a life-form ratio of plus or minus fifty percent (50%) of pre- disturbance levels and a total percent plant cover of at least seventy percent (70%) of pre-disturbance levels, excluding noxious weeds. If alternate seed mix is required by the state, private owner or tribe, it will be implemented with administrative approval if needed. COPC will repeat seeding or planting will be continued until successful vegetative growth occurs.

Provision 13 was accomplished through complying with BLM seeding requirements as allowed by the BLM/OCD MOU.

12. A minimum of four feet of cover shall be achieved and the cover shall include one foot of suitable material, with chloride concentrations less than 600 mg/kg as analyzed by EPA Method 300.0, to establish vegetation at the site, or the background thickness of topsoil, whichever is greater.

The below-grade tank area was backfilled and more than four feet of cover was achieved and the cover included one foot of suitable material to establish vegetation at the site.

- 13. All closure activities will include proper documentation and be available for review upon request and will be submitted to OCD within 60 days of closure of the below-grade tank. Closure report will be filed on C-144 and incorporate the following:
 - Soil Backfilling and Cover Installation (See Report)
 - Re-vegetation application rates and seeding techniques (See Report)
 - Photo documentation of the site reclamation (Included as an attachment)
 - Confirmation Sampling Results (Included as an attachment)
 - Proof of closure notice (Missing)

District I 1625 N. French Dr., Hobbs, NM 88240 District II 1301 W. Grand Avenue, Artesia, NM 88210 District III 1000 Rio Brazos Road, Aztec, NM 87410 District IV 1220 S. St. Francis Dr., Santa Fe, NM 87505

State of New Mexico Energy Minerals and Natural Resources

Form C-141 Revised August 8, 2011

Oil Conservation Division 1220 South St. Francis Dr. Santa Fe, NM 87505

Submit 1 Copy to appropriate District Office to accordance with 19.15.29 NMAC.

			Rele	ease Notifi	catio	n and C	orrective A	ction				
						OPERA	TOR	[Initi	al Report	\boxtimes	Final Repo
Name of Co						Contact Crystal Walker						
Address 340				[No.(505) 326-98	837				
Facility Name: San Juan 29-6 Unit 72A						Facility Ty	e: Gas Well					
Surface Owner PRIVATE Mineral Owner						FEDERAL			API No	30-039-2	21344	
				LOC	ATIO	N OF RE	LEASE					
Unit Letter		Township	Range	Feet from the	Nort	h/South Line	Feet from the	East/We		County		
F	22	29N	6W	1450		North	1620	W	est	Rio Arrib	a	
			Latitud	e <u>36.71471</u>		Longitud	le <u>-107.45373</u>	3	_			
				NA'	TURE	E OF REL	EASE					
Type of Rele						Volume of	Release			Recovered		
Source of Re	lease					Date and I	Hour of Occurrence	ce	Date and	Hour of Dis	covery	
Was Immedi	ate Notice Gi	ven?				If YES, To	Whom?					
Was Illinoan	are Proffee Gr		Yes [No Not F	Required		WHOM:					
By Whom?						Date and I	Hour					
Was a Water	course Reach						olume Impacting	the Water	course.			
			Yes 🛛 1	No								
If a Watercou	irse was Imp	acted, Descri	ibe Fully.3	k								
N/A												
Describe Cau	se of Problem	m and Remed	dial Action	n Taken.*								
No release w	as encounte	red during t	the BGT	Closure.								
Describe Are	a Affected ar	nd Cleanup A	Action Tak	en.*								
N/A												
							knowledge and u					
							nd perform correct arked as "Final R					
should their	perations ha	ve failed to a	dequately	investigate and	remedia	ate contaminat	ion that pose a thr	reat to gro	und water	r, surface wa	iter, hu	man health
or the environ	nment. In ad	dition, NMO	CD accep				ve the operator of					
federal, state,	or local law	s and/or regu	lations.				OW GOV	ann.	TT CO. T	DIVITATA		
Signature:			1	,			OIL CON	SERVA	ATION	DIVISIO	<u>N</u>	
	-st	el a	Jaly	tec								
						Approved by	Environmental S	pecialist:				
Printed Name	e: Crystal W	alker										
Title: Regula	atory Coordin	nator				Approval Da	te:	Ex	piration	Date:		
E-mail Addre	ess: crys	tal.walker@	cop.com			Conditions o	f Approval:			Attached		
Date: 116	117	Phone: (505	326-983	7								
Attach Addi	tional Sheet											

AES

Animas Environmental Services, LLC

www.animasenvironmental.com

624 E. Comanche Farmington, NM 87401 505-564-2281

> Durango, Colorado 970-403-3084

February 24, 2014

Lisa Hunter
ConocoPhillips
San Juan Business Unit
Office 214-04
5525 Hwy 64
Farmington, New Mexico 87401

Via electronic mail to: SJBUE-Team@ConocoPhillips.com

RE: Below Grade Tank Closure Report

San Juan 29-6 #72A

Rio Arriba County, New Mexico

Dear Ms. Hunter:

Animas Environmental Services, LLC (AES) is pleased to provide the final report associated with the below grade tank (BGT) closure at ConocoPhillips (CoP) San Juan 29-6 #72A, located in Rio Arriba County, New Mexico. Tank removal had been completed by CoP contractors prior to AES' arrival at the location.

1.0 Site Information

1.1 Location

Site Name - San Juan 29-6 #72A

Legal Description – SE½ NW½, Section 22, T29N, R6W, Rio Arriba County, New Mexico Well Latitude/Longitude – N36.71447 and W107.45380, respectively BGT Latitude/Longitude – N36.71471 and W107.45373, respectively Land Jurisdiction – Private

Figure 1. Topographic Site Location Map

Figure 2. Aerial Site Map, January 2014

1.2 NMOCD Ranking

In accordance with the New Mexico Oil Conservation Division (NMOCD) *Guidelines for Remediation of Leaks, Spills, and Releases* (August 1993), the location was given a ranking score of 20 based on the following factors:

- Depth to Groundwater: A cathodic protection report form dated February 1992 reported the depth to groundwater at 70 feet below ground surface (bgs). (10 points)
- Wellhead Protection Area: The tank location is not within a wellhead protection area. (0 points)
- Distance to Surface Water Body: An unnamed wash which discharges to the wash in Gobernador Canyon is located approximately 540 feet south of the location. (10 points)

1.3 BGT Closure Assessment

AES was initially contacted by Steve Welch, CoP representative, on January 22, 2014, and on January 23, 2014, Stephanie Lynn and David Reese of AES mobilized to the location. AES personnel collected six soil samples from below the BGT liner. Four samples were collected from the perimeter of the BGT footprint, one sample was collected from the center of the BGT footprint, and one sample was composited from the four perimeter samples and one center sample.

2.0 Soil Sampling

On January 23, 2014, AES personnel conducted field screening and collected five soil samples (S-1 through S-5) and one 5-point composite (SC-1) from below the BGT. Soil samples were collected from approximately 0.5 feet below the former BGT for field screening of volatile organic compounds (VOCs) and total petroleum hydrocarbon (TPH). Soil sample SC-1 was field screened for VOCs and chloride and was submitted for confirmation laboratory analysis. Soil sample locations are included on Figure 2.

2.1 Field Screening

2.1.1 Volatile Organic Compounds

A portion of each sample was utilized for field screening of VOC vapors with a photo-ionization detector (PID) organic vapor meter (OVM). Before beginning field screening, the PID-OVM was first calibrated with 100 parts per million (ppm) isobutylene gas.

2.1.2 Total Petroleum Hydrocarbons

Soil samples were also analyzed in the field for TPH per USEPA Method 418.1 using a Buck Scientific Model HC-404 Total Hydrocarbon Analyzer Infrared Spectrometer (Buck). A 3-point calibration was completed prior to conducting soil analyses. Field analytical protocol followed AES's Standard Operating Procedure: Field Analysis Total Petroleum Hydrocarbons per EPA Method 418.1.

2.1.3 Chlorides

Soil sample SC-1 was field screened for chlorides using Chloride Drop Count Titration with silver nitrate. Sampling and analysis methods followed procedures provided by Hach Company.

2.2 Laboratory Analyses

The composite soil sample SC-1 collected for laboratory analysis was placed into a new, clean, laboratory-supplied container, which was then labeled, placed on ice, and logged onto a sample chain of custody record. The sample was maintained on ice until delivery to the analytical laboratory, Hall Environmental Analysis Laboratory (Hall), in Albuquerque, New Mexico. Soil sample SC-1 was laboratory analyzed for:

- Benzene, toluene, ethylbenzene, and xylene (BTEX) per U.S. Environmental Protection Agency (USEPA) Method 8021B; and
- Chloride per USEPA Method 300.0.

2.3 Field and Laboratory Analytical Results

Field screening readings for VOCs via OVM ranged from 0.1 ppm in S-1, S-3, S-4, and SC-1 up to 0.2 ppm in S-2 and S-5. Field TPH concentrations were measured at less than 20.0 mg/kg in S-1 through S-5. The field chloride concentration in SC-1 was 60 mg/kg. Field screening results are summarized in Table 1 and presented on Figure 2. The AES Field Screening Report is attached.

Table 1. Soil Field Screening VOCs, TPH, and Chloride Results San Juan 29-6 #72A BGT Closure, January 2014

Sample ID	Date Sampled	Depth below BGT (ft)	VOCs OVM Reading (ppm)	Field TPH (mg/kg)	Field Chlorides (mg/kg)
NMOCD Action	Level (NMAC 19.	15.17.13E)		100	250
S-1	1/22/14	0.5	0.1	<20.0	NA
S-2	1/22/14	0.5	0.2	<20.0	NA
S-3	1/22/14	0.5	0.1	<20.0	NA
S-4	1/22/14	0.5	0.1	<20.0	NA
S-5	1/22/14	0.5	0.2	<20.0	NA
SC-1	1/22/14	0.5	0.1	NA	60

NA - not analyzed

Laboratory analytical results reported benzene and total BTEX concentrations in SC-1 as less than 0.032 mg/kg and 0.161 mg/kg, respectively. The laboratory chloride concentration was reported below the laboratory detection limit of 30 mg/kg. Laboratory analytical results are summarized in Table 2 and included on Figure 2. The laboratory analytical report is attached.

Table 2. Soil Laboratory Analytical Results San Juan 29-6 #72A BGT Closure, January 2014

Sample ID	Date Sampled	Depth (ft)	Benzene (mg/kg)	Total BTEX (mg/kg)	TPH- GRO (mg/kg)	TPH- DRO (mg/kg)	Chlorides (mg/kg)
	NMOCD Act		0.2	50	10	00	250
SC-1	1/23/14	0.5	< 0.032	<0.161	NA	NA	<30

NA - not analyzed

3.0 Conclusions and Recommendations

NMOCD action levels for BGT closures are specified in New Mexico Administrative Code (NMAC) 19.15.17.13E. Field TPH concentrations were below the NMOCD action level of 100 mg/kg, with concentrations reported at less than 20.0 mg/kg in each sample. Benzene and total BTEX concentrations in SC-1 were below the NMOCD action levels of 0.2 mg/kg and 50 mg/kg, respectively. Chloride concentrations in SC-1 were below the NMOCD action level of 250 mg/kg. Based on field screening and laboratory analytical results for benzene, total BTEX, TPH, and chlorides, no further work is recommended at San Juan 29-6 #72A.

If you have any questions about this report or site conditions, please do not hesitate to contact Deborah Watson at (505) 564-2281.

Sincerely,

David J. Reese

Environmental Scientist

Vizobuth V MiNdly

Dail g Rem


Elizabeth McNally, P.E.

Lisa Hunter San Juan 29-6 #72A BGT Closure Report February 24, 2014 Page 5 of 5

Attachments:

Figure 1. Topographic Site Location Map Figure 2. Aerial Site Map, January 2014 AES Field Screening Report 012314 Hall Analytical Report 1401995

R:\Animas 2000\Dropbox\0000 Animas Server Dropbox EM\2014 Projects\ConocoPhillips\SJ 29-6 #72A\San Juan 29-6 #72A BGT Closure Report 022414.docx

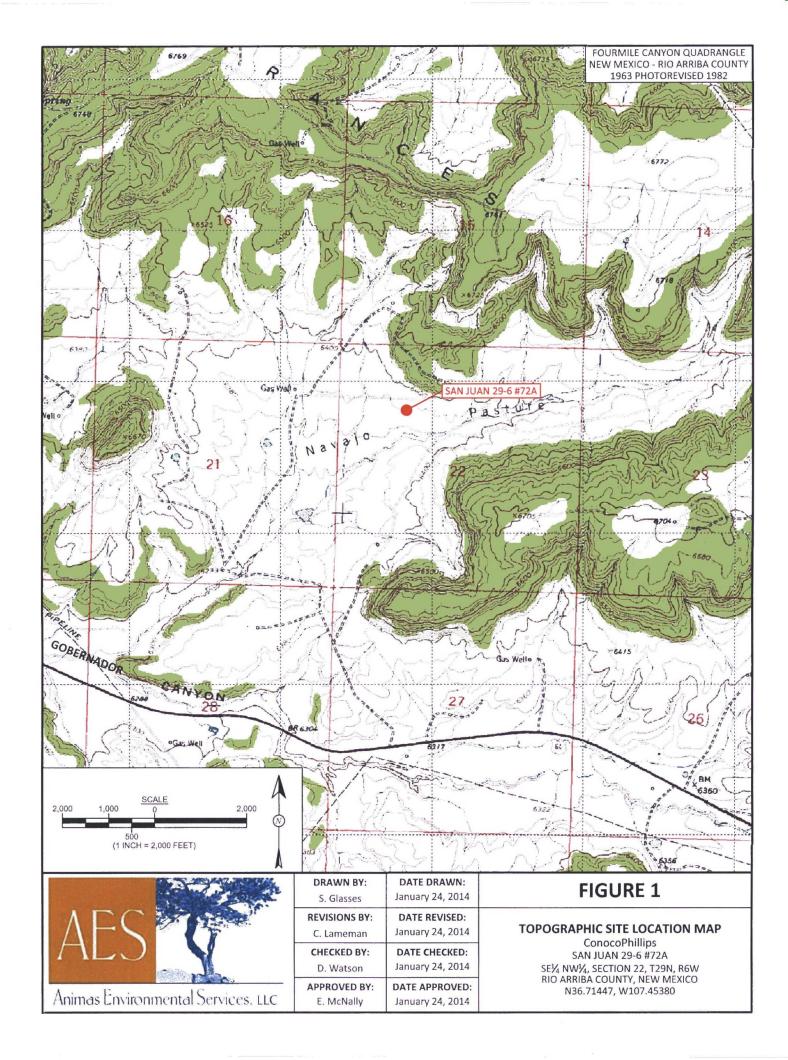


SAMPLE LOCATIONS

Sample ID	Date	OVM- PID (ppm)	TPH (mg/kg)	Chlorides (mg/kg)
NMOCD ACT	TION LEVEL		100	250
S-1	1/23/14	0.1	<20.0	NA
S-2	1/23/14	0.2	<20.0	NA
S-3	1/23/14	0.1	<20.0	NA
S-4	1/23/14	0.1	<20.0	NA
S-5	1/23/14	0.2	<20.0	NA
SC-1	1/23/14	0.1	NA	60

		Laborato	ry Analytica	al Results		
Sample ID	Date	Benzene (mg/kg)	Total BTEX (mg/kg)	TPH - GRO (mg/kg)	TPH - DRO (mg/kg)	Chlorides (mg/kg)
NMOCD AC	TION LEVEL	0.2	50	10	00	250
SC-1	1/23/14	< 0.032	< 0.161	NA	NA	<30

S-5 S-4 S-3 BGT - N36.71471 W107.45373

SAN JUAN 29-6 #72A WELLHEAD

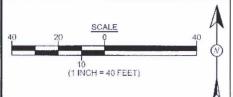

AERIAL SOURCE: © 2013 GOOGLE EARTH, AERIAL DATE: MAY 2, 2013

150	
TLU	

DRAWN BY: S. Glasses	DATE DRAWN: January 24, 2014
REVISIONS BY: C. Lameman	DATE REVISED: January 24, 2014
CHECKED BY: D. Watson	DATE CHECKED: January 24, 2014
APPROVED BY: E. McNally	DATE APPROVED: January 24, 2014

AERIAL SITE MAP BELOW GRADE TANK CLOSURE JANUARY 2014 ConocoPhillips

ConocoPhillips SAN JUAN 29-6 #72A SE¼ NW¼, SECTION 22, T29N, R6W RIO ARRIBA COUNTY, NEW MEXICO N36.71447, W107.45380

AES Field Screening Report

Client: ConocoPhillips

Project Location: San Juan 29-6 #72A

Date: 1/23/2014

Matrix: Soil



www.animasenvironmental.com

624 E. Comanche Farminaton, NM 87401 505-564-2281

> Durango, Colorado 970-403-3084

Sample ID	Collection Date	Time of Sample Collection	Sample Location	OVM (ppm)	Field Chloride (mg/kg)	Field TPH Analysis Time	Field TPH* (mg/kg)	TPH PQL (mg/kg)	DF	TPH Analysts Initials				
S-1	1/23/2014	11:09	North	0.1	NA	11:41	12.7	20.0	1	SL				
S-2	1/23/2014	11:11	South	0.2	NA	11:47	14.0	20.0	1	SL				
S-3	1/23/2014	11:13	East	0.1	NA	11:48	14.0	20.0	1	SL				
S-4	1/23/2014	11:15	West	0.1	NA	11:51	7.50	20.0	1	SL				
S-5	1/23/2014	11:17	Center	0.2	NA	11:53	14.0	20.0	1	SL				
SC-1	1/23/2014	11:20	Composite	0.1	60	Not Analyzed for TPH								

Field Chloride - Quantab Chloride Titrators or Drop Count

Titration with Silver Nitrate

Total Petroleum Hydrocarbons - USEPA 418.1

Analyst: Steplanie Algo

DF

Dilution Factor

NA ND Not Analyzed

Not Detected at the Reporting Limit

PQL

Practical Quantitation Limit

*Field TPH concentrations recorded may be below PQL.



Hall Environmental Analysis Laboratory 4901 Hawkins NE Albuquerque, NM 87109 TEL: 505-345-3975 FAX: 505-345-4107 Website: www.hallenvironmental.com

OrderNo.: 1401995

January 28, 2014

Debbie Watson Animas Environmental 624 East Comanche Farmington, NM 87401 TEL: (505) 486-4071

FAX

RE: COP San Juan 29-6 #72A

Dear Debbie Watson:

Hall Environmental Analysis Laboratory received 1 sample(s) on 1/24/2014 for the analyses presented in the following report.

These were analyzed according to EPA procedures or equivalent. To access our accredited tests please go to www.hallenvironmental.com or the state specific web sites. In order to properly interpret your results it is imperative that you review this report in its entirety. See the sample checklist and/or the Chain of Custody for information regarding the sample receipt temperature and preservation. Data qualifiers or a narrative will be provided if the sample analysis or analytical quality control parameters require a flag. When necessary, data qualifers are provided on both the sample analysis report and the QC summary report, both sections should be reviewed. All samples are reported, as received, unless otherwise indicated. Lab measurement of analytes considered field parameters that require analysis within 15 minutes of sampling such as pH and residual chlorine are qualified as being analyzed outside of the recommended holding time.

Please don't hesitate to contact HEAL for any additional information or clarifications.

ADHS Cert #AZ0682 -- NMED-DWB Cert #NM9425 -- NMED-Micro Cert #NM0190

Sincerely,

Andy Freeman

Laboratory Manager

4901 Hawkins NE

Albuquerque, NM 87109

Analytical Report

Lab Order 1401995

Date Reported: 1/28/2014

Hall Environmental Analysis Laboratory, Inc.

CLIENT: Animas Environmental

Project: COP San Juan 29-6 #72A

Lab ID: 1401995-001

Client Sample ID: SC-1

Collection Date: 1/23/2014 11:20:00 AM

Matrix: MEOH (SOIL) Received Date: 1/24/2014 10:15:00 AM

Analyses	Result	al Units	DF	Date Analyzed	Batch	
EPA METHOD 8021B: VOLATILES					Analyst	: JMP
Benzene	ND	0.032	mg/Kg	1	1/24/2014 11:33:56 AM	R16278
Toluene	ND	0.032	mg/Kg	1	1/24/2014 11:33:56 AM	R16278
Ethylbenzene	ND	0.032	mg/Kg	1	1/24/2014 11:33:56 AM	R16278
Xylenes, Total	ND	0.065	mg/Kg	1	1/24/2014 11:33:56 AM	R16278
Surr: 4-Bromofluorobenzene	97.0	80-120	%REC	1	1/24/2014 11:33:56 AM	R16278
EPA METHOD 300.0: ANIONS					Analyst	JRR
Chloride	ND	30	mg/Kg	20	1/24/2014 1:28:17 PM	11394

Refer to the QC Summary report and sample login checklist for flagged QC data and preservation information.

Qualifiers:

- Value exceeds Maximum Contaminant Level.
- E Value above quantitation range
- J Analyte detected below quantitation limits
- O RSD is greater than RSDlimit
- R RPD outside accepted recovery limits
- S Spike Recovery outside accepted recovery limits
- B Analyte detected in the associated Method Blank
- H Holding times for preparation or analysis exceeded
- ND Not Detected at the Reporting Limit

Page 1 of 3

- P Sample pH greater than 2 for VOA and TOC only.
- RL Reporting Detection Limit

QC SUMMARY REPORT

Hall Environmental Analysis Laboratory, Inc.

WO#: 1401995

28-Jan-14

Client:

Animas Environmental

Project:

COP San Juan 29-6 #72A

Sample ID MB-11394

SampType: MBLK

TestCode: EPA Method 300.0: Anions

Client ID:

PBS

Batch ID: 11394

RunNo: 16309

Prep Date: 1/24/2014 Analysis Date: 1/24/2014

SeqNo: 470266

Units: mg/Kg

Qual

Analyte

Result PQL

ND

SPK value SPK Ref Val %REC LowLimit

HighLimit

%RPD **RPDLimit**

Chloride

Client ID:

Prep Date:

1.5

SampType: LCS

SeqNo: 470267

TestCode: EPA Method 300.0: Anions

Sample ID LCS-11394

LCSS

Batch ID: 11394 Analysis Date: 1/24/2014

PQL

RunNo: 16309

Units: mg/Kg

Analyte

%RPD **RPDLimit** Qual

15.00

110

SPK value SPK Ref Val 1.5

%REC 92.7

LowLimit

HighLimit

Chloride

1/24/2014

14

Qualifiers:

Value exceeds Maximum Contaminant Level.

Spike Recovery outside accepted recovery limits

E Value above quantitation range

Analyte detected below quantitation limits J

0 RSD is greater than RSDlimit

R RPD outside accepted recovery limits В Analyte detected in the associated Method Blank

H Holding times for preparation or analysis exceeded

ND Not Detected at the Reporting Limit Sample pH greater than 2 for VOA and TOC only.

Reporting Detection Limit

Page 2 of 3

QC SUMMARY REPORT

Hall Environmental Analysis Laboratory, Inc.

WO#: 1401995

28-Jan-14

Client:

Animas Environmental

Project:

COP San Juan 29-6 #72A

Sample ID MB-11370

SampType: MBLK

TestCode: EPA Method 8021B: Volatiles

Client ID:

PBS

Batch ID: 11370

RunNo: 16278

Prep Date: 1/23/2014

SeqNo: 469902

Units: %REC

Analyte

Analysis Date: 1/24/2014

SPK value SPK Ref Val %REC Result

LowLimit

Qual

Surr: 4-Bromofluorobenzene

0.98

1.000

97.9

HighLimit 120

Sample ID LCS-11370

SampType: LCS

TestCode: EPA Method 8021B: Volatiles

Client ID: LCSS

Batch ID: 11370

RunNo: 16278

Prep Date: 1/23/2014

Analysis Date: 1/24/2014

SeqNo: 469903

Units: %REC

Analyte

Result

Result

0.98

PQL

SPK value SPK Ref Val

%REC

HighLimit

RPDLimit

RPDLimit

Qual

Client ID:

Prep Date:

1.0

1.000

104

LowLimit 80 120 %RPD

%RPD

Surr: 4-Bromofluorobenzene

Sample ID MB-11370

Sample ID LCS-11370

SampType: MBLK

TestCode: EPA Method 8021B: Volatiles

Batch ID: 11370

PQL

Batch ID: 11370

Analysis Date: 1/24/2014

PQL

RunNo: 16278

97.9

RunNo: 16278

80

Units: %REC

120

Analyte

1/23/2014

Analysis Date: 1/24/2014

SeqNo: 469924 SPK value SPK Ref Val %REC

LowLimit

HighLimit %RPD **RPDLimit**

Qual

Qual

Client ID:

Prep Date:

Surr: 4-Bromofluorobenzene

LCSS

1/23/2014

SampType: LCS

TestCode: EPA Method 8021B: Volatiles

SeqNo: 469925

Units: %REC

Analyte

SPK value SPK Ref Val

1.000

%REC

80

HighLimit

%RPD

RPDLimit

Surr: 4-Bromofluorobenzene

Result 1.0

1.000

104

LowLimit

120

Qualifiers:

Analyte detected below quantitation limits

R RPD outside accepted recovery limits

Value exceeds Maximum Contaminant Level.

Spike Recovery outside accepted recovery limits

Value above quantitation range E

0 RSD is greater than RSDlimit

Analyte detected in the associated Method Blank B

H Holding times for preparation or analysis exceeded

ND Not Detected at the Reporting Limit Sample pH greater than 2 for VOA and TOC only. P

Reporting Detection Limit

Page 3 of 3



Linvironmental Analysis Laboratory 4901 Hawkins NE

Sample Log-In Check List Albuquerque, NM 87105 TEL: 505-345-3975 FAX: 505-345-4107 Website: www.hallenvironmental.com PontNo: 1

Client Name: Animas Environmental Work Order	Number: 1401995		ксричо.	
Received by/date: 01 754 15				
Logged By: Lindsay Mangin 1/24/2014 10	:15:00 AM	July Hayes		
Completed By: Lindsay Mangin 1/24/2014 10	:21:50 AM	Smin Harr		
		05.00		
Reviewed By: AT 0/24//L				
Custody seals intact on sample bottles?	Yes	No 🗆	Not Present ✓	
2. Is Chain of Custody complete?	Yes ✓	No 🗆	Not Present	
3. How was the sample delivered?	Courier			
<u>Log In</u>				
Was an attempt made to cool the samples?	Yes 🗹	No 🗌	NA 🗆	
5. Were all samples received at a temperature of >0° C to 6.	.0°C Yes ✓	No 🗆	NA 🗆	
6. Sample(s) In proper container(s)?	Yes 🗹	No 🗆		
7. Sufficient sample volume for indicated test(s)?	Yes 🗹	No 🗆		
8. Are samples (except VOA and ONG) properly preserved?	Yes 🗹	No 🗆		
9. Was preservative added to bottles?	Yes	No 🗹	NA \square	
10.VOA vials have zero headspace?	Yes	No 🗆	No VOA Vials 🗹	
11. Were any sample containers received broken?	Yes	No 🗹	# of preserved	_
12. Does paperwork match bottle labels?	Yes 🗹	No 🗆	bottles checked for pH:	
(Note discrepancies on chain of custody)	163			r >12 unless noted)
13. Are matrices correctly identified on Chain of Custody?	Yes 🗹	No 🗆	Adjusted?	
14. Is it clear what analyses were requested?	Yes 🗹	No 🗆		
15. Were all holding times able to be met? (If no, notify customer for authorization.)	Yes 🗹	No 📙	Checked by:	
Special Handling (if applicable)				
16. Was client notified of all discrepancies with this order?	Yes	No 🗆	NA 🗹	1
Person Notified:	Date:			
By Whom:	Via: eMail F	hone Fax	☐ In Person	
Regarding:				
Client Instructions:				
17. Additional remarks: per DW use	collection -	fine on	Sample 1a	/AT 01/241
18. Cooler Information Cooler No. Temp C. Condition. Seal Intact. Sea		Signediby	ر ا	/ATOI/241
I GOOD INOT Present				

onam-or-oustouy necord						LLL HALL ENVIRONMENTAL															
Client: Animas Envilonmental Services			Standard Rush Same day Project Name:				ANALYSIS LABORATORY														
	980			Project Name:				www.hallenvironmental.com													•
Mailing	Address	67	4 E Comarche ton, NM 87401 564-2281	Cop San Juga 29-6 #72A Project #: Project Manager:				4901 Hawkins NE - Albuquerque, NM 87109													
	F	arming	ton, NM 87401					Tel. 505-345-3975 Fax 505-345-4107													
Phone #	# :	505	564-2281						Analysis Request												
email or	Fax#:								ر کا	ဂ္ဂ				18	040				1		
QA/QC Package:							302	38 0	N N			8	4	, S	PCB's						
Standard □ Level 4 (Full Validation)			D- L	vatson			#B/s (8021)	Ö	8			SIMS)	ľ	Z.	2 P(
Accreditation			Sampler: S	Lynn/O.	Reese		H	퓝	/ D	=		023	Ď,	S.	808					Î	
□ NEL		□ Othe	r	On Ice			STATE OF THE PERSON NAMED IN	A	+	NS	418	504	r 82	"W	ő	S		(A)			5
□ EDD	(Type)_		1	Sample Tem	perature:	1,2		H	胎	3 (G	ро	8	0	etal	죍	cide	8	j-K			\\ \chi_{\omega}
Date	01/24/12 Time	Matrix	Sample Request ID	Container Type and #	Preservative Type	HEAL	No	BTEX + NE	BTEX + MTBE + TPH (Gas only)	PH 8015	TPH (Method 418.1)	EDB (Method 504.1)	PAH's (8310 or 8270	RCRA 8 Metals	nions (F(8081 Pesticides / 8082	8260B (VOA)	8270 (Semi-VOA)			Air Bubbles (Y or N)
23/14		S7	SC-1	MeoH kit	MeOH_		1 D	N N	B	Ŀ	-	Ш	Д.	_	<u> </u>	ă	80	80	+	++	<
27/17	10.70	08//	36-2	1.702		, = 0	0						\dashv	1	+	\dashv			\top	$\forall \exists$	\top
												*									
																		_	\bot	$\perp \perp$	
								_				_	\dashv	_	-	_			+		$\vdash \vdash$
											-	\dashv	\dashv	-		\dashv	_	\dashv	+	+	\vdash
														-	-				_	+	
												_	-	-	\dashv				+	+	$\vdash\vdash$
													\neg							+	-
Date: Time: Relinquished by: 123/14/1607 Dans TRans		Received by: Date Time Austre Warte 1/23/14 1607			Remarks: Bill to Conoco Phillips WO: 10356487 Activitis T110 Superitor: Golos Rey Ordered by: Steve welch																
1/23/14	1710	Relinquish	Vite Vacte	Received by		01 24 14	1015	4	50	TD:	Be	pale									
) I1	necessary,	samples sub	mitted to Hall Environmental may be subc	contracted to other a	corredited laboratori	ies. This serves a	as notice of this	s possi	bility.	Any su	ub-cont	racted	data d	will be	clearly	y nota	ted on	the an	alytical re	∍port.	

