

District I
1625 N. French Dr., Hobbs, NM 88240
District II
811 S. First St., Artesia, NM 88210
District III
1000 Rio Brazos Road, Aztec, NM 87410
District IV
1220 S. St. Francis Dr., Santa Fe, NM 87505

State of New Mexico
Energy Minerals and Natural Resources

Oil Conservation Division
1220 South St. Francis Dr.
Santa Fe, NM 87505

Form C-141
Revised August 8, 2011

Submit 1 Copy to appropriate District Office in
accordance with 19.15.29 NMAC.

Release Notification and Corrective Action

OPERATOR

☐ Initial Report ☒ Final Report

Name of Company - Chevron	Contact - Bret Larson	
Address - 332 CR3100 Aztec NM 87410	Telephone No.- 505-333-1915	
Facility Name - Rincon 234	Facility Type - Well Pad	
Surface Owner - BLM	Mineral Owner-BLM	API No.- 30-039-22832

LOCATION OF RELEASE

Unit Letter	Section	Township	Range	Feet from the	North/South Line	Feet from the	East/West Line	County
E	-2	-26N	-7w	1490	N	830	W	Rio Arriba

Latitude_36.517669 Longitude_-107.550325

NATURE OF RELEASE

Type of Release - produced water with possible hydro carbons	Volume of Release - TBD	Volume Recovered - 1400 yards
Source of Release - BGT	Date and Hour of Occurrence - unknown	Date and Hour of Discovery -3/17/2017 1:00pm
Was Immediate Notice Given? ☒ Yes ☐ No ☐ Not Required	If YES, To Whom? Cory Smith	
By Whom? Isaac Reyes	Date and Hour - 3/18/2017 9:59am	
Was a Watercourse Reached? ☐ Yes ☒ No	If YES, Volume Impacting the Watercourse.	

OIL CONS. DIV DIST. 3
JUL 31 2017

If a Watercourse was Impacted, Describe Fully.* NA


Describe Cause of Problem and Remedial Action Taken.*-

During replacement of BGT visually impacted soil was discovered below tank. Impact is suspected to be from historical earthen pit on location that was not fully remediated. Impacted soil was removed and sent to Envirotech land farm for remediation. Excavated area was sprayed with potassium permanganate and backfilled with clean fill material.

Describe Area Affected and Cleanup Action Taken.*-

Affected area was below surface inside the berm area on location. Impact was suspected to be due to presence of historical earthen pit. All visually affected soil was removed from the area. Soil was removed from side walls until lab analysis showed soil samples were below closure limits for TPH and BTEX. Soil was removed from the excavated area's floor until top of sandstone was reached at 19 feet depth. Permission was obtained from BLM and NMOCD to spray potassium permanganate over excavated area and backfill with clean fill material.

I hereby certify that the information given above is true and complete to the best of my knowledge and understand that pursuant to NMOCD rules and regulations all operators are required to report and/or file certain release notifications and perform corrective actions for releases which may endanger public health or the environment. The acceptance of a C-141 report by the NMOCD marked as "Final Report" does not relieve the operator of liability should their operations have failed to adequately investigate and remediate contamination that pose a threat to ground water, surface water, human health or the environment. In addition, NMOCD acceptance of a C-141 report does not relieve the operator of responsibility for compliance with any other federal, state, or local laws and/or regulations.

Signature: 	OIL CONSERVATION DIVISION	
Printed Name: Bret Larson	Approved by Environmental Specialist: 	
Title: HES	Approval Date: 8/8/17	Expiration Date:
E-mail Address: larsobr@chevron.com	Conditions of Approval:	Attached ☐
Date: 7/26/2017	Phone: 505-333-1915	

NCS 1708 632189

33

Reyes, Isaac

From: Thomas, Leigh <l1thomas@blm.gov>
Sent: Tuesday, June 20, 2017 7:17 AM
To: Smith, Cory, EMNRD
Cc: Reyes, Isaac; Fields, Vanessa, EMNRD
Subject: **[**EXTERNAL**]** Re: Potassium Permanganate Use Request: Rincon 234 Soil Remediation

Isaac,

The BLM has reviewed your request to utilize potassium permanaganate and backfill the site. Chevron's proposal has been approved by the BLM. if you have any questions please let me know.

Thank you

Whitney Thomas
Natural Resource Specialist
Farmington Field Office
6251 North College Boulevard
Suite A
Farmington, NM 87402
Office: 505-564-7680
Cell: 505-635-9796
email: l1thomas@blm.gov

On Fri, Jun 16, 2017 at 1:34 PM, Smith, Cory, EMNRD <Cory.Smith@state.nm.us> wrote:

Isaac,

OCD has reviewed and have approved Chevrons request to spray Potassium Permanganate and backfill the excavation. Please include this approval in your Final C-141.

To answer your question, The OCD will review on a case by case basis for alternative closure's provided by the operator. Typically speaking operators who have reached practicable extent, with no other factors in the past have been approved to spray and close excavations.

Cory Smith

Environmental Specialist

Oil Conservation Division

Energy, Minerals, & Natural Resources

1000 Rio Brazos, Aztec, NM 87410

(505)334-6178 ext 115

cory.smith@state.nm.us

From: Reyes, Isaac [mailto:isaacreyes@chevron.com]

Sent: Friday, June 16, 2017 10:36 AM

To: Smith, Cory, EMNRD <Cory.Smith@state.nm.us>; Fields, Vanessa, EMNRD <Vanessa.Fields@state.nm.us>; Thomas, Leigh <11thomas@blm.gov>

Subject: Potassium Permanganate Use Request: Rincon 234 Soil Remediation

Good morning.

The purpose of this email is to request permission from the BLM and NMOCD for the use of potassium permanganate spray for soil remediation on our Rincon 234 well pad (API #30-039-22832). During routine tank replacement this year, we discovered historical contamination on this location from an old earthen pit and have since been conducting remediation efforts, primarily by removing impacted soil and conducting periodic lab analysis of soil samples for TPH and BTEX. At present time the excavated area has reached a depth of 20' and a total of 1400 yards of impacted soil have been removed and sent to Envirotech's landfarm.

We have ranked this location as a 20 according to the NMOCD's guidelines due to its proximity to a recognized surface waterway (260') and our records of its proximity to groundwater (80' depth), requiring TPH measurements below 100 mg/kg and BTEX measurements below 50 mg/kg for closure. From soil samples taken 5/1/2017, we obtained the following results for the side walls and bottom:

Sample	TPH (mg/kg)	BTEX (mg/kg)
North Wall	27.6	ND
South Wall	ND	ND
West Wall	92.5	ND
East Wall	ND	ND
Bottom Floor	250	ND

We continued soil removal on the bottom floor to the extent possible, however at time of this report our latest samples indicate we are still above the closure limits. Soil samples of the bottom floor taken 6/5/2017 yielded the following results:

Sample	TPH (mg/kg)	BTEX (mg/kg)
North Bottom	28.2	ND
East Bottom	279	ND
South Bottom	41.5	ND
West Bottom	ND	ND
Center Bottom	2784.7	2.45
Composite Bottom	1720	0.21

Both reports are attached to this email. We suspect that over time several rains have caused the residual contamination to "pool" in the center of the bowl-shaped bottom floor, explaining why there seems to be a single hot spot dead center. The bottom floor of the excavated area is now at the maximum depth allowed before an engineered excavation is required (20'); furthermore, we encountered sandstone around 19' depth, both of which are preventing us from conducting further excavation/soil removal. Envirotech recommended the use of potassium permanganate to remediate what contamination remains, and we would like to obtain permission from both agencies to pursue that option.

I have one follow up question: my understanding is that in instances where sandstone is reached and further excavation is not practical, the agencies will sometimes allow for final closure activities (backfilling excavated area) following the use of the spray. Is this true, or will we need to complete additional sampling after using the spray before backfilling?

Please do not hesitate to reach out with any questions or concerns. Let me know if you need any further information or clarification.

Best,

Isaac Reyes

Facilities Engineer

Chevron Midcontinent Business Unit

San Juan Field Management Team

332 CR 3100. Aztec NM 87410

Office: (505) 333-1929

Cell: (505) 386-8610



Analytical Report

Report Summary

Client: Chevron

Chain Of Custody Number:

Samples Received: 6/5/2017 3:40:00PM

Job Number: 92270-0596

Work Order: P706007


Project Name/Location: Rincon #234

Report Reviewed By:



Date: 6/8/17

Walter Hinchman, Laboratory Director

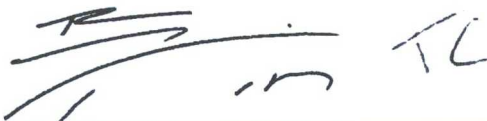

Date: 6/8/17

Tim Cain, Quality Assurance Officer

The results in this report apply to the samples submitted to Envirotech's Analytical Laboratory and were analyzed in accordance with the chain of custody document supplied by you, the client, and as such are for your exclusive use only. The results in this report are based on the sample as received unless otherwise noted. Partial or incomplete reproduction of this report is prohibited, unless approved by Envirotech, Inc. If you have any questions regarding this analytical report, please don't hesitate to contact Envirotech's Laboratory Staff.

Chevron
 322 Road 3100
 Aztec NM, 87410

Project Name: Rincon #234
 Project Number: 92270-0596
 Project Manager: Isaac Reyes

Reported:
 08-Jun-17 16:12

Analytical Report for Samples

Client Sample ID	Lab Sample ID	Matrix	Sampled	Received	Container
N. Bottom	P706007-01A	Soil	06/05/17	06/05/17	Glass Jar, 4 oz.
E. Bottom	P706007-02A	Soil	06/05/17	06/05/17	Glass Jar, 4 oz.
S. Bottom	P706007-03A	Soil	06/05/17	06/05/17	Glass Jar, 4 oz.
W. Bottom	P706007-04A	Soil	06/05/17	06/05/17	Glass Jar, 4 oz.
Composite	P706007-05A	Soil	06/05/17	06/05/17	Glass Jar, 4 oz.
Center	P706007-06A	Soil	06/05/17	06/05/17	Glass Jar, 4 oz.

Partial or incomplete reproduction of this report is prohibited, unless approved by Envirotech, Inc.

5796 US Highway 64, Farmington, NM 87401

Ph (505) 632-0615 Fx (505) 632-1865

Three Springs • 65 Mercado Street, Suite 115, Durango, CO 81301

Ph (970) 259-0615 Fr (800) 362-1879

envirotech inc.com
 Laboratory@envirotech inc.com

Chevron
 322 Road 3100
 Aztec NM, 87410

 Project Name: Rincon #234
 Project Number: 92270-0596
 Project Manager: Isaac Reyes

 Reported:
 08-Jun-17 16:12

N. Bottom
P706007-01 (Solid)

Reporting

Analyte	Result	Limit	Units	Dilution	Batch	Prepared	Analyzed	Method	Notes
---------	--------	-------	-------	----------	-------	----------	----------	--------	-------

Volatile Organics by EPA 8021

Benzene	ND	0.10	mg/kg	1	1723006	06/06/17	06/07/17	EPA 8021B	
Toluene	ND	0.10	mg/kg	1	1723006	06/06/17	06/07/17	EPA 8021B	
Ethylbenzene	ND	0.10	mg/kg	1	1723006	06/06/17	06/07/17	EPA 8021B	
p,m-Xylene	ND	0.20	mg/kg	1	1723006	06/06/17	06/07/17	EPA 8021B	
o-Xylene	ND	0.10	mg/kg	1	1723006	06/06/17	06/07/17	EPA 8021B	
Total Xylenes	ND	0.10	mg/kg	1	1723006	06/06/17	06/07/17	EPA 8021B	
Total BTEX	ND	0.10	mg/kg	1	1723006	06/06/17	06/07/17	EPA 8021B	
Surrogate: 4-Bromochlorobenzene-PID		95.9 %		50-150	1723006	06/06/17	06/07/17	EPA 8021B	

Nonhalogenated Organics by 8015

Gasoline Range Organics (C6-C10)	ND	20.0	mg/kg	1	1723006	06/06/17	06/07/17	EPA 8015D	
Diesel Range Organics (C10-C28)	28.2	25.0	mg/kg	1	1723009	06/06/17	06/07/17	EPA 8015D	
Surrogate: 1-Chloro-4-fluorobenzene-FID		113 %		50-150	1723006	06/06/17	06/07/17	EPA 8015D	
Surrogate: n-Nonane		104 %		50-200	1723009	06/06/17	06/07/17	EPA 8015D	

Partial or incomplete reproduction of this report is prohibited, unless approved by Envirotech, Inc.

5796 US Highway 64, Farmington, NM 87401

Three Springs • 65 Mercado Street, Suite 115, Durango, CO 81301

Ph (505) 632-0615 Fx (505) 632-1865

Ph (970) 259-0615 Fr (800) 362-1879

 envirotech inc.com
 Laboratory: envirotech inc.com



Chevron	Project Name:	Rincon #234	Reported:
322 Road 3100	Project Number:	92270-0596	08-Jun-17 16:12
Aztec NM, 87410	Project Manager:	Isaac Reyes	

E. Bottom
P706007-02 (Solid)

Reporting									
Analyte	Result	Limit	Units	Dilution	Batch	Prepared	Analyzed	Method	Notes
Volatile Organics by EPA 8021									
Benzene	ND	0.10	mg/kg	1	1723006	06/06/17	06/07/17	EPA 8021B	
Toluene	ND	0.10	mg/kg	1	1723006	06/06/17	06/07/17	EPA 8021B	
Ethylbenzene	ND	0.10	mg/kg	1	1723006	06/06/17	06/07/17	EPA 8021B	
p,m-Xylene	ND	0.20	mg/kg	1	1723006	06/06/17	06/07/17	EPA 8021B	
o-Xylene	ND	0.10	mg/kg	1	1723006	06/06/17	06/07/17	EPA 8021B	
Total Xylenes	ND	0.10	mg/kg	1	1723006	06/06/17	06/07/17	EPA 8021B	
Total BTEX	ND	0.10	mg/kg	1	1723006	06/06/17	06/07/17	EPA 8021B	
Surrogate: 4-Bromochlorobenzene-PID		95.9 %		50-150	1723006	06/06/17	06/07/17	EPA 8021B	
Nonhalogenated Organics by 8015									
Gasoline Range Organics (C6-C10)	ND	20.0	mg/kg	1	1723006	06/06/17	06/07/17	EPA 8015D	
Diesel Range Organics (C10-C28)	279	25.0	mg/kg	1	1723009	06/06/17	06/07/17	EPA 8015D	
Surrogate: 1-Chloro-4-fluorobenzene-FID		112 %		50-150	1723006	06/06/17	06/07/17	EPA 8015D	
Surrogate: n-Nonane		107 %		50-200	1723009	06/06/17	06/07/17	EPA 8015D	

Partial or incomplete reproduction of this report is prohibited, unless approved by Envirotech, Inc.

5796 US Highway 64, Farmington, NM 87401

Three Springs • 65 Mercado Street, Suite 115, Durango, CO 81301

Ph (505) 632-0615 Fx (505) 632-1865

Ph (970) 259-0615 Fr (800) 362-1879

envirotech-inc.com
laboratory@envirotech-inc.com

Chevron	Project Name:	Rincon #234	Reported:
322 Road 3100	Project Number:	92270-0596	08-Jun-17 16:12
Aztec NM, 87410	Project Manager:	Isaac Reyes	

S. Bottom
P706007-03 (Solid)

Reporting									
Analyte	Result	Limit	Units	Dilution	Batch	Prepared	Analyzed	Method	Notes
Volatile Organics by EPA 8021									
Benzene	ND	0.10	mg/kg	1	1723006	06/06/17	06/07/17	EPA 8021B	
Toluene	ND	0.10	mg/kg	1	1723006	06/06/17	06/07/17	EPA 8021B	
Ethylbenzene	ND	0.10	mg/kg	1	1723006	06/06/17	06/07/17	EPA 8021B	
p,m-Xylene	ND	0.20	mg/kg	1	1723006	06/06/17	06/07/17	EPA 8021B	
o-Xylene	ND	0.10	mg/kg	1	1723006	06/06/17	06/07/17	EPA 8021B	
Total Xylenes	ND	0.10	mg/kg	1	1723006	06/06/17	06/07/17	EPA 8021B	
Total BTEX	ND	0.10	mg/kg	1	1723006	06/06/17	06/07/17	EPA 8021B	
Surrogate: 4-Bromochlorobenzene-PID		95.8 %		50-150	1723006	06/06/17	06/07/17	EPA 8021B	
Nonhalogenated Organics by 8015									
Gasoline Range Organics (C6-C10)	ND	20.0	mg/kg	1	1723006	06/06/17	06/07/17	EPA 8015D	
Diesel Range Organics (C10-C28)	41.5	25.0	mg/kg	1	1723009	06/06/17	06/07/17	EPA 8015D	
Surrogate: 1-Chloro-4-fluorobenzene-FID		112 %		50-150	1723006	06/06/17	06/07/17	EPA 8015D	
Surrogate: n-Nonane		109 %		50-200	1723009	06/06/17	06/07/17	EPA 8015D	

Partial or incomplete reproduction of this report is prohibited, unless approved by Envirotech, Inc.

5796 US Highway 64, Farmington, NM 87401

Three Springs • 65 Mercado Street, Suite 115, Durango, CO 81301

Ph (505) 632-0615 Fx (505) 632-1865

Ph (970) 259-0615 Fr (800) 362-1879

envirotech inc.com
 Laboratory@envirotech inc.com

Chevron	Project Name:	Rincon #234	Reported:
322 Road 3100	Project Number:	92270-0596	08-Jun-17 16:12
Aztec NM, 87410	Project Manager:	Isaac Reyes	

W. Bottom
P706007-04 (Solid)

Reporting								
Analyte	Result	Limit	Units	Dilution	Batch	Prepared	Analyzed	Method
Volatile Organics by EPA 8021								
Benzene	ND	0.10	mg/kg	1	1723006	06/06/17	06/07/17	EPA 8021B
Toluene	ND	0.10	mg/kg	1	1723006	06/06/17	06/07/17	EPA 8021B
Ethylbenzene	ND	0.10	mg/kg	1	1723006	06/06/17	06/07/17	EPA 8021B
p,m-Xylene	ND	0.20	mg/kg	1	1723006	06/06/17	06/07/17	EPA 8021B
o-Xylene	ND	0.10	mg/kg	1	1723006	06/06/17	06/07/17	EPA 8021B
Total Xylenes	ND	0.10	mg/kg	1	1723006	06/06/17	06/07/17	EPA 8021B
Total BTEX	ND	0.10	mg/kg	1	1723006	06/06/17	06/07/17	EPA 8021B
Surrogate: 4-Bromochlorobenzene-PID		96.1 %		50-150	1723006	06/06/17	06/07/17	EPA 8021B
Nonhalogenated Organics by 8015								
Gasoline Range Organics (C6-C10)	ND	20.0	mg/kg	1	1723006	06/06/17	06/07/17	EPA 8015D
Diesel Range Organics (C10-C28)	ND	25.0	mg/kg	1	1723009	06/06/17	06/07/17	EPA 8015D
Surrogate: 1-Chloro-4-fluorobenzene-FID		112 %		50-150	1723006	06/06/17	06/07/17	EPA 8015D
Surrogate: n-Nonane		105 %		50-200	1723009	06/06/17	06/07/17	EPA 8015D

Partial or incomplete reproduction of this report is prohibited, unless approved by Envirotech, Inc.

Chevron
 322 Road 3100
 Aztec NM, 87410

 Project Name: Rincon #234
 Project Number: 92270-0596
 Project Manager: Isaac Reyes

 Reported:
 08-Jun-17 16:12

Composite
P706007-05 (Solid)

Reporting

Analyte	Result	Limit	Units	Dilution	Batch	Prepared	Analyzed	Method	Notes
Volatile Organics by EPA 8021									
Benzene	ND	0.10	mg/kg	1	1723006	06/06/17	06/07/17	EPA 8021B	
Toluene	ND	0.10	mg/kg	1	1723006	06/06/17	06/07/17	EPA 8021B	
Ethylbenzene	ND	0.10	mg/kg	1	1723006	06/06/17	06/07/17	EPA 8021B	
p,m-Xylenc	0.21	0.20	mg/kg	1	1723006	06/06/17	06/07/17	EPA 8021B	
o-Xylene	ND	0.10	mg/kg	1	1723006	06/06/17	06/07/17	EPA 8021B	
Total Xylenes	0.21	0.10	mg/kg	1	1723006	06/06/17	06/07/17	EPA 8021B	
Total BTEX	0.21	0.10	mg/kg	1	1723006	06/06/17	06/07/17	EPA 8021B	
Surrogate: 4-Bromochlorobenzene-PID		98.2 %		50-150	1723006	06/06/17	06/07/17	EPA 8021B	
Nonhalogenated Organics by 8015									
Gasoline Range Organics (C6-C10)	ND	20.0	mg/kg	1	1723006	06/06/17	06/07/17	EPA 8015D	
Diesel Range Organics (C10-C28)	1720	25.0	mg/kg	1	1723009	06/06/17	06/07/17	EPA 8015D	
Surrogate: 1-Chloro-4-fluorobenzene-FID		114 %		50-150	1723006	06/06/17	06/07/17	EPA 8015D	
Surrogate: n-Nonane		128 %		50-200	1723009	06/06/17	06/07/17	EPA 8015D	

Partial or incomplete reproduction of this report is prohibited, unless approved by Envirotech, Inc.

5796 US Highway 64, Farmington, NM 87401

Three Springs - 65 Mercado Street, Suite 115, Durango, CO 81301

Ph (505) 632-0615 Fx (505) 632-1865

Ph (970) 259-0615 Fr (800) 362-1879

 envirotech inc.com
 Laboratory@envirotech inc.com



Chevron	Project Name:	Rincon #234	Reported: 08-Jun-17 16:12
322 Road 3100	Project Number:	92270-0596	
Aztec NM, 87410	Project Manager:	Isaac Reyes	

Center
P706007-06 (Solid)

Reporting									
Analyte	Result	Limit	Units	Dilution	Batch	Prepared	Analyzed	Method	Notes
Volatile Organics by EPA 8021									
Benzene	ND	0.10	mg/kg	1	1723006	06/06/17	06/07/17	EPA 8021B	
Toluene	ND	0.10	mg/kg	1	1723006	06/06/17	06/07/17	EPA 8021B	
Ethylbenzene	0.11	0.10	mg/kg	1	1723006	06/06/17	06/07/17	EPA 8021B	
p,m-Xylene	1.79	0.20	mg/kg	1	1723006	06/06/17	06/07/17	EPA 8021B	
o-Xylene	0.55	0.10	mg/kg	1	1723006	06/06/17	06/07/17	EPA 8021B	
Total Xylenes	2.34	0.10	mg/kg	1	1723006	06/06/17	06/07/17	EPA 8021B	
Total BTEX	2.45	0.10	mg/kg	1	1723006	06/06/17	06/07/17	EPA 8021B	
Surrogate: 4-Bromochlorobenzene-PID		101 %		50-150	1723006	06/06/17	06/07/17	EPA 8021B	
Nonhalogenated Organics by 8015									
Gasoline Range Organics (C6-C10)	44.7	20.0	mg/kg	1	1723006	06/06/17	06/07/17	EPA 8015D	
Diesel Range Organics (C10-C28)	2740	250	mg/kg	10	1723009	06/06/17	06/07/17	EPA 8015D	
Surrogate: 1-Chloro-4-fluorobenzene-FID		115 %		50-150	1723006	06/06/17	06/07/17	EPA 8015D	
Surrogate: n-Nonane		125 %		50-200	1723009	06/06/17	06/07/17	EPA 8015D	

Partial or incomplete reproduction of this report is prohibited, unless approved by Envirotech, Inc.

5796 US Highway 64, Farmington, NM 87401

Three Springs • 65 Mercado Street, Suite 115, Durango, CO 81301

Ph (505) 632-0615 Fx (505) 632-1865

Ph (970) 259-0615 Fr (800) 362-1879

envirotech inc.com
Laboratory@envirotech inc.com



Chevron
322 Road 3100
Aztec NM, 87410

Project Name: Rincon #234
Project Number: 92270-0596
Project Manager: Isaac Reyes

Reported:
08-Jun-17 16:12

Volatile Organics by EPA 8021 - Quality Control

Envirotech Analytical Laboratory

Analyte	Result	Reporting Limit	Units	Spike Level	Source Result	%REC	%REC Limits	RPD	RPD Limit	Notes
---------	--------	-----------------	-------	-------------	---------------	------	-------------	-----	-----------	-------

Batch 1723006 - Purge and Trap EPA 5030A

Blank (1723006-BLK1)

Prepared: 06-Jun-17 Analyzed: 07-Jun-17

Benzene	ND	0.10	mg/kg							
Toluene	ND	0.10	"							
Ethylbenzene	ND	0.10	"							
p,m-Xylene	ND	0.20	"							
o-Xylene	ND	0.10	"							
Total Xylenes	ND	0.10	"							
Total BTEX	ND	0.10	"							
Surrogate: 4-Bromochlorobenzene-PID	7.26		"	8.00		90.7	50-150			

LCS (1723006-BS1)

Prepared: 06-Jun-17 Analyzed: 07-Jun-17

Benzene	3.80	0.10	mg/kg	5.00		76.1	70-130			
Toluene	4.04	0.10	"	5.00		80.9	70-130			
Ethylbenzene	4.15	0.10	"	5.00		83.1	70-130			
p,m-Xylene	8.29	0.20	"	10.0		82.9	70-130			
o-Xylene	4.07	0.10	"	5.00		81.5	70-130			
Surrogate: 4-Bromochlorobenzene-PID	7.66		"	8.00		95.7	50-150			

Matrix Spike (1723006-MS1)

Source: P706007-03

Prepared: 06-Jun-17 Analyzed: 07-Jun-17

Benzene	3.69	0.10	mg/kg	5.00	ND	73.8	54.3-133			
Toluene	3.95	0.10	"	5.00	ND	78.9	61.4-130			
Ethylbenzene	4.06	0.10	"	5.00	ND	81.3	61.4-133			
p,m-Xylene	8.10	0.20	"	10.0	ND	81.0	63.3-131			
o-Xylene	3.99	0.10	"	5.00	ND	79.8	63.3-131			
Surrogate: 4-Bromochlorobenzene-PID	7.76		"	8.00		97.0	50-150			

Matrix Spike Dup (1723006-MSD1)

Source: P706007-03

Prepared: 06-Jun-17 Analyzed: 07-Jun-17

Benzene	3.74	0.10	mg/kg	5.00	ND	74.9	54.3-133	1.50	20	
Toluene	4.02	0.10	"	5.00	ND	80.5	61.4-130	1.92	20	
Ethylbenzene	4.14	0.10	"	5.00	ND	82.9	61.4-133	1.97	20	
p,m-Xylene	8.25	0.20	"	10.0	ND	82.6	63.3-131	1.90	20	
o-Xylene	4.07	0.10	"	5.00	ND	81.4	63.3-131	1.92	20	
Surrogate: 4-Bromochlorobenzene-PID	7.73		"	8.00		96.6	50-150			

Partial or incomplete reproduction of this report is prohibited, unless approved by Envirotech, Inc.

5796 US Highway 64, Farmington, NM 87401

Three Springs - 65 Mercado Street, Suite 115, Durango, CO 81301

Ph (505) 632-0615 Fx (505) 632-1865

Ph (970) 259-0615 Fr (800) 362-1879

envirotech-inc.com

Laboratory - envirotech-inc.com



Chevron	Project Name:	Rincon #234	Reported: 08-Jun-17 16:12
322 Road 3100	Project Number:	92270-0596	
Aztec NM, 87410	Project Manager:	Isaac Reyes	

Nonhalogenated Organics by 8015 - Quality Control

Envirotech Analytical Laboratory

Analyte	Result	Reporting Limit	Units	Spike Level	Source Result	%REC	%REC Limits	RPD	RPD Limit	Notes
---------	--------	-----------------	-------	-------------	---------------	------	-------------	-----	-----------	-------

Batch 1723006 - Purge and Trap EPA 5030A

Blank (1723006-BLK1)

Prepared: 06-Jun-17 Analyzed: 07-Jun-17

Gasoline Range Organics (C6-C10)	ND	20.0	mg/kg							
Surrogate: 1-Chloro-4-fluorobenzene-FID	9.06		"	8.00		113	50-150			

LCS (1723006-BS1)

Prepared: 06-Jun-17 Analyzed: 07-Jun-17

Gasoline Range Organics (C6-C10)	57.2	20.0	mg/kg	60.9		94.0	70-130			
Surrogate: 1-Chloro-4-fluorobenzene-FID	9.11		"	8.00		114	50-150			

Matrix Spike (1723006-MS1)

Source: P706007-03

Prepared: 06-Jun-17 Analyzed: 07-Jun-17

Gasoline Range Organics (C6-C10)	55.7	20.0	mg/kg	60.9	ND	91.5	70-130			
Surrogate: 1-Chloro-4-fluorobenzene-FID	9.14		"	8.00		114	50-150			

Matrix Spike Dup (1723006-MSD1)

Source: P706007-03

Prepared: 06-Jun-17 Analyzed: 07-Jun-17

Gasoline Range Organics (C6-C10)	56.3	20.0	mg/kg	60.9	ND	92.4	70-130	0.983	20	
Surrogate: 1-Chloro-4-fluorobenzene-FID	9.07		"	8.00		113	50-150			

Partial or incomplete reproduction of this report is prohibited, unless approved by Envirotech, Inc.

5796 US Highway 64, Farmington, NM 87401

Ph (505) 632-0615 Fx (505) 632-1865

Three Springs • 65 Mercado Street, Suite 115, Durango, CO 81301

Ph (970) 259-0615 Fr (800) 362-1879

envirotech, inc. com
Laboratory - envirotech, inc. com

Chevron
 322 Road 3100
 Aztec NM, 87410

 Project Name: Rincon #234
 Project Number: 92270-0596
 Project Manager: Isaac Reyes

 Reported:
 08-Jun-17 16:12

Nonhalogenated Organics by 8015 - Quality Control
Envirotech Analytical Laboratory

Analyte	Result	Reporting Limit	Units	Spike Level	Source Result	%REC	%REC Limits	RPD	RPD Limit	Notes
---------	--------	-----------------	-------	-------------	---------------	------	-------------	-----	-----------	-------

Batch 1723009 - DRO Extraction EPA 3570
Blank (1723009-BLK1)

Prepared: 06-Jun-17 Analyzed: 07-Jun-17

Diesel Range Organics (C10-C28)	ND	25.0	mg/kg							
Surrogate: n-Nonane	51.2		"	50.0		102	50-200			

LCS (1723009-BS1)

Prepared: 06-Jun-17 Analyzed: 07-Jun-17

Diesel Range Organics (C10-C28)	476	25.0	mg/kg	500		95.2	38-132			
Surrogate: n-Nonane	52.5		"	50.0		105	50-200			

Matrix Spike (1723009-MS1)

Source: P706007-01

Prepared: 06-Jun-17 Analyzed: 07-Jun-17

Diesel Range Organics (C10-C28)	525	25.0	mg/kg	500	28.2	99.4	38-132			
Surrogate: n-Nonane	55.5		"	50.0		111	50-200			

Matrix Spike Dup (1723009-MSD1)

Source: P706007-01

Prepared: 06-Jun-17 Analyzed: 07-Jun-17

Diesel Range Organics (C10-C28)	509	25.0	mg/kg	500	28.2	96.1	38-132	3.20	20	
Surrogate: n-Nonane	53.5		"	50.0		107	50-200			

Partial or incomplete reproduction of this report is prohibited, unless approved by Envirotech, Inc.

5796 US Highway 64, Farmington, NM 87401

Ph (505) 632-0615 Fx (505) 632-1865

Three Springs • 65 Mercado Street, Suite 115, Durango, CO 81301

Ph (970) 259-0615 Fx (800) 362-1879

 envirotech inc.com
 Laboratory: envirotech inc.com



Chevron
322 Road 3100
Aztec NM, 87410

Project Name: Rincon #234
Project Number: 92270-0596
Project Manager: Isaac Reyes

Reported:
08-Jun-17 16:12

Notes and Definitions

DET Analyte DETECTED
ND Analyte NOT DETECTED at or above the reporting limit
NR Not Reported
dry Sample results reported on a dry weight basis
RPD Relative Percent Difference

Partial or incomplete reproduction of this report is prohibited, unless approved by Envirotech, Inc.

5796 US Highway 64, Farmington, NM 87401

Three Springs - 65 Mercado Street, Suite 115, Durango, CO 81301

Ph (505) 632-0615 Fx (505) 632-1865

Ph (970) 259-0615 Fr (800) 362-1879

envirotech inc.com
laboratory@envirotech inc.com

Lab Use Only	Analysis and Method							lab Only
Lab WO# P706007	RO by 8015	y 8021	418.1	e by 300.0	etals	le 910-1		
Job Number 92270-0596								
(of)								Lab Number t Cont/Prsrv (s) Y/N

Sample ID	Sample Date	Sample Time	Matrix	Containers QTY - Vol/TYPE/Preservative	GRO/DF	BTEX by	TPH by	Chloride	TCLP Me	CO Tabl	TDS				Correct
N. Bottom	6/05/17	11:14	S	1-glass/402/coo1	✓	✓								1	Y
E. Bottom		11:15												2	
S. Bottom		11:17												3	
W. Bottom		11:16												4	
Composite		11:22												5	
Center		11:20												6	

Relinquished by: (Signature)

Relinquished by: (Signature)

Date

6/05/17

Date

Time

2:40 PM

Time

Received by: (Signature)

Received by: (Signature)

Date

6/5/17

Date

Time

15:40

Time

Lab Use Only

**Received on: (Y/N)

T1

T2

T3

AVG Temp °C

40.0

Sample Matrix: S - Soil, Sd - Solid, Sg - Sludge, A - Aqueous, O - Other

Container Type: g - glass, p - poly/plastic, ag - amber glass

**Samples requiring thermal preservation must be received on ice the day they are sampled or received packed in ice at an avg temp above 0 but less than 6 °C on subsequent days.

Sample(s) dropped off after hours to a secure drop off area.

Chain of Custody

Notes/Billing info:

ice in cooler - 4y





Analytical Report

Report Summary

Client: Chevron

Chain Of Custody Number:

Samples Received: 5/1/2017 4:15:00PM

Job Number: 92270-1573

Work Order: P705005

Project Name/Location: Rincon 234

Report Reviewed By:

A handwritten signature in black ink, appearing to read 'Walter Hinchman', followed by a small monogram 'JH'.

Date: 5/8/17

Walter Hinchman, Laboratory Director

A handwritten signature in black ink, appearing to read 'Tim Cain', with a stylized flourish.

Date: 5/8/17

Tim Cain, Quality Assurance Officer

The results in this report apply to the samples submitted to Envirotech's Analytical Laboratory and were analyzed in accordance with the chain of custody document supplied by you, the client, and as such are for your exclusive use only. The results in this report are based on the sample as received unless otherwise noted. Partial or incomplete reproduction of this report is prohibited, unless approved by Envirotech, Inc. If you have any questions regarding this analytical report, please don't hesitate to contact Envirotech's Laboratory Staff.



Chevron
322 Road 3100
Aztec NM, 87410

Project Name: Rincon 234
Project Number: 92270-1573
Project Manager: Felipe Aragon

Reported:
08-May-17 12:08

Analytical Report for Samples

Client Sample ID	Lab Sample ID	Matrix	Sampled	Received	Container
Bottom Floor	P705005-01A	Soil	05/01/17	05/01/17	Glass Jar, 4 oz.
North Wall	P705005-02A	Soil	05/01/17	05/01/17	Glass Jar, 4 oz.
South Wall	P705005-03A	Soil	05/01/17	05/01/17	Glass Jar, 4 oz.
West Wall	P705005-04A	Soil	05/01/17	05/01/17	Glass Jar, 4 oz.
East Wall	P705005-05A	Soil	05/01/17	05/01/17	Glass Jar, 4 oz.

Partial or incomplete reproduction of this report is prohibited, unless approved by Envirotech, Inc.

5796 US Highway 64, Farmington, NM 87401

Three Springs • 65 Mercado Street, Suite 115, Durango, CO 81301

Ph (505) 632-0615 Fx (505) 632-1865

Ph (970) 259-0615 Fr (800) 362-1879

envirotech-inc.com
laboratory - envirotech-inc.com

Chevron
 322 Road 3100
 Aztec NM, 87410

 Project Name: Rincon 234
 Project Number: 92270-1573
 Project Manager: Felipe Aragon

 Reported:
 08-May-17 12:08

Bottom Floor
P705005-01 (Solid)

Reporting									
Analyte	Result	Limit	Units	Dilution	Batch	Prepared	Analyzed	Method	Notes
Volatile Organics by EPA 8021									
Benzene	ND	0.10	mg/kg	1	1718009	05/01/17	05/02/17	EPA 8021B	
Toluene	ND	0.10	mg/kg	1	1718009	05/01/17	05/02/17	EPA 8021B	
Ethylbenzene	ND	0.10	mg/kg	1	1718009	05/01/17	05/02/17	EPA 8021B	
p,m-Xylenc	ND	0.20	mg/kg	1	1718009	05/01/17	05/02/17	EPA 8021B	
o-Xylene	ND	0.10	mg/kg	1	1718009	05/01/17	05/02/17	EPA 8021B	
Total Xylenes	ND	0.10	mg/kg	1	1718009	05/01/17	05/02/17	EPA 8021B	
Total BTEX	ND	0.10	mg/kg	1	1718009	05/01/17	05/02/17	EPA 8021B	
<i>Surrogate: 4-Bromochlorobenzene-PID</i>		94.7 %		50-150	1718009	05/01/17	05/02/17	EPA 8021B	
Nonhalogenated Organics by 8015									
Gasoline Range Organics (C6-C10)	ND	20.0	mg/kg	1	1718009	05/01/17	05/02/17	EPA 8015D	
Diesel Range Organics (C10-C28)	154	25.0	mg/kg	1	1718010	05/02/17	05/02/17	EPA 8015D	
Oil Range Organics (C28-C40+)	96.0	50.0	mg/kg	1	1718010	05/02/17	05/02/17	EPA 8015D	
<i>Surrogate: 1-Chloro-4-fluorobenzene-FID</i>		103 %		50-150	1718009	05/01/17	05/02/17	EPA 8015D	
<i>Surrogate: n-Nonane</i>		107 %		50-200	1718010	05/02/17	05/02/17	EPA 8015D	

Partial or incomplete reproduction of this report is prohibited, unless approved by Envirotech, Inc.

5796 US Highway 64, Farmington, NM 87401

Three Springs • 65 Mercado Street, Suite 115, Durango, CO 81301

Ph (505) 632-0615 Fx (505) 632-1865

Ph (970) 259-0615 Fr (800) 362-1879

 envirotech-inc.com
 Laboratory - envirotech-inc.com

Chevron
 322 Road 3100
 Aztec NM, 87410

 Project Name: Rincon 234
 Project Number: 92270-1573
 Project Manager: Felipe Aragon

 Reported:
 08-May-17 12:08

North Wall
P705005-02 (Solid)

Reporting									
Analyte	Result	Limit	Units	Dilution	Batch	Prepared	Analyzed	Method	Notes
Volatiles Organics by EPA 8021									
Benzene	ND	0.10	mg/kg	1	1718009	05/02/17	05/02/17	EPA 8021B	
Toluene	ND	0.10	mg/kg	1	1718009	05/02/17	05/02/17	EPA 8021B	
Ethylbenzene	ND	0.10	mg/kg	1	1718009	05/02/17	05/02/17	EPA 8021B	
p,m-Xylene	ND	0.20	mg/kg	1	1718009	05/02/17	05/02/17	EPA 8021B	
o-Xylene	ND	0.10	mg/kg	1	1718009	05/02/17	05/02/17	EPA 8021B	
Total Xylenes	ND	0.10	mg/kg	1	1718009	05/02/17	05/02/17	EPA 8021B	
Total BTEX	ND	0.10	mg/kg	1	1718009	05/02/17	05/02/17	EPA 8021B	
Surrogate: 4-Bromochlorobenzene-PID		95.7 %		50-150	1718009	05/02/17	05/02/17	EPA 8021B	
Nonhalogenated Organics by 8015									
Gasoline Range Organics (C6-C10)	ND	20.0	mg/kg	1	1718009	05/02/17	05/02/17	EPA 8015D	
Diesel Range Organics (C10-C28)	27.6	25.0	mg/kg	1	1718017	05/03/17	05/03/17	EPA 8015D	
Oil Range Organics (C28-C40+)	ND	50.0	mg/kg	1	1718017	05/03/17	05/03/17	EPA 8015D	
Surrogate: 1-Chloro-4-fluorobenzene-FID		103 %		50-150	1718009	05/02/17	05/02/17	EPA 8015D	
Surrogate: n-Nonane		108 %		50-200	1718017	05/03/17	05/03/17	EPA 8015D	

Partial or incomplete reproduction of this report is prohibited, unless approved by Envirotech, Inc.

5796 US Highway 64, Farmington, NM 87401

Three Springs - 65 Mercado Street, Suite 115, Durango, CO 81301

Ph (505) 632-0615 Fx (505) 632-1865

Ph (970) 259-0615 Fr (800) 362-1879

 envirotech inc.com
 Laboratory - envirotech inc.com

Chevron
 322 Road 3100
 Aztec NM, 87410

 Project Name: Rincon 234
 Project Number: 92270-1573
 Project Manager: Felipe Aragon

 Reported:
 08-May-17 12:08

South Wall
P705005-03 (Solid)

Reporting									
Analyte	Result	Limit	Units	Dilution	Batch	Prepared	Analyzed	Method	Notes
Volatile Organics by EPA 8021									
Benzene	ND	0.10	mg/kg	1	1718009	05/02/17	05/02/17	EPA 8021B	
Toluene	ND	0.10	mg/kg	1	1718009	05/02/17	05/02/17	EPA 8021B	
Ethylbenzene	ND	0.10	mg/kg	1	1718009	05/02/17	05/02/17	EPA 8021B	
p,m-Xylene	ND	0.20	mg/kg	1	1718009	05/02/17	05/02/17	EPA 8021B	
o-Xylene	ND	0.10	mg/kg	1	1718009	05/02/17	05/02/17	EPA 8021B	
Total Xylenes	ND	0.10	mg/kg	1	1718009	05/02/17	05/02/17	EPA 8021B	
Total BTEX	ND	0.10	mg/kg	1	1718009	05/02/17	05/02/17	EPA 8021B	
Surrogate: 4-Bromochlorobenzene-PID		95.5 %		50-150	1718009	05/02/17	05/02/17	EPA 8021B	
Nonhalogenated Organics by 8015									
Gasoline Range Organics (C6-C10)	ND	20.0	mg/kg	1	1718009	05/02/17	05/02/17	EPA 8015D	
Diesel Range Organics (C10-C28)	ND	25.0	mg/kg	1	1718017	05/03/17	05/03/17	EPA 8015D	
Oil Range Organics (C28-C40+)	ND	50.0	mg/kg	1	1718017	05/03/17	05/03/17	EPA 8015D	
Surrogate: 1-Chloro-4-fluorobenzene-FID		104 %		50-150	1718009	05/02/17	05/02/17	EPA 8015D	
Surrogate: n-Nonane		95.1 %		50-200	1718017	05/03/17	05/03/17	EPA 8015D	

Partial or incomplete reproduction of this report is prohibited, unless approved by Envirotech, Inc.

5796 US Highway 64, Farmington, NM 87401

Three Springs - 65 Mercado Street, Suite 115, Durango, CO 81301

Ph (505) 632-0615 Fx (505) 632-1865

Ph (970) 259-0615 Fr (800) 362-1879

 envirotech inc.com
 Laboratory - envirotech inc.com



Chevron 322 Road 3100 Aztec NM, 87410	Project Name: Rincon 234 Project Number: 92270-1573 Project Manager: Felipe Aragon	Reported: 08-May-17 12:08
---	--	------------------------------

West Wall
P705005-04 (Solid)

Reporting									
Analyte	Result	Limit	Units	Dilution	Batch	Prepared	Analyzed	Method	Notes

Volatile Organics by EPA 8021

Benzene	ND	0.10	mg/kg	1	1718009	05/02/17	05/02/17	EPA 8021B	
Toluene	ND	0.10	mg/kg	1	1718009	05/02/17	05/02/17	EPA 8021B	
Ethylbenzene	ND	0.10	mg/kg	1	1718009	05/02/17	05/02/17	EPA 8021B	
p,m-Xylene	ND	0.20	mg/kg	1	1718009	05/02/17	05/02/17	EPA 8021B	
o-Xylene	ND	0.10	mg/kg	1	1718009	05/02/17	05/02/17	EPA 8021B	
Total Xylenes	ND	0.10	mg/kg	1	1718009	05/02/17	05/02/17	EPA 8021B	
Total BTEX	ND	0.10	mg/kg	1	1718009	05/02/17	05/02/17	EPA 8021B	
Surrogate: 4-Bromochlorobenzene-PID		97.0 %		50-150	1718009	05/02/17	05/02/17	EPA 8021B	

Nonhalogenated Organics by 8015

Gasoline Range Organics (C6-C10)	ND	20.0	mg/kg	1	1718009	05/02/17	05/02/17	EPA 8015D	
Diesel Range Organics (C10-C28)	92.5	25.0	mg/kg	1	1718017	05/03/17	05/03/17	EPA 8015D	
Oil Range Organics (C28-C40+)	ND	50.0	mg/kg	1	1718017	05/03/17	05/03/17	EPA 8015D	
Surrogate: 1-Chloro-4-fluorobenzene-FID		103 %		50-150	1718009	05/02/17	05/02/17	EPA 8015D	
Surrogate: n-Nonane		99.8 %		50-200	1718017	05/03/17	05/03/17	EPA 8015D	

Partial or incomplete reproduction of this report is prohibited, unless approved by Envirotech, Inc.

5796 US Highway 64, Farmington, NM 87401

Three Springs • 65 Mercado Street, Suite 115, Durango, CO 81301

Ph (505) 632-0615 Fx (505) 632-1865

Ph (970) 259-0615 Fr (800) 362-1879

envirotech-inc.com
laboratory@envirotech-inc.com

Chevron
 322 Road 3100
 Aztec NM, 87410

 Project Name: Rincon 234
 Project Number: 92270-1573
 Project Manager: Felipe Aragon

 Reported:
 08-May-17 12:08

East Wall
P705005-05 (Solid)

Reporting									
Analyte	Result	Limit	Units	Dilution	Batch	Prepared	Analyzed	Method	Notes
Volatile Organics by EPA 8021									
Benzene	ND	0.10	mg/kg	1	1718009	05/02/17	05/02/17	EPA 8021B	
Toluene	ND	0.10	mg/kg	1	1718009	05/02/17	05/02/17	EPA 8021B	
Ethylbenzene	ND	0.10	mg/kg	1	1718009	05/02/17	05/02/17	EPA 8021B	
p,m-Xylene	ND	0.20	mg/kg	1	1718009	05/02/17	05/02/17	EPA 8021B	
o-Xylene	ND	0.10	mg/kg	1	1718009	05/02/17	05/02/17	EPA 8021B	
Total Xylenes	ND	0.10	mg/kg	1	1718009	05/02/17	05/02/17	EPA 8021B	
Total BTEX	ND	0.10	mg/kg	1	1718009	05/02/17	05/02/17	EPA 8021B	
Surrogate: 4-Bromochlorobenzene-PID		96.1 %		50-150	1718009	05/02/17	05/02/17	EPA 8021B	
Nonhalogenated Organics by 8015									
Gasoline Range Organics (C6-C10)	ND	20.0	mg/kg	1	1718009	05/02/17	05/02/17	EPA 8015D	
Diesel Range Organics (C10-C28)	ND	25.0	mg/kg	1	1718017	05/03/17	05/03/17	EPA 8015D	
Oil Range Organics (C28-C40+)	ND	50.0	mg/kg	1	1718017	05/03/17	05/03/17	EPA 8015D	
Surrogate: 1-Chloro-4-fluorobenzene-FID		105 %		50-150	1718009	05/02/17	05/02/17	EPA 8015D	
Surrogate: n-Nonane		91.1 %		50-200	1718017	05/03/17	05/03/17	EPA 8015D	

Partial or incomplete reproduction of this report is prohibited, unless approved by Envirotech, Inc.



Chevron	Project Name:	Rincon 234	Reported:
322 Road 3100	Project Number:	92270-1573	08-May-17 12:08
Aztec NM, 87410	Project Manager:	Felipe Aragon	

Volatile Organics by EPA 8021 - Quality Control
Envirotech Analytical Laboratory

Analyte	Result	Reporting Limit	Units	Spike Level	Source Result	%REC	%REC Limits	RPD	RPD Limit	Notes
---------	--------	-----------------	-------	-------------	---------------	------	-------------	-----	-----------	-------

Batch 1718009 - Purge and Trap EPA 5030A

Blank (1718009-BLK1)

Prepared: 01-May-17 Analyzed: 02-May-17

Benzene	ND	0.10	mg/kg							
Toluene	ND	0.10	"							
Ethylbenzene	ND	0.10	"							
p,m-Xylene	ND	0.20	"							
o-Xylene	ND	0.10	"							
Total Xylenes	ND	0.10	"							
Total BTEX	ND	0.10	"							
Surrogate: 4-Bromochlorobenzene-PID	7.29		"	8.00		91.1	50-150			

LCS (1718009-BS1)

Prepared: 01-May-17 Analyzed: 02-May-17

Benzene	4.78	0.10	mg/kg	5.00		95.6	70-130			
Toluene	4.73	0.10	"	5.00		94.6	70-130			
Ethylbenzene	4.73	0.10	"	5.00		94.7	70-130			
p,m-Xylene	9.46	0.20	"	10.0		94.6	70-130			
o-Xylene	4.63	0.10	"	5.00		92.6	70-130			
Surrogate: 4-Bromochlorobenzene-PID	7.68		"	8.00		96.0	50-150			

Matrix Spike (1718009-MS1)

Source: P705005-01

Prepared: 01-May-17 Analyzed: 02-May-17

Benzene	4.98	0.10	mg/kg	5.00	ND	99.7	54.3-133			
Toluene	4.90	0.10	"	5.00	ND	98.0	61.4-130			
Ethylbenzene	4.90	0.10	"	5.00	ND	98.1	61.4-133			
p,m-Xylene	9.78	0.20	"	10.0	ND	97.8	63.3-131			
o-Xylene	4.80	0.10	"	5.00	ND	96.0	63.3-131			
Surrogate: 4-Bromochlorobenzene-PID	7.68		"	8.00		96.0	50-150			

Matrix Spike Dup (1718009-MSD1)

Source: P705005-01

Prepared: 01-May-17 Analyzed: 02-May-17

Benzene	5.11	0.10	mg/kg	5.00	ND	102	54.3-133	2.61	20	
Toluene	5.04	0.10	"	5.00	ND	101	61.4-130	2.82	20	
Ethylbenzene	5.05	0.10	"	5.00	ND	101	61.4-133	2.89	20	
p,m-Xylene	10.1	0.20	"	10.0	ND	101	63.3-131	2.92	20	
o-Xylene	4.94	0.10	"	5.00	ND	98.9	63.3-131	2.88	20	
Surrogate: 4-Bromochlorobenzene-PID	7.69		"	8.00		96.1	50-150			

Partial or incomplete reproduction of this report is prohibited, unless approved by Envirotech, Inc.

5796 US Highway 64, Farmington, NM 87401

Ph (505) 632-0615 Fx (505) 632-1865

Three Springs • 65 Mercado Street, Suite 115, Durango, CO 81301

Ph (970) 259-0615 Fr (800) 362-1879

envirotech inc.com
 Laboratory - envirotech inc.com



Chevron	Project Name:	Rincon 234	Reported:
322 Road 3100	Project Number:	92270-1573	08-May-17 12:08
Aztec NM, 87410	Project Manager:	Felipe Aragon	

Nonhalogenated Organics by 8015 - Quality Control

Envirotech Analytical Laboratory

Analyte	Result	Reporting Limit	Units	Spike Level	Source Result	%REC	%REC Limits	RPD	RPD Limit	Notes
---------	--------	-----------------	-------	-------------	---------------	------	-------------	-----	-----------	-------

Batch 1718009 - Purge and Trap EPA 5030A

Blank (1718009-BLK1)				Prepared: 01-May-17 Analyzed: 02-May-17						
Gasoline Range Organics (C6-C10)	ND	20.0	mg/kg							
Surrogate: 1-Chloro-4-fluorobenzene-FID	8.86		"	8.00		111	50-150			
LCS (1718009-BS1)				Prepared: 01-May-17 Analyzed: 02-May-17						
Gasoline Range Organics (C6-C10)	58.5	20.0	mg/kg	60.9		96.0	70-130			
Surrogate: 1-Chloro-4-fluorobenzene-FID	8.17		"	8.00		102	50-150			
Matrix Spike (1718009-MS1)				Source: P705005-01		Prepared: 01-May-17 Analyzed: 02-May-17				
Gasoline Range Organics (C6-C10)	59.8	20.0	mg/kg	60.9	ND	98.3	70-130			
Surrogate: 1-Chloro-4-fluorobenzene-FID	8.07		"	8.00		101	50-150			
Matrix Spike Dup (1718009-MSD1)				Source: P705005-01		Prepared: 01-May-17 Analyzed: 02-May-17				
Gasoline Range Organics (C6-C10)	61.2	20.0	mg/kg	60.9	ND	101	70-130	2.31	20	
Surrogate: 1-Chloro-4-fluorobenzene-FID	8.04		"	8.00		101	50-150			


Partial or incomplete reproduction of this report is prohibited, unless approved by Envirotech, Inc.

5796 US Highway 64, Farmington, NM 87401

Three Springs - 65 Mercado Street, Suite 115, Durango, CO 81301

Ph (505) 632-0615 Fx (505) 632-1865

Ph (970) 259-0615 Fx (800) 362-1879





Chevron	Project Name:	Rincon 234	Reported: 08-May-17 12:08
322 Road 3100	Project Number:	92270-1573	
Aztec NM, 87410	Project Manager:	Felipe Aragon	

Nonhalogenated Organics by 8015 - Quality Control

Envirotech Analytical Laboratory

Analyte	Result	Reporting Limit	Units	Spike Level	Source Result	%REC	%REC Limits	RPD	RPD Limit	Notes
---------	--------	-----------------	-------	-------------	---------------	------	-------------	-----	-----------	-------

Batch 1718010 - DRO Extraction EPA 3570

Blank (1718010-BLK1)

Prepared & Analyzed: 02-May-17

Diesel Range Organics (C10-C28)	ND	25.0	mg/kg							
Oil Range Organics (C28-C40+)	ND	50.0	"							
Surrogate: n-Nonane	47.4		"	50.0		94.8	50-200			

LCS (1718010-BS1)

Prepared & Analyzed: 02-May-17

Diesel Range Organics (C10-C28)	452	25.0	mg/kg	500		90.4	38-132			
Surrogate: n-Nonane	52.3		"	50.0		105	50-200			

Matrix Spike (1718010-MS1)

Source: P705005-01

Prepared & Analyzed: 02-May-17

Diesel Range Organics (C10-C28)	508	25.0	mg/kg	500	154	70.7	38-132			
Surrogate: n-Nonane	51.8		"	50.0		104	50-200			

Matrix Spike Dup (1718010-MSD1)

Source: P705005-01

Prepared & Analyzed: 02-May-17

Diesel Range Organics (C10-C28)	541	25.0	mg/kg	500	154	77.3	38-132	6.35	20	
Surrogate: n-Nonane	52.9		"	50.0		106	50-200			

Partial or incomplete reproduction of this report is prohibited, unless approved by Envirotech, Inc.

5796 US Highway 64, Farmington, NM 87401

Ph (505) 632-0615 Fx (505) 632-1865

Three Springs • 65 Mercado Street, Suite 115, Durango, CO 81301

Ph (970) 259-0615 Fr (800) 362-1879

envirotech inc.com
laboratory@envirotech-inc.com

Chevron
 322 Road 3100
 Aztec NM, 87410

 Project Name: Rincon 234
 Project Number: 92270-1573
 Project Manager: Felipe Aragon

 Reported:
 08-May-17 12:08

Nonhalogenated Organics by 8015 - Quality Control
Envirotech Analytical Laboratory

Analyte	Result	Reporting Limit	Units	Spike Level	Source Result	%REC	%REC Limits	RPD	RPD Limit	Notes
---------	--------	-----------------	-------	-------------	---------------	------	-------------	-----	-----------	-------

Batch 1718017 - DRO Extraction EPA 3570
Blank (1718017-BLK1)

Prepared & Analyzed: 03-May-17

Diesel Range Organics (C10-C28)	ND	25.0	mg/kg							
Oil Range Organics (C28-C40+)	ND	50.0	"							
Surrogate: n-Nonane	58.8		"	50.0		118	50-200			

LCS (1718017-BS1)

Prepared & Analyzed: 03-May-17

Diesel Range Organics (C10-C28)	480	25.0	mg/kg	500		96.0	38-132			
Surrogate: n-Nonane	55.0		"	50.0		110	50-200			

Matrix Spike (1718017-MS1)

Source: P705005-02

Prepared & Analyzed: 03-May-17

Diesel Range Organics (C10-C28)	509	25.0	mg/kg	500	27.6	96.3	38-132			
Surrogate: n-Nonane	52.8		"	50.0		106	50-200			

Matrix Spike Dup (1718017-MSD1)

Source: P705005-02

Prepared & Analyzed: 03-May-17

Diesel Range Organics (C10-C28)	526	25.0	mg/kg	500	27.6	99.6	38-132	3.17	20	
Surrogate: n-Nonane	56.7		"	50.0		113	50-200			

Partial or incomplete reproduction of this report is prohibited, unless approved by Envirotech, Inc.

5796 US Highway 64, Farmington, NM 87401

Three Springs • 65 Mercado Street, Suite 115, Durango, CO 81301

Ph (505) 632-0615 Fx (505) 632-1865

Ph (970) 259-0615 Fr (800) 362-1879

 envirotech-inc.com
 Laboratory - envirotech-inc.com



Chevron
322 Road 3100
Aztec NM, 87410

Project Name: Rincon 234
Project Number: 92270-1573
Project Manager: Felipe Aragon

Reported:
08-May-17 12:08

Notes and Definitions

DET Analyte DETECTED
ND Analyte NOT DETECTED at or above the reporting limit
NR Not Reported
dry Sample results reported on a dry weight basis
RPD Relative Percent Difference

Partial or incomplete reproduction of this report is prohibited, unless approved by Envirotech, Inc.

5796 US Highway 64, Farmington, NM 87401

Three Springs • 65 Mercado Street, Suite 115, Durango, CO 81301

Ph (505) 632-0615 Fx (505) 632-1865

Ph (970) 259-0615 Fr (800) 362-1879

envirotech-inc.com
Laboratory@envirotech-inc.com

