

30-039-07430

4615

DATA SHEET FOR DEEP GROUND BED CATHODIC PROTECTION WELLS
NORTHWESTERN NEW MEXICO
(Submit 3 copies to OCD Aztec Office)

Operator MERIDIAN OIL Location: Unit NE Sec. 17 Twp 29 Rng 7

Name of Well/Wells or Pipeline Serviced SAN JUAN 29-7 UNIT # 44

cps 87w

Elevation 6666' Completion Date 12/14/62 Total Depth 200' Land Type* N/A

Casing, Sizes, Types & Depths N/A

If Casing is cemented, show amounts & types used N/A

If Cement or Bentonite Plugs have been placed, show depths & amounts used
N/A

Depths & thickness of water zones with description of water when possible:
Fresh, Clear, Salty, Sulphur, Etc. N/A

Depths gas encountered: N/A

Type & amount of coke breeze used: 1360 lbs.

Depths anodes placed: 176', 170', 164', 158', 82', 71'

Depths vent pipes placed: N/A

Vent pipe perforations: N/A

Remarks: gb #1 HOLE LOSING WATER FAST, WATER TRUCK HAD TO STAND BY.

#2 & #3

If any of the above data is unavailable, please indicate so. Copies of all logs, including Drillers Log, Water Analyses & Well Bore Schematics should be submitted when available. Unplugged abandoned wells are to be included.

*Land Type may be shown: F-Federal; I-Indian; S-State; P-Fee.
If Federal or Indian, add Lease Number.

RECEIVED
MAY 31 1991
OIL CON. DIV.
DIST. 3

WELL CASING
CATHODIC PROTECTION CONSTRUCTION REPORT
DAILY LOG

DATE 12-14-62

WELL NAME SAN JUAN 29-7 # 44

CPS NO. 87W

LOCATION 17-29N-7W

WORK ORDER NUMBER 184-40542-50-02

ANODE HOLE DEPTH 200'

TOTAL DRILLING RIG TIME 10 hrs

DRILLING TIME FOR RECTIFIER POLE HOLE 0

TYPE AND SIZE BIT USED _____

NUMBER SACKS MUD USED 2

NUMBER SACKS LOST CIRCULATION MAT'L USED 1

ANODE DEPTHS #1 176, #2 170, #3 164, #4 158 5.82' 6.71

TOTAL LBS. COKE USED 1360 lbs 16 SACKS

ANODE OUTPUTS 12 VOLTS, #1 1.5, #2 2.2, #3 2.2, #4 2.7 53.6632

TOTAL CIRCUIT RESISTANCE: VOLTS 11.5 AMPERES 6.8 OHMS 1.7

NUMBER FEET SURFACE CABLE CONDUIT 295'

DRILLING LOG (ATTACH HERETO).

FORMATION LOG (ATTACH HERETO).

REMARKS: Static G/S = .67 R 600' N

4 ANODES = 2.8 Ω


5 ANODES = 2.05 Ω

Hole losing water
fast water truck
had to standby

ALL CONSTRUCTION COMPLETED

E. Paulik
SIGNATURE

GROUND BED LAYOUT SKETCH

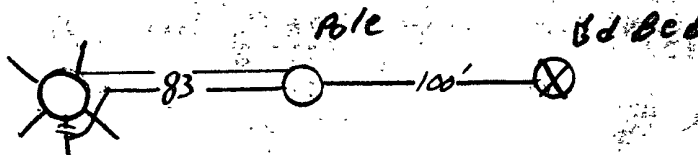

& 1 COPY
TS

1151'

19

morning to new day
E R
Community Supervisor

Compani y-Superw, 801