

(SUBMIT IN TRIPLICATE)

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY

Land Office New Mexico

Lease No. 613654

Unit Hincon Unit

SUNDRY NOTICES AND REPORTS ON WELLS
RECEIVED

NOTICE OF INTENTION TO DRILL		SUBSEQUENT REPORT OF WATER SHUT-OFF	
NOTICE OF INTENTION TO CHANGE PLANS	MAY 29 1958	SUBSEQUENT REPORT OF SHOOTING OR ACIDIZING	
NOTICE OF INTENTION TO TEST WATER SHUT-OFF		SUBSEQUENT REPORT OF ALTERING CASING	
NOTICE OF INTENTION TO RE-DRILL OR REPAIR WELL		SUBSEQUENT REPORT OF RE-DRILLING OR REPAIR	
NOTICE OF INTENTION TO SHOOT OR ACIDIZE		SUBSEQUENT REPORT OF ABANDONMENT	
NOTICE OF INTENTION TO PULL OR ALTER CASING		SUPPLEMENTARY WELL HISTORY	
NOTICE OF INTENTION TO ABANDON WELL		Water Frac.	X

(INDICATE ABOVE BY CHECK MARK NATURE OF REPORT, NOTICE, OR OTHER DATA)

May 27, 1958

Well No. 105 is located 1650 ft. from SW line and 990 ft. from E line of sec. 17

SE Sec. 17
(1/4 Sec. and Sec. No.)

27N
(Twp.)

0N
(Range)

N.M.P.M.
(Meridian)

So. Blanco F. C.
(Field)

Rio Arriba
(County or Subdivision)


New Mexico
(State or Territory)

The elevation of the derrick floor above sea level is 6621 ft.

DETAILS OF WORK

(State names of and expected depths to objective sands; show sizes, weights, and lengths of proposed casings; indicate mudding jobs, cementing points, and all other important proposed work)

9-10-58 Total depth 3319'. C.O.F.D. 3260'. Water fraced Pictured Cliffs perf. int. 3222-3244 w/37,850 gallons water and 35,000# sand. BB pr. 2200#, max. pr. 2200#, avg. tr. pr. 1700#. I.H. 53.7 RPM. Flush 3250 gallons.

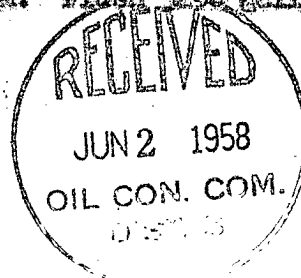

I understand that this plan of work must receive approval in writing by the Geological Survey before operations may be commenced.

Company El Paso Natural Gas Company

Address Box 997

Farmington, New Mexico

By Original Signed D. C. Johnston

Title Petroleum Engineer