

98 30-039-07733

421 30-039-24221

DATA SHEET FOR DEEP GROUND BED CATHODIC PROTECTION WELLS
NORTHWESTERN NEW MEXICO
(Submit 3 copies to OCD Aztec Office)

Operator MERIDIAN OIL Location: Unit NE Sec 34 Twp 30 Rng 7

Name of Well/Wells or Pipeline Serviced SAN JUAN 30-6 UNIT #98, #421

cps 286w

Elevation 6313' Completion Date 3/21/63 Total Depth 85' Land Type* N/A

Casing, Sizes, Types & Depths N/A

If Casing is cemented, show amounts & types used N/A

If Cement or Bentonite Plugs have been placed, show depths & amounts used

N/A

Depths & thickness of water zones with description of water when possible:

Fresh, Clear, Salty, Sulphur, Etc. N/A

Depths gas encountered: N/A

Type & amount of coke breeze used: 595 lbs.

Depths anodes placed: 70', 64', 58', 52', 46'

Depths vent pipes placed: N/A

Vent pipe perforations: N/A

Remarks: gb #1

RECEIVED

MAY 31 1991

OIL CON. DIV
DIST. 3

If any of the above data is unavailable, please indicate so. Copies of all logs, including Drillers Log, Water Analyses & Well Bore Schematics should be submitted when available. Unplugged abandoned wells are to be included.

*Land Type may be shown: F-Federal; I-Indian; S-State; P-Fee.
If Federal or Indian, add Lease Number.

WELL CASING
CATHODIC PROTECTION CONSTRUCTION REPORT
DAILY LOG

DATE 3-21-63

WELL NAME Wilson #4 30-6 #98 CPS NO. 286W

LOCATION 34-30N-7W

WORK ORDER NUMBER 184-40542-50-02

ANODE HOLE DEPTH 85'

TOTAL DRILLING RIG TIME 4 hrs

DRILLING TIME FOR RECTIFIER POLE HOLE 0

TYPE AND SIZE BIT USED _____

NUMBER SACKS MUD USED 0

NUMBER SACKS LOST CIRCULATION MAT'L USED 0

ANODE DEPTHS #1 70', #2 64', #3 58', #4 52' 5.46'

TOTAL LBS. COKE USED 595 lbs

ANODE OUTPUTS 12 VOLTS, #1 3.5, #2 3.6, #3 3.5, #4 4.0 52.9

TOTAL CIRCUIT RESISTANCE: VOLTS 11.4 AMPERES 8.6 OHMS 1.34

NUMBER FEET SURFACE CABLE ~~CONDUIT~~ 311'

DRILLING LOG (ATTACH HERETO).


FORMATION LOG (ATTACH HERETO).

REMARKS: Static C/S = .65 R 600' W.

ALL CONSTRUCTION COMPLETED

E. Paulk
SIGNATURE

GROUND BED LAYOUT SKETCH

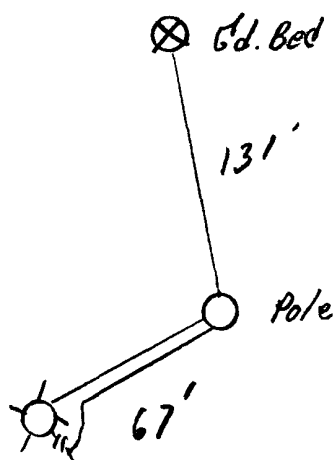

ORIGINAL & 1 COPY
ALL REPORTS

676'

MORNING	DAYLIGHT	EVENING
1	2	3
4	5	6
7	8	9
10	11	12
13	14	15
16	17	18
19	20	21
22	23	24
25	26	27
28	29	30
31	32	33
34	35	36
37	38	39
40	41	42
43	44	45
46	47	48
49	50	51
52	53	54
55	56	57
58	59	60
61	62	63
64	65	66
67	68	69
70	71	72
73	74	75
76	77	78
79	80	81
82	83	84
85	86	87
88	89	90
91	92	93
94	95	96
97	98	99
100	101	102
103	104	105
106	107	108
109	110	111
112	113	114
115	116	117
118	119	120
121	122	123
124	125	126
127	128	129
130	131	132
133	134	135
136	137	138
139	140	141
142	143	144
145	146	147
148	149	150
151	152	153
154	155	156
157	158	159
160	161	162
163	164	165
166	167	168
169	170	171
172	173	174
175	176	177
178	179	180
181	182	183
184	185	186
187	188	189
190	191	192
193	194	195
196	197	198
199	200	201
202	203	204
205	206	207
208	209	210
211	212	213
214	215	216
217	218	219
220	221	222
223	224	225
226	227	228
229	230	231
232	233	234
235	236	237
238	239	240
241	242	243
244	245	246
247	248	249
250	251	252
253	254	255
256	257	258
259	260	261
262	263	264
265	266	267
268	269	270
271	272	273
274	275	276
277	278	279
280	281	282
283	284	285
286	287	288
289	290	291
292	293	294
295	296	297
298	299	300
301	302	303
304	305	306
307	308	309
310	311	312
313	314	315
316	317	318
319	320	321
322	323	324
325	326	327
328	329	330
331	332	333
334	335	336
337	338	339
340	341	342
343	344	345
346	347	348
349	350	351
352	353	354
355	356	357
358	359	360
361	362	363
364	365	366
367</		

Company Supervisor