ConocoPhillips

Schematic - Current

API # 30-039-30746

SAN JUAN 30-6 UNIT #98M

Burlington Resources Oil & Gas Company, LP

Most Recent Job

Jobs

Job Category	Primary Job Type	Secondary Job Type	Actual Start Date	End Date
COMPLETIONS	INITIAL COMPLETION	INITIAL COMPLETION	4/19/2010	6/22/2010

Well Config: DEVIATED - Original Hole, 6/24/2010 8 19:35 AM

ftKB (MD)	Schematic - Actual
16	2-1, Casing Joints, 7, 6.366, 16
	1-1, Casing Joints, 9 5/8, 9.001, 16
17	2-2, Casing Hanger, 7, 6.366, 16, 1.0
	3-1, Casing Hanger, 4 1/2, 4.000, 16, 1.0
19	1-2, Casing Hanger, 9 5/8, 9.001, 16, 3 3
25	2-3, Casing Pup Joint, 7, 6.366, 17, 8.0
31	3-2, Casing Pup Joint, 4 1/2, 4.000, 17, 14.1
409	1-3, Casing Joints, 9 5/8, 9.001, 19, 389.8
410	1-4, Sawtooth Collar, 9 5/8, 9.001, 409, 0.9
415	
1,936	
2,931	2-4, Casing Joints, 7, 6.366, 25, 2,905 7
2,933	2-5, Stage Collar, 7, 6.366, 2,931, 2.1
3,708	2-6, Casing Joints, 7, 6.366, 2,933, 775 5
3,709	2-7, Float Collar, 7, 6.366, 3,708, 0.7
3,752	2-8, Casing Joints, 7, 6.366, 3,709, 42.9
3,753	2-9, Float Shoe, 7, 6 366, 3,752, 0 8
3,763	1-1, Tubing, 2 3/8, 1 995, 16, 7,945 9
4,219	3-3, Casing Joints, 4 1/2, 4.000, 31, 4,188.4
4,230	3-4, Marker Joint, 4 1/2, 4.000, 4,220, 10.1
4,532	PERFORATED, 4,532-4,944, 6/2/2010
4,944	
5,061	PERFORATED, 5,061-5,460, 6/2/2010
5,460	
5,516	PERFORATED, 5,516-6,052, 5/20/2010
6,052	
7,646	3-5, Casing Joints, 4 1/2, 4.000, 4,230, 3,416.7
7,656	3-6, Marker Joint, 4 1/2, 4 000, 7,646, 10.0
7,848	PERFORATED, 7,848-7,946, 5/19/2010
7,946	
7,962	1-2, Tubing Pup Joint, 2 3/8, 1.995, 7,962, 2 0
7,964	1-3, Tubing, 2 3/8, 1.995, 7,964, 30.9
7,995	1-4, Profile Nipple, 2 3/8, 1.785, 7,995, 1 1
7,996	1-5, Mule Shoe W/exp-chk, 2 3/8, 1.785, 7,996, 1.0
7,997	PERFORATED, 7,964-8,053, 5/19/2010
8,053	
8,054	
8,068	3-7, Casing Joints, 4 1/2, 4.000, 7,656, 411.7
8,069	3-8, Float Collar, 4 1/2, 4.000, 8,068, 0.6
8,070	3-9, Float Shoe, 4 1/2, 4 000, 8,069, 0.6
8,070	

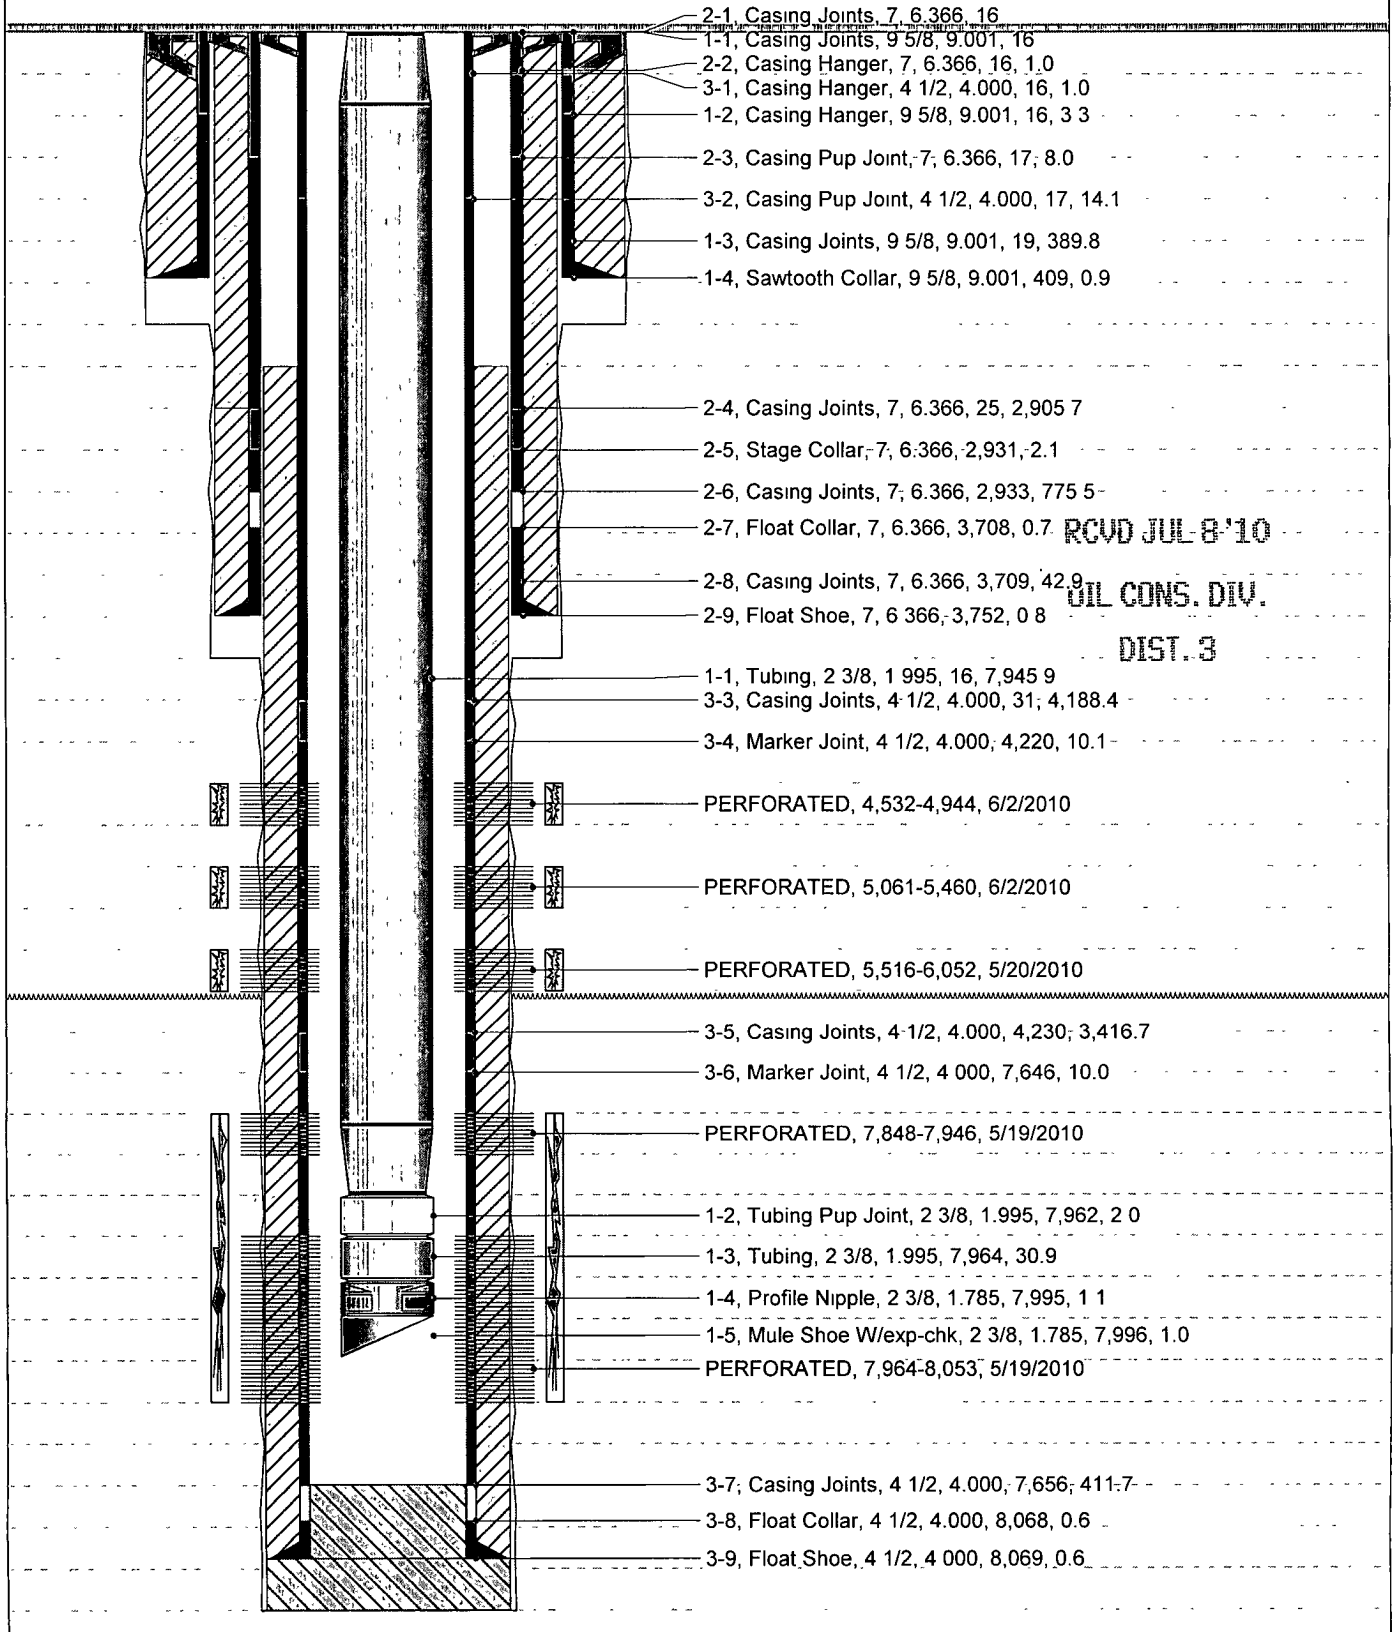

RCVD JUL 8 '10
OIL CONS. DIV.
DIST. 3

Report Printed: 6/24/2010