

**UNITED STATES
DEPARTMENT OF THE INTERIOR
BUREAU OF LAND MANAGEMENT**

Sundry Notices and Reports on Wells

1. Type of Well GAS	5. Lease Number NM-03521
2. Name of Operator CONOCOPHILLIPS COMPANY	6. If Indian, All. or Tribe Name
3. Address & Phone No. of Operator PO Box 4289, Farmington, NM 87499 (505) 326-9700	7. Unit Agreement Name San Juan 28-7 Unit NP
4. Location of Well, Footage, Sec., T, R, M Surf: Unit D (NWNW), 990' FNL & 990' FWL, Section 20, T27N, R7W, NMPM	8. Well Name & Number San Juan 28-7 Unit 43
	9. API Well No. 30-039-07014
	10. Field and Pool
	11. So. Blanco PC County and State Rio Arriba Co., NM

12. CHECK APPROPRIATE BOX TO INDICATE NATURE OF NOTICE, REPORT, OTHER DATA

Type of Submission

Type of Action

☐ Notice of Intent☒ Abandonment☐ Change of Plans☒ Other -- ☐ P&A☒ Subsequent Report☐ Recompletion☐ New Construction☐ Final Abandonment☐ Plugging☐ Non-Routine Fracturing☐ Casing Repair☐ Water Shut off☐ Altering Casing☐ Conversion to Injection

13. Describe Proposed or Completed Operations

ConocoPhillips P&A'd subject well per attached A Plus Report.

RCVD AUG 12 '10

OIL CONS. DIV.

14. I hereby certify that the foregoing is true and correct.

DIST. 3

Signed Jamie Goodwin Jamie Goodwin Title Regulatory Technician Date 8/9/10

(This space for Federal or State Office use)

APPROVED BY _____ Title _____ Date _____

CONDITION OF APPROVAL, if any:

Title 18 U.S.C. Section 1001, makes it a crime for any person knowingly and willfully to make any department or agency of the United States any false, fictitious or fraudulent statements or representations as to any matter within its jurisdiction

ACCEPTED FOR RECORD

AUG 10 2010

FARMINGTON FIELD OFFICE

NMOCD

A-PLUS WELL SERVICE, INC.

P.O. BOX 1979

Farmington, New Mexico 87499

Phone: (505) 325-2627 * Fax: (505) 325-1211

To: Burlington Resources

From: A-Plus Well Service

Date: July 15, 2010

Subject: San Juan 28-7 Unit NP #43

API # 30-039-07014

Attached please find the items listed below that document the plugging of your well. We suggest you file this packet of information in the permanent well file. We sincerely appreciate the opportunity to work for you and look forward to doing so again. Thank you for your business.

 ✓ Plug and Abandonment Report; 1 page(s)

 ✓ Plugging Control Worksheet; 1 page(s)

 ✓ Tower Reports for rig work; 4 page(s)

A-PLUS WELL SERVICE, INC.

P.O. BOX 1979

Farmington, New Mexico 87499

505-325-2627 * fax: 505-325-1211

**ORIGINAL
INVOICE**

ConocoPhillips

San Juan 28-7 Unit NP 43

July 15, 2010

Page 1 of 1

990' FNL & 990' FWL, Section 20, T-27-N, R-7-W

Rio Arriba Country, NM

Lease Number: NM-03521

API#30-039-07014

Plug and Abandonment Report

Notified NMOCD and BLM on 7/14/10

Plugging Summary:

- 07/14/10 MOL and RU. Check well pressures: tubing and casing, 120 PSI; bradenhead, 0 PSI. Pump 40 bbls of water down casing and 10 bbls of water down tubing. PU on 1" tubing. Strip off 5.5" x 2.875" swedge. NU BOP and companion flange, test. SI well. SDFD.
- 07/15/10 Check well pressures: tubing and casing, 100 PSI. Blow well down. Kill well with 20 bbls of water. Load tubing with 6 bbls of water, casing started circulating. TOH and LD total 150 joints 1" line pipe. Round trip 5.5" gauge ring to 2860'. TIH with 5.5" CIBP and set at 2850'. Tally and TIH with 91 joints 2.375" tubing and tag CIBP. Load the casing with 60 bbls of water. Pressure test casing to 800 PSI, held OK for 10 minutes. Joe Ruybalid, BLM representative, approved procedure change to combine Plug #1 and #2. **Plug #1 and #2 combined** with CIBP at 2850', spot 108 sxs Class B cement (127.44 cf) inside casing above CIBP up to 1897' to isolate the Pictured Cliffs interval and cover the Fruitland top. TOH with tubing. SI well. SDFD.
- 07/16/10 Open well, no pressure. TIH with tubing and tag cement at 1934'. TOH with tubing. Perforate 3 holes at 828'. Establish rate into squeeze holes 2 bpm at 200 PSI. TIH with 5.5" DHS cement retainer and set at 783'. Load the casing with 1 bbl of water. Sting into cement retainer. Establish rate 2 bpm at 200 PSI. Start to mix cement; cement truck has hydraulic leak. Stop job. Sting out of cement retainer and reverse circulate tubing clean. SI well. SDFD.
- 07/19/10 Open well, no pressure. Load tubing with 2 bbls of water. Sting into cement retainer at 783'. Establish rate 2 bpm at 200 PSI. **Plug #3** with CR at 783', mix and pump 61 sxs Class B cement (71.98 cf), squeeze 49 sxs outside casing and below CR and leave 12 sxs inside casing above CR up to 678' to cover the Nacimiento top. TOH and LD all tubing. Perforate 3 holes at 183'. Load well with 1-1/2 bbls of water. Establish circulation out the bradenhead valve with 2 additional bbls of water. Establish rate 2 bpm at 100 PSI. **Plug #4** with 70 sxs Class B cement (82.6 cf) down the 5.5" casing from 183' to surface to cover the 9.625" surface casing shoe, circulate good cement out the bradenhead valve. SI well and WOC. Dig out wellhead. Found cement down 30' in the 5.5" casing. ND wellhead. Issue Hot Work Permit. Monitor well. Cut off wellhead. Found cement down 20' in the annulus. Top off the 5.5" casing and install P&A marker with 21 sxs Class B cement. Cut off anchors. RD and MOL.

Jimmy Yates, ConocoPhillips representative, was on location.

A-PLUS WELL SERVICE, INC.

P.O. BOX 1979

Farmington, New Mexico 87499

505-325-2627 * fax: 505-325-1211

PLUGGING CONTROL WORKSHEET

Company: CoPC

Start Work: 7-14-10

Well Name: 55 28-7 #43

Job Complete: 7-19-10

Purpose: To compare Proposed Plugging Plan (Sundry Procedure) To Actual Work
Complete For Each Plug Set:

Date and Time Plug Set: 7-15-10 @ 4:00 PM Initials: BR

Sundry Procedure:

Plug # 1 & 2

From: 2850 To: 1950

With: 108 sxs cement

Perforate: X No or at _____

CIBP: _____ No or at 2850

Cement Rt: X No or at _____

Actual Work Done:

Plug # 1

From: 2850 To: 1897

With: 108 sxs cement

Perforate at: X (____ holes)

CIBP set at: 2850

Cement Rt set at: X; _____ sxs Under
_____ sxs Above; _____ sxs Into Annulus

Does Procedure and Actual Agree? Yes X No

If No, Why Changes? PLUGS 1 & 2 COMBINED

Changes Approved By (Include Time and Date): J RUYBAHD w/ BLM 7-15-10 ON LOC

Date and Time Plug Set: 7-19-10 @ 8:30 AM Initials: PF

Sundry Procedure:

Plug # 3

From: 828 To: 728

With: 60 sxs cement

Perforate: _____ No or at 828

CIBP: X No or at _____

Cement Rt: _____ No or at 788

Actual Work Done:

Plug # 2

From: 783 To: 678 TOC ABOVE CR

With: 61 sxs cement

Perforate at: 828 (____ holes)

CIBP set at: X

Cement Rt set at: 783; 49 sxs Under
12 sxs Above; _____ sxs Into Annulus

Does Procedure and Actual Agree? Yes X No

If No, Why Changes? _____

Changes Approved By (Include Time and Date): _____

Date and Time Plug Set: 7-19-10 @ 10:00 AM Initials: PF

Sundry Procedure:

Plug # 4

From: 183 To: 0

With: 75 sxs cement

Perforate: _____ No or at 183

CIBP: X No or at _____

Cement Rt: 0 No or at _____

Actual Work Done:

Plug # 3

From: 183 To: 0

With: 70 sxs cement

Perforate at: 183 (____ holes)

CIBP set at: X

Cement Rt set at: 0; _____ sxs Under
_____ sxs Above; _____ sxs Into Annulus

Does Procedure and Actual Agree? Yes X No

If No, Why Changes? _____

Changes Approved By (Include Time and Date): _____

A - PLUS WELL SERVICE

P.O. BOX 1979 • FARMINGTON, NM 87499
505-325-2627 • FAX (505) 325-1211

ORIGINAL INVOICE

Rig No. 7

Date 7-14-10 Day WED

Well Name SAN JUAN 29-7 NP #43

Company COPC

990 FNL 990 FWL Sec. 20, T27N, R7W

FROM	TO	DESCRIPTION OF OPERATION
11:30	12:00	ROD RIG + equip.
12:00		SPOT RIG + HSM on JSA
	2:30	RU RIG, PT + Lines, CK pressure thg + csg 120, BH @
2:30		Pump 40 BBLS down csg + 10 BBLS down thg
		PU on 1" thg, unscrew 5 1/2 x 2 3/4 + strip off
		strip on 5 1/2 swedge, 5 1/2 x 8 3/4 thg head, WSI 8 3/4 compass
		flange, RU floor + Handrails
		Get ready to Pull 1", S.W., secure lue.
	4:30	DEBRIEF
4:30	6:00	TRAVEL BACK TO YARD

Well Name/ Rig: SAN JUAN 28-7 #43 - APLUS 7

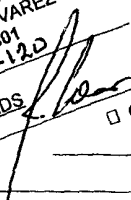
Engineer: JUAN ALVAREZ

Network #: 10284301

Activity Code: 2-120

Plant: HZF1

User ID: NUTADS

Signature: 

☐ Check for Special Attention

ConocoPhillips

NOTIFIED BLM AT 8:45 A.M

NOTIFIED AT 8:50 A.M

Well Name/ Rig: SAN JUAN 28-7 #43 - APLUS 7
Engineer: JUAN ALVAREZ
Network #: 10284301
Activity Code: E-120
Plant: HZF1
User ID: NUTTADS
Signature: 
☐ Check for Sp

US 7
ConocoPhillips

☐ Check for Special Attention

NOTIFIED BLM AT 8:45 A.M.

NMOCB AT 8:50 AM

Fuel & Motor Oil _____ Water Hauled _____

Rental Equipment _____ Cement Retainers _____

Cementing _____

Wireline _____

CREW	NAME	UNIT #	MILEAGE	HOURS
Supervisor	B. RANDALL	59	42	
Operator	D. COMANCHE ✓	47	42	6 1/2
Derrick	R. PARDO ✓			6 1/2
Floors	A. LOZANO ✓			6 1/2
Floors	A. Reyes ✓			6 1/2
Floors	Robert Wilson ✓			6 1/2

P.O. BOX 1979 • FARMINGTON, NM 87499
505-325-2627 • FAX (505) 325-1211

RC1 - 090576

Daily Report

A - PLUS WELL SERVICE

P.O. BOX 1979 • FARMINGTON, NM 87499
505-325-2627 • FAX (505) 325-1211ORIGINAL
INVOICERig No 7Date 7-16-10 Day FRIWell Name SIT 28-7 UNIT NP # 43Company COPC

FROM	TO	DESCRIPTION OF OPERATION
5:30	7:00	TRAVEL TO LOC.
7:00	7:30	SERV 2 EQUIP + HSM ON ISA, STUB'S, BROTHER'S KEEPER for NEW HAND
7:30		CR PRESSURES @ on well + open-well
		TIH w/15 STANDS, PU 1st, TAG w/10' STICK, TAG TOC AT 1934'
	9:00	LD tky up to 752', SB 12 STANDS, S.I.W
9:00	10:30	WAIT ON WIRELINE
10:30		HSM w/W.L., RIH + Perf at 828' w/3-34" HSC
	11:30	EST RATE at 28PM at 200' w/20 BBLs
11:30		RIH 1-5 1/2 DHS CR, TIH w/12 STANDS, PU 1st, set CR at 783'
		String out load ceg w/ 11396, string back in, set same rate w/5 BBLs
		START AIR CEMENT, cement truck has bad Hyd leak on Hyd pump STOP JOB
		WASH-UP equip + string-out + Reverse tky clean w/10 BBLs, NO sign of cement
	1:00	S.I.W, DEBRIS, secure loc.
1:00	2:30	TRAVEL BACK
		TAKING cement truck in for repairs
		#1024430 / E20
		7/16/10
		JOE RUYBALIN w/BLM on box + approved TOC at 1934'

Fuel & Motor Oil _____ Water Hauled _____

Rental Equipment _____ Cement Retainers 1-5 1/2 DHS

Cementing _____

Wireline Perf at 828' CR AT 783' BY N.F.

CREW	NAME	UNIT #	MILEAGE	HOURS
Supervisor	B. RANUALL	59	82	
Operator	D. COMANCHE	47	82	9
Derrick	R. PARRO			9
Floors	A. LOZANO			9
Floors	* Robert Wilson			9
Floors				

RCI - 090576A

P.O. BOX 1979 • FARMINGTON, NM 87499
505-325-2627 • FAX (505) 325-1211

ORIGINAL
INVOICE

Date 7-19-10 Day MONDAY

Company COLC

#1028430
7/19/10

Wireline 3 1/8" HSC GUN - 3 HOLES @ 183' - N.I.

CREW	NAME	UNIT #	MILEAGE	HOURS
Supervisor	P FITZPATRICK	52	41	
Operator	D COMANCHE	47	41	10
Derrick	R PARDO			10
Floors	A LOZANO			10
Floors	* R WILSON			10
Floors				