

District I
1625 N. French Dr., Hobbs, NM 88240
District II
1301 W. Grand Avenue, Artesia, NM 88210
District III
1000 Rio Brazos Road, Aztec, NM 87410
District IV
1220 S. St. Francis Dr., Santa Fe, NM 87505

State of New Mexico
Energy Minerals and Natural Resources

Oil Conservation Division
1220 South St. Francis Dr.
Santa Fe, NM 87505

Form C-141
Revised March 17, 1999

Submit 2 Copies to appropriate
District Office in accordance
with Rule 116 on back
side of form

Release Notification and Corrective Action

30-039-23408

OPERATOR

☒ Initial Report ☐ Final Report

Name of Company Questar Expl & Prod Co.	Contact Kirby Sanchez - Lybrook (Nageezi) NM
Address 1050 17th Street #500, Denver, CO 80265	Telephone No. 505-568-4420 QEP Lybrook Office
Facility Name Escrito Gallup Unit #29	Facility Type Tank Battery

Surface Owner Federal	Mineral Owner	Lease No. 14-08-0001-8691
--------------------------	---------------	------------------------------

LOCATION OF RELEASE

Unit Letter	Section 20	Township 24N	Range 7W	Feet from the 790	North/South Line	Feet from the 790	East/West Line	County Rio Arriba
-------------	---------------	-----------------	-------------	----------------------	------------------	----------------------	----------------	----------------------

NATURE OF RELEASE

Type of Release Oil & PW spill	Volume of Release 135/10bbl	Volume Recovered 117 bbls oil
Source of Release Tank #1220 water drain valve	Date and Hour of Occurrence 12-06-05 2 AM	Date and Hour of Discovery 12-06-05 10 AM
Was Immediate Notice Given? <input checked="" type="checkbox"/> Yes <input type="checkbox"/> No <input type="checkbox"/> Not Required	If YES, To Whom? Steve Hayden @ OCD District III Office	
By Whom? Alan Pitney (303) 672-6969	Date and Hour 12-07-05 AM - apx 9:47	
Was a Watercourse Reached? <input type="checkbox"/> Yes <input checked="" type="checkbox"/> No	If YES, Volume Impacting the Watercourse.	

If a Watercourse was Impacted, Describe Fully.*

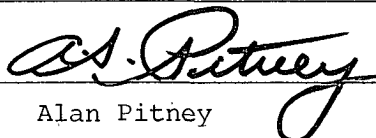
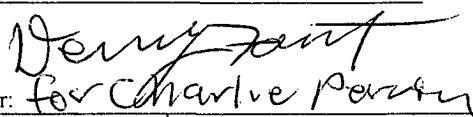
Describe Cause of Problem and Remedial Action Taken.*

Water drain valve froze and broke, emptying 145 bbls of mostly oil (10 bbls PW) into dike. Recovered 117 bbls of oil with VAC truck. Used backhoe to clean up residue on edge and fire wall. Floated and removed add'l residue on 12/09 w/hot oiler.

Describe Area Affected and Cleanup Action Taken.*

All but 1 bbl was contained inside dike. 1 bbl trickled approx 65-ft to road edge. Approximately 18-inches of soil depth inside fire wall is affected. Will excavate soil and remediate on loc. w/fertilizer and SimpleGreen (if parifin) & sample 5+pts of dike.

I hereby certify that the information given above is true and complete to the best of my knowledge and understand that pursuant to NMOC rules and regulations all operators are required to report and/or file certain release notifications and perform corrective actions for releases which may endanger public health or the environment. The acceptance of a C-141 report by the NMOC marked as "Final Report" does not relieve the operator of liability should their operations have failed to adequately investigate and remediate contamination that pose a threat to ground water, surface water, human health or the environment. In addition, NMOC acceptance of a C-141 report does not relieve the operator of responsibility for compliance with any other federal, state, or local laws and/or regulations.

Signature: 	OIL CONSERVATION DIVISION	
Printed Name: Alan Pitney	Approved by District Supervisor: 	
Title: EHS Coordinator	Approval Date: 12/26/05	Expiration Date:
Date: 12-16-05 Phone: 303-672-6969	Conditions of Approval:	Attached <input type="checkbox"/>

* Attach Additional Sheets If Necessary

Clear land farm

N DG F0535-433525