


(SUBMIT IN TRIPLICATE)

Land Office **Santa Fe**
Lease No. **SF 078562**
Unit _____

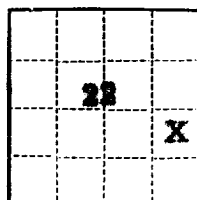

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY

SUNDRY NOTICES AND REPORTS ON WELLS

NOTICE OF INTENTION TO DRILL.....	SUBSEQUENT REPORT OF WATER SHUT-OFF.....	
NOTICE OF INTENTION TO CHANGE PLANS.....	SUBSEQUENT REPORT OF SHOOTING OR ACIDIZING.....	
NOTICE OF INTENTION TO TEST WATER SHUT-OFF.....	SUBSEQUENT REPORT OF ALTERING CASING.....	
NOTICE OF INTENTION TO RE-DRILL OR REPAIR WELL.....	SUBSEQUENT REPORT OF RE-DRILLING OR REPAIR.....	
NOTICE OF INTENTION TO SHOOT OR ACIDIZE.....	SUBSEQUENT REPORT OF ABANDONMENT.....	
NOTICE OF INTENTION TO PULL OR ALTER CASING.....	SUPPLEMENTARY WELL HISTORY.....	X
NOTICE OF INTENTION TO ABANDON WELL.....		

(INDICATE ABOVE BY CHECK MARK NATURE OF REPORT, NOTICE, OR OTHER DATA)

December 12, 1960

Lybrook
Well No. **2-22** is located **2060** ft. from **N** line and **660** ft. from **E** line of sec. **22**
NE SE/4 Sec. 22 **34N** **7W** **NMPM**
(1/4 Sec. and Sec. No.) (Twp.) (Range) (Meridian)
Escrito **Rio Arriba** **New Mexico**
(Field) (County or Subdivision) (State or Territory)

derrick Floor **6789**
The elevation of the ~~derrick floor~~ above sea level is **6789** ft.

DETAILS OF WORK

(State names of and expected depths to objective sands; show sizes, weights, and lengths of proposed casings; indicate mudding jobs, cementing points, and all other important proposed work)

Spudded 12-1/4" hole at 5:30 P. M. 11-26-60. Drilling to 234'. Ran 7 jts. 8-5/8" 24#, J-55 casing. T. E. 219.21' set at 230'. Cemented w/130 sx reg. w/3% CaCl₂ POB 11:55 P. M. 11-26-60. After 18 hours, press. to 1100 psi for 30 min., no pressure drop. Drilling 7-7/8" hole to 5674'. Ran ES-Ind. log to TD. Ran 179 jts. 4-1/2", 9.5#, J-55 casing. T. E. 5682.93' set at 5674'. Cemented w/100 sx reg. with 6% gel & 50 sx reg. POB at 10:00 PM, 12-7-60. After 18 hrs. tested casing with 1250 psi for 30 min., no pressure drop. Preparing to complete.

I understand that this plan of work must receive approval in writing by the Geological Survey before operations may be commenced.

Company **Val R. Reese & Associates, Inc.**

Address **Lobby of Simms Bldg.**

Albuquerque, N. Mex.

By **Lewis C. James**

Title **Geologist**