

DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY

SUNDRY NOTICES AND REPORTS ON WELLS

(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir.
Use "APPLICATION FOR PERMIT—" for such proposals.)

1. OIL WELL ☒ GAS WELL ☐ OTHER ☐

2. NAME OF OPERATOR
BCO, Inc.

3. ADDRESS OF OPERATOR
P. O. Box 669 Santa Fe, New Mexico 87501

4. LOCATION OF WELL (Report location clearly and in accordance with any State requirements.*
See also space 17 below.)
At surface
2060 FSL 660 FEL Sec 22 T24N R7W NMPM

14. PERMIT NO.

15. ELEVATIONS (Show whether DP, RT, GR, etc.)
6748 Gr

5. LEASE DESIGNATION AND SERIAL NO.
SF-078562

6. IF INDIAN, ALLOTTEE OR TRIBE NAME

7. UNIT AGREEMENT NAME

8. FARM OR LEASE NAME
Lybrook

9. WELL NO.
2

10. FIELD AND POOL, OR WILDCAT
Escrito, Gallup

11. SEC., T., R., M. OR BLM. AND SURVEY OR ARMA
22-24N-7E

12. COUNTY OR PARISH
Rio Arriba

13. STATE
NM

16. Check Appropriate Box To Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:		SUBSEQUENT REPORT	
TEST WATER SHUT-OFF	☐	WATER SHUT-OFF	☐
FRACTURE TREAT	☐	FRACTURE TREATMENT	☐
SHOOT OR ACIDIZE	☐	SHOOTING OR ACIDIZING	☐
REPAIR WELL	☐	(Other)	☐
(Other)	☐		
PULL OR ALTER CASING	☐	REPAIRING WELL	☒
MULTIPLE COMPLETE	☐	ALTERING CASING	☐
ABANDON*	☐	ABANDONMENT	☐
CHANGE PLANS	☐		

(NOTE: Report results of multiple completion on Well Completion or Recompletion Report and Log form.)

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting and proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)*


1- 7-78 Set retrievable bridge plug at 4978.

1- 8-78 Found hole in casing below 2040 and above 2100. Hole was above and below 2070. Tried to circulate thru hole up backside and got very marginal returns out the bradenhead.

1- 9-78 Set packer at 1608 and squeezed hole with 150 sacks Class B Cement with 2% CaCl and 6/10 of 1% Halad 9.

1-14-78 Drilled solid cement from 1947 to 2090. Pressure tested casing at 750# and held.

1-15-78 to 1-19-78 Removed bridge plug which was set at 4978 and landed tubing at 5603. Swabbed well and placed back in production.

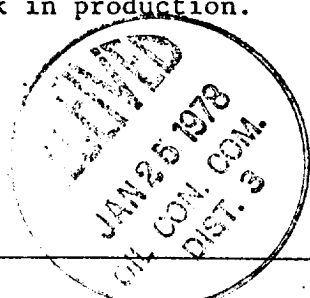

18. I hereby certify that the foregoing is true and correct

SIGNED Harry R. Bigha TITLE President DATE 1-28-78

(This space for Federal or State office use)

APPROVED BY _____ TITLE _____ DATE _____

CONDITIONS OF APPROVAL, IF ANY: