


(SUBMIT IN TRIPLICATE)

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY

Land Office Santa Fe
Lease No. 07813
Unit Lindrich Unit

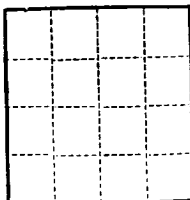

SUNDRY NOTICES AND REPORTS ON WELLS

NOTICE OF INTENTION TO DRILL	SUBSEQUENT REPORT OF WATER SHUT-OFF
NOTICE OF INTENTION TO CHANGE PLANS	SUBSEQUENT REPORT OF SHOOTING OR ACIDIZING
NOTICE OF INTENTION TO TEST WATER SHUT-OFF	SUBSEQUENT REPORT OF ALTERING CASING
NOTICE OF INTENTION TO RE-DRILL OR REPAIR WELL	SUBSEQUENT REPORT OF RE-DRILLING OR REPAIR
NOTICE OF INTENTION TO SHOOT OR ACIDIZE	SUBSEQUENT REPORT OF ABANDONMENT
NOTICE OF INTENTION TO PULL OR ALTER CASING	SUPPLEMENTARY WELL HISTORY
NOTICE OF INTENTION TO ABANDON WELL	

(INDICATE ABOVE BY CHECK MARK NATURE OF REPORT, NOTICE, OR OTHER DATA)

October 14, 1959

Well No. 32 is located 1646 ft. from S line and 1650 ft. from W line of sec. 16

SW Sec. 16 (1/4 Sec. and Sec. No.) 24N (Twp.) 3E (Range) N.M.P.M. (Meridian)
So. Blanco P. Co. (Field) Rio Arriba (County or Subdivision) New Mexico (State or Territory)

The elevation of the derrick floor above sea level is 7036 ft.

DETAILS OF WORK

(State names of and expected depths to objective sands; show sizes, weights, and lengths of proposed casings; indicate mudlogging jobs, cementing points, and all other important proposed work)

Spud date 8-23-59.

On 8-24-59 Total Depth 123' Ran 4 joints, 8 5/8", 32#, J-55 casing (100') set at 110' with 70 sacks regular cement, 2% Cel, 2% Calcium Chloride, 35 cu. ft.

Strata-Crete 6" circulated to surface.

Held 500#/30 minutes.

On 8-28-59 Total Depth 3271'.

Ran 81 joints 5 1/2", J-55, 15.50# casing (3257') set at 3267' with 70 sacks regular cement, 1/4# Floccel/sk.

Held 1000#/30 minutes.

Top of cement by temperature survey at 2800'.

I understand that this plan of work must receive approval in writing by the Geological Survey before operations may be commenced.

Company El Paso Natural Gas Company

Address Box 997

Farmington, New Mexico

By

Title Petroleum Engineer

