

X			

(SUBMIT IN TRIPLICATE)

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY

Land Office Santa Fe
Lease No. 078908
Unit Lindrith Unit

SUNDRY NOTICES AND REPORTS ON WELLS

NOTICE OF INTENTION TO DRILL.....	SUBSEQUENT REPORT OF WATER SHUT-OFF.....
NOTICE OF INTENTION TO CHANGE PLANS.....	SUBSEQUENT REPORT OF SHOOTING OR ACIDIZING.....
NOTICE OF INTENTION TO TEST WATER SHUT-OFF.....	SUBSEQUENT REPORT OF ALTERING CASING.....
NOTICE OF INTENTION TO RE-DRILL OR REPAIR WELL.....	SUBSEQUENT REPORT OF RE-DRILLING OR REPAIR.....
NOTICE OF INTENTION TO SHOOT OR ACIDIZE.....	SUBSEQUENT REPORT OF ABANDONMENT.....
NOTICE OF INTENTION TO PULL OR ALTER CASING.....	SUPPLEMENTARY WELL HISTORY.....
NOTICE OF INTENTION TO ABANDON WELL.....	Subsequent Report of Sandfrac Treatment X

(INDICATE ABOVE BY CHECK MARK NATURE OF REPORT, NOTICE, OR OTHER DATA)

October 20th, 19 58

Well No. 27 is located 990 ft. from N line and 990 ft. from E line of sec. 8
SW/4 SW/4 Sec. 8 24N 2W N.M.P.M.
(1/4 Sec. and Sec. No.) (Twp.) (Range) (Meridian)
S. Blanco PC Ext. Rio Arriba New Mexico
(Field) (County or Subdivision) (State or Territory)


The elevation of the derrick floor above sea level is 7212 ft.

DETAILS OF WORK

(State names of and expected depths to objective sands; show sizes, weights, and lengths of proposed casings; indicate mudding jobs, cementing points, and all other important proposed work)

8-13-58 TD 3394'. Cleaned out to 3345'. Perforated 3278-88' and 3325-40' with 4 shots per foot. Sandfraced with 45,000 gallons water and 50,000# sand, flushed with 5,000 gallons water. Breakdown pressure 3300#, treating pressure 2000-3000#, average injection rate 59.7 barrels per minute.

8-15-58 After 48 hours flowing 263 MCF/day

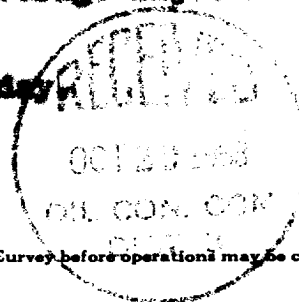

I understand that this plan of work must receive approval in writing by the Geological Survey before operations may be commenced.

Company EL PASO NATURAL GAS COMPANY

Address Box 997
Farmington, New Mexico

By E. S. Cherry
 Title Senior Petroleum Engineer