


FIELD PIT SITE ASSESSMENT FORM

GENERAL	Meter: <u>74528</u> Location: <u>Lindrich Unit No. 14</u> Operator #: <u>2999</u> Operator Name: <u>MOI</u> P/L District: <u>Djito</u> Coordinates: Letter: <u>E</u> Section <u>9</u> Township: <u>24</u> Range: <u>3</u> Or Latitude _____ Longitude _____ Pit Type: Dehydrator _____ Location Drip: ☒ Line Drip: _____ Other: _____ Site Assessment Date: <u>6/14/94</u> Area: <u>08</u> Run: <u>83</u>
SITE ASSESSMENT	NMOCD Zone: (From NMOCD Maps) Inside ☒ (1) Outside ☐ (2) Land Type: BLM ☐ (1) State ☐ (2) Fee ☒ (3) <i>Dennis E. Faust</i> DEPUTY OIL & GAS INSPECTOR SEP 10 1996 Depth to Groundwater Less Than 50 Feet (20 points) ☒ (1) 50 Ft to 99 Ft (10 points) ☐ (2) Greater Than 100 Ft (0 points) ☐ (3) Wellhead Protection Area : Is it less than 1000 ft from wells, springs, or other sources of fresh water extraction? , or ; Is it less than 200 ft from a private domestic water source? ☐ (1) YES (20 points) ☒ (2) NO (0 points) Horizontal Distance to Surface Water Body Less Than 200 Ft (20 points) ☒ (1) 200 Ft to 1000 Ft (10 points) ☐ (2) Greater Than 1000 Ft (0 points) ☐ (3) Name of Surface Water Body <u>Canada Largo</u> (Surface Water Body : Perennial Rivers, Major Wash, Streams, Creeks, Irrigation Canals, Ditches, Lakes, Ponds) Distance to Nearest Ephemeral Stream ☐ (1) < 100' (Navajo Pits Only) ☐ (2) > 100' TOTAL HAZARD RANKING SCORE: <u>40</u> POINTS
REMARKS	Remarks : <u>Redline Book - Inside</u> <u>Vulnerable Zone Topo - Inside</u> <u>1 pit. Will close. Pit dry</u> <u>DIG + HAUL</u>

ORIGINAL PIT LOCATION

ORIGINAL PIT LOCATION

Original Pit : a) Degrees from North 107° Footage from Wellhead 122'
b) Length : 19' Width : 18' Depth : 3'

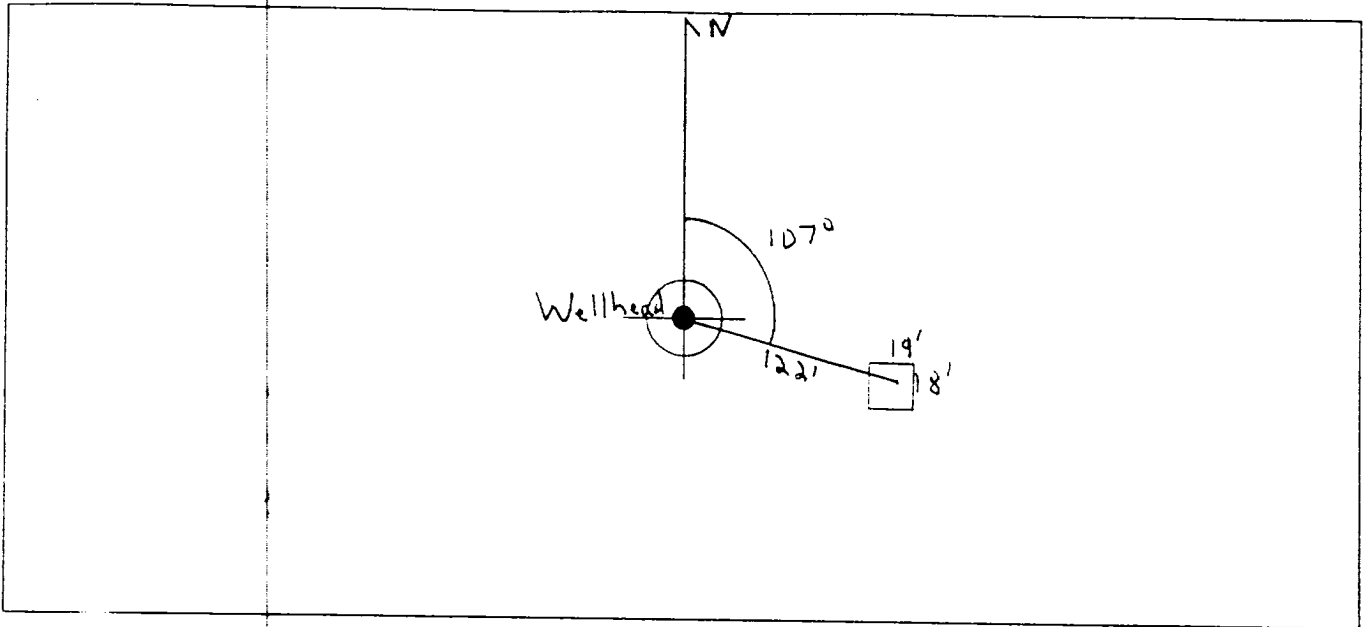

REMARKS

Remarks :

Pictures @ 1452 (5 - 8)
Dump Truck

Completed By:

Cory Chase
Signature

6/14/94
Date

FILL PIT REMEDIATION/CLOSURE FORM

GENERAL	Meter: <u>74528</u> Location: <u>Lindrieth Unit #14</u> Coordinates: Letter: <u>E</u> Section <u>9</u> Township: <u>24</u> Range: <u>3</u> Or Latitude _____ Longitude _____ Date Started : <u>10/11/94</u> Run: <u>08</u> <u>03</u>
FIELD OBSERVATIONS	Sample Number(s): <u>KD 332</u> Sample Depth: <u>12'</u> Feet Final PID Reading <u>13 p.p.m</u> PID Reading Depth <u>12'</u> Feet Yes No Groundwater Encountered ☐ ☒ Approximate Depth _____ Feet
CLOSURE	Remediation Method : Excavation Onsite Bioremediation Backfill Pit Without Excavation ☐ Approx. Cubic Yards <u>0</u> ☐ ☒ Soil Disposition: Envirotech ☐ Other Facility ☐ ☐ Tierra Name: _____ Pit Closure Date: <u>10/11/94</u> Pit Closed By: <u>SEI</u>
REMARKS	Remarks : <u>Dugtest Hole to 12', took pid sample, closed pit.</u>
Signature of Specialist: <u><i>Kenny Dean</i></u>	



Analytical**Technologies**, Inc.

2709-D Pan American Freeway, NE Albuquerque, NM 87107
Phone (505) 344-3777 FAX (505) 344-4413

ATI I.D. 410405

October 26, 1994

El Paso Natural Gas Company
P.O. Box 4990
Farmington, NM 87499

Project Name/Number: PIT CLOSURE 24324

Attention: John Lambdin

On 10/18/94, Analytical Technologies, Inc., (ADHS License No. AZ0015), received a request to analyze **non-aqueous** samples. The samples were analyzed with EPA methodology or equivalent methods. The results of these analyses and the quality control data, which follow each set of analyses, are enclosed.


If you have any questions or comments, please do not hesitate to contact us at (505) 344-3777.

Letitia Krakowski, Ph.D.
Project Manager

H. Mitchell Rubenstein, Ph.D.
Laboratory Manager

MR:jt

Enclosure

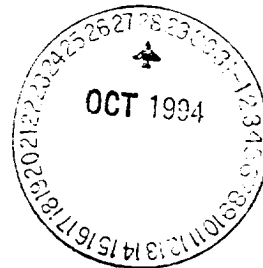



Analytical Technologies, Inc.

GAS CHROMATOGRAPHY RESULTS

TEST : BTEX (EPA 8020)
CLIENT : EL PASO NATURAL GAS CO. ATI I.D.: 410405
PROJECT # : 24324
PROJECT NAME : PIT CLOSURE

SAMPLE			DATE	DATE	DATE	DIL.
ID. #	CLIENT I.D.	MATRIX	SAMPLED	EXTRACTED	ANALYZED	FACTOR
13	946404	NON-AQ	10/11/94	10/19/94	10/20/94	1
14	946405	NON-AQ	10/11/94	10/19/94	10/19/94	1
15	946406	NON-AQ	10/11/94	10/19/94	10/20/94	1
PARAMETER			UNITS	13	14	15
BENZENE			MG/KG	<0.025	<0.025	<0.025
TOLUENE			MG/KG	0.066	0.16	<0.025
ETHYLBENZENE			MG/KG	0.044	<0.025	<0.025
TOTAL XYLENES			MG/KG	0.46	0.054	<0.025

SURROGATE:
BROMOFLUOROBENZENE (%) 97 102 95



FIELD SERVICES LABORATORY

ANALYTICAL REPORT

PIT CLOSURE PROJECT - Soil Samples Inside the GWV Zone

SAMPLE IDENTIFICATION

SAMPLE NUMBER:

MTR CODE | SITE NAME:

SAMPLE DATE | TIME (Hrs):

SAMPLED BY:

DATE OF TPH EXT. | ANAL.:

DATE OF BTEX EXT. | ANAL.:

TYPE | DESCRIPTION:

Field ID	Lab ID
KD 332	9416404
74528	N/A
12-11-94	1215
N/A	
12-11-94	12-17-94
10-19-94	12-20-94
VG	From 1300 - 1300

REMARKS:

RESULTS

PARAMETER	RESULT	UNITS	QUALIFIERS			
			DF	Q	M(g)	V(ml)
BENZENE	< 0.025	MG/KG				
TOLUENE	< 0.025	MG/KG				
ETHYL BENZENE	< 0.025	MG/KG				
TOTAL XYLENES	< 0.025	MG/KG				
TOTAL BTEX	< 0.10	MG/KG				
TPH (418.1)	19.6	MG/KG			5.04	28
HEADSPACE PID	13	PPM				
PERCENT SOLIDS	58.4	%				

-- TPH is by EPA Method 418.1 and BTEX is by EPA Method 8020 --

The Surrogate Recovery was at 95 % for this sample All QA/QC was acceptable.
Narrative:

ATI Results attached.

DF = Dilution Factor Used

ND

Date:

10/3/00